

| Ref. No. | Date | Time | Location | Construction Noise Level | Unit | Action Level | Limit Level | Follow-up action | |
|----------|--|-------|---|--------------------------|-------------|--|-------------|-----------------------------|---|
| X_10N131 | 3-Jun-13 | 14:25 | M6 - HK Baptist Church Henrietta Secondary School | 72 | Leq(30-min) | when one documented complaint was received. | 65 | Possible reason: | Traffic nearby was observed during monitoring and was considered as the major noise contribution. |
| | | | | | | 10001104 | | Action taken / to be taken: | Repeat measurement to confirm result and reviewed the trend of noise measurement. Analysis of contractor's working procedure. Noise mitigation measures by contractor including erection of tempoary noise barrier was confirmed in place. |
| | | | | | | | | Remarks / Other Obs: | Pile head breaking works for Contract HY/2009/19 was conducted during the measurement. It was observed that traffic noise was a major noise source during monitoring. It is concluded that the exceedance was not due to project but to traffic noise nearby. |
| X_10N132 | Complaint dated on 30 May 2013 and 6 June 2013 | N/A | Location near Central Pier | N/A | N/A | when one documented complaint was received. | 75 | Possible reason: | According the information confirmed by RSS, construction activities undertaken at works area near Central Pier during the concerned time include - Breaking up existing D-wall concrete and excavation at portion 4B and 4C - Sheet pilling works at Portion VI (Man Kat Street) |
| | | | | | | | | Action taken / to be taken: | Review and analyze of contractor's working procedure at the concerned period. Review noise monitoring result. Noise mitigation measures by contractor including erection of tempoary noise barrier was confirmed in place. |
| | | | | | | | | Remarks / Other Obs: | One documented complaint regarding noise emanated at construction site near Central area pier was received from EPD on 11 June 2013.Reviewing the noise monitoring data at monitoring stations (M7e-Internation Finance Centre Eastern End of Podium and M7w- International Finance Centre Western End of Podium), no limit level exceedances were recorded during routine noise monitoring event on 28 May 2013 and 03 June 2013. As similar construction works activities conducted on 30 May 2013 was continued across the above monitoring period, the noise emanated from the construction activities under Contract HY/2009/18 was considered to complied with the statutory requirement. |
| | | | | | | | | | In addition, weekly environmental site inspection was conducted on 30 May 2013 at around 10:00. According to the inspection record, no particular observation regarding noise impact was recorded and the mitigation measures including erection of of temporary noise barrier was observed in place. |
| | | | | | | | | | As such, no direct information associated with the noise concerned raised was considered available and no non-conformity was identified. |
| X_10N133 | 13-Jun-13 | 8:05 | M6 - HK Baptist Church Henrietta Secondary School | 67 | Leq(30-min) | when one documented complaint was received. | 65 | Possible reason: | Traffic nearby was observed during monitoring and was considered as the major noise contribution. |
| | | | | | | | | | Repeat measurement to confirm result and reviewed the trend of noise measurement. Analysis of contractor's working procedure. Noise mitigation measures by contractor including erection of tempoary noise barrier was confirmed in place. |
| | | | | | | | | Remarks / Other Obs: | Formwork installation works for Contract HY/2009/19 was conducted during the measurement. It was observed that traffic noise was a major noise source during monitoring. It is concluded that the exceedance was not due to project but to traffic noise nearby. |