



Ref. No.	Date	Time	Location	Measured TSP Level	Unit	Action Level	Limit Level	Follow-up action
X_16A013	28-Oct-16	13:30	CMA5b- Pedestrian Plaza	359.1	1 hr TSP (ug/m ³)	332.0	500	<p>Possible reason: Elevated TSP level potentially in relate to other sources affecting local ambient condition such as road traffic next to the monitoring station</p> <p>Action taken / to be taken: Reviewed the trend of air quality measurement across monitoring stations. Reviewed Contractor's working procedures. Mitigation measures including maintaining haul road in dampened condition was implemented by Contractor.</p> <p>Remarks / Other Obs: Despite formwork erection and re-bar fixing for MVB were undertaken on the monitoring date at around Pedestrian Plaza under Contractor of HK/2012/08, dust suppression measure including haul road maintained in dampened condition were implemented and no particular observation regarding air quality impact was observed during sampling. In view of the above, the action level exceedance was considered to be non-project related and potentially contributed by other sources affecting local ambient condition such as road traffic next to the monitoring station. In addition, non WDII-CWB Project construction activities opposite to the monitoring station was observed on the monitoring date. Nevertheless, the Contractor of HK/2012/08 was reminded to maintain regularly dust suppression measures for any potential dusty surface and dust generating operation around the concerned location to avoid any potential cumulative air quality impact.</p>
X_16A014	28-Oct-16	13:30	CMA5b- Pedestrian Plaza	359.1	1 hr TSP (ug/m ³)	332.0	500	<p>Possible reason: Elevated TSP level potentially in relate to other sources affecting local ambient condition such as road traffic next to the monitoring station</p> <p>Action taken / to be taken: Reviewed the trend of air quality measurement across monitoring stations. Reviewed contractor's working procedures.</p> <p>Remarks / Other Obs: Noise barrier concreting works was undertaken on the monitoring date around Pedestrian Plaza under Contract HK/2009/01 and no particular observation regarding air quality impact was observed during sampling. In view of the above, the action level exceedance was considered to be non-project related and potentially contributed by other sources affecting local ambient condition such as road traffic next to the monitoring station. In addition, non WDII-CWB Project construction activities opposite to the monitoring station was observed on the monitoring date. Nevertheless, the Contractor of HK/2009/01 was reminded to maintain regular dust suppression measures for any potential dusty surface and dust generating operation around the concerned location to avoid any potential cumulative air quality impact.</p>