Ref. No.	Date	Time	Location	Construction Noise Level, dB(A)	Parameter	Action Level	Limit Level dB(A)	Follow-up action	
X_16N068	16-May-17	13:48	M1a-Harbour Road Sports Centre	77	Leq(30min)	when one documented complaint was received.	75	Possible reason:	Breaking and drilling operation next to the monitoring statoin under non WDII-CWB Contractor was observed as the major noise contribution.
								Action taken / to be taken:	A repeat measurement was conducted to confirm result and reviewed the trend of previous noise monitoring and Contractor's working procedure.
								Remarks / Other Obs:	Re-bar and formwork fixing at Portion 5 were conducted under Contract HK/2009/02 around the concerned location during the time of measurement. No major noise was observed from the above construction activities while breaking and drilling operation next to the monitoring station under non WDII-CWB Contractor was observed as the major noise contribution during monitoring. As such, the exceedance was considered as non-Project related.
X_16N069	16-May-17	13:48	M1a-Harbour Road Sports Centre	77	Leq(30min)	when one documented complaint was received.	75	Possible reason:	Breaking and drilling next to the monitoring statoin under non WDII-CWB Contractor was observed as the major noise contribution.
								Action taken / to be taken:	A repeat measurement was conducted to confirm result and reviewed the trend of previous noise monitoring and Contractor's working procedure.
								Remarks / Other Obs:	No construction works was conducted under Contract HK/2009/01 during the time of measurement while breaking and drilling operation next to the monitoring station under non WDII-CWB Contractor was observed as the major noise contribution during monitoring. As such, the exceedance was considered as non-Project related.
X_16N071	25-May-17	10:45	M1a-Harbour Road Sports Centre	77	Leq(30min)	when one documented complaint was received.	75	Possible reason:	Bored piling works next to the monitoring statoin under non WDII-CWB Contractor was observed as the major noise contribution.
								Action taken / to be taken:	A repeat measurement was conducted to confirm result and reviewed the trend of previous noise monitoring and Contractor's working procedure.
								Remarks / Other Obs:	Re-bar fixing at Portion 5 was conducted under Contract HK/2009/02 around the concerned location during the time of measurement. No major noise was observed from the above construction activities while bored piling works next to the monitoring station under non WDII-CWB Contractor was observed as the major noise contribution during monitoring. As such, the exceedance was considered as non-Project related.
X_16N072	25-May-17	10:45	M1a-Harbour Road Sports Centre	77	Leq(30min)	when one documented complaint was received.	75	Possible reason:	Bored piling works next to the monitoring statoin under non WDII-CWB Contractor was observed as the major noise contribution.
								Action taken / to be taken:	A repeat measurement was conducted to confirm result and reviewed the trend of previous noise monitoring and Contractor's working procedure.
								Remarks / Other Obs:	No construction works was conducted under Contract HK/2009/01 during the time of measurement while bored piling works next to the monitoring station under non WDII-CWB Contractor was observed as the major noise contribution during monitoring. As such, the exceedance was considered as non-Project related.

Lam Geotechnics Limited

Ref no.	Date	Tidal	Location	Parameters (Unit)	Measured	Action Level	Limit Level	Follow-up action	
X_16W083	28-Apr-17	Mid-ebb	WSD19	DO(mg/l)	6.49	3.17	2.63	Possible reason:	Natural variation or changes of water quality in the vicinity of water quality monitoring
									station.
				Turbidity	32.61	10.01	_	Action taken/ to be taken:	Immediate repeated in-situ measurement to confirm the exceedances. Checked with Contractor works and reviewed previous monitoring data.
				SS	16.00	16.26	19.74	Remarks/ Other Obs:	No marine construction activity under Contract HK/2012/08 was conducted on the monitoring date. Location of the construction area was at downstream of monitoring station WSD19 during the monitoring period. In view of the above, the exceedance was considered not project related. No exceedance was recorded on the subsequent monitoring on 28 April 2017 flood tide.

Lam Geotechnics Limited

Ref no.	Date	Tidal	Location	Parameters (Unit)	Measured	Action Level	Limit Level	Follow-up action	
X_16C073	17-May-17	Mid-ebb	C7	DO(mg/l)	5.48	3.36	2.73	Possible reason:	Natural variation or changes of water quality in the vicinity of water abstraction location for the water quality monitoring station.
				Turbidity	35.98	9.10	10.25	Action taken/ to be taken:	Repeated the measurement to confirm the result. Checked with Contractor works and reviewed previous monitoring data.
				ss	28.13	15.00	22.13	Remarks/ Other Obs:	No marine activity was conducted under Contract HY/2009/15 at Causeway Bay Typhoon Shelter on the monitoring date. In view of no marine construction activity, the exceedance was considered not related to Contract HY/2009/15 construction works. Despite removal of TS3 temporary reclamation at SW area was conducted under Contract HY/2010/08 on the monitoring date, Contractor mitigation measures including the use of impermeable barrier and silt curtain was in place and the installed silt screen was in place. No particular observation regarding water quality impact found in the vicinity of the monitoring station during the monitoring period. In view of the above, it was considered that the turbidity and suspended solid exceedances were not project related. No turbidity and suspended solid exceedance were recorded on the subsequent monitoring on 19 May 2017 ebb tide.