



Ref. No.	Date	Time	Location	Measured TSP Level	Unit	Action Level	Limit Level	Follow-up action
X_18A004	29-Dec-17	10:15	CMA5b- Pedestrian Plaza	430.0	1hr TSP (ug/m ³)	339.7	500	<p>Possible reason: TSP level potentially in relate to the nearby traffic and ambient condition around the monitoring station at the time of monitoring.</p> <p>Action taken / to be taken: Reviewed the trend of air quality measurement across monitoring stations. Analysis of contractor's working procedures.</p> <p>Remarks / Other Obs: Road and drains works for P2 road was undertaken by the Contractor of HK/2012/08 around the monitoring location on the monitoring date and no particular observation regarding air quality impact was observed during sampling.</p> <p>Meanwhile, non WDII-CWB Project construction works was observed opposite to the monitoring station on the monitoring date.</p> <p>In view of the above, the exceedance was considered to be not related to the Project works under Contract HK/2012/08 and potentially contributed by ambient air quality condition and nearby traffic exhaust. Nevertheless, the Contractor of HK/2012/08 was advised to strengthen the overall dust suppression control measures to ensure all dusty surface are dampened to avoid potential dust emission.</p>



Ref. No.	Date	Time	Location	Construction Noise Level, dB(A)	Parameter	Action Level	Limit Level dB(A)	Follow-up action
X_18N001	29-Dec-17	13:50	M1a-Footbridge at Ex Harbour Road Sports Centre	76	Leq(30min)	when one documented complaint was received.	75	<p>Possible reason: Non WDII-CWB excavation works next to the monitoring station was observed as the major noise contribution during monitoring with mechanical operation directly next to noise monitoring position.</p> <p>Action taken / to be taken: A repeat measurement was conducted to confirm result and reviewed the trend of previous noise monitoring and Contractor's working procedure.</p> <p>Remarks / Other Obs: No construction work under EP-376/2009 was conducted by Contract HK/2012/08 around the concerned location during the time of measurement while non WDII-CWB excavation works next to the monitoring station was observed as the major noise contribution during monitoring. As such, the exceedance was considered as not relate to Project works under HK/2012/08.</p>
X_18N004	16-Jan-18	13:45	M1a-Footbridge at Ex Harbour Road Sports Centre	78	Leq(30min)	when one documented complaint was received.	75	<p>Possible reason: Non WDII-CWB steel frame erection works with hammering next to the monitoring station was observed as the major noise contribution during monitoring.</p> <p>Action taken / to be taken: A repeat measurement was conducted to confirm result and reviewed the trend of previous noise monitoring and Contractor's working procedure.</p> <p>Remarks / Other Obs: No construction work under EP-376/2009 was conducted by Contract HK/2012/08 around the concerned location during the time of measurement while steel frame erection and hammering were conducted by non-WDII-CWB contractor next to the monitoring station and considered as the major noise contribution during monitoring. As such, the exceedance was considered as not relate to Project works under HK/2012/08.</p>
X_18N007	23-Jan-18	13:15	M1a-Footbridge at Ex Harbour Road Sports Centre	88	Leq(30min)	when one documented complaint was received.	75	<p>Possible reason: Non WDII-CWB breaking works next to the monitoring station was observed as the major noise contribution during monitoring with mechanical operation directly next to noise monitoring position.</p> <p>Action taken / to be taken: A repeat measurement was conducted to confirm result and reviewed the trend of previous noise monitoring and Contractor's working procedure.</p> <p>Remarks / Other Obs: No construction work under EP-376/2009 was conducted by Contract HK/2012/08 around the concerned location during the time of measurement while breaking works by excavator mounted breaker was conducted under non-WDII-CWB contractor next to the monitoring station and observed as the major noise contribution during monitoring. As such, the exceedance was considered as not relate to Project works under HK/2012/08.</p>