



Lam Geotechnics Limited

Contract No. HK/2015/01
Wan Chai Development Phase II and Central Wanchai Bypass
- Sampling, Field Measurement and Testing Works (Stage 3)
Monthly EM&A Report (March 2018)

CONTRACT NO: HK/2015/01

WANCHAI DEVELOPMENT PHASE II AND CENTRAL
WANCHAI BYPASS
SAMPLING, FIELD MEASUREMENT AND TESTING WORK
(STAGE 3)

ENVIRONMENTAL PERMIT NO. EP-364/2009/E,
FURTHER ENVIRONMENTAL PERMIT NOS. FEP-01/364/2009,
FEP-02/364/2009, FEP-05/364/2009/A, FEP-06/364/2009/A, FEP-
07/364/2009/D, FEP-09/364/2009/B, FEP-10/364/2009/B AND
FEP-11/364/2009/E, FEP-12/364/2009/D

MONTHLY ENVIRONMENTAL MONITORING & AUDIT REPORT

- MARCH 2018 -

CLIENTS:

Civil Engineering and Development
Department

and

Highways Department

PREPARED BY:

Lam Geotechnics Limited

11/F Centre Point
181-185 Gloucester Road,
Wanchai, H.K.

Telephone: (852) 2882-3939
Facsimile: (852) 2882-3331
E-mail: info@lamenviro.com
Website: <http://www.lamenviro.com>

CERTIFIED BY:

Raymond Dai
Environmental Team Leader

DATE:

16 April 2018



Ref.: AACWBIECEM00_0_10349L.18

16 April 2018

AECOM Asia Company Limited
11/F, Tower 2
Grand Central Plaza
138 Shatin Rural Committee Road
Shatin, New Territories
Hong Kong

By Post and Fax (2691 2649)

Attention: Mr. Conrad Ng

Dear Mr. Ng,

**Re: Contract No. HK/2015/01
Wan Chai Development Phase II - Central-Wan Chai Bypass
Sampling, Field Measurement and Testing Works (Stage 3)**

**Monthly Environmental Monitoring and Audit Report (March 2018)
for EP-364/2009/E, FEP-01/364/2009, FEP-02/364/2009,
FEP-05/364/2009/A, FEP-06/364/2009/A, FEP-07/364/2009/D,
FEP-09/364/2009/B, FEP-10/364/2009/B, FEP-11/364/2009/E and
FEP-12/364/2009/D**

Reference is made to the Environmental Team's submission of the captioned Monthly Environmental Monitoring and Audit (EM&A) Report for March 2018 received by e-mail on 16 April 2017 for our review and comment.

Please be informed that we have no adverse comment on the captioned submission. We write to verify the captioned submission in accordance with Condition 3.4 in the captioned Environmental Permits.

Thank you very much for your attention and please do not hesitate to contact the undersigned should you have any queries.

Yours sincerely,

David Yeung
Independent Environmental Checker

c.c.	HyD	Attn: Mr. Tony Cheung	by fax: 2714 5289
	CEDD	Attn: Mr. Henry Tsang	by fax: 2301 1277
	Lam	Attn: Mr. Raymond Dai	by fax: 2882 3331
	AECOM	Attn: Mr. Francis Leong/ Stephen Lai	by fax: 2691 2649

Q:\Projects\AACWBIECEM00\Corr\AACWBIECEM00_0_10349L.18.docx



TABLE OF CONTENTS

EXECUTIVE SUMMARY	4
1 INTRODUCTION	12
1.1 Scope of the Report	12
1.2 Structure of the Report	12
2 PROJECT BACKGROUND	14
2.1 Background	14
2.2 Scope of the Project and Site Description.....	14
2.3 Division of the Project Responsibility	15
2.4 Project Organization and Contact Personnel.....	16
3 STATUS OF REGULATORY COMPLIANCE	22
3.1 Status of Environmental Licensing and Permitting under the Project.....	22
4 MONITORING REQUIREMENTS	35
4.1 Noise Monitoring.....	35
4.2 Air Quality Monitoring	37
5 MONITORING RESULTS	39
5.1 Noise Monitoring Results	40
5.2 Real Time Noise Monitoring Results	43
5.3 Air Quality Monitoring Results	46
5.4 Waste Monitoring Results	51
6 COMPLIANCE AUDIT	57
6.1 Noise Monitoring.....	57
6.2 Air Quality Monitoring	59
6.3 Review of the Reasons for and the Implications of Non-compliance.....	60
6.4 Summary of action taken in the event of and follow-up on non-compliance	61
7 CUMULATIVE CONSTRUCTION IMPACT DUE TO THE CONCURRENT PROJECTS	61
8 ENVIROMENTAL SITE AUDIT	64
9 COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTION	66
10 CONCLUSION	69

LIST OF TABLES

Table 2.1	Schedule 2 Designated Projects under this Project
Table 2.2	Details of Individual Contracts under the Project
Table 2.3	Contact Details of Key Personnel
Table 3.1	Summary of the current status on licences and/or permits on environmental protection pertinent to the Project
Table 3.2	Cumulative Summary of Valid Licences and Permits under Contract no. HK/2009/01
Table 3.3	Summary of submission status under FEP-02/364/2009
Table 3.4	Cumulative Summary of Valid Licences and Permits under Contract no. HK/2009/02
Table 3.5	Summary of submission status under FEP-01/364/2009
Table 3.6	Cumulative Summary of Valid Licences and Permits under Contract no. HY/2009/18
Table 3.7	Summary of submission status under FEP-05/364/2009/A
Table 3.8	Cumulative Summary of Valid Licences and Permits under Contract no. HY/2009/15
Table 3.9	Summary of submission status under FEP-06/364/2009/A
Table 3.10	Cumulative Summary of Valid License and Permits under Contract no. HY/2009/19
Table 3.11	Summary of submission status under FEP-07/364/2009/D
Table 3.12	Cumulative Summary of Valid License and Permits under Contract no. HK/2012/08
Table 3.13	Summary of submission status under FEP-12/364/2009/D
Table 3.14	Cumulative Summary of Valid License and Permits under Contract no. HY/2010/08
Table 3.15	Summary of submission status under FEP-10/364/2009/B
Table 3.16	Cumulative Summary of Valid License and Permits under Contract no. HY/2011/08
Table 3.17	Summary of submission status under FEP-11/364/2009/E
Table 4.1	Noise Monitoring Stations
Table 4.2	Real Time Noise Monitoring Stations
Table 4.3	Air Quality Monitoring Stations
Table 5.1	Noise Monitoring Stations for Contract no. HY/2009/18
Table 5.2	Noise Monitoring Station for Contract no HK/2009/01 and HK/2009/02
Table 5.3	Noise Monitoring Stations for Contract no. HY/2009/15
Table 5.4	Noise Monitoring Stations for Contract no. HY/2009/19
Table 5.5	Noise Monitoring Stations for Contract no. HY/2010/08
Table 5.6	Noise Monitoring Stations for Contract no. HY/2011/08
Table 5.7	Real Time Noise Monitoring Stations for Contract no. HY/2009/19
Table 5.8	Real Time Noise Monitoring Stations for Contract no. HY/2011/08
Table 5.9	Air Quality Monitoring Station for Contract no. HY/2009/18
Table 5.10	Air Quality Monitoring Station for Contract no. HK/2009/01
Table 5.11	Air Quality Monitoring Station for Contract no. HK/2009/02
Table 5.12	Air Quality Monitoring Stations for Contract no. HY/2009/15
Table 5.13	Air Quality Monitoring Station for Contract no. HY/2009/19
Table 5.14	Air Quality Monitoring Station for Contract no. HK/2012/08
Table 5.15	Air Quality Monitoring Stations for Contract no. HY/2010/08
Table 5.16	Air Quality Monitoring Stations for Contract no. HY/2011/08
Table 5.17	Details of Waste Disposal for Contract no. HK/2009/01
Table 5.18	Details of Waste Disposal for Contract no. HK/2009/02
Table 5.19	Details of Waste Disposal for Contract no. HY/2009/18
Table 5.20	Details of Waste Disposal for Contract no. HY/2009/15
Table 5.21	Details of Waste Disposal for Contract no. HY/2009/19
Table 5.22	Details of Waste Disposal for Contract no. HK/2012/08
Table 5.23	Details of Waste Disposal for Contract no. HY/2010/08
Table 5.24	Details of Waste Disposal for Contract no. HY/2011/08
Table 8.1	Summary of Environmental Inspections for Contract no. HY/2009/15 (NOT USED)
Table 8.2	Summary of Environmental Inspections for Contract no. HY/2009/18 (NOT USED)
Table 8.3	Summary of Environmental Inspections for Contract no. HY/2009/19
Table 8.4	Summary of Environmental Inspections for Contract no. HK/2009/01 (NOT USED)
Table 8.5	Summary of Environmental Inspections for Contract no. HK/2009/02 (NOT USED)



Table 8.6	Summary of Environmental Inspections for Contract no. HK/2012/08
Table 8.7	Summary of Environmental Inspections for Contract no. HY/2010/08
Table 8.8	Summary of Environmental Inspections for Contract no. HY/2011/08) (NOT USED)
Table 9.1	Cumulative Statistics on Complaints
Table 9.2	Cumulative Statistics on Successful Prosecutions
Table 10.1	Summary of Key Construction Activities of Individual Contract(s) to be commenced in Coming Reporting period

LIST OF FIGURES

<u>Figure 2.1</u>	Project Layout
<u>Figure 2.2</u>	Project Organization Chart
<u>Figure 4.1</u>	Locations of Environmental Monitoring Stations

LIST OF APPENDICES

<u>Appendix 3.1</u>	Environmental Mitigation Implementation Schedule
<u>Appendix 4.1</u>	Action and Limit Level
<u>Appendix 4.2</u>	Copies of Calibration Certificates
<u>Appendix 5.1</u>	Monitoring Schedule for Reporting period and Coming month
<u>Appendix 5.2</u>	Noise Monitoring Results and Graphical Presentations
<u>Appendix 5.3</u>	Air Quality Monitoring Results and Graphical Presentations
<u>Appendix 5.4</u>	Real-time Noise Monitoring Results and Graphical Presentations
<u>Appendix 6.1</u>	Event Action Plans
<u>Appendix 6.2</u>	Notification of Exceedance
<u>Appendix 9.1</u>	Complaint Log
<u>Appendix 10.1</u>	Construction Programme of Individual Contracts



EXECUTIVE SUMMARY

- i. This is the Environmental Monitoring and Audit (EM&A) Monthly Report – [March 2018](#) specific for Environmental Permit no. EP-364/2009/E, Further Environmental Permit nos. FEP-01/364/2009, FEP-02-364/2009, FEP-05/364/2009/A, FEP-06/364/2009/A FEP-07/364/2009/D, FEP-09/364/2009/B, FEP-10/364/2009/B, FEP-11/364/2009/E and FEP-12/364/2009/D. The EM&A report is prepared by the Environmental Team (ET) employed under Contract No. HK/2015/01 – Wan Chai Development Phase II and Central Wanchai Bypass – Sampling, Field Measurement and Testing Works (Stage 3). This report presents the environmental monitoring findings and information recorded during the period of [27 February 2018 to 26 March 2018](#).
- ii. The implementation of the Environmental Monitoring and Audit Programme for the Wan Chai Development phase II and Central-Wan Chai Bypass Project has been taken over by the Lam Geotechnics Limited (LGL) under Contract HK/2015/01 – Wan Chai Development Phase II and Central Wanchai Bypass – Sampling, Field Measurement and Testing Works (Stage 3) from 27 December 2015 in continuation of the previous Environmental Team employed under Contact HK/2011/07 – Wan Chai Development Phase II and Central Wanchai Bypass – Sampling, Field Measurement and Testing Works (Stage 2).
- iii. In the reporting period, the principal work activities of individual contracts are included as follows:
 - Contract no. HY/2009/18 - Central - Wan Chai Bypass (CWB) - Central Interchange under FEP-05/364/2009/A
 - [Maintenance works](#)
 - Contract no. HK/2009/01 - Wan Chai Development Phase II - Central - Wan Chai Bypass at Hong Kong Convention and Exhibition Centre - Tunnel Works under FEP-02/364/2009
 - [Reinstatement of amenity area](#)
 - Contract no. HK/2009/02 - Wan Chai Development Phase II - Central - Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009
 - [Joint Inspection with ASD, AECOM and JV for completion of rectification work within the rooms under Staircases](#)
 - [Water test to the Types 3 and 4 Covered Walkway at West Wing](#)
 - [New PMMA for the replacement of 8 nos. of damaged PMMA panels](#)
 - [Preparation for raising the vent shaft, water meters chambers and multi-part covers of P7, P8 and P9](#)
 - [Drainage work](#)
 - [Excavation for relocation of temporary fire hydrant PH2582](#)
 - [Jointed inspection with HKE, AECOM and JV on the new pillar box work](#)
 - [Remedial works against water leakage inside OHVD cells](#)
 - [Backfilling behind seawall block](#)
 - [Steel fixing of Culvert O bay 15A top slab and wall](#)
 - [Base slab of Culvert O Bay 16A](#)

- Pipe piling work for ELS of Culvert O
- Remedial works against water leakage inside OHVD cells
- Raising of CMS draw pits and caisson wall units access opening covers
- Installation of surface drain cover
- All backfilling works at surface drain trench
- Remedial works for 0.5T rock armor
- Sewage works at Wan Shing Street

Contract no. HY/2009/19 - Central - Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/D

- Approach ramp structure Construction.
- Bridge Construction & installation of enclosure.
- Retaining wall construction.
- FEHD depot re-provision works.
- Oil street drainage works.
- Installation of skin parapet on TB bridge at Pier 15-17.
- Landscape deck, column & pile cap foundation works.
- Watson Road Water mains laying works.
- EVA at EVB.
- Hing Fat Street road and drainage works.
- IEC TD bridge parapet installation.

Contract no. HK/2012/08 – Wan Chai Development Phase II – Central- Wan Chai Bypass at Wan Chai West under FEP-12/364/2009/D

- Construction of Slip Road 1
- Construction of drainage
- Asphalt paving
- Construction of roundabout

Contract no. HY/2010/08 –Central - Wan Chai Bypass (CWB) –Tunnel (Slip Road 8) under FEP-10/364/2009/B

- Tree protection works next to existing BGO,
- Drainage improvement works,
- Utility diversion works,
- Retaining wall works
- ELS works,
- Construction works for subway extension

Contract no. HY/2011/08 –Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009/E

- Construction of Ventilation Buildings, inclusive of Administration Building, Central Ventilation Building, East Ventilation Shaft/Building, West Ventilation Building
- Application of Thermal Barrier inside the Tunnel, asphalt pavement
- Construction of Tunnel Thermal Barrier
- Installation of Electricals and Mechanicals



- Installation of Tunnel Features

Noise Monitoring

- iv. Noise monitoring during daytime was conducted at M1a – Footbridge for Harbour Road Sports Center; M2b - Noon-day gun area; M3a - Tung Lo Wan Fire Station; M4b - Victoria Center; M5b - City Garden, M6 - HK Baptist Church Henrietta Secondary School, M7e and M7w – International Financial Centre East Podium and International Finance Centre West Podium and M8 – City Hall on weekly basis in the reporting period.
- v. With respect to the shift in major construction site portions at Wan Chai North, the noise monitoring station M1a – Harbour Road Sports Centre was finely adjusted from East of Harbour Road Sports Centre to West of Harbour Road Sports Centre on 21 June 2016.
- vi. With respect to the demolition of Ex-Harbour Road Sports Centre, the respective noise monitoring station M1a – Harbour Road Sports Centre were finely adjusted on 16 and 25 May 2017 and thereafter to the Footbridge for Harbour Road Sports for noise monitoring.
- vii. With respect to the non-CWB Project building construction at Oil Street, the real-time noise monitoring station RTN2a- Hong Kong Electric Centre was finely adjusted from Northeast Side to Northwestern side at Roof Top location on 03 March 2017.
- viii. [One limit level exceedance was recorded at M6 – HK Baptist Church Henrietta Secondary School on 06 March 2018 and the exceedance was concluded as Project related.](#)
- ix. [One action level exceedance regarding noise emanation on 12 March 2018 under Contract HY/2009/19 was referred to the Environmental Team on 27 March 2018. After investigation, the noise emanation was found to be related to the breaking works conducted on IECL around YLMF memorial school and Wharf Road causing noise nuisance to the nearby receivers.](#)
- x. [24-hour real time noise monitoring was conducted at RTN1 - FEHD Hong Kong Transport Section Whitfield Depot. No limit level exceedance was recorded in the reporting period.](#)
- xi. [24-hour real time noise monitoring was conducted at RTN2a – Hong Kong Electric Centre. No project related exceedance was recorded in the reporting period.](#)
- xii. [24-hour real time noise monitoring was conducted at RTN3 – Yu Lee Mo Fan Memorial School. After investigation, the exceedances recorded on 01, 02, 03, 05, 06, 07, 09, 10, 12, 14, 15, 16, 20, 21, 22, 23 and 24 March 2018 were considered as Project related and while other exceedances recorded are considered as non-Project related.](#)
- xiii. [24-hour real time noise monitoring was conducted at RTN4 – Causeway Bay Community Centre. No limit level exceedance was recorded in the reporting period.](#)

Air Quality Monitoring

- xiv. 1-hour and 24-hour Total Suspended Particulates (TSP) monitoring were conducted at CMA1b – Harbour Grand Hotel Boundary Wall; CMA2a - Causeway Bay Community Center; CMA3a - CWB PRE Site Office Area; CMA4a – Society for the Prevention of Cruelty to Animals; CMA5b - Pedestrian Plaza; MA1e and MA1w – International Finance Centre eastern and western podium on every six days basis.
- xv. With respect to the proposed demolition of eastern podium of Oil Street Site Office, the respective air quality monitoring station CMA1b – Oil Street Site Office was finely adjusted from East podium of the Oil Street Site Office to the West podium of the Oil Street Site Office on 21 December 2016.

- xvi. With respect to the proposed demolition of the Oil Street Site Office, the respective air quality monitoring station CMA1b – Harbour Grand Hotel Boundary Wall was finely adjusted from the Oil Street Site Office to Harbor Grand Hotel Boundary Wall from 05 June 2017 onwards.
- Complaints, Notifications of Summons and Successful Prosecutions
- xvii. One environmental complaint was received in the reporting period.

An ICC complaint (Case Ref: 2-4495970766, lodged at 0955hrs on 12 March 2018) was referred to the ET on 27 March 2018. The ICC hotline operator reported that a public complaint was referred by the Police Force regarding noise emanation from road construction works at North Point section Island East Corridor (IEC) near 19 Wharf Road at around 0920hrs on 12 March 2018. Further information regarding the same event was received via ICC hotline (Case ref: 2-449606553, lodged at 1004hrs on 12 March 2018) was referred to the ET on 27 March 2018. The complainant further reported that noise was emanated from road construction works on Island Eastern Corridor (IEC) near Yu Lee Mo Fan Memorial School. Temporary noise barrier observed to be transparent in nature was speculated to be ineffective; and it was observed that only 3 out of the 6 units of temporary noise barrier are installed. The complainant suggested that additional 6 sections of noise barrier shall be installed. The noise emanation was started from 0800hrs and he is a resident at 18 Wharf Road and his rest was adversely affected by the concerned noise emanation. He has contacted the Environmental Protection Department and the Police Force regarding the noise emanation. The Environmental Protection Department has replied that construction works conducted after 0700hrs does not violate statutory requirement while the Police Force has created an ICC complaint case file (2-4495970766) for follow up.

ET confirmed with the Resident Site Staff that Concrete breaking works on IEC Eastbound near Pier F8 and Pier F9 was conducted under Contract HY/2009/19 from 0900hrs to 1000hrs on 12 March 2018. Noise mitigation measure including wrapping of breaking head with acoustic material was implemented. Enhancement measures including provision of 2.5m high temporary noise barrier were subsequent implemented on 12 March 2018.

According to RSS confirmed information, concrete breaking works on IEC Eastbound near Pier F8 and Pier F9 was conducted under Contract HY/2009/19 from 0900hrs to 1000hrs on 12 March 2018. Noise mitigation measure including wrapping of breaking head with acoustic material was implemented. Enhancement measures including provision of 2.5m high temporary noise barrier were subsequent implemented on 12 March 2018.

Based on review on relevant site record, noise impact associated with the breaking works on IECL opposite to the concerned location was observed across March 2018 and project related exceedances were recorded at nearby noise monitoring station at YLMF Memorial School across March 2018. Upon identification of the project related exceedance at YLMF memorial school noise monitoring station, the Contractor is requested to adopt remedial and enhancement measures to minimize the noise emanation and avoid noise impact to the nearby sensitive receivers.

According to ET follow up checking, the following enhancement measures were proposed and implemented by the Contractor by 16 March 2018 including provide additional temporary noise barrier and repair damaged or incomplete temporary noise barrier installed for the breaking works, provide additional acoustics screen to the breaking tip in addition to temporary noise barrier installed, provide covering of breaker tip with acoustic material for noise reduction and conduct breaking works intermittently.

Nevertheless, subsequent to 16 March 2018, it was observed at times that the above mitigation measures were not fully implemented by the Contractor throughout the remaining breaking works period. Upon identification of deficiency in mitigation measures, the Contractor has been requested to rectify any deficiency observed and ensure relevant noise mitigation measures are implemented and the observed deficiencies are rectified prior to resumption of the concerned impact associated works. According to Contractor information, the concerned breaking works have been completed by 26 March 2018.

In view of the public concern and the identified noise concern, the Contractor of HY/2009/19 was reminded that, shall future breaking works be required to be conducted on IECL (at works area located at the East of the noise enclosure), noise mitigation measure including but not limit to provision of temporary noise barrier with adequate height and extend and additional noise screen shall be proposed for ET/IEC review and confirmation prior to conducting the corresponding works to minimize the potential impact to the surroundings. The Contractor is also advised to review the adopt construction method with consideration on alternative PME with reduced noise emanation to minimize the potential noise impact to the surroundings.

Site Inspections and Audit

- xviii. The Environmental Team (ET) conducted weekly site inspections for Contract no. HY/2009/18, HY/2009/19, HY/2010/08, HK/2009/01, HK/2009/02, HK/2012/08 and HY/2011/08 in this reporting period.
- xix. Construction of bored pile E3B under HY/2009/17 was confirmed completed and the respective work area under FEP-03/364/2009 was handover and inspected under HY/2009/19 from 19 Dec 2012 onwards.
- xx. Construction works under HK/2010/06 was confirmed completed and the respective work area under FEP-08/364/2009/A was handover and inspected under HK/2012/08 from 22 Sep 2014 onwards.
- xxi. As confirmed with CWB RSS, the construction works under Contract HY/2009/15 was completed from 27 October 2017 onwards. The respective weekly site audit inspection for HY/2009/15 was therefore suspended from 27 October 2017 onwards.
- xxii. The Contractors rectified major observations and recommendations made during the audit sessions. No non-conformance was identified during the site inspections.

Future Key Issues

- i. In the coming reporting period, the principal work activities of individual contracts are anticipated as follows:

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

- Maintenance works

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009

- Reinstatement of amenity area

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

- Requisitioned Wan Chai Ferry Pier
- Rectification work for the leakage of covered walkway at Expo Drive East
- Remedial works against water leakage inside OHVD cells.
- Partial removal of TWCR4 to +2.5mPD
- Backfilling works
- Construction of box culvert 'O'
- Temporary works for construction of box culvert 'O'
- Remedial works against water leakage inside OHVD cells.
- Remedial and Outstanding Works inside Tunnel
- Remedial works for damaged caisson seawall under C2
- Remedial works for damaged caisson seawall and CMS under C1
- Modification of levels of caisson seawall access, manhole covers and CMS draw pit covers.
- Construction of surface channel at potion 5
- Remedial work for 0.5 ton armour at WCR3
- Sewage works at Wan Shing Street.

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/D

- Approach ramp structure Construction.
- Bridge Construction & installation of enclosure.
- Retaining wall construction.
- FEHD re-provision works.
- Oil Street drainage works.
- Installation of skin parapet on TB bridge at Pier 15-17.
- Landscape deck, column & pile cap foundation works.
- Watson Road Water mains laying works.
- EVA at EVB.
- Hing Fat Street road and drainage works.



- IEC TD bridge parapet installation.
- Watson Road Cul-de-sac construction.

Contract no. HK/2012/08 – Wan Chai Development Phase II – Central- Wan Chai Bypass at Wan Chai West under FEP-12/364/2009/D

- Construction of Slip Road 1
- Construction of drainage
- Asphalt paving
- Construction of roundabout

Contract no. HY/2010/08 –Central - Wan Chai Bypass (CWB) –Tunnel (Slip Road 8) under FEP-10/364/2009

- Tree protection works next to existing BGO,
- Drainage improvement works,
- Utility diversion works,
- Retaining wall works
- ELS works,
- Construction works for subway extension

Contract no. HY/2011/08 – Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009/E

- Construction of Ventilation Buildings, inclusive of Administration Building, Central Ventilation Building, East Ventilation Shaft/Building, West Ventilation Building
- Application of Thermal Barrier inside the Tunnel, asphalt pavement
- Installation of Electricals and Mechanicals
- Installation of Tunnel Features

1 INTRODUCTION

1.1 Scope of the Report

1.1.1. Lam Geotechnics Limited (LGL) has been appointed to work as the Environmental Team (ET) under Environmental Permit no. EP-364/2009/E and Further Environmental permit nos. FEP-01/364/2009, FEP-02-364/2009, FEP-05/364/2009/A, FEP-06/364/2009/A FEP-07/364/2009/D, FEP-09/364/2009/B, FEP-10/364/2009/B, FEP-11/364/2009/E and FEP-12/364/2009/D to implement the Environmental Monitoring and Audit (EM&A) programme as stipulated in the EM&A Manual of the approved Environmental Impact Assessment (EIA) Report for Wan Chai Development phase II and Central-Wan Chai Bypass (Register No.: AEIAR-125/2008) and in the EM&A Manual of the approved EIA Report for Central-Wan Chai Bypass and Island Eastern Corridor Link (Register No. AEIAR-041/2001).

1.1.2. This report presents the environmental monitoring and auditing work carried out in accordance to the Section 10.3 of EM&A Manual and “*Environmental Monitoring and Audit Requirements*” under Particular Specification Section 27.

1.1.3. This report documents the finding of EM&A works for Environmental Permit (EP) no. EP-364/2009/E, Further Environmental Permit (FEP) nos. FEP-01/364/2009, FEP-02-364/2009, FEP-05/364/2009/A, FEP-06/364/2009/A FEP-07/364/2009/D, FEP-09/364/2009/B, FEP-10/364/2009/B, FEP-11/364/2009/E and FEP-12/364/2009/D during the period [27 February 2018 to 26 March 2018](#).

1.2 Structure of the Report

Section 1 *Introduction* – details the scope and structure of the report.

Section 2 *Project Background* – summarizes background and scope of the project, site description, project organization and contact details of key personnel during the reporting period.

Section 3 *Status of Regulatory Compliance* – summarizes the status of valid Environmental Permits / Licenses during the reporting period.

Section 4 *Monitoring Requirements* – summarizes all monitoring parameters, monitoring methodology and equipment, monitoring locations, monitoring frequency, criteria and respective event and action plan and monitoring programmes.

Section 5 *Monitoring Results* – summarizes the monitoring results obtained in the reporting period.

Section 6 *Compliance Audit* – summarizes the auditing of monitoring results, all exceedances environmental parameters.



- Section 7** *Cumulative Construction Impact due to the Concurrent Projects* – summarizes the relevant cumulative construction impact due to the concurrent activities of the concurrent Projects.
- Section 8** *Environmental Site Audit* – summarizes the findings of weekly site inspections undertaken within the reporting period, with a review of any relevant follow-up actions within the reporting period.
- Section 9** *Complaints, Notification of summons and Prosecution* – summarizes the cumulative statistics on complaints, notification of summons and prosecution
- Section 10** *Conclusion*

2 PROJECT BACKGROUND

2.1 Background

2.1.1. “Wan Chai Development phase II and Central-Wan Chai Bypass” and “Central-Wan Chai Bypass and Island Eastern Corridor Link” (hereafter called “the Project”) are Designated Project (DP) under the Environmental Impact Assessment Ordinance (Cap. 499) (EIAO). The Environmental Impact Assessment (EIA) Reports for Central-Wan Chai Bypass and Island Eastern Corridor Link (Register No. AEIAR-041/2001) and Wan Chai Development phase II and Central-Wan Chai Bypass (Register No.: AEIAR-125/2008) have been approved on 31 August 2001 and 11 December 2008 respectively.

2.1.2. The key purpose of Wan Chai Development Phase II (WDII) is to provide land at Wan Chai North and North Point for construction of the Central-Wan Chai Bypass and Island Eastern Corridor Link (CWB). Land formed under the project will be developed as a world-class waterfront promenade joining that at the new Central waterfront for public enjoyment.

2.1.3. There is a compelling and present need for the CWB to provide relief to the very congested east-west Connaught Road Central/Harcourt Road / Gloucester Road Corridor (the Corridor) which is currently operating beyond its capacity. The CWB will provide relief to the existing congestion along the Corridor and cater for the anticipated growth of traffic on Hong Kong Island. Without the CWB and its access roads, there will not be sufficient capacity to serve the heavy traffic demands at both strategic and local levels.

2.2 Scope of the Project and Site Description

2.2.1. Design and Construction of Central – Wan Chai Bypass and Island Eastern Corridor Link under the Project involves the construction and operation of a trunk road and its road tunnel more than 800m in length between portals that is shown at **Figure 2.1**.

2.2.2. The study area encompasses existing developments from Central to North Point. The scope of the Central-Wanchai Bypass (CWB) and Island Eastern Corridor Link (IECL) includes:

- A dual three-lane trunk road, approximately 4.5 km in length, and tunnel approximately 3.7 km in length defined from the connection with the existing Rumsey Street Flyover in Central, through to a connection with the existing Island Eastern Corridor to the east of the Causeway Bay Typhoon Shelter (CBTS);
- The Central Interchange near the Rumsey Street Flyover to provide road connections to the Central area;
- Tunnel control buildings and ventilation buildings;
- Slip roads to connect the CWB to the local road system in the Wan Chai North and Causeway Bay area;
- Associated road lighting, road signing, traffic control and surveillance system; and
- Other associated works.

2.2.3. The project also contains various Schedule 2 DPs that, under the EIAO, require Environmental Permits (EPs) to be granted by the DEP before they may be either constructed or operated. **Table 2.1** summarises the five individual DPs under this Project. **Figure 2.1** shows the locations of these Schedule 2 DPs.

Table 2.1 Schedule 2 Designated Projects under this Project

Item	Designated Project	EIAO Reference	Reason for inclusion
DP1	Central-Wanchai Bypass (CWB) including its road tunnel and slip roads	Schedule 2, Part I, A.1 and A.7	Trunk road and road tunnel more than 800 m in length
DP2	Road P2 and other roads which are classified as primary/district distributor roads	Schedule 2, Part I, A.1	Primary / district distributor roads
DP3	Reclamation works including associated dredging works	Schedule 2, Part I, C.1 and C.12	Reclamation more than 5 ha in size and a dredging operation less than 100 m from a seawater intake point
DP5	Wan Chai East Sewage Outfall	Schedule 2, Part I, F.5 and F.6	Submarine sewage pipelines with a total diameter more than 1,200 mm and include a submarine sewage outfall
DP6	Dredging for the Cross-harbour Water Mains from Wan Chai to Tsim Sha Tsui	Schedule 2, Part I, C.12	A dredging operation less than 100 m from a seawater intake point

2.3 Division of the Project Responsibility

2.3.1. Due to the multi-contract nature of the Project, there are a number of contracts sub-dividing the whole works area into different work areas to be commenced. Contractors of individual contracts will be required by the EP holder to apply Further Environmental Permits such that the impact monitoring stations are sub-divided accordingly to facilitate the implementation of EM&A programme and to streamline the EM&A reporting for individual FEP holders correspondingly.

2.3.2. The details of individual contracts are summarized in **Table 2.2**.

Table 2.2 Details of Individual Contracts under the Project

Contract No.	Contract Title	Associated DP(s)	Construction Commencement Date
HY/2009/17	Central – Wan Chai Bypass (CWB) at FEHD Whitfield Depot – Advanced piling works.	DP1	5 October 2010 (Completed)
HY/2009/18	Central – Wan Chai Bypass (CWB) – Central Interchange	DP1	21 April 2011
04/HY/2006	Reconstruction of Bus Terminus near Man Yiu Street and Man Kwong Street	DP1	September 2010 (Completed)
HK/2009/01	Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works	DP1, DP2	25 August 2011

Contract No.	Contract Title	Associated DP(s)	Construction Commencement Date
HK/2009/02	Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East(CWB Tunnel)	DP1	26 April 2011
HY/2009/15	Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section)	DP1,DP3	13 July 2011 (Completed)
HY/2009/19	Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link	DP1	24 March 2011
HK/2010/06	Wan Chai Development Phase II-Central-Wan Chai Bypass over MTR Tsuen Wan Line	DP3	22 March 2011 (Completed)
HK/2012/08	Wan Chai Development Phase II-Central-Wan Chai Bypass at Wan Chai West	DP1,DP2, DP3	10 March 2014
HY/2010/08	Central- Wanchai Bypass Tunnel – Tunnel (Slip Road 8)	DP1, DP2, DP3	21 March 2013
HY/2011/08	Central - Wan Chai Bypass (CWB) – Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning	DP1	8 October 2014

2.4 Project Organization and Contact Personnel

2.4.1. Civil Engineering and Development Department and Highways Department are the overall project controllers for the Wan Chai Development Phase II and Central-Wan Chai Bypass respectively. For the construction phase of the Project, Project Engineer, Contractor(s), Environmental Team and Independent Environmental Checker are appointed to manage and control environmental issues.

2.4.2. The proposed project organization and lines of communication with respect to environmental protection works are shown in **Figure 2.2**. Key personnel and contact particulars are summarized in **Table 2.3**.

Table 2.3 Contact Details of Key Personnel

Party	Role	Post	Name	Contact No.	Contact Fax
AECOM	Engineer's Representative for WDII	Principal Resident Engineer	Mr. Frankie Fan	2587 1778	2587 1877
	Engineer's Representative for CWB	Principal Resident Engineer	Mr. Peter Poon	3912 3388	3912 3328
Chun Wo – Leader Joint Venture	Contractor under Contract no. HK/2009/01	Project Manager	Mr. Simon Liu	9304 8355	2587 1878
		Environmental Officer	Mr. Terry Tsang	6683 9394	
Chun Wo – CRGL Joint	Contractor under Contract	Site Agent	Mr. K.K. Yuen	3658-3002	2827 9996



Party	Role	Post	Name	Contact No.	Contact Fax
Venture	no. HK/2009/02	Project Manager	Mr. Paul Yu	3658 3085	
		Environmental Officer	Mr. C.P. Ho	9191 8856	
Chun Wo - CRGL - MBEC_Joint Venture	Contractor under Contract no. HY/2009/19	Project Manager	Mr. David Lau	3758 8879	2570 8013
		Site Agent	Mr. William Luk	9456 9819	
		Deputy Site Agent	Mr. Andy Chan	3758 8879	
		Environmental Officer	Mr. M.H. Isa	3757 8218	
		Assistant Environmental Officer	Mr. James Chan	3757 8217	
Leighton Contractors (Asia) Limited	Contractor under Contract no. HY/2009/18	Site Agent	Mr. Jimmy Chu	3973 0803	2140 6799
		Construction Manager	Mr. Darren Grant	3971 1460	
		Environmental Supervisor	Ms. Penny Yiu	3973 1065	
China State Construction Engineering (HK) Ltd.	Contractor under Contract no. HY/2009/15	Project Director	Mr. Chris Leung	3557 6393	2865 5229
		Site Agent	Mr. Patrick Ho	3557 6405	2566 2192
		Environmental Officer	Mr. Desmond Ho	3557 6347	
China State-Build King JV	Contractor under Contract no. HK/2012/08	Project Director	Mr. C.N. Lai	9137 1811	2877 1522
		Site Agent	Mr. George Cheung	9268 1918	
		Environmental Officer	Mr. James MA	9130 9549	
China State	Contractor under Contract no. HY/2010/08	Project Director	Chris Leung	9210 7116	2566 8061
		Site Agent	Mr. Thomas Lui	3557 6407	
		Environmental Officer	Mr. Gabriel Wong	3557 6466	
Leighton Joint Venture	Contractor under Contract no. HY/2011/08	Site Agent	Mr. Colman Wong	2823 1410	21406799
		Environmental Officer	Mr. Chris Chan	3973 0850	
		Environmental Supervisor	Ms. Penny Yiu	3973 1065	
Ramboll Hong Kong Limited	Independent Environmental Checker (IEC)	Independent Environmental Checker (IEC)	Mr. David Yeung	3465 2888	3465 2899
Lam Geotechnics Limited	Environmental Team (ET)	Environmental Team Leader (ETL)	Mr. Raymond Dai	2882 3939	2882 3331

2.4.3. In this reporting period, the principal work activities of individual contracts are included as follows:

Contract no. HY/2009/18 - Central - Wan Chai Bypass (CWB) - Central Interchange under FEP-05/364/2009/A

- Maintenance works

Contract no. HK/2009/01 - Wan Chai Development Phase II - Central - Wan Chai Bypass at Hong Kong Convention and Exhibition Centre - Tunnel Works under FEP-02/364/2009

- Reinstatement of amenity area

Contract no. HK/2009/02 - Wan Chai Development Phase II - Central - Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

- Joint Inspection with ASD, AECOM and JV for completion of rectification work within the rooms under Staircases
- Water test to the Types 3 and 4 Covered Walkway at West Wing
- New PMMA for the replacement of 8 nos. of damaged PMMA panels
- Preparation for raising the vent shaft, water meters chambers and multi-part covers of P7, P8 and P9
- Drainage work
- Excavation for relocation of temporary fire hydrant PH2582
- Jointed inspection with HKE, AECOM and JV on the new pillar box work
- Remedial works against water leakage inside OHVD cells
- Backfilling behind seawall block
- Steel fixing of Culvert O bay 15A top slab and wall
- Base slab of Culvert O Bay 16A
- Pipe piling work for ELS of Culvert O
- Remedial works against water leakage inside OHVD cells
- Raising of CMS draw pits and caisson wall units access opening covers
- Installation of surface drain cover
- All backfilling works at surface drain trench
- Remedial works for 0.5T rock armor
- Sewage works at Wan Shing Street

Contract no. HY/2009/19 - Central - Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/D

- Approach ramp structure Construction.
- Bridge Construction & installation of enclosure.
- Retaining wall construction.
- FEHD depot re-provision works.
- Oil street drainage works.
- Installation of skin parapet on TB bridge at Pier 15-17.
- Landscape deck, column & pile cap foundation works.
- Watson Road Water mains laying works.
- EVA at EVB.



- Hing Fat Street road and drainage works.
- IEC TD bridge parapet installation.

Contract no. HK/2012/08 – Wan Chai Development Phase II – Central- Wan Chai Bypass at Wan Chai West under FEP-12/364/2009/D

- Construction of Slip Road 1
- Construction of drainage
- Asphalt paving
- Construction of roundabout

Contract no. HY/2010/08 –Central - Wan Chai Bypass (CWB) –Tunnel (Slip Road 8) under FEP-10/364/2009/B

- Tree protection works next to existing BGO,
- Drainage improvement works,
- Utility diversion works,
- Retaining wall works
- ELS works,
- Construction works for subway extension

Contract no. HY/2011/08 –Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009/E

- Construction of Ventilation Buildings, inclusive of Administration Building, Central Ventilation Building, East Ventilation Shaft/Building, West Ventilation Building
- Application of Thermal Barrier inside the Tunnel, asphalt pavement
- Construction of Tunnel Thermal Barrier
- Installation of Electricals and Mechanicals
- Installation of Tunnel Features

2.4.4. In coming reporting period, the principal work activities of individual contracts are anticipated as follows:

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

- Maintenance works

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009

- Reinstatement of amenity area

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

- Provisioned Wan Chai Ferry Pier
- Rectification work for the leakage of covered walkway at Expo Drive East
- Remedial works against water leakage inside OHVD cells.
- Partial removal of TWCR4 to +2.5mPD
- Backfilling works
- Construction of box culvert 'O'
- Temporary works for construction of box culvert 'O'
- Remedial works against water leakage inside OHVD cells.
- Remedial and Outstanding Works inside Tunnel
- Remedial works for damaged caisson seawall under C2
- Remedial works for damaged caisson seawall and CMS under C1
- Modification of levels of caisson seawall access, manhole covers and CMS draw pit covers.
- Construction of surface channel at potion 5
- Remedial work for 0.5 ton armour at WCR3
- Sewage works at Wan Shing Street.

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/D

- Approach ramp structure Construction.
- Bridge Construction & installation of enclosure.
- Retaining wall construction.
- FEHD re-provision works.
- Oil Street drainage works.
- Installation of skin parapet on TB bridge at Pier 15-17.
- Landscape deck, column & pile cap foundation works.
- Watson Road Water mains laying works.
- EVA at EVB.
- Hing Fat Street road and drainage works.
- IEC TD bridge parapet installation.
- Watson Road Cul-de-sac construction.



Contract no. HK/2012/08 – Wan Chai Development Phase II – Central- Wan Chai Bypass at Wan Chai West under FEP-12/364/2009/D

- Construction of Slip Road 1
- Construction of drainage
- Asphalt paving
- Construction of roundabout

Contract no. HY/2010/08 –Central - Wan Chai Bypass (CWB) –Tunnel (Slip Road 8) under FEP-10/364/2009

- Tree protection works next to existing BGO,
- Drainage improvement works,
- Utility diversion works,
- Retaining wall works
- ELS works,
- Construction works for subway extension

Contract no. HY/2011/08 – Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009/E

- Construction of Ventilation Buildings, inclusive of Administration Building, Central Ventilation Building, East Ventilation Shaft/Building, West Ventilation Building
- Application of Thermal Barrier inside the Tunnel, asphalt pavement
- Installation of Electricals and Mechanicals
- Installation of Tunnel Features

3 STATUS OF REGULATORY COMPLIANCE

3.1 Status of Environmental Licensing and Permitting under the Project

3.1.1. A summary of the current status on licences and/or permits on environmental protection pertinent to the Project is shown in **Table 3.1**.

Table 3.1 Summary of the current status on licences and/or permits on environmental protection pertinent to the Project

Permits and/or Licenses	Reference No.	Issued Date	Status
Environmental Permit	EP-356/2009	30 Jul 2009	Valid
Environmental Permit	EP-364/2009/E	22 Dec 2016	Valid
Environmental Permit	EP-376/2009	13 Nov 2010	Valid
Further Environmental Permit	FEP-01/356/2009	18 Feb 2010	Surrendered
Further Environmental Permit	FEP-02/356/2009	24 Mar 2010	Valid
Further Environmental Permit	FEP-03/356/2009	24 Mar 2010	Valid
Further Environmental Permit	FEP-04/356/2009	15 Nov 2010	Valid
Further Environmental Permit	FEP-05/356/2009	24 Mar 2011	Surrendered
Further Environmental Permit	FEP-06/356/2009	5 March 2013	Valid
Further Environmental Permit	FEP-07/356/2009	26 July 2013	Valid
Further Environmental Permit	FEP-01/364/2009	24 Mar 2010	Valid
Further Environmental Permit	FEP-02/364/2009	21 Apr 2010	Valid
Further Environmental Permit	FEP-03/364/2009	12 July 2010	Surrendered
Further Environmental Permit	FEP-04/364/2009/A	14 Oct 2010	Surrendered
Further Environmental Permit	FEP-05/364/2009/A	15 Nov 2010	Valid
Further Environmental Permit	FEP-06/364/2009/A	22 Nov 2010	Valid
Further Environmental Permit	FEP-07/364/2009/D	24 Nov 2015	Valid
Further Environmental Permit	FEP-08/364/2009/A	15 June 2012	Surrendered
Further Environmental Permit	FEP-09/364/2009/B	5 March 2013	Valid
Further Environmental Permit	FEP-10/364/2009/B	26 July 2013	Valid
Further Environmental Permit	FEP-11/364/2009/E	22 Dec 2016	Valid
Further Environmental Permit	FEP-12/364/2009/D	01 Aug 2016	Valid



- 3.1.2. Due to the multi-contract nature of the Project, the status of permits and/or licences under the individual contract(s) are presented as below:

Contract no. HY/2009/17 – Central – Wan Chai Bypass (CWB) at FEHD Whitfield Depot – Advanced piling works under FEP-03/364/2009

- 3.1.3. The construction works was completed and the FEP-03/364/2009 was surrendered by the Contractor on 28 March 2013.

Contract no. 04/HY/2006 – Reconstruction of Bus Terminus near Man Yiu Street and Man Kwong Street under FEP-04/364/2009/A

- 3.1.4. The construction works was completed, and the FEP-04/HY/2006 was surrendered by the Contractor on 11 February 2011.

Contract no. HK/2010/06 - Wan Chai Development Phase II - Central - Wan Chai Bypass over MTR Tsuen Wan Line under FEP-08/364/2009/A

- 3.1.5. The construction works was completed, and the FEP-08/364/2009/A was surrendered by the Contractor on 3 October 2014.

Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A

- 3.1.6. The Construction works under HY/2009/15 was confirm completed by the RSS from 27 October 2017 onwards. The weekly site audit inspection and the associated monitoring station for HY/2009/15 were temporally suspended from 27 October 2017 onwards.

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009

3.1.7. Summary of the current status on licences and/or permits on environmental protection pertinent and submission under FEP-02/364/2009 for contract no. HK/2009/01 are shown in **Table 3.2** and **Table 3.3**.

Table 3.2 Cumulative Summary of Valid Licences and Permits under Contract no. HK/2009/01

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-02/356/2009	24 Mar 2010	N/A	Valid
	FEP-02/364/2009	21 Apr 2010	N/A	Valid
Notification of Works Under APCO	313088	06 Jan 2010	N/A	Valid
Discharge License	WT00024952-2016	06 Jul 2016	31 Jul 2021	Valid
	WT00021138-2015	17 Mar 2014	31 Mar 2020	Valid
Billing account under Waste Disposal Ordinance	7010069	21 Jan 2010	N/A	Valid
Registration as a Chemical Waste Producer	WPN5213-134-C3585-01	21 Jan 2010	N/A	Valid

Table 3.3 Summary of submission status under FEP-02/364/2009

EP Condition	Submission	Date of Submission
Condition 2.7 & 2.8	Works Schedule and Location Plan	18 May 2011
Condition 2.6	Environmental Management Organization Chart	18 May 2011
Condition 1.12	Commencement Date of Works	20 Jun 2011
Condition 2.9	Noise Management Plan	10 Jun 2011
Condition 2.11	Landscape Plan (Rev.5)	25 January 2018

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

3.1.8. Summary of the current status on licences and/or permits on environmental protection pertinent and submission under FEP-01/364/2009 for contract no. HK/2009/02 are shown in **Table 3.4** and **Table 3.5**.

Table 3.4 Cumulative Summary of Valid Licences and Permits under Contract no. HK/2009/02

Permits and/or Licenses	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-03/356/2009	24 Mar 2010	N/A	Valid
	FEP-01/364/2009	24 Mar 2010	N/A	Valid
Notification of Works Under APCO	313962	2 Feb 2010	N/A	Valid
Construction Noise Permit (CNP) for non-piling equipment	GW-RS0756-17	04 Sep 2017	07 Sep 2017 to 28 Feb 2018	Expired
	GW-RS0843-17	28 Sep 2017	07 Oct 2017 to 25 Mar 2018	Expired
	GW-RS0869-17	10 Oct 2017	15 Oct 2017 to 11 Mar 2018	Expired
	GW-RS0884-17	12 Oct 2017	24 Oct 2017 to 23 Apr 2018	Valid
	GW-RS0885-17	12 Oct 2017	14 Oct 2017 to 12 Apr 2018	Cancelled
	GW-RS0159-18	22 Feb 2018	1 Mar 2018 to 31 Aug 2018	Valid
	GW-RS0209-18	22 Feb 2018	16 Mar 2018 to 14 Sep 2018	Valid
Water Discharge License	WT00022295-2015	12 Aug 2015	31 July 2020	Valid
	WT00025276-2016	19 Sep 2016	31 July 2021	Valid
Billing Account under Waste Disposal Ordinance (Land)	7010255	10 Feb 2010	N/A	Valid
Billing Account under Waste Disposal Ordinance (Marine)	7011496	6 Oct 2010	N/A	Valid
Registration as Chemical Waste Producer (Wan Chai)	WPN5213-135-C3593-01	10 Mar 2010	N/A	Valid



Permits and/or Licenses	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Registration as Chemical Waste Producer (TKO 137)	WPN5213-839-C3593-02	22 Sep 2010	N/A	Valid

Table 3.5 Summary of submission status under FEP-01/364/2009

EP Condition	Submission	Date of Submission
Condition 2.7 and 2.8	Works Schedule and Location Plan	14 Jun 2011
Condition 2.6	Environmental Management Organization Chart	14 Jun 2011
Condition 1.12	Commencement Date of Works	21 Jun 2011
Condition 2.11	Landscape Plan (Revision B)	20 Nov 2012
Condition 2.9	Noise Management Plan (Revision B)	13 Jan 2012

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

3.1.9. Summary of the current status on licences and/or permits on environmental protection pertinent and submission under FEP-05/364/2009A for contract no. HY/2009/18 are shown in **Table 3.6** and **Table 3.7**.

Table 3.6 Cumulative Summary of Valid Licences and Permits under Contract no. HY/2009/18

Permit / License / Notification / Approval	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-05/364/2009/A	15 Nov 2010	N/A	Valid
Notification of Works Under APCO	322293	07 Oct 2010	N/A	Valid
Construction Noise Permit (CNP) for non-piling equipment	GW-RS0241-18	27 Mar 2018	29 Mar 2018 to 27 Sep 2018	Valid
'Discharge Licenses	WT00024255-2016	18 May 2016	31 Jan 2021	Valid
Registration as a Chemical Waste Producer	WPN: 8335-121-L1048-04	17 Dec 2010	N/A	Valid
Billing Account under Waste Disposal Ordinance (Land)	Account No.: 7011587	11 Oct 2010	N/A	Valid

Table 3.7 Summary of submission status under FEP-05/364/2009/A

EP Condition	Submission	Date of Submission
Condition 2.9	Noise Management Plan	01 March 2011
Condition 2.10	Landscape Plan (Rev. 6)	19 May 2014

Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A

3.1.10. Summary of the current status on licences and/or permits on environmental protection pertinent and submission under FEP-06/364/2009/A for contract no. HY/2009/15 are shown in **Table 3.8** and **Table 3.9**.

Table 3.8 Cumulative Summary of Valid Licences and Permits under Contract no. HY/2009/15

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-06/364/2009/A	22 Nov 2010	N/A	Valid
	FEP-04/356/2009	22 Nov 2010	N/A	Valid
Notification of Works Under APCO	321822	24 Sep 2010	N/A	Valid
Registration as a Chemical Waste Producer	WPN: 5213-147-C1169-35	15 Nov 2010	N/A	Valid
Billing Account under Waste Disposal Ordinance	7011553	30 Sep 2010	N/A	Valid
Construction Noise Permit	N/A	N/A	N/A	N/A
Water Discharge License (Discharge at TS1)	WT00024874-2016	20 Jul 2016	20 Jul 2016 to 31 Mar 2021	Valid

Table 3.9 Summary of submission status under FEP-06/364/2009/A

EP Condition	Submission	Date of Submission
Condition 2.6	Management Organization of Main Construction Companies	11 Mar 2011
	Amendment for Management Organization of Main Construction Companies	16 May 2011
Condition 2.7	Works Schedule	15 Mar 2011
Condition 2.8	Location Plan	15 Mar 2011
Condition 2.9	Noise Management Plan	6 May 2011
Condition 2.10	Landscape Plan (Rev.5)	25 Jan 2018

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/D

3.1.11. The current status on licences and/or permits on environmental protection pertinent and submission under FEP-07/364/2009/D for contract no. HY/2009/19 are shown in **Table 3.10** and **Table 3.11**.

Table 3.10 Cumulative Summary of Valid Licences and Permits under Contract no. HY/2009/19

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-07/364/2009/D	24 Nov 2015	N/A	Valid
Notification of Works Under APCO	326160	24 Jan 2011	N/A	Valid
Registration as a Waste Producer	7012306	10 Feb 2011	N/A	Valid
Registration as Chemical Waste Producer	5213-151-C3654-01	24 Mar 2011	N/A	Valid
Application for Vessel Disposal	7012306	21 July 2011	N/A	Valid
Construction Noise Permits (CNP) for non-piling equipment	GW-RS0021-18	12 Jan 2018	14 Jan 2018 to 03 Jul 2018	Cancelled
	GW-RS0128-18	15 Feb 2018	17 Feb 2018 to 14 Aug 2018	Cancelled
	GW-RS0127-18	15-Feb-18	17 Feb 2018 to 14 Aug 2018	Valid
	GW-RS1150-17	22 Dec 2017	28 Dec 2017 to 27 Jun 2018	Valid
	GW-RS0124-18	15 Feb 2018	17 Feb 2018 to 14 May 2018	Valid
	GW-RS0225-18	16-Mar-18	18 Mar 2018 to 14 Sep 2018	Cancelled
	GW-RS0069-18	26 Jan 2018	30 Jan 2018 to 25 Apr 2018	Cancelled
	GW-RS0093-18	30 Jan 2018	02 Feb 2018 to 28 Apr 2018	Cancelled
	GW-RS0157-18	15 Feb 2018	19 Feb 2018 to 11 Mar 2018	Expired
	GW-RS0203-18	08-Mar-18	12 Mar 2018 to 11 Jun 2018	Valid
Water Discharge License	WT00025282-2016	15 Sep 2016	30 Sep 2021	Valid

Table 3.11 Summary of submission status under FEP-07/364/2009/D

EP Condition	Submission	Date of Submission
Condition 2.13	Landscape Plan (Rev.6)	29 August 2017
Condition 2.9	Noise Management Plan (Rev.4)	07 December 2017

Contract no. HK/2012/08 – Wan Chai Development Phase II – Central- Wan Chai Bypass at Wan Chai West under FEP-12/364/2009/D

3.1.12. The current status on licences and/or permits on environmental protection pertinent and submission under FEP-12/364/2009/D for contract no. HK/2012/08 showed in **Table 3.12 and Table 3.13**.

Table 3.12 Cumulative Summary of Valid Licences and Permits under Contract no. HK/2012/08

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-09/364/2009/B	5 Mar 2013	N/A	Valid
	FEP-12/364/2009/D	1 Aug 2016	N/A	Valid
	FEP-06/356/2009	05 Mar 2013	N/A	Valid
Notification of Works Under APCO	355439	4 Feb 2013	N/A	Valid
Registration as a Chemical Waste Producer	5213-134-C3790-01	30 Jun 2016	N/A	Valid
Billing Account under Waste Disposal Ordinance	7016883	18 Feb 2013	N/A	Valid
Construction Noise Permit (CNP) for non-piling equipment	GW-RS0181-18	23 Feb 2018	26 Feb 2018 to 25 Aug 2018	Valid
	GW-RS1163-17	28 Dec 2017	13 Jan 2018 to 12 Jul 2018	Valid
	GW-RS0098-18	08 Feb 2018	13 Feb 2018 to 06 Apr 2018	Valid
	GW-RS0052-18	24 Jan 2018	26 Jan 2018 to 28 Feb 2018	Expired
Water Discharge License	WT00020594-2014	22 Dec 2014	31 Jan 2019	Valid

Table 3.13 Summary of submission status under FEP-12/364/2009/D

EP Condition	Submission	Date of Submission
Condition 2.9	Noise Management Plan (Rev.2)	9 July 2013
Condition 2.14	Landscape Plan (Rev.4)	24 August 2015

Contract no. HY/2010/08 –Central – Wanchai Bypass Tunnel – Tunnel (Slip Road 8) under FEP-10/364/2009/B

- 3.1.13. The current status on licences and/or permits on environmental protection pertinent and submission under FEP-10/364/2009/B for contract no. HK/2012/08 showed in **Table 3.14 and Table 3.15.**

Table 3.14 Cumulative Summary of Valid Licences and Permits under Contract no. HY/2010/08

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-10/364/2009/B	26 Jul 2013	NA	Valid
	FEP-07/356/2009	26 Jul 2013	NA	Valid
Notification of Works Under APCO	357176	2013-04-02	NA	Valid
Registration as a Chemical Waste Producer	WPN5213-147-C1169-44	2013-03-27	NA	Valid
Billing Account under Waste Disposal Ordinance	7017170	2013-03-27	NA	Valid
Water Discharge License	WT00020468-2014	03 Dec 2017	31 Jul 2018	Valid
Construction Noise Permit (CNP) for non-piling equipment	GW-RS1205-17	5 Jan 2018	08 Jan 2018 to 02 Jul 2018	Valid
	GW-RS1194-17	5 Jan 2018	08 Jan 2018 to 01 Jul 2018	Valid
	GW-RS1091-17	7 Dec 2017	09 Dec 2017 to 05 Jun 2018	Valid
	GW-RS0047-18	24 Jan 2018	29 Jan 2018 to 28 Jul 2018	Valid
	GW-RS0905-17	17 Oct 2017	19 Oct 2017 to 18 Apr 2018	Valid
	GW-RS1030-17	23 Nov 2017	01 Dec 2017 to 27 May 2018	Valid
	GW-RS0194-18	14 Mar 2018	14 Mar 2018 to 11 Sep 2018	Valid
	GW-RW0536-17	10 Oct 2017	26 Oct 2017 to 24 Apr 2018	Valid

Table 3.15 Summary of submission status under FEP-10/364/2009/B

EP Condition	Submission	Date of Submission
Condition 2.9	Noise Management Plan (Rev.3)	03 January 2014
Condition 2.14	Landscape Plan (Rev.2)	19 May 2014
Condition 2.16	Additional Mitigation Plan (Rev.2)	18 February 2015



Contract no. HY/2011/08 –Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009/E

3.1.14. The current status on licenses and/or permits on environmental protection pertinent and submission under FEP-11/364/2009/E for contract no. HY/2011/08 showed in **Table 3.16 and Table 3.17.**

Table 3.16 Cumulative Summary of Valid Licences and Permits under Contract no. HY/2011/08

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-11/364/2009/E	22 Dec 2016	N/A	Valid
Notification of Works Under APCO	LCAC-EN-LE-00017	7 Mar 2014	N/A	Valid
Registration as a Chemical Waste Producer	5213-121-L2837-01	19 Apr 2016	N/A	Valid
	5213-151-L2837-02	24 May 2016	N/A	Valid
	5213-134-L2898-01	16 Nov 2015	N/A	Valid
	5213-134-L2952-01	12 May 2017	N/A	Valid
Billing Account under Waste Disposal Ordinance	7019640	27 Mar 2014	N/A	Valid
Construction Noise Permit (CNP) for non-piling equipment	GW-RS0005-18	09 Jan 2018	11 Jan 2018 to 26 Mar 2018	Expired
	GW-RS0034-18	19 Jan 2018	28 Jan 2018 to 15 Jul 2018	Valid
	GW-RS-0058-18	26 Jan 2018	01 Feb 2018 to 31 Jul 2018	Valid
	GW-RS0063-18	26 Jan 2018	01 Feb 2018 to 31 Jul 2018	Valid
	GW-RS0144-18	06 Feb 2018	24 Feb 2018 to 23 Aug 2018	Valid
	GW-RS0164-18	23 Feb 2018	01 Mar 2018 to 31 Aug 2018	Valid
	GW-RS0171-18	23 Feb 2018	27 Feb 2018 to 26 Aug 2018	Valid
	GW-RS0887-17	12 Oct 2017	14 Oct 2017 to 31 Mar 2018	Cancelled
	GW-RS0930-17	26 Oct 2017	01 Nov 2017 to 30 Apr 2018	Valid
	GW-RS0935-17	26 Oct 2017	01 Nov 2017 to 30 Apr 2018	Valid



Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
	GW-RS0948-17	26 Oct 2017	01 Nov 2017 to 30 Apr 2018	Valid
	GW-RS0956-17	01 Nov 2017	03 Nov 2017 to 30 Apr 2018	Cancelled
	GW-RS1047-17	28 Nov 2017	01 Dec 2017 to 31 May 2018	Valid
	GW-RS1048-17	28 Nov 2017	01 Dec 2017 to 31 May 2018	Valid
	GW-RS1051-17	28 Nov 2017	01 Dec 2017 to 31 May 2018	Valid
	GW-RS1053-17	28 Nov 2017	30 Nov 2017 to 28 Apr 2018	Cancelled
	GW-RS1202-17	02 Jan 2018	4 Jan 2017 to 30 Jun 2018	Cancelled
	GW-RS1203-17	03 Jan 2018	06 Jan 2017 to 30 Jun 2018	Valid
	GW-RS1204-17	03 Jan 2018	06 Jan 2017 to 30 Jun 2018	Valid
	GW-RS0183-18	28 Feb 18	27 Feb 2018 to 01 Aug 2018	Valid
	GW-RS0240-18	27 Mar 18	30 Mar 2018 to 08 Apr 2018	Valid
	GW-RS0257-18	27 Mar 18	01 Apr 2018 to 30 Sep 2018	Valid
Water Discharge License	WT00022046-2015	15 Jul 2015	31 Jul 2019	Valid
	WT00022753-2015	22 Jun 2017	30 Apr 2021	Valid
	WT00024561-2016	30 May 2016	31 May 2021	Valid
	WT00025858-2016	17 Oct 2016	31 Oct 2021	Valid
	WT00026829-2017	14 Jun 2017	31 Jan 2022	Valid
	WT00027343-2017	01 Mar 2017	31 Mar 2022	Valid
	WT00028343-2017	09 Aug 2017	31 Aug 2022	Valid

Table 3.17 Summary of submission status under FEP-11/364/2009/E

EP Condition	Submission	Date of Submission
Condition 2.9	Noise Management Plan (Rev.4)	08 Nov 2016
Condition 2.14	Landscape Plan (Rev.2)	18 Feb 2015
Condition 2.13 a)	Operational Air Quality Management Plan for West Ventilation Building (Rev.0)	25 Nov 2014
Condition 2.13 b)	Operational Air Quality Management Plan for Central Ventilation Building (Rev.0)	03 Mar 2017
Condition 2.13 c)	Operational Air Quality Management Plan for East Ventilation Building and East Vent Shaft (Rev.0)	18 Feb 2015
Condition 2.13 d)	Operational Air Quality Management Plan for an Electrostatic Precipitator system for EVB Operation (Rev.0)	06 Apr 2017
Condition 2.13 e)	Operational Air Quality Management Plan for ventilation system of Eastern Portal of the CWB Tunnel (Rev.0)	23 Oct 2016

4 MONITORING REQUIREMENTS

4.1 Noise Monitoring

NOISE MONITORING STATIONS

- 4.1.1. The noise monitoring stations for the Project are listed and shown in **Table 4.1** and **Figure 4.1**. **Appendix 4.1** shows the established Action/Limit Levels for the monitoring works.

Table 4.1 Noise Monitoring Stations

Station	Description
M1a***	Footbridge for Ex-Harbour Road Sports Centre
M2b	Noon-day Gun Area
M3a	Tung Lo Wan Fire Station
M4b	Victoria Centre
M5b	City Garden
M6	HK Baptist Church Henrietta Secondary School
M7e*	International Finance Centre (Eastern End of Podium)
M7w	International Finance Centre (Western End of Podium)
M8**	City Hall

Remark *: Location ID has been updated from M7 to M8 for City Hall

Remark **: M7e has become a reference station starting from 7 Aug 2012

Remarks***: The location ID of monitoring station M1a was updated as "Footbridge for Ex-Harbour Road Sports Centre" in May 2017.

REAL TIME NOISE MONITORING STATIONS

- 4.1.2. The noise monitoring stations for the Project are listed and shown in **Table 4.2** and **Figure 4.1**. **Appendix 4.1** shows the established Action/Limit Levels for the monitoring works.

Table 4.2 Real Time Noise Monitoring Stations

District	Station	Description
Tin Hau	RTN1	FEHD Hong Kong Transport Section Whitfield Depot
North Point	RTN2a	Hong Kong Electric Centre
North Point	RTN3	Po Leung Kuk Yu Lee Mo Fan Memorial School
Tin Hau	RTN4	Causeway Bay Community Centre

NOISE MONITORING PARAMETERS, FREQUENCY AND DURATION

- 4.1.3. The construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level (L_{eq}). $L_{eq(30\text{ minutes})}$ shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays. For all other time periods, $L_{eq(5\text{ minutes})}$ shall be employed for comparison with the Noise Control Ordinance (NCO) criteria. Supplementary information for data auditing, statistical results such as L_{10} and L_{90} shall also be obtained for reference.
- 4.1.4. Noise monitoring shall be carried out at all the designated monitoring stations. The monitoring frequency shall depend on the scale of the construction activities. The following is an initial guide on the regular monitoring frequency for each station on a weekly basis when noise generating activities are underway:
- One set of measurements between 0700 and 1900 hours on normal weekdays.
- 4.1.5. Real time noise shall be carried out at the designated monitoring stations. The following is an initial guide on the regular monitoring frequency for each station on a 24 - hours basis when noise generating activities are underway:
- One set of measurements between 0700 and 1900 hours on normal weekdays.
 - One set of measurements between 1900 and 2300 hours on normal weekdays and 0700 and 2300 hours on public holidays.
 - One set of measurements between 2300 and 0700 hours on next day on everyday.
- 4.1.6. If construction works are extended to include works during the hours of 1900 – 0700 as well as public holidays and Sundays, additional weekly impact monitoring shall be carried out during respective restricted hours periods. Applicable permits under NCO shall be obtained by the Contractor.

MONITORING EQUIPMENT

- 4.1.7. As referred to in the Technical Memorandum TM issued under the NCO, sound level meters in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications shall be used for carrying out the noise monitoring. Immediately prior to and following each noise measurement the accuracy of the sound level meter shall be checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements may be accepted as valid only if the calibration level from before and after the noise measurement agree to within 1.0 dB.
- 4.1.8. Noise measurements shall not be made in fog, rain, wind with a steady speed exceeding 5 m/s or wind with gusts exceeding 10 m/s. The wind speed shall be checked with a portable wind speed meter capable of measuring the wind speed in m/s.
- 4.1.9. The sound level meter shall be checked using an acoustic calibrator generating a known sound pressure level at a known frequency before deployment to the site and during each site visit. Measurements will be accepted as valid only if the calibration level from before and after the noise measurement agree to within 1.0 dB.

4.2 Air Quality Monitoring

AIR QUALITY MONITORING STATIONS

- 4.2.1. The air quality monitoring stations for the Project are listed and shown in **Table 4.3 and Figure 4.1. Appendix 4.1** shows the established Action/Limit Levels for the monitoring works.

Table 4.3 Air Quality Monitoring Stations

Station ID	Monitoring Location	Description
CMA1b	Harbour Grand Hotel Boundary Wall**	North Point (Re-commenced on 14 November 2011)
CMA2a	Causeway Bay Community Centre	Causeway Bay
CMA3a	CWB PRE Site Office *	Causeway Bay
CMA4a	Society for the Prevention of Cruelty to Animals	Wan Chai
CMA5b	Pedestrian Plaza***	Wan Chai
MA1e	International Finance Centre (Eastern End of Podium)	Central
MA1w	International Finance Centre (Western End of Podium)	Central

Remarks*: As per the ENPC meeting in March 2011, the monitoring stations CMA3a – Future CWB site office at Wanchai Waterfront Promenade was renamed as remark.

Remarks**: The location ID of monitoring station CMA1b was updated as “Oil Street Site Office” in April 2013. The location ID of monitoring station CMA1b was updated as “Harbour Grand Hotel Boundary Wall” with respect to the fine adjustment of monitoring station from the Oil Street Site Office to Harbour Grand Hotel Boundary Wall from 05 June 2017 onwards due to demolition of Oil Street Site Office.

Remarks***: The station ID and monitoring location was updated in December 2014 with respect to monitoring station relocation.

AIR QUALITY MONITORING PARAMETERS, FREQUENCY AND DURATION

- 4.2.2. One-hour and 24-hour TSP levels should be measured to indicate the impacts of construction dust on air quality. The 24-hour TSP levels shall be measured by following the standard high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50), Appendix B.
- 4.2.3. All relevant data including temperature, pressure, weather conditions, elapsed-time meter reading for the start and stop of the sampler, identification and weight of the filter paper, and any other local atmospheric factors affecting or affected by site conditions, etc., shall be recorded down in detail.
- 4.2.4. For regular impact monitoring, the sampling frequency of at least once in every six days, shall be strictly observed at all the monitoring stations for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least three times in every six days should be undertaken when the highest dust impact occurs.

SAMPLING PROCEDURE AND MONITORING EQUIPMENT

- 4.2.5. High volume samplers (HVSs) in compliance with the following specifications shall be used for carrying out the 1-hour and 24-hour TSP monitoring:
- 0.6 – 1.7 m³ per minute adjustable flow range;
 - Equipped with a timing / control device with +/- 5 minutes accuracy for 24 hours operation;
 - Installed with elapsed-time meter with +/- 2 minutes accuracy for 24 hours operation;
 - Capable of providing a minimum exposed area of 406 cm²;
 - Flow control accuracy: +/- 2.5% deviation over 24-hour sampling period;
 - Equipped with a shelter to protect the filter and sampler;
 - Incorporated with an electronic mass flow rate controller or other equivalent devices;
 - Equipped with a flow recorder for continuous monitoring;
 - Provided with a peaked roof inlet;
 - Incorporated with a manometer;
 - Able to hold and seal the filter paper to the sampler housing at horizontal position;
 - Easily changeable filter; and
 - Capable of operating continuously for a 24-hour period.
- 4.2.6. Initial calibration of dust monitoring equipment shall be conducted upon installation and thereafter at bi-monthly intervals. The transfer standard shall be traceable to the internationally recognized primary standard and be calibrated annually. The concern parties such as IEC shall properly document the calibration data for future reference. All the data should be converted into standard temperature and pressure condition.

LABORATORY MEASUREMENT / ANALYSIS

- 4.2.7. A clean laboratory with constant temperature and humidity control, and equipped with necessary measuring and conditioning instruments to handle the dust samples collected, shall be available for sample analysis, and equipment calibration and maintenance. The laboratory should be HOKLAS accredited.
- 4.2.8. Filter paper of size 8" x 10" shall be labelled before sampling. It shall be a clean filter paper with no pinholes, and shall be conditioned in a humidity-controlled chamber for over 24 hours and be pre-weighed before use for the sampling.
- 4.2.9. After sampling, the filter paper loaded with dust shall be kept in a clean and tightly sealed plastic bag. The filter paper shall then be returned to the laboratory for reconditioning in the humidity controlled chamber followed by accurate weighing by an electronic balance with readout down to 0.1 mg. The balance shall be regularly calibrated against a traceable standard.
- 4.2.10. All the collected samples shall be kept in a good condition for 6 months before disposal.
- 4.2.11. Current calibration certificates of equipments are presented in **Appendix 4.2.**

5 MONITORING RESULTS

5.0.1. The environmental monitoring will be implemented based on the division of works areas of each designated project managed under different contracts with separate FEP applied by individual contractors. Overall layout showing work areas of various contracts, latest status of work commencement and monitoring stations is shown in **Figure 2.1** and **Figure 4.1**. The monitoring results are presented in according to the Individual Contract(s).

5.0.2. In the reporting period, the concurrent contracts are as follows:

- Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section)
- Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange
- Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link
- Contract no. HY/2010/08 – Central- Wanchai Bypass Tunnel (Slip Road 8 Section)
- Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre
- Contract no. HK/2009/02 - Wan Chai Development Phase II – Central - Wan Chai Bypass at Wan Chai East
- Contract no. HK/2012/08 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai West
- Contract no. HY/2011/08 – Central - Wan Chai Bypass (CWB)– Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning

5.0.3. The environment monitoring schedules for reporting period and coming month are presented in **Appendix 5.1**.

5.1 Noise Monitoring Results

5.1.1 Monitoring for report of review baseline noise level was performed from 11 April 2011 to 8 June 2011. Then the report was submitted on the 20 June 2011, verified by IEC on 18 July 2011 and was approved by ER by January 2012. The new baseline is used for the noise calculation starting from January 2012.

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

5.1.2 Noise monitoring for the Central Interchange works under contract no. HY/2009/18 was commenced on 22 April 2011. The proposed division of noise monitoring stations for Contract no. HY/2009/18 are summarized in **Table 5.1** below:

Table 5.1 Noise Monitoring Stations for Contract no. HY/2009/18

Station	Description
*M7e	International Finance Centre (Eastern End of Podium)
M7w	International Finance Centre (Western End of Podium)
M8	City Hall

* Remark: M7e has become a reference station starting from 7 Aug 2012

5.1.3 No action or limit level exceedance was recorded in this reporting period.

5.1.4 Noise monitoring results measured in this reporting period are reviewed and summarized. Details of noise monitoring results and graphical presentation can be referred in **Appendix 5.2**.

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009 and Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

5.1.5 The commencement of construction works for Contract no. HK/2009/01 under FEP-02/364/2009 is on 25 August 2011 and HK/2009/02 under FEP-01/364/2009 is on 26 April 2011. The proposed division of noise monitoring stations are summarized in **Table 5.2** below.

Table 5.2 Noise Monitoring Station for Contract no HK/2009/01 and HK/2009/02

Station	Description
M1a	Footbridge for Ex-Harbour Road Sports Centre

5.1.6 No action or limit level exceedance was recorded in this reporting period.

5.1.7 Noise monitoring results measured in this reporting period are reviewed and summarized. Details of noise monitoring results and graphical presentation can be referred in **Appendix 5.2**.

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/D

5.1.8 Noise monitoring for the tunnel works under contract no. HY/2009/19 was commenced on 24 April 2011. The proposed division of noise monitoring stations are summarized in **Table 5.4** below.

Table 5.4 Noise Monitoring Stations for Contract no. HY/2009/19

Station	Description
M4b	Victoria Centre
M5b	City Garden
M6	HK Baptist Church Henrietta Secondary School

5.1.9 One limit level exceedance was recorded at M6 HK Baptist Church Henrietta Secondary School on 06 March 2018 in this reporting period.

5.1.10 After checking with Contractor of HY/2009/19, concurrent saw cutting works and breaking works was conducted opposite to the monitoring location and the above construction works were observed as the major noise contribution during monitoring. As such, the exceedances were considered as Project related.

5.1.11 Remedial actions including saw cutting works alone without concurrent operation of breaker and provision of additional temporary noise barrier for cutting works were implemented by the Contractor and no further exceedances was recorded during the additional monitoring on 08 March 2018. The Contractor of HY/2009/19 was advised to avoid future concurrent operation of major noise emanating works such as breaking and saw cutting works to avoid potential cumulative impact.

5.1.12 One action level exceedance regarding noise emanation on 12 March 2018 under Contract HY/2009/19 was referred to the Environmental Team on 27 March 2018.

5.1.13 After investigation, the exceedance was found to be related to the breaking works conducted on IECL around YLMF memorial school and Wharf Road causing noise nuisance to the nearby receivers.

5.1.14 According to ET follow up checking, the following enhancement measures were proposed and implemented by the Contractor by 16 March 2018 including provide additional temporary noise barrier and repair damaged or incomplete temporary noise barrier installed for the breaking works, provide additional acoustics screen to the breaking tip in addition to temporary noise barrier installed, provide covering of breaker tip with acoustic material for noise reduction and conduct breaking works intermittently.

- 5.1.15 Noise monitoring results measured in this reporting period are reviewed and summarized. Details of noise monitoring results and graphical presentation can be referred in **Appendix 5.2**. Details of the Notification of Exceedance can be referred in **Appendix 6.2**.

Contract no. HY/2010/08 – Central-Wanchai Bypass –Wanchai Bypass Tunnel (Slip Raod 8 Section) under FEP-12/364/2009/D

- 5.1.16 The commencement of construction works for Contract no. HY/2010/08 under FEP-10/364/2009/B was on 02 September 2013. Noise monitoring was commenced on 02 September 2013. The proposed divisions of noise monitoring stations are summarized in **Table 5.5** below.

Table 5.5 Noise Monitoring Stations for Contract no. HY/2010/08

Station	Description
M2b	Noon Gun Area
M3a	Tung Lo Wan Fire Station

- 5.1.17 No action or limit level exceedance was recorded in this reporting period.
- 5.1.18 Noise monitoring results measured in this reporting period are reviewed and summarized. Details of noise monitoring results and graphical presentation can be referred in **Appendix 5.2**.

Contract no. HY/2011/08 – Central - Wan Chai Bypass (CWB) – Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning

- 5.1.19 Noise monitoring for the Central Interchange works under contract no. HY/2011/08 was commenced on 22 April 2011. The proposed division of noise monitoring stations for Contract no. HY/2011/08 are summarized in **Table 5.6** below:

Table 5.6 Noise Monitoring Stations for Contract no. HY/2011/08

Station	Description
M4b	Victoria Centre
*M7e	International Finance Centre (Eastern End of Podium)
M7w	International Finance Centre (Western End of Podium)
M8	City Hall

* Remark: M7e has become a reference station starting from 7 Aug 2012

- 5.1.20 No action or limit level exceedance was recorded in this reporting period.
- 5.1.21 Noise monitoring results measured in this reporting period are reviewed and summarized. Details of noise monitoring results and graphical presentation can be referred in **Appendix 5.2**.

5.2 Real Time Noise Monitoring Results

- 5.2.1. Real time noise monitoring at RTN4-Causeway Bay Community Centre was commenced on 13 Jan 2013. The baseline noise level of RTN4- Causeway Bay Community Centre has adopted the results from the baseline noise monitoring report for EP/364/2009 in 22 April 2010 in which approved by EPD.
- 5.2.2. Po Leung Kuk Yu Lee Mo Fan Memorial School granted permission for set up on 4 Sep 2012 and real time noise monitoring station RTN3 set up was performed on 14 Sep 2012. Real time noise baseline capturing was conducted during time period without construction work from 21 Sep 2012 to 04 Oct 2012. Real time noise monitoring at RTN3 – Po Leung Kuk Yu Lee Mo Fan Memorial School was commenced since 06 Oct 2012.
- 5.2.3. Real-time noise monitoring station RTN2 previously located at oil Street Community Liaison Centre was relocated to Hong Kong Electric Centre on 5 Oct 2012, which is a representative of the noise sensitive receiver City Garden. The baseline noise level of RTN2a will adopt the results derived from the baseline noise monitoring conducted at Hong Kong Electric Centre from 4 December 2009 to 17 December 2009.
- 5.2.4. Real-time noise monitoring station RTN1-FEHD Whitfield Depot was finely adjusted from 2/F to roof-top at FEHD Whitfield Depot on 24 June 2013 with respect to the commencement of advance works for IEC parapet demolition.
- 5.2.5. With respect to the non-CWB Project building construction at Oil Street, the real-time noise monitoring station RTN2a- Hong Kong Electric Centre was finely adjusted from Northeast Side to Northwestern side at Roof Top location on 03 March 2017.

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/D

- 5.2.6. The proposed division of noise monitoring stations are summarized in **Table 5.7** below. Real time noise monitoring for major construction works under contract no. HY/2009/19 was commenced on 24 April 2011.

Table 5.7 Real Time Noise Monitoring Stations for Contract no. HY/2009/19

Location ID	District	Description
RTN1	Tin Hau	FEHD Hong Kong Transport Section Whitfield Depot
RTN2a	North Point	Hong Kong Electric Centre
RTN3	North Point	Po Leung Kuk Yu Lee Mo Fan Memorial School
RTN4	Tin Hau	Causeway Bay Community Centre

** Real time noise monitoring results and graphical presentation during restrict hours and night time period are for information only and noise during CNP period shall be controlled under NCO.*

- 5.2.7. No limit level exceedance was recorded at RTN1 - FEHD Hong Kong Transport Section Whitfield Depot in the reporting period.
- 5.2.8. Limit level exceedances were recorded at RTN2a - Hong Kong Electric Centre on 22, 23 and 24 March 2018 in the reporting period.
- 5.2.9. After checking with the Contractor of HY/2009/19, rebar fixing, concrete chipping and removal of scaffolding was conducted on 22 March 2018 while concreting and removal of scaffolding were conducted on 23 March 2018 and soil compaction and rebar fixing were conducted on 24 March 2018 and no major noise emanation were considered for the above construction works. In addition, chiller plant maintenance and repair work was observed conducted at HKE roof top near the monitoring station was observed across the above exceedances period and considered as the major noise contribution. As such, the exceedances were considered as non-Project related.
- 5.2.10. Limit level exceedances were recorded at RTN3 - Yu Lee Mo Fan Memorial School was recorded on 27 February, 01, 02, 03, 05, 06, 07, 09, 10, 12, 14, 15, 16, 20, 21, 22, 23 and 24 March 2018.
- 5.2.11. After checking with Contractor of HY/2009/19, breaking works with hand held breakers was conducted on 27 February 2018 within the noise enclosure and no major noise emanation is considered from the above works behind the noise enclosure and the exceedance was non-continuous despite the on-going construction works. As such, the exceedance recorded was considered as non-Project related.
- 5.2.12. After checking with Contractor of HY/2009/19, breaking works were conducted on 01, 02, 05, 06, 07, 09, 10, 12, 14, 15, 16, 20, 21, 22, 23 and 24 March 2018 and environmental deficiencies including i) inadequate extend of temporary noise barrier for shielding the line of sight to nearby sensitive receiver and ii) insufficient noise screening for breaking or saw cutting and iii) continuous breaking works without intermittence were found to be the major contribution to the measured noise level and hence the exceedances were considered as Project related.
- 5.2.13. Based on the review of the site arrangement, extent of construction operation and the associated PME required for the works, overall enhancement and remedial actions including i) provision of additional temporary noise barrier, ii) repairing of damaged or incomplete temporary noise barrier installed for the breaking works, iii) provision of additional acoustics screen to the breaking tip in addition to temporary noise barrier installed, iv) covering of breaker tip with acoustic material for noise reduction and conduct breaking works intermittently were advised for Contractors implementation to mitigate the noise impact recorded at the concerned monitoring station upon identification of exceedance and the Contractor was advised to refrain from the impact associated construction works prior to the implementation of the remedial/ enhancement and confirmation of the implementation of the mitigation measure. As confirmed with the Contractor, the concerned construction works was completed as of 26 March 2018 and no further exceedance was recorded.



- 5.2.14. No limit level exceedance was recorded at RTN4- Causeway Bay Community Centre was recorded in the reporting period.
- 5.2.15. Real time noise monitoring results measured in this reporting period are reviewed and summarized. Details of real time noise monitoring results and graphical presentation can be referred to **Appendix 5.4.**

Contract no. HY/2011/08 – Central - Wan Chai Bypass (CWB) – Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning

5.2.16. The proposed division of noise monitoring stations are summarized in **Table 5.8** below. Real time noise monitoring for major construction works under contract no. HY/2011/08 was commenced on 19 March 2015.

Table 5.8 Real Time Noise Monitoring Stations for Contract no. HY/2011/08

Location ID	District	Description
RTN1	Tin Hau	FEHD Hong Kong Transport Section Whitfield Depot
RTN2a	North Point	Hong Kong Electric Centre
RTN4	Tin Hau	Causeway Bay Community Centre

**Real time noise monitoring results and graphical presentation during restrict hours and night time period are for information only and noise during CNP period shall be controlled under NCO.*

- 5.2.17. No limit level exceedance was recorded at RTN1 - FEHD Hong Kong Transport Section Whitfield Depot in the reporting period.
- 5.2.18. Limit level exceedances were recorded at RTN2a - Hong Kong Electric Centre on 22, 23 and 24 March 2018 in the reporting period.
- 5.2.19. After checking with the Contractor of HY/2011/08, architectural builders work and finishes, drainage and external works were conducted on 22, 23 and 24 March 2018 and no major noise emanation were considered for the above construction works. In addition, chiller plant maintenance and repair work was observed conducted at HKE roof top near the monitoring station was observed across the above exceedances period and considered as the major noise contribution. As such, the exceedances were considered as non-Project related.
- 5.2.20. No limit level exceedance was recorded at RTN4 - Causeway Bay Community Centre in the reporting period.

5.3 Air Quality Monitoring Results

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

5.3.1 Air quality monitoring for the Central Interchange works under contract no. HY/2009/18 was commenced on 21 April 2011. The proposed division of air quality monitoring stations are summarized in **Table 5.9** below.

Table 5.9 Air Quality Monitoring Stations for Contract no. HY/2009/18

Station	Description
MA1e	International Finance Centre (Eastern End of Podium)
MA1w	International Finance Centre (Western End of Podium)

5.3.2 No exceedance was recorded in the reporting period.

5.3.3 Air quality monitoring results measured in this reporting period are reviewed and summarized. Details of air quality monitoring results and graphical presentation can be referred in **Appendix 5.3**.

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009

5.3.4 The commencement of construction works for Contract no. HK/2009/01 under FEP-02/364/2009 is on 25 August 2011. Air quality monitoring was commenced on 25 August 2011. The proposed division of air quality monitoring stations are summarized in **Table 5.10** below.

Table 5.10 Air Quality Monitoring Station for Contract no. HK/2009/01

Station	Description
CMA5b	Pedestrian Plaza

5.3.5 No exceedance was recorded in the reporting period.

5.3.6 Air quality monitoring results measured in this reporting period are reviewed and summarized. Details of air quality monitoring results and graphical presentation can be referred in **Appendix 5.3**.

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

5.3.7 The commencement of construction works for HK/2009/02 under FEP-01/364/2009 is on 26 April 2011. The proposed division of air quality monitoring stations are summarized in **Table 5.11** below.

Table 5.11 Air Quality Monitoring Station for Contract no. HK/2009/02

Station	Description
CMA3a	CWB site office at Wanchai Waterfront Promenade
CMA4a	Society for the Prevention of Cruelty to Animals

5.3.8 No exceedance was recorded in the reporting period.

5.3.9 Air quality monitoring results measured in this reporting period are reviewed and summarized. Details of air quality monitoring results and graphical presentation can be referred in **Appendix 5.3**.

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/D

5.3.10 The proposed division of air quality monitoring stations are summarized in **Table 5.13** below. Air quality monitoring for the tunnel works under contract no. HY/2009/19 was commenced on 26 April 2011.

Table 5.13 Air Quality Monitoring Stations for Contract no. HY/2009/19

Station	Description
CMA1b	Harbour Grand Hotel Boundary Wall
CMA2a	Causeway Bay Community Centre

5.3.11 No exceedance was recorded in the reporting period.

5.3.12 Air quality monitoring results measured in this reporting period are reviewed and summarized. Details of air quality monitoring results and graphical presentation can be referred in **Appendix 5.3**.

Contract no. HK/2012/08- Wan Chai Development Phase II – Central-Wan Chai Bypass at Wan Chai West

5.3.13 The commencement of construction works for Contract no. HK/2012/08 under FEP-09/364/2009/B was on May 2014. Air quality monitoring was commenced on 25 August 2011. The proposed division of air quality monitoring stations are summarized in **Table 5.14** below.

Table 5.14 Air Quality Monitoring Station for Contract no. HK/2012/08

Station	Description
CMA5b	Pedestrian Plaza

5.3.14 No exceedance was recorded in the reporting period.

5.3.15 Air quality monitoring results measured in this reporting period are reviewed and summarized. Details of air quality monitoring results and graphical presentation can be referred in **Appendix 5.3**.

Contract no. HY/2010/08 – Central-Wanchai Bypass –Wanchai Bypass Tunnel (Slip Raod 8 Section) under FEP-12/364/2009/D

5.3.16 The commencement of construction works for Contract no. HY/2010/08 under FEP-12/364/2009/D was on July 2014. Air quality monitoring was commenced on 14 July 2011. The proposed division of air quality monitoring stations are summarized in **Table 5.15** below.

Table 5.15 Air Quality Monitoring Station for Contract no. HY/2010/08

Station	Description
CMA3a	CWB PRE Site Office

5.3.17 No exceedance was recorded in the reporting period.

5.3.18 Air quality monitoring results measured in this reporting period are reviewed and summarized. Details of air quality monitoring results and graphical presentation can be referred in **Appendix 5.3**.

Contract no. HY/2011/08 – Central - Wan Chai Bypass (CWB) – Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning

5.3.19 Air quality monitoring for the Central Interchange works under contract no. HY/2011/08 was commenced on 21 April 2011. The proposed division of air quality monitoring stations are summarized in **Table 5.16** below.

Table 5.16 Air Quality Monitoring Stations for Contract no. HY/2011/08

Station	Description
MA1e	International Finance Centre (Eastern End of Podium)
MA1w	International Finance Centre (Western End of Podium)
CMA1b	Harbour Grand Hotel Boundary Wall
CMA2a	Causeway Bay Community Centre
CMA5b	Pedestrian Plaza

5.3.20 No exceedance was recorded in the reporting period.

5.3.21 Air quality monitoring results measured in this reporting period are reviewed and summarized. Details of air quality monitoring results and graphical presentation can be referred in **Appendix 5.3**.

5.4 Waste Monitoring Results

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009

5.4.1. Inert C&D wastes and non-inert C&D wastes were disposed in this reporting period. Details of the waste flow table are summarized in **Table 5.17**.

Table 5.17 Details of Waste Disposal for Contract no. HK/2009/01

Waste Type	Quantity this month	Cumulative-to-Date	Disposal / Dumping Grounds
Inert C&D materials disposed, m ³	Nil	108087.815	TKO137, TM38
Inert C&D materials recycled, m ³	Nil	98512.03	N/A
Non-inert C&D materials disposed, m ³	Nil	5341.44	SENT Landfill
Non-inert C&D materials recycled, kg	Nil	1285746	N/A
Chemical waste disposed, kg	Nil	10400	N/A
Marine Sediment (Type 1 – Open Sea Disposal), m ³	Nil	11527	South of Cheung Chau
Marine Sediment (Type 1 – Open Sea Disposal (Dedicate Sites) & Type 2 – Confined Marine Disposal), m ³	Nil	16261	East of Cha Chau South Brothers

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

5.4.2. Inert C&D & non-inert C&D wastes were disposed of in this reporting period. Details of the waste flow table are summarized in **Table 5.18**.

Table 5.18 Details of Waste Disposal for Contract no. HK/2009/02

Waste Type	Quantity this month	Cumulative Quantity-to-Date	Disposal / Dumping Grounds
Inert C&D materials disposed, m ³	9.3	522730.51	TKO137 / TM 38
Inert C&D materials recycled, m ³	Nil	46520	N/A
Non-inert C&D materials disposed, m ³	28.3	5586.22	SENT Landfill
Non-inert C&D materials recycled, m ³	Nil	N/A	N/A
Chemical waste disposed, kg	Nil	17718	N/A
Marine Sediment (Type 1 – Open Sea Disposal) , m ³	Nil	65663	South Cheung Chau

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

5.4.3. Inert C&D and non-inert C&D waste was disposed of in this reporting period. Details of the waste flow table are summarized in **Table 5.19**.

Table 5.19 Details of Waste Disposal for Contract no. HY/2009/18

Waste Type	Quantity this month	Cumulative-to-Date	Disposal / Dumping Grounds
Inert C&D materials disposed, m ³	Nil	1415580.18	T.K.O. 137, TM 38
Inert C&D materials recycled, m ³	Nil	58787.05	N/A
Non-inert C&D materials disposed, m ³	Nil	4572.26	SENT Landfill
Non-inert C&D materials recycled, ton	Nil	878.37	N/A
Chemical waste disposed, kg	Nil	6772	N/A

Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A

5.4.4. Inert & Non-inert C&D wastes were disposed of in this reporting period. Details of the waste flow table are summarized in **Table 5.20**.

Table 5.20 Details of Waste Disposal for Contract no. HY/2009/15

Waste Type	Quantity this month	Cumulative Quantity-to-Date	Disposal / Dumping Grounds
Inert C&D materials disposed, m ³	Nil	625200.92	Tuen Mun Area 38
	Nil	245453.3	TKO137 FB
Inert C&D materials recycled, m ³	Nil	358660.77	HY/2009/11 ex-PCWA TS4 /TS2 WDII Lun Ku Tan WENT HY/2010/08
Non-inert C&D materials disposed, m ³	Nil	4675.67	SENT Landfill
	Nil	1.58	WENT Landfill
Non-inert C&D materials recycled, m ³	Nil	5496446.2	Xun Xiang Metalware Skylight Recycle (paper)
Chemical waste disposed, kg	Nil	22755	Dunwell Group
Marine Sediment (Type1-Open Sea Disposal (Dedicate Sites) & Type 2 – Confined Marine Disposal), m ³	Nil	5684	South of the Brothers

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/D

5.4.5. Inert and Non-inert C&D wastes were disposed of in this reporting period. Details of the waste flow table are summarized in **Table 5.21**.

Table 5.21 Details of Waste Disposal for Contract no. HY/2009/19

Waste Type	Quantity this month	Cumulative-to-Date	Disposal / Dumping Grounds
Inert C&D materials disposed, ton	680.45	782703.58	TM38
Inert C&D materials recycled, ton	Nil	82349.7	N/A
Non-inert C&D materials disposed, ton	199.74	6989.61	SENT Landfill
Non-inert C&D materials recycled, ton	Nil	565.63	N/A
Chemical waste disposed, kg	Nil	11.26	N/A
Marine Sediment (Tunnel) (Type-1 Open Sea Disposal), m ³	Nil	20737.96	South of Cheung Chau
Marine Sediment (Tunnel) (Type 1- Open Sea Disposal (Dedicated Sites) & Type 2 – Confined Marine Disposal), m ³	Nil	30751	East of Sha Chau
Marine Sediment (Approach Ramp) (Type 2 – Confined Marine Disposal), m ³	Nil	6491	East of Sha Chau

Contract no. HK/2012/08 Wan Chai Development Phase II - Central-Wan Chai Bypass at Wan Chai West under FEP-12/364/2009/D

5.4.6. No inert and Non-inert C&D wastes were disposed of in this reporting period. Details of the waste flow table are summarized in **Table 5.22**.

Table 5.22 Details of Waste Disposal for Contract no. HK/2012/08

Waste Type	Quantity this month*	Cumulative-to-Date	Disposal / Dumping Grounds
Inert C&D materials disposed, m ³	791 91	184443 117109	TKO 137 TM38
Inert C&D materials recycled, m ³	Nil	Nil	N/A
Non-inert C&D materials disposed, m ³	80	8892	SENT
Non-inert C&D materials recycled, m ³	Nil	Nil	N/A
Chemical waste disposed, kg	Nil	Nil	N/A
Marine sediment (Type 1) disposal, m ³	Nil	3145	South of Cheung Chau / East of Sha Chau / South of The Brothers

Remarks*: The quantity of inert C&D material disposed, recycled, non-inert C&D material disposed, recycled are reported up to calendar month of March 2018.

Contract no. HY/2010/08 Central – Wan Chai Bypass (CWB) – Tunnel (Slip Road 8) under FEP-10/364/2009/B

5.4.7. No inert and Non-inert C&D wastes were disposed of in this reporting period. Details of the waste flow table are summarized in **Table 5.23**.

Table 5.23 Details of Waste Disposal for Contract no. HY/2010/08

Waste Type*	Quantity this month	Cumulative-to-Date	Disposal / Dumping Grounds
Inert C&D materials disposed, m ³	702.917	592067.10	TM 38/ CW
	Nil	262656.6	WENT
	Nil	82911.8	SENT
	Nil	72704.53	TKO area 137
Inert C&D materials recycled, m ³	Nil	Nil	N/A
Non-inert C&D materials disposed, m ³	11.51	5906.69	SENT / WENT
Non-inert C&D materials recycled, m ³	Nil	Nil	N/A
Chemical waste disposed, kg	Nil	1431	N/A
Type 1 – Open Sea Disposal, m ³	Nil	16368.4	East Sha Chau/ South Brothers Island
Type 2 – Confined Marine disposal, m ³	Nil	549.2	East Sha Chau

Contract no. HY/2011/08 Central –Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009/E

5.4.8. No inert and Non-inert C&D wastes were disposed of in this reporting period. Details of the waste flow table are summarized in **Table 5.24**.

Table 5.24 Details of Waste Disposal for Contract no. HY/2011/08

Waste Type*	Quantity this month	Cumulative-to-Date	Disposal / Dumping Grounds
Inert C&D materials disposed, m ³	381.1	4389.52	CWPF & TKO137
Inert C&D materials recycled, m ³	Nil	Nil	N/A
Non-inert C&D materials disposed, m ³	473.2	6345.96	SENT
Non-inert C&D materials recycled, ton	Nil	31.72	N/A
Chemical waste disposed, kg	Nil	3800	N/A

6 COMPLIANCE AUDIT

6.0.1. The Event Action Plan for construction noise, air qualities are presented in **Appendix 6.1**.

6.1 Noise Monitoring

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

6.1.1. No exceedance was recorded in the reporting period.

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention Exhibition Centre – Tunnel Works under FEP-02/364/2009

6.1.2. No exceedance was recorded in the reporting period.

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

6.1.3. No exceedance was recorded in the reporting period.

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/D

5.3.22 One limit level exceedance was recorded on 06 March 2018 at M6 HK Baptist Church Henrietta Secondary School in this reporting period. After investigation, the exceedance as Project related.

5.3.23 One action level exceedance regarding noise emanation on 12 March 2018 under Contract HY/2009/19 was referred to the Environmental Team on 27 March 2018. After investigation, the noise emanation was found to be related to the breaking works conducted on IECL around YLMF memorial school and Wharf Road causing noise nuisance to the nearby receivers.

Contract no. HY/2010/08 – Central-Wanchai Bypass – Tunnel (Slip Raod 8 Section) under FEP-10/364/2009/B

6.1.4. No exceedance was recorded in the reporting period.

Contract no. HY/2011/08 Central –Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009/E

6.1.5. No exceedance was recorded in the reporting period.

Real Time Noise Monitoring

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/D

- 6.1.6. No limit level exceedance was recorded at RTN1 - FEHD Hong Kong Transport Section Whitfield Depot in the reporting period.
- 6.1.7. Limit level exceedances were recorded at RTN2a - Hong Kong Electric Centre on 22, 23 and 24 March 2018 in the reporting period.

After checking with the Contractor of HY/2009/19, rebar fixing, concrete chipping and removal of scaffolding was conducted on 22 March 2018 while concreting and removal of scaffolding were conducted on 23 March 2018 and soil compaction and rebar fixing were conducted on 24 March 2018 and no major noise emanation were considered for the above construction works. In addition, chiller plant maintenance and repair work was observed conducted at HKE roof top near the monitoring station was observed across the above exceedances period and considered as the major noise contribution. As such, the exceedances were considered as non-Project related.

- 6.1.8. Limit level exceedances were recorded at RTN3- Yu Lee Mo Fan Memorial School was recorded on 27 February, 01, 02, 03, 05, 06, 07, 09, 10, 12, 14, 15, 16, 20, 21, 22, 23 and 24 March 2018.

After checking with Contractor of HY/2009/19, breaking works with hand held breakers was conducted on 27 February 2018 within the noise enclosure and no major noise emanation is considered from the above works behind the noise enclosure and the exceedance was non-continuous despite the on-going construction works. As such, the exceedance recorded was considered as non-Project related.

After checking with Contractor of HY/2009/19, breaking works were conducted on 01, 02, 05, 06, 07, 09, 10, 12, 14, 15, 16, 20, 21, 22, 23 and 24 March 2018 and environmental deficiencies including i) inadequate extend of temporary noise barrier for shielding the line of sight to nearby sensitive receiver and ii) insufficient noise screening for breaking or saw cutting and iii) continuous breaking works without intermittence were found to be the major contribution to the measured noise level and hence the exceedances were considered as Project related.

Based on the review of the site arrangement, extent of construction operation and the associated PME required for the works, overall enhancement and remedial actions including i) provision of additional temporary noise barrier, ii) repairing of damaged or incomplete temporary noise barrier installed for the breaking works, iii) provision of additional acoustics screen to the breaking tip in addition to temporary noise barrier installed, iv) covering of breaker tip with acoustic material for noise reduction and conduct breaking works intermittently were advised for Contractors implementation to mitigate the noise impact recorded at the concerned monitoring station upon identification of exceedance and the Contractor was advised to refrain from the impact associated construction works prior to the



implementation of the remedial/ enhancement and confirmation of the implementation of the mitigation measure. As confirmed with the Contractor, the concerned construction works was completed as of 26 March 2018 and no further exceedance was recorded.

- 6.1.9. No limit level exceedance was recorded at RTN4- Causeway Bay Community Centre was recorded in the reporting period.

Contract no. HY/2011/08 Central –Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009/E

- 6.1.10. No limit level exceedance was recorded at RTN1-FEHD Hong Kong Transport Section Whitfield Depot in the reporting period.

- 6.1.11. No project related exceedance was recorded at RTN2a - Hong Kong Electric Centre in the reporting period.

- 6.1.12. No limit level exceedance was recorded at RTN4- Causeway Bay Community Centre was recorded in the reporting period.

6.2 Air Quality Monitoring

Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under FEP-05/364/2009/A

6.2.1. No exceedance was recorded in the reporting period.

Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009

6.2.2. No exceedance was recorded in the reporting period.

Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

6.2.3. No exceedance was recorded in the reporting period.

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/D

6.2.4. No exceedance was recorded in the reporting period.

Contract no. HK/2012/08 Wan Chai Development Phase II - Central-Wan Chai Bypass at Wan Chai West under FEP-12/364/2009/D

6.2.5. No exceedance was recorded in the reporting period.

Contract no. HY/2010/08 – Central-Wanchai Bypass – Tunnel (Slip Road 8 Section) under FEP-10/364/2009/B

6.2.6. No exceedance was recorded in the reporting period.

Contract no. HY/2011/08 Central –Central - Wan Chai Bypass (CWB) –Tunnel Buildings, Systems and Fittings, and Works Associated with Tunnel Commissioning under FEP-11/364/2009/E

6.2.1 No exceedance was recorded in the reporting period.

6.3 Review of the Reasons for and the Implications of Non-compliance

- 6.3.1 There was no non-compliance from the site audits in the reporting period. The observations and recommendations made in each individual site audit session were presented in Section 8.
- 6.3.2 A project related noise limit level exceedance under HY/2009/19 was recorded at M6 – HK Baptist Church Henrietta Secondary School on 06 March 2018. After investigation, it was found that concurrent saw cutting works and breaking works was conducted opposite to the monitoring location and the above construction works were observed as the major noise contribution during monitoring.
- 6.3.3 Project related noise limit level exceedances under Contract HY/2009/19 were recorded at RTN3 – YLMF Memorial School on 01, 02, 05, 06, 07, 09, 10, 12, 14, 15, 16, 20, 21, 22, 23 and 24 March 2018. After investigation, breaking works and environmental deficiencies including i) inadequate extend of temporary noise barrier for shielding the line of sight to nearby sensitive receiver and ii) insufficient noise screening for breaking or saw cutting and iii) continuous breaking works without intermittence were found to be the major contribution to the measured noise level.
- 6.3.4 One action level exceedance regarding noise emanation on 12 March 2018 under Contract HY/2009/19 was referred to the Environmental Team on 27 March 2018. After investigation, the exceedance was found to be related to the breaking works conducted on IECL around YLMF memorial school and Wharf Road causing noise nuisance to the nearby receivers.

6.4 Summary of action taken in the event of and follow-up on non-compliance

- 6.4.1 Further to the noise limit level project related recorded under Contract HY/2009/19 on 06 March 2018, remedial actions including saw cutting works alone without concurrent operation of breaker and provision of additional temporary noise barrier for cutting works were implemented by the Contractor and no further exceedances was recorded during the additional monitoring on 08 March 2018. The Contractor of HY/2009/19 was advised to avoid future concurrent operation of major noise emanating works such as breaking and saw cutting works to avoid potential cumulative impact.
- 6.4.2 Further to the Project related exceedances recorded at RTN3 – Yu Lee Mo Fan Memorial School on 01, 02, 05, 06, 07, 09, 10, 12, 14, 15, 16, 20, 21, 22, 23 and 24 March 2018 and based on the review of the site arrangement, extent of construction operation and the associated PME required for the works, overall enhancement and remedial actions including i) provision of additional temporary noise barrier, ii) repairing of damaged or incomplete temporary noise barrier installed for the breaking works, iii) provision of additional acoustics screen to the breaking tip in addition to temporary noise barrier installed, iv) covering of breaker tip with acoustic material for noise reduction and conduct breaking works intermittently were advised for Contractors implementation to mitigate the noise impact recorded at the concerned monitoring station upon identification of exceedance and the Contractor was advised to refrain from the impact associated construction works prior to the implementation of the remedial/ enhancement and confirmation of the implementation of the



mitigation measure. As confirmed with the Contractor, the concerned construction works was completed as of 26 March 2018 and no further exceedance was recorded.

- 6.4.3 According to ET follow up checking, the following enhancement measures were proposed and implemented by the Contractor by 16 March 2018 including provide additional temporary noise barrier and repair damaged or incomplete temporary noise barrier installed for the breaking works, provide additional acoustics screen to the breaking tip in addition to temporary noise barrier installed, provide covering of breaker tip with acoustic material for noise reduction and conduct breaking works intermittently.

7 CUMULATIVE CONSTRUCTION IMPACT DUE TO THE CONCURRENT PROJECTS

- 7.0.1. According to Condition 3.4 of the EP-364/2009/E, this section addresses the relevant cumulative construction impact due to the concurrent activities of the current projects including the Central Reclamation Phase III (CRIII), Wan Chai Development Phase II (WDII), Central-WanChai Bypass (CWB), Island Eastern Corridor Link projects (IECL) and Wan Chai Development Phase II – Central – Wan Chai Bypass at Wan Chai East (CWB Tunnel).
- 7.0.2. According to the Final EM&A Report of Central Reclamation Phase III (CRIII) for Contract HK 12/02, the major construction activities were completed by end of January 2014 and no construction activities were undertaken thereafter and the water quality monitoring was completed in October 2011. As such, it is considered that there were no cumulative construction impact due to the concurrent activities of the current projects with the Central Reclamation Phase III (CRIII) undertaken by contractor HK12/02 in the reporting period.
- 7.0.3. According to the construction programme of Central-Wanchai Bypass at Wanchai West at the Central Reclamation Phase III area include roadworks, back-filling, drainage and trimming of rock level were performed in March 2018 reporting period. As no project related exceedance were recorded during the reporting period, cumulative construction impact due to the concurrent activities of the current projects with the Central Reclamation Phase III (CRIII) was considered as insignificant.
- 7.0.4. According to the construction programme of Wan Chai Development Phase II, Central-Wan Chai Bypass and Island Eastern Corridor Link projects, the major construction activities under Wan Chai Development Phase II were road and drains construction and removal of preparation of temporary reclamation at Wan Chai West and Wan Chai East. The major construction activities under Central-Wan Chai Bypass and Island Eastern Corridor Link Projects were drainage works and ventilation building construction at Central; reinstatement works at Causeway Bay, road works at Victoria Park; bridge construction, approach ramp construction and building construction at North Point area in the reporting period. In addition, other non-Wan Chai Development Phase II, Central-Wan Chai Bypass and Island Eastern Corridor Link projects was observed undertaken at Wan Chai North and North Point area.
- 7.0.5. As relevant site mitigation measures for air quality and construction noise were implemented, no significant air quality impact and noise impact from construction activities was concluded in the reporting period. Besides, no project related exceedance was recorded during the air quality and noise environmental monitoring events in the reporting period. Thus, it is evaluated that the cumulative construction impact from the concurrent projects including Central Reclamation Phase III (CRIII), Wan Chai Development Phase II (WDII), Central-WanChai Bypass (CWB), Island Eastern Corridor Link projects (IECL) was insignificant.

8 ENVIRONMENTAL SITE AUDIT

8.0.1. During this reporting period, weekly environmental site audits were conducted for Contracts HY/2009/18, HY/2009/19, HK/2012/08, HK/2009/01, HK/2009/02, HY/2010/08 and HY/2011/08. No non-conformance was identified during the site audits. The Contractors rectified major observations and recommendations made during the audit sessions.

8.0.2. Site inspections for Contract no. HY/2009/18 were carried out during this reporting period. No observation was found in the reporting period

8.0.3. Site inspections for Contract no. HY/2009/19 were carried out during this reporting period. The results of these inspections and outcomes are summarized in **Table 8.3**.

Table 8.3 Summary of Environmental Inspections for Contract no. HY/2009/19

Item	Date	Observations	Action taken by Contractor	Completion date
180321_1	21 Mar 2018	Drip tray shall be provided to chemical containers (Portion VII)	Drip tray was provided to chemical containers	Completion as observed on 28 March 2018

8.0.4. Site inspections for Contract no. HK/2009/01 was carried out during this reporting period. No observation was found in the reporting period.

8.0.5. Site inspections for Contract no. HK/2009/02 were carried out during this reporting period. The results of these inspections and outcomes are summarized in **Table 8.5**.

Table 8.5 Summary of Environmental Inspections for Contract no. HK/2009/02

Item	Date	Observations	Action taken by Contractor	Completion date
180320_1	20 Mar 2018	Sufficient dust mitigation shall be provided to dusty surface to avoid dust emission (Portion 3, 4, 5)	Watering was provided to the concern area	Completion as observed on 28 March 2018
180320_2	20 Mar 2018	Tree protection zone shall be deployed around the retained tree and avoid storage of construction material inside tree protection zone (Portion 3, 4)	Tree protection zone was deployed and the construction material stored nearby was cleared	Completion as observed on 28 March 2018
180320_3	20 Mar 2018	Contractor shall repair the excavator to avoid oil leakage and oil leaked shall be cleaned as chemical waste (Wan Shing Street)	Leaked oil was cleaned at the concerned location and no further leakage of oil was observed from the concerned excavator	Completion as observed on 28 March 2018

8.0.6. Site inspection for Contract no. HK/2012/08 were carried out during this reporting period. The results of these inspections and outcomes are summarized in **Table 8.6**.

Table 8.6 Summary of Environmental Inspections for Contract no. HK/2012/08

Item	Date	Observations	Action taken by Contractor	Completion date
180227_01	27-Feb-18	Contractor shall provide valid NRMM label to rollers (Slip Road 1)	Valid NRMM label was provided to roller	Completion as observed on 6 March 2018
180306_01	6-Mar-18	Contractor shall provide valid NRMM label to breaker (Expo Drive)	Valid NRMM label was provided to Breaker	Completion as observed on 13 March 2018
180320_01	20-Mar-18	Dust mitigation measure shall be provided to breaking works to avoid dust emission (Expo. Drive)	No further breaking works was observed at the concerned location	Completion as observed on 27 March 2018

8.0.7. Site inspections for Contract no. HY/2010/08 were carried out during this reporting period. No observation was found in the reporting period.

Table 8.7 Summary of Environmental Inspections for Contract no. HY/2010/08

Item	Date	Observations	Action taken by Contractor	Completion date
180228_1	28-Feb-18	NRMM Label shall be provided to drilling rig (TS3)	Valid NRMM label was provided to drilling rig	Completion as observed on 7 March 2018
180316_1	16-Mar-18	Covering shall be provided to stockpile stored on-site to avoid potential dust emission (Victoria Park)	Covering was provided to stockpile	Completion as observed on 21 March 2018
180321_1	21-Mar-18	Contractor shall critically review the dosage and effectiveness of wastewater treatment unit to ensure the discharge quality (Victoria Park)	The operation of wastewater treatment unit was observed to be normal	Completion as observed on 28 March 2018

8.0.8. Site inspections for Contract no. HY/2011/08 were carried out during this reporting period. No observation was found in the reporting period.



9 COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTION

9.0.1. One environmental complaint was received in the reporting period.

9.0.2. An ICC complaint (Case Ref: 2-4495970766, lodged at 0955hrs on 12 March 2018) was referred to the ET on 27 March 2018. The ICC hotline operator reported that a public complaint was referred by the Police Force regarding noise emanation from road construction works at North Point section Island East Corridor (IEC) near 19 Wharf Road at around 0920hrs on 12 March 2018. Further information regarding the same event was received via ICC hotline (Case ref: 2-449606553, lodged at 1004hrs on 12 March 2018) was referred to the ET on 27 March 2018. The complainant further reported that noise was emanated from road construction works on Island Eastern Corridor (IEC) near Yu Lee Mo Fan Memorial School. Temporary noise barrier observed to be transparent in nature was speculated to be ineffective; and it was observed that only 3 out of the 6 units of temporary noise barrier are installed. The complainant suggested that additional 6 sections of noise barrier shall be installed. The noise emanation was started from 0800hrs and he is a resident at 18 Wharf Road and his rest was adversely affected by the concerned noise emanation. He has contacted the Environmental Protection Department and the Police Force regarding the noise emanation. The Environmental Protection Department has replied that construction works conducted after 0700hrs does not violate statutory requirement while the Police Force has created an ICC complaint case file (2-4495970766) for follow up.

ET confirmed with the Resident Site Staff that Concrete breaking works on IEC Eastbound near Pier F8 and Pier F9 was conducted under Contract HY/2009/19 from 0900hrs to 1000hrs on 12 March 2018. Noise mitigation measure including wrapping of breaking head with acoustic material was implemented. Enhancement measures including provision of 2.5m high temporary noise barrier were subsequent implemented on 12 March 2018.

According to RSS confirmed information, concrete breaking works on IEC Eastbound near Pier F8 and Pier F9 was conducted under Contract HY/2009/19 from 0900hrs to 1000hrs on 12 March 2018. Noise mitigation measure including wrapping of breaking head with acoustic material was implemented. Enhancement measures including provision of 2.5m high temporary noise barrier were subsequent implemented on 12 March 2018.

Based on review on relevant site record, noise impact associated with the breaking works on IECL opposite to the concerned location was observed across March 2018 and project related exceedances were recorded at nearby noise monitoring station at YLMF Memorial School across March 2018. Upon identification of the project related exceedance at YLMF memorial school noise monitoring station, the Contractor is requested to adopt remedial and enhancement measures to minimize the noise emanation and avoid noise impact to the nearby sensitive receivers.

According to ET follow up checking, the following enhancement measures were proposed and implemented by the Contractor by 16 March 2018 including provide additional temporary

noise barrier and repair damaged or incomplete temporary noise barrier installed for the breaking works, provide additional acoustics screen to the breaking tip in addition to temporary noise barrier installed, provide covering of breaker tip with acoustic material for noise reduction and conduct breaking works intermittently

Nevertheless, subsequent to 16 March 2018, it was observed at times that the above mitigation measures were not fully implemented by the Contractor throughout the remaining breaking works period. Upon identification of deficiency in mitigation measures, the Contractor has been requested to rectify any deficiency observed and ensure relevant noise mitigation measures are implemented and the observed deficiencies are rectified prior to resumption of the concerned impact associated works. According to Contractor information, the concerned breaking works have been completed by 26 March 2018.

In view of the public concern and the identified noise concern, the Contractor of HY/2009/19 was reminded that, shall future breaking works be required to be conducted on IECL (at works area located at the East of the noise enclosure), noise mitigation measure including but not limit to provision of temporary noise barrier with adequate height and extend and additional noise screen shall be proposed for ET/IEC review and confirmation prior to conducting the corresponding works to minimize the potential impact to the surroundings. The Contractor is also advised to review the adopt construction method with consideration on alternative PME with reduced noise emanation to minimize the potential noise impact to the surroundings.

- 9.0.3. The details of cumulative complaint log and updated summary of complaints are presented in **Appendix 9.1**
- 9.0.4. Cumulative statistic on complaints and successful prosecutions are summarized in **Table 9.1** and **Table 9.2** respectively.

Table 9.1 Cumulative Statistics on Complaints

Reporting Period	No. of Complaints
March 2018	1
September 2010 – February 2018	92
Total	93

Table 9.2 Cumulative Statistics on Successful Prosecutions

Environmental Parameters	Cumulative No. Brought Forward	No. of Successful Prosecutions this month (Offence Date)	Cumulative No. Project-to-Date
Air	1	0	1
Noise	1	0	1
Water	0	0	0
Waste	0	0	0
Total	2	0	2

10 CONCLUSION

10.0.1. The EM&A programme was carried out in accordance with the EM&A Manual requirements, minor alterations to the programme proposed were made in response to changing circumstances.

10.0.2. The scheduled construction activities and the recommended mitigation measures for the coming month are listed in **Table 10.1**. The construction programmes of individual contracts are provided in [Appendix 10.1](#).

Table 10.1 Summary of Key Construction Activities of Individual Contract(s) to be commenced in Coming Reporting period

Contract No.	Key Construction Works	Recommended Mitigation Measures
HY/2009/18	<ul style="list-style-type: none"> Maintenance works 	<ul style="list-style-type: none"> Dust control during dust generating activities
HY/2009/19	<ul style="list-style-type: none"> Approach ramp structure Construction. Bridge Construction & installation of enclosure. Retaining wall construction. FEHD depot re-provision works. Oil street drainage works. Installation of skin parapet on TB bridge at Pier 15-17. Landscape deck, column & pile cap foundation works. Watson Road Water mains laying works. EVA at EVB. Hing Fat Street road and drainage works. IEC TD bridge parapet installation. 	<ul style="list-style-type: none"> Noise level shall be controlled by reducing the breaking operation rate. Noise barrier shall be implemented Dust control during dust generating works Provide protection works and adequate drainage system to ensure no direct discharge into public drainage system or the sea.
HK/2009/01	<ul style="list-style-type: none"> Reinstatement of amenity area 	<ul style="list-style-type: none"> Dust control during dust generating works



HK/2009/02	<ul style="list-style-type: none">• Joint Inspection with ASD, AECOM and JV for completion of rectification work within the rooms under Staircases• Water test to the Types 3 and 4 Covered Walkway at West Wing• New PMMA for the replacement of 8 nos. of damaged PMMA panels• Preparation for raising the vent shaft, water meters chambers and multi-part covers of P7, P8 and P9• Drainage work• Excavation for relocation of temporary fire hydrant PH2582• Jointed inspection with HKE, AECOM and JV on the new pillar box work• Remedial works against water leakage inside OHVD cells• Backfilling behind seawall block• Steel fixing of Culvert O bay 15A top slab and wall• Base slab of Culvert O Bay 16A• Pipe piling work for ELS of Culvert O• Remedial works against water leakage inside OHVD cells• Raising of CMS draw pits and caisson wall units access opening covers• Installation of surface drain cover• All backfilling works at surface drain trench• Remedial works for 0.5T rock armor• Sewage works at Wan Shing Street	<ul style="list-style-type: none">• Dust control during dust generating works• Proper maintenance boundary surface runoff protection and water treatment facilities to avoid potential runoff related impact.• Provision of protection measures to ensure no runoff out of site area or direct discharge into public drainage system.
------------	--	---

HK/2012/08	<ul style="list-style-type: none"> • Construction of Slip Road 1 • Construction of drainage • Asphalt paving • Construction of roundabout 	<ul style="list-style-type: none"> • Dust control during dust generating works • Provide protection works and adequate drainage system to ensure no direct discharge into public drainage system.
HY/2010/08	<ul style="list-style-type: none"> • Tree protection works next to existing BGO, • Drainage improvement works, • Utility diversion works, • Retaining wall works • ELS works, • Construction works for subway extension 	<ul style="list-style-type: none"> • Dust control during dust generating works and stockpile stored on site. • Appropriate measures should be taken to ensure adequate protections are provided for trees being transplanted and retained on site. • Provision of protection to ensure no runoff out of site area or direct discharge into public drainage system.
HY/2011/08	<ul style="list-style-type: none"> • Construction of Ventilation Buildings, inclusive of Administration Building, Central Ventilation Building, East Ventilation Shaft/Building, West Ventilation Building • Application of Thermal Barrier inside the Tunnel, asphalt pavement • Construction of Tunnel Thermal Barrier • Installation of Electricals and Mechanicals • Installation of Tunnel Features 	<ul style="list-style-type: none"> • Dust control during dust generating works

10.0.3. The construction works of Contract no. 04/HY/2006 – Reconstruction of Bus Terminus near Man Yiu Street and Man Kwong Street under FEP-04/364/2009/A was completed, and the FEP was surrendered by the Contractor on 11 February 2011.

10.0.4. The construction works of Contract no. HY/2009/17 - Advance piling works at Whitfield Depot under FEP-03/264/2009 was completed, and the FEP was surrendered by the Contractor and found in order by EPD on 25 April 2013.

10.0.5. The construction works of Contract HK/2010/06 was completed, and the FEP-08/364/2009/A was surrendered by the Contractor on 3 October 2014.





10.0.6. The Construction works under HY/2009/15 was confirm completed by the RSS from 27 October 2017 onwards.



Figure 2.1

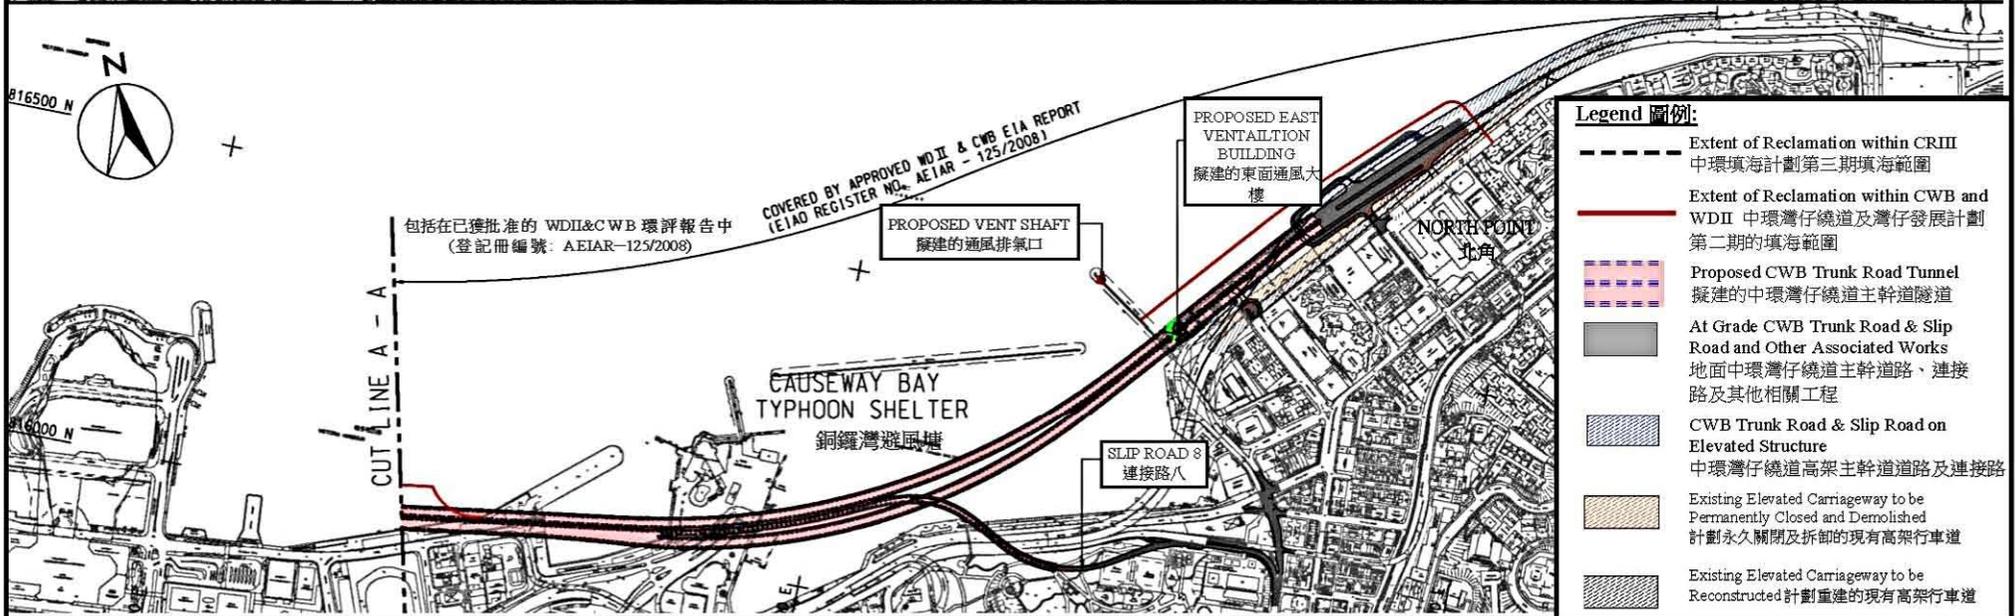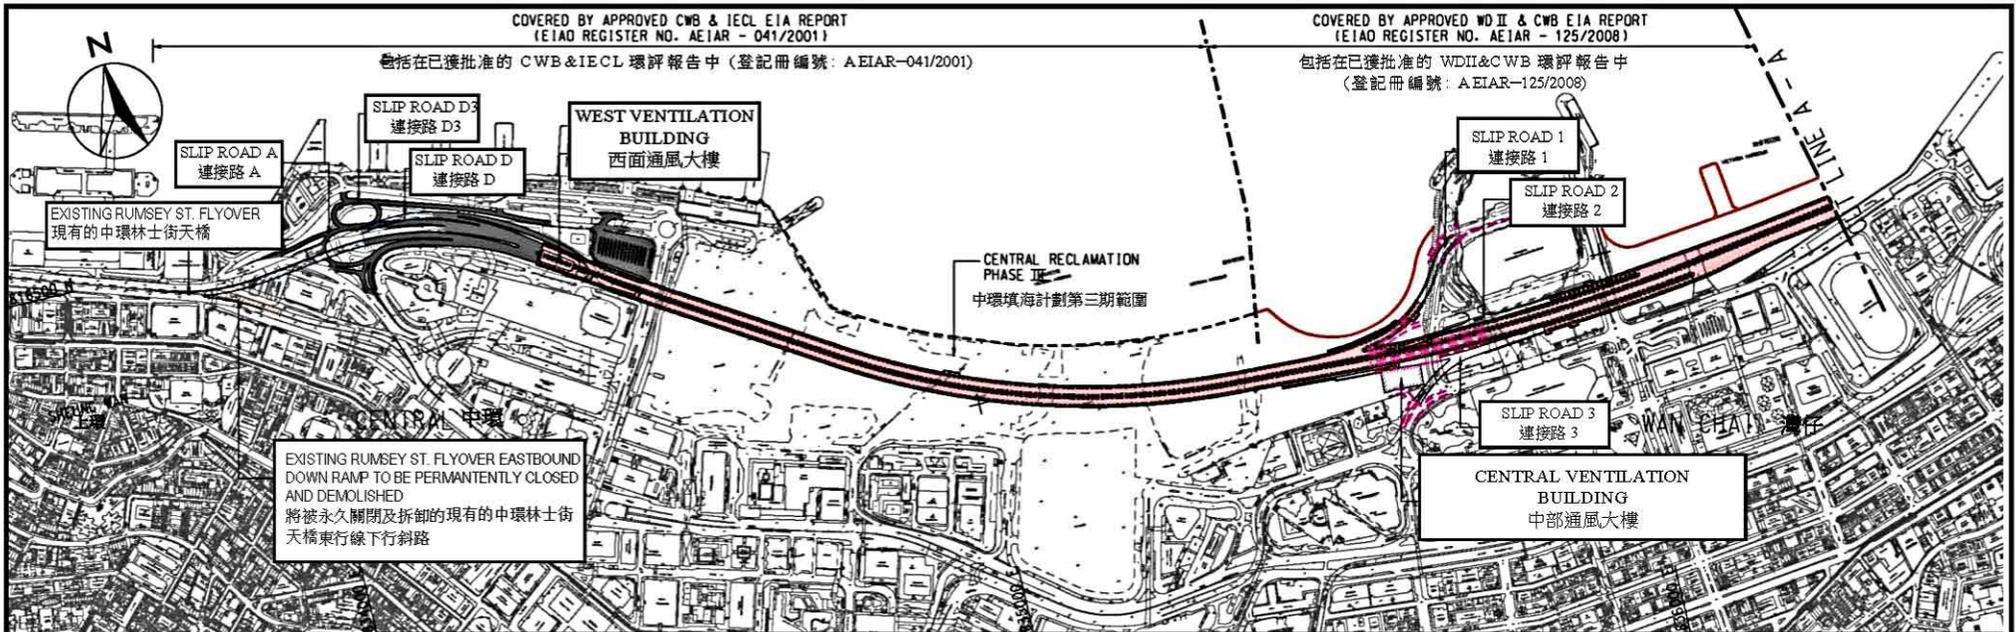Project Layout



Project Title: Central-Wanchai Bypass (CWB) Including Its Road Tunnel and Slip Roads
工程項目名稱: 中環灣仔繞道包括其行車隧道及連接路

Environmental Permit No.: EP-364/2009/E
環境許可證編號: EP-364/2009/E

Figure 1: Location of the Project
圖 1: 工程項目位置

(This figure was prepared based on Figure 1.1 of the Application for Environmental Permit (Application No.: AEP-364/2009))
(本圖是根據環境許可證的申請(申請書編號 AEP-364/2009 圖 1.1 編製))



Figure 2.2

Project Organization Chart



Project Organization Chart

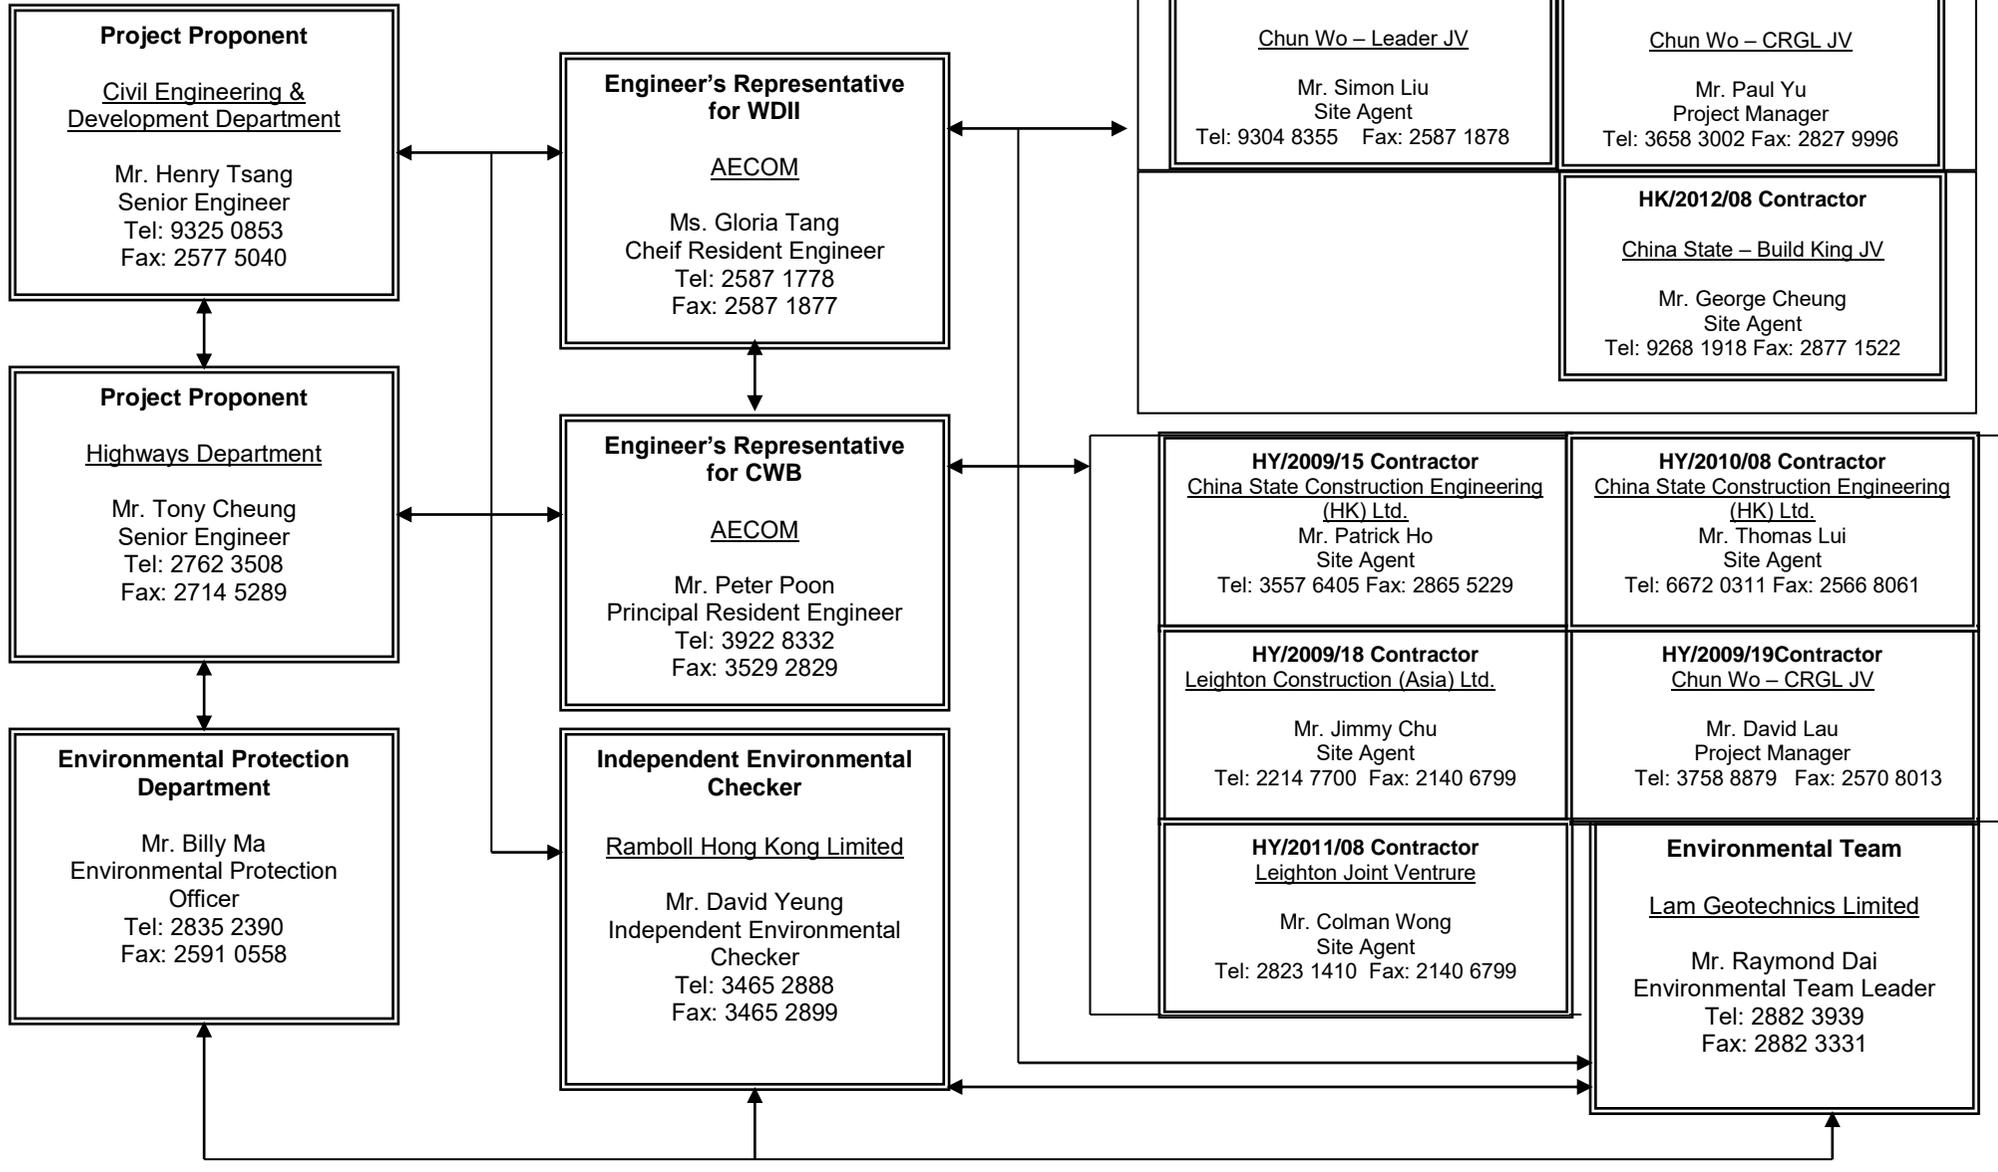


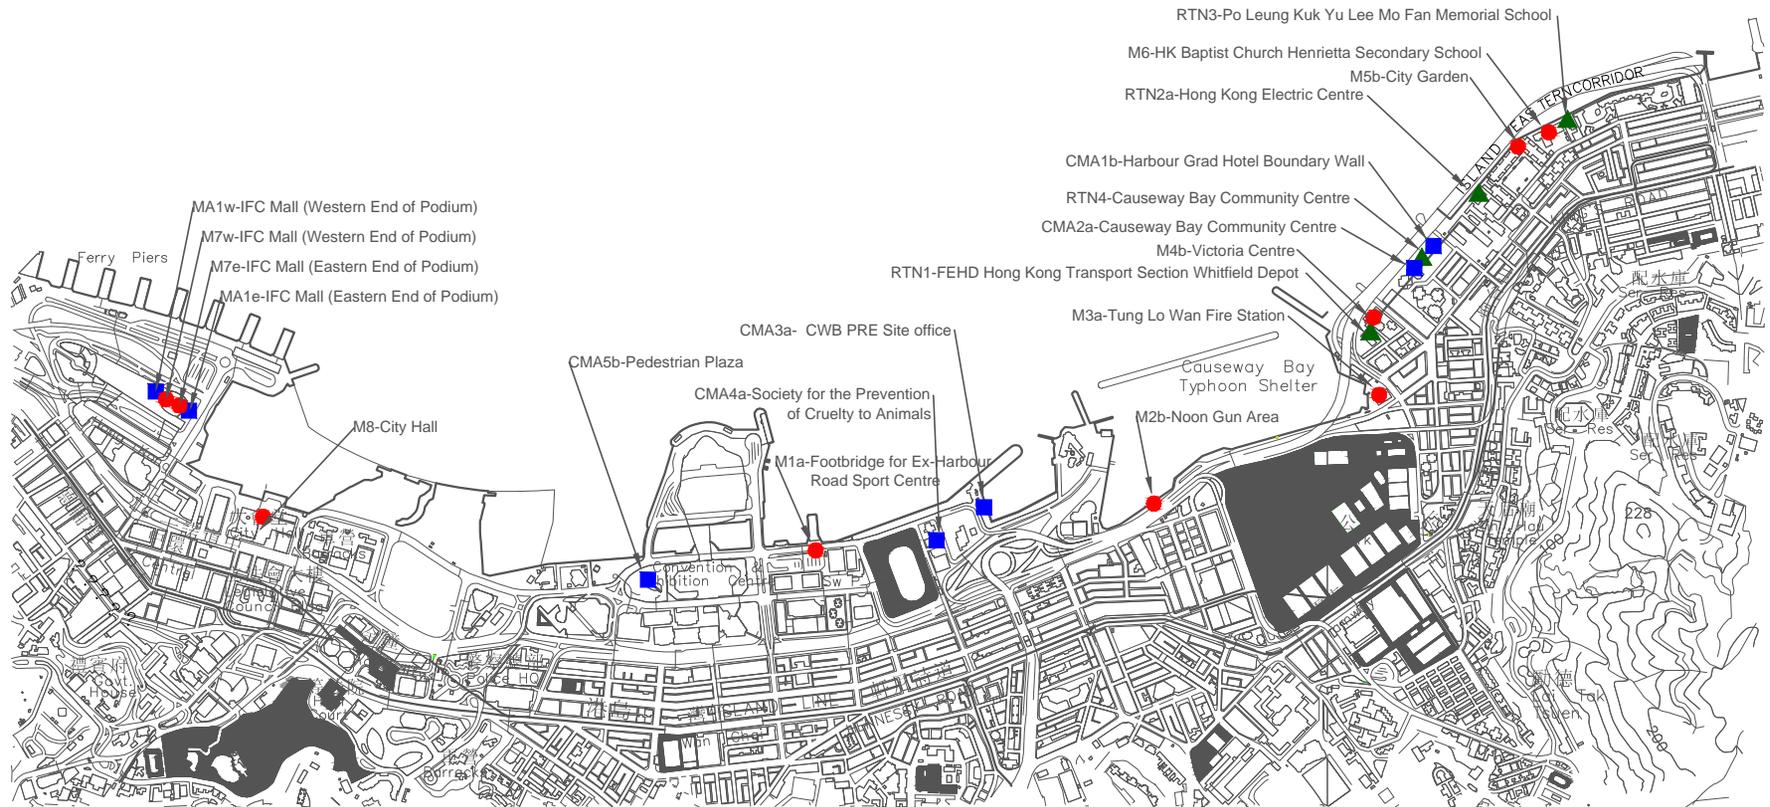


Figure 4.1

Locations of Monitoring Stations

Legend

- Noise Monitoring Station
- Air Monitoring Station
- ▲ Real-time Noise Monitoring Station



LOCATIONS OF AIR QUALITY AND NOISE MONITORING STATIONS



Appendix 3.1

Environmental Mitigation Implementation Schedule

IMPLEMENTATION SCHEDULE OF THE PROPOSED MITIGATION MEASURES**Table A.1 Implementation Schedule for Air Quality Control**

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
Construction Phase								
S3.6.5	Four times a day watering of the work site with active operations.	Work site / during construction	Contractor		√			EIAO-TM
S3.8.1	Implementation of dust suppression measures stipulated in Air Pollution Control (Construction Dust) Regulation. The following mitigation measures, good site practices and a comprehensive dust monitoring and audit programme are recommended to minimise cumulative dust impacts. <ul style="list-style-type: none"> Strictly limit the truck speed on site to below 10 km per hour and water spraying to keep the haul roads in wet condition; Watering during excavation and material handling; Provision of vehicle wheel and body washing facilities at the exit points of the site, combined with cleaning of public roads where necessary; and Tarpaulin covering of all dusty vehicle loads transported to, from and between site locations. 	Work site / during construction	Contractor		√			
Operational Phase								
S3.6.53 – S3.6.54	The design parameters of the East and Central Ventilation Buildings as set in Tables 3.10 and 3.11 of Volume 1 of the WDII & CWB EIA Report.	East and Central Ventilation Buildings / During operation of the Trunk Road	HyD			√		
S3.10.2	Air quality monitoring for the operation performance of the East Ventilation Building and associated East Vent Shaft will be conducted.	East Vent Shaft / During operation of the East Ventilation Building and associated East Vent Shaft	HyD			√		EIAO-TM

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Table A.2 Implementation Schedule for Noise Control

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
Construction Phase								
S4.9.3	<p>Good Site Practice:</p> <ul style="list-style-type: none"> Only well-maintained plant shall be operated on-site and plant shall be serviced regularly during the construction program. Silencers or mufflers on construction equipment shall be utilized and shall be properly maintained during the construction program. Mobile plant, if any, shall be sited as far away from NSRs as possible. Machines and plant (such as trucks) that may be in intermittent use shall be shut down between works periods or shall be throttled down to a minimum. Plant known to emit noise strongly in one direction shall, wherever possible, be orientated so that the noise is directed away from the nearby NSRs. Material stockpiles and other structures shall be effectively utilized, wherever practicable, in screening noise from on-site construction activities. 	Work Sites / During Construction	Contractor		√			EIAO-TM, NCO
S4.8.1 – S4.8.11	<p>Use of quiet powered mechanical equipment, movable noise barrier and temporary noise barrier for the following tasks:</p> <ul style="list-style-type: none"> Slip road 8 tunnel Construction of diaphragm wall and substructures of the tunnel approach ramp Excavation Construction of slabs Backfill 	Work Sites / During Construction	Contractor		√			EIAO-TM, NCO

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
	<ul style="list-style-type: none"> Demolition and construction of substructures for the IEC Demolition works of existing piers and crossheads of the marine section of the existing IEC <p>Use of PME grouping for the following tasks:</p> <ul style="list-style-type: none"> At-grade road construction Substructure for IECL connection 							
Operation Phase								
S4.8.12 – S4.8.23	<p>For Existing NSRs</p> <ul style="list-style-type: none"> about 235m length of noise semi-enclosure with transparent panel covering the westbound slip road from the IEC about 230m length of noise semi-enclosure with transparent panel covering the main carriageways (eastbound and westbound) of the CWB and IEC about 135m length of 5.5m high cantilevered noise barrier with 4.5m cantilever inclined at 45° with transparent panel on the eastbound slip road to the IEC (amended under EP-364/2009/A) about 95m length of 5.5m high cantilevered noise barrier with 1m cantilever inclined at 45° with transparent panel on the eastbound slip road to the IEC about 350m length of 3.5m high vertical noise barrier with transparent panel on the eastbound slip road to the IEC low noise road surfacing for the trunk road (except tunnel section and beneath the landscaped deck at the eastern portal area)) with speed limit of 70 km/hour 	Near North Point / Before commencement of operation of road project	HyD	√	√	√		EIAO-TM

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
	<p>For Future/Planned NSRs</p> <ul style="list-style-type: none"> • about 265m length of noise semi-enclosure with transparent panel covering the westbound slip road from the IEC • The openable windows of the temple, if any, should be orientated so as to avoid direct line of sight to the existing Victoria Park Road as far as practicable. 	<p>In between the Electric Centre (next to City Garden) and CDA(1) site / Before occupation of Planned NSRs in CDA and CDA(1) sites.</p> <p>Near Causeway Bay Fire Station / During detailed design of the re-provisioned Tin Hau Temple</p>	<p>HyD</p> <p>Project Proponent for the re-provisioned Tin Hau Temple</p>	√	√ #			

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Only the steel frame for this section of noise semi-enclosure would be erected in advance during the construction of the westbound slip road.

Table A.4 Implementation Schedule for Waste Management

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
Construction Phase								
S6.5.14	Floating Refuse During the construction phase, the project proponent's contractor will be responsible for the collection of any refuse within their works area. Floating booms will be provided on the water surface to confine the refuse from the working barges as well as to avoid the accumulation of pollutants within temporary embayment as mentioned in Table D9.3.	Work site / During the construction period	Contractor		√			
S6.6.1	Good Site Practices Recommendations for good site practices during the construction activities include: <ul style="list-style-type: none"> • nomination of an approved person, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site; • training of site personnel in proper waste management and chemical waste handling procedures; • provision of sufficient waste disposal points and regular collection for disposal; • appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers; • regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors; and • a recording system for the amount of wastes generated, recycled and disposed of (including the disposal sites). 	Work site / During the construction period	Contractor		√			Waste Disposal Ordinance (Cap.354)

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
S6.6.2	<p><i>Waste Reduction Measures</i></p> <p>Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices. Recommendations to achieve waste reduction include:</p> <ul style="list-style-type: none"> • segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; • to encourage collection of aluminium cans, PET bottles and paper, separate labelled bins shall be provided to segregate these wastes from other general refuse generated by the work force; • any unused chemicals or those with remaining functional capacity shall be recycled; • use of reusable non-timber formwork, such as in casting the tunnel box sections, to reduce the amount of C&D material. • prior to disposal of C&D waste, it is recommended that wood, steel and other metals shall be separated for re-use and / or recycling to minimise the quantity of waste to be disposed of to landfill; • proper storage and site practices to minimise the potential for damage or contamination of construction materials; and • plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste. 	Work site / During planning and design stage, and construction stage	Contractor	√	√			

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
S6.6.4	<p><i>General Refuse</i></p> <p>General refuse shall be stored in enclosed bins or compaction units separate from C&D material. A licensed waste collector shall be employed by the contractor to remove general refuse from the site, separately from C&D material.</p> <p>A collection area shall be provided where wastes can be stored and loaded prior to removal from site. An enclosed and covered area is recommended to reduce the occurrence of 'wind blow' light material.</p>	Work site / During the construction period	Contractor		√			Public Health and Municipal Services Ordinance (Cap. 132)
S6.6.5	<p><i>Chemical Wastes</i></p> <p>After use, chemical wastes (for example, cleaning fluids, solvents, lubrication oil and fuel) shall be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Spent chemicals shall be collected by a licensed collector for disposal at the CWTF or other licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.</p>	Work site / During the construction period	Contractor		√			<p>Waste Disposal (Chemical Waste) (General) Regulation</p> <p>Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes</p>
S6.6.6	<p><i>Construction and Demolition Material</i></p> <p>C&D material shall be sorted on-site into inert C&D material (that is, public fill) and C&D waste. All the suitable inert C&D material shall be broken down to 250 mm in size for reuse as public fill in the WDII reclamation. C&D waste, such as wood, glass, plastic, steel and other metals shall be reused or recycled and, as a last resort, disposed of to landfill. A suitable area shall be designated to facilitate the sorting process and a temporary stockpiling area will be required for the separated materials.</p>	Work site / During the construction period	Contractor		√			ETWB TCW No. 33/2002, 31/2004, 19/2005

WDH & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
S6.6.7	In order to monitor the disposal of public fill and C&D waste at public fill reception facilities and landfills, respectively, and to control fly tipping, a trip-ticket system shall be included as one of the contractual requirements and implemented by the Environmental Team undertaking the environmental monitoring and audit work. An Independent Environment Checker shall be responsible for auditing the results of the system.	Work site / During the construction period	Contractor and Independent Environmental Checker		√			ETWB TCW No. 31/2004
S6.6.8	<p><i>Bentonite Slurry</i></p> <p>The disposal of residual used bentonite slurry shall follow the good practice guidelines stated in ProPECC PN 1/94 "Construction Site Drainage" and listed as follows:</p> <ul style="list-style-type: none"> • If the disposal of a certain residual quantity cannot be avoided, the used slurry may be disposed of at the marine spoil grounds subject to obtaining a marine dumping licence from EPD on a case-by-case basis. • If the used bentonite slurry is intended to be disposed of through the public drainage system, it shall be treated to the respective effluent standards applicable to foul sewers, storm drains or the receiving waters as set out in the Technical Memorandum of Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Waters. • If the used bentonite slurry is intended to be disposed to public fill reception facilities, it will be mixed with dry soil on site before disposal. 	Work site / During the construction period	Contractor		√			ProPECC PN 1/94

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Table A.5 Implementation Schedule for Land Contamination

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
Construction and Operation Phase								
S.7.1.1	As no potential contaminative land uses were identified within the Study Area, adverse land contamination impacts associated with the construction and operation of the Project is not expected. As such, environmental protection and mitigation measures are considered not necessary and will not be covered in this EM&A Manual.	-	-					-

* Des - Design, C - Construction, O – Operation, and Dec - Decommissioning

Table A.7 Implementation Schedule for Landscape and Visual

WDII & CWB EIA Report Ref	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stages*				Relevant Legislation and Guidelines
				Des	C	O	Dec	
Construction Phase								
Table 10.5	CM1 Topsoil, where identified, shall be stripped and stored for re-use in the construction of the soft landscape works, where practical.	Work site / During Construction Phase	Contractor	√	√			EIAO TM
Table 10.5	CM2 Existing trees to be retained on site shall be carefully protected during construction.	Work site / During Construction Phase	Contractor	√	√			EIAO TM
Table 10.5	CM3 Trees unavoidably affected by the works shall be transplanted where practical.	Work site / During Construction Phase	Contractor	√	√			EIAO TM
Table 10.5	CM4 Compensatory tree planting shall be provided to compensate for felled trees.	Work site / During Construction Phase	Contractor	√	√			EIAO TM
Table 10.5	CM5 Control of night-time lighting.	Work site / During Construction Phase	Contractor		√			EIAO TM
Table 10.5	CM6 Erection of decorative screen hoarding compatible with the surrounding setting.	Work site / During Construction Phase	Contractor		√			EIAO TM
Operation Phase								
Table 10.6, Figure 10.5.1-10.5.5	OM1 Aesthetic design of buildings and road-related structures, including viaducts, vent buildings, subways, footbridges and noise barriers and enclosure.	Work site / During Design Stage and Operation Phases	HyD	√	√	√		ETWB TCW 2/2004
Table 10.6, Figure 10.5.1-10.5.5	OM3 Buffer Tree and Shrub Planting to screen proposed roads and associated structures.	Work site / During Design Stage and Operation Phases	HyD	√	√	√		ETWB TCW 2/2004
Table 10.6, Figure 10.5.1-10.5.5	OM5 Aesthetic streetscape design.	Work site / During Design Stage and Operation Phases	HyD	√	√	√		ETWB TCW 2/2004
Table 10.6, Figure 10.5.1-10.5.5	OM6 Aesthetic design of roadside amenity areas.	Work site / During Design Stage and Operation Phases	HyD	√	√	√		ETWB TCW 2/2004

*Des - Design, C - Construction, O - Operation, and Dec - Decommissioning



Appendix 4.1

Action and Limit Level



Action and Limit Level

Action and Limit Level for Noise Monitoring

Time Period	Action Level	Limit Level
07:00 – 19:00 hours on normal weekdays	When one documented complaint is received.	75 dB(A)/ 70 dB(A)/ 65 dB(A) ^{Note 1}

Note 1:

- 70dB(A) and 65 dB(A) for schools during normal teaching periods and school examination periods, respectively.
- If works are to be carried out during the restricted hours, the conditions stipulated in the Construction Noise Permit (CNP) issued by the Noise Control Authority have to be followed.

Action and Limit Level for Air Quality Monitoring

Monitoring Location	1-hour TSP Level in $\mu\text{g}/\text{m}^3$		24-hour TSP Level in $\mu\text{g}/\text{m}^3$	
	Action Level	Limit Level	Action Level	Limit Level
CMA1b	320.1	500	176.7	260
CMA2a	323.4	500	169.5	260
CMA3a	311.3	500	171.0	260
CMA4a	312.5	500	171.2	260
CMA5b	332.0	500	181.0	260
MA1e	325.1	500	173.4	260
MA1w	325.1	500	173.4	260



Appendix 4.2

Copies of Calibration Certificates



TISCH ENVIRONMENTAL, INC.
 145 SOUTH MIAMI AVE
 VILLAGE OF CLEVELAND, OH
 45002
 513.467.9000
 877.263.7610 TOLL FREE
 513.467.9009 FAX

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - Mar 20, 2017 Rootsmeter S/N 0438320 Ta (K) - 293
 Operator Tisch Orifice I.D. - 0005 Pa (mm) - 759.46

PLATE OR Run #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER DIFF Hg (mm)	ORFICE DIFF H2O (in.)
1	NA	NA	1.00	1.3960	3.2	2.00
2	NA	NA	1.00	0.9970	6.4	4.00
3	NA	NA	1.00	0.8910	7.8	5.00
4	NA	NA	1.00	0.8500	8.7	5.50
5	NA	NA	1.00	0.6990	12.7	8.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)	Va	(x axis) Qa	(y axis)
1.0120	0.7249	1.4257	0.9958	0.7133	0.8784
1.0078	1.0108	2.0163	0.9916	0.9946	1.2423
1.0058	1.1288	2.2543	0.9896	1.1107	1.3889
1.0047	1.1820	2.3643	0.9885	1.1630	1.4567
0.9993	1.4296	2.8514	0.9832	1.4066	1.7568
Qstd slope (m) = 2.02533			Qa slope (m) = 1.26823		
intercept (b) = -0.03593			intercept (b) = -0.02214		
coefficient (r) = 0.99983			coefficient (r) = 0.99983		
y axis = $\text{SQRT}[\text{H2O}(\text{Pa}/760)(298/\text{Ta})]$			y axis = $\text{SQRT}[\text{H2O}(\text{Ta}/\text{Pa})]$		

CALCULATIONS

$V_{std} = \text{Diff. Vol} [(\text{Pa} - \text{Diff. Hg}) / 760] (298 / \text{Ta})$
 $Q_{std} = V_{std} / \text{Time}$

$V_a = \text{Diff Vol} [(\text{Pa} - \text{Diff Hg}) / \text{Pa}]$
 $Q_a = V_a / \text{Time}$

For subsequent flow rate calculations:

$Q_{std} = 1/m \{ [\text{SQRT}(\text{H2O}(\text{Pa}/760)(298/\text{Ta}))] - b \}$
 $Q_a = 1/m \{ [\text{SQRT} \text{H2O}(\text{Ta}/\text{Pa})] - b \}$



Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA1b
 Equipment no. : HVS001

Calibration Date : 17-Jan-18
 Calibration Due Date : 17-Mar-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	293	Kelvin	Pressure, P _a
			1014 mmHg

Orifice Transfer Standard Information					
Equipment No.	Ori001	Slope, m _c	2.02533	Intercept, b _c	-0.03593
Last Calibration Date	20-Mar-17	$(H \times P_a / 1013.3 \times 298 / T_a)^{1/2}$ $m_c \times Q_{std} + b_c$			
Next Calibration Date	20-Mar-18				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	1.6	1.6	3.2	0.9088	28	28.2476
2	2.5	2.5	5.0	1.1316	36	36.3184
3	3.9	3.9	7.8	1.4089	45	45.3980
4	5.1	5.1	10.2	1.6086	52	52.4599
5	6.4	6.4	12.8	1.7998	58	58.5130

By Linear Regression of Y on X

Slope, m = 33.9466 Intercept, b = -2.3715
 Correlation Coefficient* = 0.9998
 Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been

re-assigned from EL452 to HVS001 with respect to the update in quality management system.

Calibrated by : Jackey MA
 Date : 17-Jan-18

Checked by : Pauline Wong
 Date : 17-Jan-18



Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA1b
 Equipment no. : HVS001

Calibration Date : 08-Mar-18
 Calibration Due Date : 08-May-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	288	Kelvin	Pressure, P _a
			1019 mmHg

Orifice Transfer Standard Information					
Equipment No.	Ori001	Slope, m _c	2.02533	Intercept, b _c	-0.03593
Last Calibration Date	20-Mar-17	$(H \times P_a / 1013.3 \times 298 / T_a)^{1/2}$ $m_c \times Q_{std} + b_c$			
Next Calibration Date	20-Mar-18				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	H (inches of water)	(up)	(down)			
1	1.6	1.6	3.2	0.9187	28	28.5620
2	2.5	2.5	5.0	1.1439	36	36.7225
3	3.8	3.8	7.6	1.4062	44	44.8831
4	5.0	5.0	10.0	1.6104	52	53.0436
5	6.2	6.2	12.4	1.7913	60	61.2042

By Linear Regression of Y on X

Slope, m = 36.7366 Intercept, b = -5.5976
 Correlation Coefficient* = 0.9978
 Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been re-assigned from EL452 to HVS001 with respect to the update in quality management system.

Calibrated by : Jackey MA
 Date : 08-Mar-18

Checked by : Pauline Wong
 Date : 08-Mar-18



Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA2a Calibration Date : 17-Jan-18
 Equipment no. : HVS002 Calibration Due Date : 17-Mar-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	293	Kelvin	Pressure, P _a
			1014 mmHg

Orifice Transfer Standard Information					
Equipment No.	Ori001	Slope, m _c	2.02533	Intercept, b _c	-0.03593
Last Calibration Date	20-Mar-17	$(H \times P_a / 1013.3 \times 298 / T_a)^{1/2}$ $m_c \times Q_{std} + b_c$			
Next Calibration Date	20-Mar-18				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	1.8	1.8	3.6	0.9628	33	33.2919
2	2.8	2.8	5.6	1.1965	41	41.3626
3	4.1	4.1	8.2	1.4441	50	50.4422
4	5.4	5.4	10.8	1.6547	56	56.4953
5	6.6	6.6	13.2	1.8275	60	60.5307

By Linear Regression of Y on X

Slope, m = 31.9847 Intercept, b = 3.0980
 Correlation Coefficient* = 0.9970
 Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been

re-assigned from EL449 to HVS002 with respect to the update in quality management system.

Calibrated by : Jackey MA Checked by : Pualine Wong
 Date : 17-Jan-18 Date : 17-Jan-18



Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA2a Calibration Date : 08-Mar-18
 Equipment no. : HVS002 Calibration Due Date : 08-May-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	288	Kelvin	Pressure, P _a
			1019 mmHg

Orifice Transfer Standard Information					
Equipment No.	Ori001	Slope, m _c	2.02533	Intercept, b _c	-0.03593
Last Calibration Date	20-Mar-17	$(H \times P_a / 1013.3 \times 298 / T_a)^{1/2}$ $m_c \times Q_{std} + b_c$			
Next Calibration Date	20-Mar-18				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	1.6	1.6	3.2	0.9187	30	30.6021
2	2.5	2.5	5.0	1.1439	38	38.7627
3	3.9	3.9	7.8	1.4244	50	51.0035
4	5.2	5.2	10.4	1.6420	55	56.1038
5	6.5	6.5	13.0	1.8337	62	63.2443

By Linear Regression of Y on X

Slope, m = 35.6180 Intercept, b = -1.6563
 Correlation Coefficient* = 0.9966
 Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been

re-assigned from EL449 to HVS002 with respect to the update in quality management system.

Calibrated by : Jackey MA Checked by : Pualine Wong
 Date : 08-Mar-18 Date : 08-Mar-18



Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA3a
 Equipment no. : HVS012

Calibration Date : 16-Jan-18
 Calibration Due Date : 16-Mar-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition						
Temperature, T _a	291		Kelvin	Pressure, P _a	1015 mmHg	
Orifice Transfer Standard Information						
Equipment No.	Ori001		Slope, m _c	2.02533	Intercept, b _c	-0.03593
Last Calibration Date	20-Mar-17		$(H \times P_a / 1013.3 \times 298 / T_a)^{1/2}$ $m_c \times Q_{std} + b_c$			
Next Calibration Date	20-Mar-18					
Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	1.4	1.4	2.8	0.8545	35	35.4482
2	2.2	2.2	4.4	1.0667	40	40.5122
3	3.4	3.4	6.8	1.3218	48	48.6146
4	4.4	4.4	8.8	1.5012	53	53.6786
5	5.6	5.6	11.2	1.6913	58	58.7427
By Linear Regression of Y on X						
Slope, m		=	28.3766	Intercept, b		= 10.8760
Correlation Coefficient*		=	0.9991			
Calibration Accepted		=	Yes/No**			

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been re-assigned from EL333 to HVS012 with respect to the update in quality management system.

Calibrated by : Jackey MA
 Date : 16-Jan-18

Checked by : Pauline Wong
 Date : 16-Jan-18



Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA3a
 Equipment no. : HVS012

Calibration Date : 09-Mar-18
 Calibration Due Date : 09-May-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition						
Temperature, T _a	288		Kelvin	Pressure, P _a	1023 mmHg	
Orifice Transfer Standard Information						
Equipment No.	Ori001		Slope, m _c	2.02533	Intercept, b _c	-0.03593
Last Calibration Date	20-Mar-17		$(H \times P_a / 1013.3 \times 298 / T_a)^{1/2}$ $m_c \times Q_{std} + b_c$			
Next Calibration Date	20-Mar-18					
Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC <small>(W(P_a/1013.3x298/T_a)^{1/2}/35.31) Y-axis</small>
	(up)	(down)	(difference)			
1	1.5	1.5	3.0	0.8918	34	34.7504
2	2.4	2.4	4.8	1.1234	40	40.8828
3	3.7	3.7	7.4	1.3905	48	49.0594
4	4.8	4.8	9.6	1.5813	54	55.1918
5	6.0	6.0	12.0	1.7659	59	60.3021
By Linear Regression of Y on X						
Slope, m		=	29.6409	Intercept, b		= 8.0050
Correlation Coefficient*		=	0.9995			
Calibration Accepted		=	Yes/No**			

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been re-assigned from EL333 to HVS012 with respect to the update in quality management system.

Calibrated by : Jackey MA
 Date : 09-Mar-18

Checked by : Pauline Wong
 Date : 09-Mar-18



Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA4a
 Equipment no. : HVS004

Calibration Date : 16-Jan-18
 Calibration Due Date : 16-Mar-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	291	Kelvin	Pressure, P _a
			1015 mmHg

Orifice Transfer Standard Information					
Equipment No.	Ori001	Slope, m _c	2.02533	Intercept, b _c	-0.03593
Last Calibration Date	20-Mar-17	$(H \times P_a / 1013.3 \times 298 / T_a)^{1/2}$ $m_c \times Q_{std} + b_c$			
Next Calibration Date	20-Mar-18				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC $(W(P_a/1013.3 \times 298/T_a)^{1/2}/35.31)$ Y-axis
	H (inches of water) (up)	(down)	(difference)			
1	1.5	1.5	3.0	0.8839	24	24.3073
2	2.4	2.4	4.8	1.1133	33	33.4225
3	3.7	3.7	7.4	1.3781	42	42.5378
4	4.8	4.8	9.6	1.5671	50	50.6402
5	5.7	5.7	11.4	1.7062	55	55.7042

By Linear Regression of Y on X

Slope, m = 38.0715 Intercept, b = -9.3021
 Correlation Coefficient* = 0.9995
 Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been

re-assigned from EL390 to HVS004 with respect to the update in quality management system.

Calibrated by : Jackey MA

Checked by : Pauline Wong

Date : 16-Jan-18

Date : 16-Jan-18



Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA4a
 Equipment no. : HVS004

Calibration Date : 09-Mar-18
 Calibration Due Date : 09-May-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	288	Kelvin	Pressure, P _a
			1023 mmHg

Orifice Transfer Standard Information					
Equipment No.	Ori001	Slope, m _c	2.02533	Intercept, b _c	-0.03593
Last Calibration Date	20-Mar-17	$(H \times P_a / 1013.3 \times 298 / T_a)^{1/2}$ $m_c \times Q_{std} + b_c$			
Next Calibration Date	20-Mar-18				

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC $(W(P_a/1013.3 \times 298/T_a)^{1/2}/35.31)$ Y-axis
	H (inches of water)	(up)	(down)			
1	1.5	1.5	3.0	0.8918	28	28.6180
2	2.5	2.5	5.0	1.1462	38	38.8387
3	3.8	3.8	7.6	1.4089	48	49.0594
4	4.9	4.9	9.8	1.5975	54	55.1918
5	6.2	6.2	12.4	1.7948	62	63.3683

By Linear Regression of Y on X

Slope, m = 38.0787 Intercept, b = -5.0704
 Correlation Coefficient* = 0.9995
 Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been

re-assigned from EL390 to HVS004 with respect to the update in quality management system.

Calibrated by : Jackey MA

Checked by : Pauline Wong

Date : 09-Mar-18

Date : 09-Mar-18



Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA5b
 Equipment no. : HVS010

Calibration Date : 16-Jan-18
 Calibration Due Date : 16-Mar-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	291	Kelvin	Pressure, P _a
			1015 mmHg

Orifice Transfer Standard Information				
Equipment No.	Ori001	Slope, m _c	2.02533	Intercept, b _c
				-0.03593
Last Calibration Date	20-Mar-17	$\left(H \times P_a / 1013.3 \times 298 / T_a \right)^{1/2}$ $= m_c \times Q_{std} + b_c$		
Next Calibration Date	20-Mar-18			

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	H (inches of water)	(up)	(down)			
1	1.4	1.4	2.8	0.8545	40	40.5122
2	2.1	2.1	4.2	1.0426	46	46.5890
3	3.1	3.1	6.2	1.2629	53	53.6786
4	3.9	3.9	7.8	1.4144	58	58.7427
5	4.7	4.7	9.4	1.5509	63	63.8067

By Linear Regression of Y on X

Slope, m = 33.2153 Intercept, b = 11.9753
 Correlation Coefficient* = 0.9997
 Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been re-assigned from EL222 to HVS010 with respect to the update in quality management system.

Calibrated by : Jackey MA
 Date : 16-Jan-18

Checked by : Pauline Wong
 Date : 16-Jan-18



Calibration Data for High Volume Sampler (TSP Sampler)

Location : CMA5b
 Equipment no. : HVS010

Calibration Date : 09-Mar-18
 Calibration Due Date : 09-May-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	288	Kelvin	Pressure, P _a
			1023 mmHg

Orifice Transfer Standard Information				
Equipment No.	Ori001	Slope, m _c	2.02533	Intercept, b _c
				-0.03593
Last Calibration Date	20-Mar-17	$(H \times P_a / 1013.3 \times 298 / T_a)^{1/2}$ $= m_c \times Q_{std} + b_c$		
Next Calibration Date	20-Mar-18			

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	H (inches of water)	(up)	(down)			
1	1.5	1.5	3.0	0.8918	32	32.7062
2	2.5	2.5	5.0	1.1462	40	40.8828
3	3.9	3.9	7.8	1.4271	48	49.0594
4	5.1	5.1	10.2	1.6294	54	55.1918
5	5.9	5.9	11.8	1.7512	59	60.3021

By Linear Regression of Y on X

Slope, m = 31.3759 Intercept, b = 4.6699
 Correlation Coefficient* = 0.9989
 Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been re-assigned from EL222 to HVS010 with respect to the update in quality management system.

Calibrated by : Jackey MA
 Date : 09-Mar-18

Checked by : Pauline Wong
 Date : 09-Mar-18



Calibration Data for High Volume Sampler (TSP Sampler)

Location : MA1e
 Equipment no. : HVS007

Calibration Date : 16-Jan-18
 Calibration Due Date : 16-Mar-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	291	Kelvin	Pressure, P _a
			1015 mmHg

Orifice Transfer Standard Information			
Equipment No.	Ori001	Slope, m _c	2.02533
		Intercept, b _c	-0.03593
Last Calibration Date	20-Mar-17	$(H \times P_a / 1013.3 \times 298 / T_a)^{1/2}$	
Next Calibration Date	20-Mar-18		
		$m_c \times Q_{std} + b_c$	

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC $(W(P_a/1013.3 \times 298/T_a)^{1/2}/35.31)$ Y-axis
	(up)	(down)	(difference)			
1	1.6	1.6	3.2	0.9123	30	30.3841
2	2.6	2.6	5.2	1.1581	38	38.4866
3	4.2	4.2	8.4	1.4671	48	48.6146
4	5.4	5.4	10.8	1.6611	54	54.6914
5	6.7	6.7	13.4	1.8483	59	59.7555

By Linear Regression of Y on X

Slope, m = 31.6483 Intercept, b = 1.7822
 Correlation Coefficient* = 0.9995
 Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been re-assigned from EL455 to HVS007 with respect to the update in quality management system.

Calibrated by : Jackey MA
 Date : 16-Jan-18

Checked by : Pauline Wong
 Date : 16-Jan-18



Calibration Data for High Volume Sampler (TSP Sampler)

Location : MA1e
 Equipment no. : HVS007

Calibration Date : 09-Mar-18
 Calibration Due Date : 09-May-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	288	Kelvin	Pressure, P _a
			1023 mmHg

Orifice Transfer Standard Information			
Equipment No.	Ori001	Slope, m _c	2.02533
		Intercept, b _c	-0.03593
Last Calibration Date	20-Mar-17	$(H \times P_a / 1013.3 \times 298 / T_a)^{1/2}$ $m_c \times Q_{std} + b_c$	
Next Calibration Date	20-Mar-18		

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC $(W(P_a/1013.3 \times 298/T_a)^{1/2}/35.31)$ Y-axis
	(up)	(down)	(difference)			
1	1.6	1.6	3.2	0.9205	30	30.6621
2	2.5	2.5	5.0	1.1462	38	38.8387
3	4.0	4.0	8.0	1.4451	48	49.0594
4	5.2	5.2	10.4	1.6452	54	55.1918
5	6.5	6.5	13.0	1.8373	62	63.3683

By Linear Regression of Y on X

Slope, m = 34.9949 Intercept, b = -1.5278
 Correlation Coefficient* = 0.9991
 Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been re-assigned from EL455 to HVS007 with respect to the update in quality management system.

Calibrated by : Jackey MA
 Date : 09-Mar-18

Checked by : Pauline Wong
 Date : 09-Mar-18



Calibration Data for High Volume Sampler (TSP Sampler)

Location : MA1w
 Equipment no. : HVS008

Calibration Date : 16-Jan-18
 Calibration Due Date : 16-Mar-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	291	Kelvin	Pressure, P _a
			1015 mmHg

Orifice Transfer Standard Information				
Equipment No.	Ori001	Slope, m _c	2.02533	Intercept, b _c
				-0.03593
Last Calibration Date	20-Mar-17	$\left(H \times P_a / 1013.3 \times 298 / T_a \right)^{1/2}$ $= m_c \times Q_{std} + b_c$		
Next Calibration Date	20-Mar-18			

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	1.5	1.5	3.0	0.8839	20	20.2561
2	2.5	2.5	5.0	1.1359	30	30.3841
3	3.9	3.9	7.8	1.4144	39	39.4994
4	5.1	5.1	10.2	1.6148	45	45.5762
5	6.3	6.3	12.6	1.7928	52	52.6658

By Linear Regression of Y on X

Slope, m = 34.8424 Intercept, b = -10.0007
 Correlation Coefficient* = 0.9988
 Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been re-assigned from EL080 to HVS008 with respect to the update in quality management system.

Calibrated by : Jackey MA
 Date : 16-Jan-18

Checked by : Pauline Wong
 Date : 16-Jan-18



Calibration Data for High Volume Sampler (TSP Sampler)

Location : MA1w
 Equipment no. : HVS008

Calibration Date : 09-Mar-18
 Calibration Due Date : 09-May-18

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition			
Temperature, T _a	288	Kelvin	Pressure, P _a
			1023 mmHg

Orifice Transfer Standard Information				
Equipment No.	Ori001	Slope, m _c	2.02533	Intercept, b _c
				-0.03593
Last Calibration Date	20-Mar-17	$\left(H \times P_a / 1013.3 \times 298 / T_a \right)^{1/2}$ $= m_c \times Q_{std} + b_c$		
Next Calibration Date	20-Mar-18			

Calibration of TSP						
Calibration Point	Manometer Reading			Q _{std} (m ³ / min.) X-axis	Continuous Flow Recorder, W (CFM)	IC (W(P _a /1013.3x298/T _a) ^{1/2} /35.31) Y-axis
	(up)	(down)	(difference)			
1	1.6	1.6	3.2	0.9205	22	22.4855
2	2.5	2.5	5.0	1.1462	30	30.6621
3	3.8	3.8	7.6	1.4089	39	39.8607
4	5.0	5.0	10.0	1.6136	45	45.9932
5	6.4	6.4	12.8	1.8232	52	53.1476

By Linear Regression of Y on X

Slope, m = 33.7575 Intercept, b = -8.2390
 Correlation Coefficient* = 0.9995
 Calibration Accepted = Yes/No**

* if Correlation Coefficient < 0.990, check and recalibration again.

Remarks : As per client's provided information, the equipment reference no. of the calibrated High Volume Sampler has been re-assigned from EL080 to HVS008 with respect to the update in quality management system.

Calibrated by : Jackey MA
 Date : 09-Mar-18

Checked by : Pauline Wong
 Date : 09-Mar-18



CERTIFICATE OF CALIBRATION

Certificate No.: 17CA0426 01-02 Page 1 of 2

Item tested

Description:	Sound Level Meter (Type 1)	Microphone
Manufacturer:	Larson Davis	PCB
Type/Model No.:	LxT1	377B02
Serial/Equipment No.:	0003737	171529
Adaptors used:	-	-

Item submitted by

Customer Name: Lam Environmental Service Ltd.
Address of Customer: -
Request No.: -
Date of receipt: 26-Apr-2017

Date of test: 28-Apr-2017

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Multi function sound calibrator	B&K 4226	2288444	18-Jun-2017	CIGISMEC
Signal generator	DS 360	61227	01-Apr-2018	CEPREI

Ambient conditions

Temperature: 21 ± 1 °C
Relative humidity: 50 ± 10 %
Air pressure: 1010 ± 5 hPa

Test specifications

- The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
- The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of +20%.
- The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure responsiveness of the Sound Level Meter.

Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on worksheets.

Approved Signatory:


Huang Jun Qi / Feng Jun Qi

Date: 04-May-2017

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 17CA0426 01-02

Page 2 of 2

1, Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertainty (dB)	Coverage Factor
Self-generated noise	A	Pass	0.3	2.1
	C	Pass	0.8	
	Lin	Pass	1.6	
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	2.2
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
Linearity range for SPL	A	Pass	0.3	
	C	Pass	0.3	
	Lin	Pass	0.3	
	Single Burst Fast	Pass	0.3	
Peak response	Single Burst Slow	Pass	0.3	
	Single 100µs rectangular pulse	N/A	N/A	
R.M.S. accuracy	Crest factor of 3	Pass	0.3	
	Single burst 5 ms at 2000 Hz	Pass	0.3	
	Repeated at frequency of 100 Hz	Pass	0.3	
Time weighting I	1 ms burst duty factor 1/10 ³ at 4kHz	Pass	0.3	
	1 ms burst duty factor 1/10 ⁴ at 4kHz	Pass	0.3	
Time averaging	Single burst 10 ms at 4 kHz	Pass	0.4	
	Single burst 10 ms at 4 kHz	Pass	0.4	
Sound exposure level	SPL	Pass	0.3	
	Leq	Pass	0.4	
Overload indication				

2, Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertainty (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

3, Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

- End -

Calibrated by:

Lai Sheng Jie
Date: 28-Apr-2017

Checked by:

Fung Chi Yip
Date: 04-May-2017

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



CERTIFICATE OF CALIBRATION

Certificate No.: 17CA0524 01 Page 1 of 2

Item tested

Description:	Sound Level Meter (Type 1)	Microphone	Preamp
Manufacturer:	Larson Davis	PCB	PCB
Type/Model No.:	LxT1	377B02	PRMLxT1L
Serial/Equipment No.:	0004796	155507	042621
Adaptors used:	-	-	-

Item submitted by

Customer Name: Lam Environmental Service Ltd.
Address of Customer: -
Request No.: -
Date of receipt: 24-May-2017

Date of test: 25-May-2017

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Multi function sound calibrator	B&K 4226	2288444	18-Jun-2017	CIGISMEC
Signal generator	DS 360	61227	01-Apr-2018	CEPREI

Ambient conditions

Temperature: 21 ± 1 °C
Relative humidity: 50 ± 10 %
Air pressure: 1010 ± 5 hPa

Test specifications

1. The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
2. The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of $\pm 20\%$.
3. The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure responses of the Sound Level Meter.

Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on worksheets.

Approved Signatory:


Huang Jiamin Feng Junqi

Date: 26-May-2017

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 17CA0524 01

Page 2 of 2

1. Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertainty (dB)	Coverage Factor
Self-generated noise	A	Pass	0.3	2.1
	C	Pass	0.8	
	Lin	Pass	1.6	
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	2.2
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
Linearity range for SPL	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	A	Pass	0.3	
	C	Pass	0.3	
Frequency weightings	Lin	Pass	0.3	
	Single Burst Fast	Pass	0.3	
	Single Burst Slow	Pass	0.3	
Peak response	Single 100 μ s rectangular pulse	Pass	0.3	
	R.M.S. accuracy	Pass	0.3	
Time weighting I	Single burst 5 ms at 2000 Hz	Pass	0.3	
	Repeated at frequency of 100 Hz	Pass	0.3	
Time averaging	1 ms burst duty factor 1/10 ³ at 4kHz	Pass	0.3	
	1 ms burst duty factor 1/10 ⁴ at 4kHz	Pass	0.3	
Pulse range	Single burst 10 ms at 4 kHz	Pass	0.4	
	Sound exposure level	Pass	0.4	
Overload indication	SPL	Pass	0.3	
	Leq	Pass	0.4	

2. Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertainty (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

3. Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

- End -

Calibrated by:

Kai Sheng Jie

Date: 25-May-2017

Checked by:

Fung Chi Yip

Date: 26-May-2017

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



CERTIFICATE OF CALIBRATION

Certificate No.: 18CA0213 02 Page 1 of 2

Item tested

Description:	Sound Level Meter (Type 1)	Microphone	Preamp
Manufacturer:	B & K	B & K	B & K
Type/Model No.:	2250	4950	ZC0032
Serial/Equipment No.:	2701778	2755097	19223
Adaptors used:	-	-	-

Item submitted by

Customer Name: Lam Geotechnics Limited.
Address of Customer: -
Request No.: -
Date of receipt: 13-Feb-2018

Date of test: 21-Feb-2018

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Multi function sound calibrator	B&K 4226	2268444	08-Sep-2018	CIGISMEC
Signal generator	DS 360	33873	25-Apr-2018	CEPREI
Signal generator	DS 360	61227	01-Apr-2018	CEPREI

Ambient conditions

Temperature: 20 ± 1 °C
Relative humidity: 50 ± 10 %
Air pressure: 1000 ± 5 hPa

Test specifications

- The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
- The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of +20%.
- The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure response of the Sound Level Meter.

Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on worksheets.

Approved Signatory:



Feng Jun Qi

Date: 21-Feb-2018

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 18CA0213 02 Page 2 of 2

1. Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertainty (dB)	Coverage Factor
Self-generated noise	A	Pass	0.3	
	C	Pass	0.8	
	Lin	Pass	1.6	
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
Linearity range for SPL	A	Pass	0.3	
	C	Pass	0.3	
	Lin	Pass	0.3	
Time weightings	Single Burst Fast	Pass	0.3	
	Single Burst Slow	Pass	0.3	
Peak response	Single 100µs rectangular pulse	Pass	0.3	
R.M.S. accuracy	Crest factor of 3	Pass	0.3	
Time weighting I	Single burst 5 ms at 2000 Hz	Pass	0.3	
	Repeated at frequency of 100 Hz	Pass	0.3	
Time averaging	1 ms burst duty factor 1/10 ³ at 4kHz	Pass	0.3	
	1 ms burst duty factor 1/10 ⁴ at 4kHz	Pass	0.3	
Pulse range	Single burst 10 ms at 4 kHz	Pass	0.4	
Sound exposure level	Single burst 10 ms at 4 kHz	Pass	0.4	
Overload indication	SPL	Pass	0.3	
	Leq	Pass	0.4	

2. Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertainty (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

3. Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

Calibrated by:

Date:

Fung Chi Yip
21-Feb-2018

Checked by:

Date:

Lam Tze Wai
21-Feb-2018

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



CERTIFICATE OF CALIBRATION

Certificate No.: 17CA0320 02 Page 1 of 2

Item tested

Description:	Sound Level Meter (Type 1)	Microphone	Preamp
Manufacturer:	B & K	B & K	B & K
Type/Model No.:	2250-L	4950	ZC0032
Serial/Equipment No.:	2722310	2698702	13318
Adaptors used:	-	-	-

Item submitted by

Customer Name: Lam Geotechnics Ltd.
Address of Customer: -
Request No.: -
Date of receipt: 20-Mar-2017

Date of test: 23-Mar-2017

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Multi function sound calibrator	B&K 4226	2288444	18-Jun-2017	CIGISMEC
Signal generator	DS 360	33873	18-Apr-2017	CEPREI
Signal generator	DS 360	61227	18-Apr-2017	CEPREI

Ambient conditions

Temperature: 21 ± 1 °C
Relative humidity: 60 ± 10 %
Air pressure: 1010 ± 5 hPa

Test specifications

- The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
- The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of ±20%.
- The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure responsiveness of the Sound Level Meter.

Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on worksheets.

Approved Signatory:


Huang Jian Min/Feng Jun Qi

Date: 24-Mar-2017

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 17CA0320 02 Page 2 of 2

1. Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertainty (dB)	Coverage Factor
Self-generated noise	A	Pass	0.3	
	C	Pass	0.8	
	Lin	Pass	1.6	
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
Linearity range for SPL	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	Frequency weightings			
Time weightings	A	Pass	0.3	
	C	Pass	0.3	
	Lin	Pass	0.3	
Peak response	Single Burst Fast	Pass	0.3	
	Single Burst Slow	Pass	0.3	
R.M.S. accuracy	Single 100µs rectangular pulse	Pass	0.3	
	Crest factor of 3	Pass	0.3	
Time weighting I	Single burst 5 ms at 2000 Hz	Pass	0.3	
	Repeated at frequency of 100 Hz	Pass	0.3	
Time averaging	1 ms burst duty factor 1/10 ³ at 4kHz	Pass	0.3	
	1 ms burst duty factor 1/10 ⁴ at 4kHz	Pass	0.3	
Pulse range	Single burst 10 ms at 4 kHz	Pass	0.4	
Sound exposure level	Single burst 10 ms at 4 kHz	Pass	0.4	
Overload indication	SPL	Pass	0.3	
	Leq	Pass	0.4	

2. Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertainty (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

3. Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

- End -

Calibrated by:

Lai Sheng Jie

Date: 23-Mar-2017

Checked by:

Fung Chi Yip

Date: 24-Mar-2017

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



CERTIFICATE OF CALIBRATION

Certificate No.: 18CA0309 01 Page 1 of 2

Item tested

Description:	Sound Level Meter (Type 1)	Microphone	Preamp
Manufacturer:	B & K	B & K	B & K
Type/Model No.:	2250-L	4950	ZC0032
Serial/Equipment No.:	2722310	2698702	13318
Adaptors used:	-	-	-

Item submitted by

Customer Name:	Lam Geotechnics Ltd.
Address of Customer:	-
Request No.:	-
Date of receipt:	09-Mar-2018

Date of test: 10-Mar-2018

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Multi function sound calibrator	B&K 4226	2288444	08-Sep-2018	CIGISMEC
Signal generator	DS 360	33873	25-Apr-2018	CEPREI
Signal generator	DS 360	61227	01-Apr-2018	CEPREI

Ambient conditions

Temperature:	21 ± 1 °C
Relative humidity:	50 ± 10 %
Air pressure:	1000 ± 5 hPa

Test specifications

1. The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
2. The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of ±20%.
3. The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure responsiveness of the Sound Level Meter.

Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on worksheets.

Approved Signatory:

Feng Jun Q

Date: 12-Mar-2018

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 18CA0309 01

Page 2 of 2

1. Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertainty (dB)	Coverage Factor
Self-generated noise	A	Pass	0.3	
	C	Pass	0.8	
	Lin	Pass	1.6	
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
Linearity range for SPL	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	A	Pass	0.3	
Frequency weightings	C	Pass	0.3	
	Lin	Pass	0.3	
	Time weightings	Single Burst Fast	Pass	0.3
Peak response	Single Burst Slow	Pass	0.3	
	Single 100µs rectangular pulse	Pass	0.3	
R.M.S. accuracy	Crest factor of 3	Pass	0.3	
	Time weighting I	Single burst 5 ms at 2000 Hz	Pass	0.3
Time averaging	Repeated at frequency of 100 Hz	Pass	0.3	
	1 ms burst duty factor 1/10 ³ at 4kHz	Pass	0.3	
Pulse range	1 ms burst duty factor 1/10 ⁴ at 4kHz	Pass	0.3	
	Single burst 10 ms at 4 kHz	Pass	0.4	
Sound exposure level	Single burst 10 ms at 4 kHz	Pass	0.4	
	Overload indication	SPL	Pass	0.3
	Leq	Pass	0.4	

2. Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertainty (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

3. Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

Calibrated by:

Date: 10-Mar-2018

Fung Chi Yip

- End -

Checked by:

Date: 12-Mar-2018

Lam Tze Wai

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



CERTIFICATE OF CALIBRATION

Certificate No.: 17CA0505 01 Page 1 of 2

Item tested

Description:	Sound Level Meter (Type 1)	Microphone	Preamp
Manufacturer:	B & K	B & K	B & K
Type/Model No.:	2250-L	4950	ZC0032
Serial/Equipment No.:	2722311	2698703	13321
Adaptors used:	-	-	-

Item submitted by

Customer Name: Lam Geotechnics Ltd.
Address of Customer: -
Request No.: -
Date of receipt: 05-May-2017

Date of test: 06-May-2017

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Multi function sound calibrator	B&K 4226	2288444	18-Jun-2017	CIGISMEC
Signal generator	DS 360	61227	01-Apr-2018	CEPREI

Ambient conditions

Temperature: 22 ± 1 °C
Relative humidity: 50 ± 10 %
Air pressure: 1010 ± 5 hPa

Test specifications

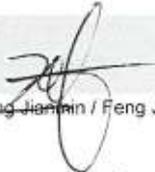
- The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
- The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of $\pm 20\%$.
- The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure response of the Sound Level Meter.

Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on worksheets.

Approved Signatory:  Date: 09-May-2017 Company Chop:

Huang Jianmin / Feng Junqi



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 17CA0505 01 Page 2 of 2

1. Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertainty (dB)	Coverage Factor
Self-generated noise	A	Pass	0.3	
	C	Pass	0.8	
	Lin	Pass	1.6	
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
Linearity range for SPL	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	A	Pass	0.3	
	C	Pass	0.3	
Frequency weightings	Lin	Pass	0.3	
	Time weightings	Single Burst Fast	Pass	0.3
	Single Burst Slow	Pass	0.3	
Peak response	Single 100µs rectangular pulse	Pass	0.3	
	R.M.S. accuracy	Crest factor of 3	Pass	0.3
Time weighting I	Single burst 5 ms at 2000 Hz	Pass	0.3	
	Repeated at frequency of 100 Hz	Pass	0.3	
Time averaging	1 ms burst duty factor 1/10 ³ at 4kHz	Pass	0.3	
	1 ms burst duty factor 1/10 ⁴ at 4kHz	Pass	0.3	
Pulse range	Single burst 10 ms at 4 kHz	Pass	0.4	
Sound exposure level	Single burst 10 ms at 4 kHz	Pass	0.4	
Overload indication	SPL	Pass	0.3	
	Leq	Pass	0.4	

2. Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertainty (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

3. Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

- End -

Calibrated by:

Lai Sheng Jie

Date: 06-May-2017

Checked by:

Fung Chi Yip

Date: 09-May-2017

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



CERTIFICATE OF CALIBRATION

Certificate No.: 18CA0116 01 Page 1 of 2

Item tested

Description:	Sound Level Meter (Type 1)	Microphone	Preamp
Manufacturer:	B & K	B & K	B & K
Type/Model No.:	2250L	4950	ZC0032
Serial/Equipment No.:	3002695	2940839	18582
Adaptors used:	-	-	-

Item submitted by

Customer Name: Lam Geotechnics Ltd.
Address of Customer: -
Request No.: -
Date of receipt: 16-Jan-2018

Date of test: 18-Jan-2018

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Multi function sound calibrator	B&K 4226	2288444	08-Sep-2018	CIGISMEC
Signal generator	DS 360	33873	25-Apr-2018	CEPREI
Signal generator	DS 360	61227	01-Apr-2018	CEPREI

Ambient conditions

Temperature: 21 ± 1 °C
Relative humidity: 50 ± 10 %
Air pressure: 1005 ± 5 hPa

Test specifications

- The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
- The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of ±20%.
- The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure responsess of the Sound Level Meter.

Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on worksheets.

Approved Signatory:



Feng Jun Qi

Date: 18-Jan-2018

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 18CA0116 01

Page 2 of 2

1, Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertainty (dB)	Coverage Factor
Self-generated noise	A	Pass	0.3	
	C	Pass	0.8	
	Lin	Pass	1.6	
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
Linearity range for SPL	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	A	Pass	0.3	
	C	Pass	0.3	
Frequency weightings	Lin	Pass	0.3	
	Single Burst Fast	Pass	0.3	
	Single Burst Slow	Pass	0.3	
Time weightings	Single 100µs rectangular pulse	Pass	0.3	
	Crest factor of 3	Pass	0.3	
R.M.S. accuracy	Single burst 5 ms at 2000 Hz	Pass	0.3	
	Repeated at frequency of 100 Hz	Pass	0.3	
Time averaging	1 ms burst duty factor 1/10 ³ at 4kHz	Pass	0.3	
	1 ms burst duty factor 1/10 ⁴ at 4kHz	Pass	0.3	
Pulse range	Single burst 10 ms at 4 kHz	Pass	0.4	
	Single burst 10 ms at 4 kHz	Pass	0.4	
Sound exposure level	SPL	Pass	0.3	
	Leq	Pass	0.4	

2, Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertainty (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

3, Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

- End -

Calibrated by:

Fung Chi Yip

Date: 18-Jan-2018

Checked by:

Lam Tze Wai

Date: 18-Jan-2018

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



CERTIFICATE OF CALIBRATION

Certificate No.: 17CA0904 02 Page 1 of 2

Item tested

Description:	Sound Level Meter (Type 1)	Microphone	Preamp
Manufacturer:	B & K	B & K	B & K
Type/Model No.:	2250-L	4950	ZC0032
Serial/Equipment No.:	3006790	2827240	21213
Adaptors used:	-	-	-

Item submitted by

Customer Name: Lam Geotechnics Limited
Address of Customer: -
Request No.: -
Date of receipt: 04-Sep-2017

Date of test: 09-Sep-2017

Reference equipment used in the calibration

Description:	Model:	Serial No.:	Expiry Date:	Traceable to:
Multi function sound calibrator	B&K 4226	2288444	08-Sep-2018	CIGISMEC
Signal generator	DS 360	33673	25-Apr-2018	CEPREI
Signal generator	DS 360	81227	01-Apr-2018	CEPREI

Ambient conditions

Temperature: 21 ± 1 °C
Relative humidity: 50 ± 10 %
Air pressure: 1015 ± 5 hPa

Test specifications

1. The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
2. The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of $\pm 20\%$.
3. The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure responsiveness of the Sound Level Meter.

Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate

Actual Measurement data are documented on worksheets.

Approved Signatory:


Huang Jian Min/Feng Jun Qi

Date: 09-Sep-2017

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 17CA0904 02

Page 2 of 2

1, Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertainty (dB)	Coverage Factor
Self-generated noise	A	Pass	0.3	
	C	Pass	0.8	
	Lin	Pass	1.6	
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
Linearity range for SPL	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	A	Pass	0.3	
	C	Pass	0.3	
Frequency weightings	Lin	Pass	0.3	
	Time weightings	Single Burst Fast	Pass	0.3
	Single Burst Slow	Pass	0.3	
Peak response	Single 100µs rectangular pulse	Pass	0.3	
	R.M.S. accuracy	Crest factor of 3	Pass	0.3
Time weighting I	Single burst 5 ms at 2000 Hz	Pass	0.3	
	Repeated at frequency of 100 Hz	Pass	0.3	
Time averaging	1 ms burst duty factor 1/10 ³ at 4kHz	Pass	0.3	
	1 ms burst duty factor 1/10 ⁴ at 4kHz	Pass	0.3	
Pulse range	Single burst 10 ms at 4 kHz	Pass	0.4	
Sound exposure level	Single burst 10 ms at 4 kHz	Pass	0.4	
Overload indication	SPL	Pass	0.3	
	Leq	Pass	0.4	

2, Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertainty (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

3, Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

Calibrated by:

Lai Sheng Jie

Date: 09-Sep-2017

- End -

Checked by:

Fung Chi Yip

Date: 09-Sep-2017

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



CERTIFICATE OF CALIBRATION

Certificate No.: 17CA1110 02

Page: 1 of 2

Item tested

Description: Acoustical Calibrator (Class 1)
Manufacturer: Rion Co., Ltd.
Type/Model No.: NC-73
Serial/Equipment No.: 10707358
Adaptors used: -

Item submitted by

Customer: Lam Geotechnics Ltd.
Address of Customer: -
Request No.: -
Date of receipt: 10-Nov-2017

Date of test: 14-Nov-2017

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Lab standard microphone	B&K 4180	2341427	11-Apr-2018	SCL
Preamplifier	B&K 2673	2239857	05-May-2018	CEPREI
Measuring amplifier	B&K 2610	2346941	03-May-2018	CEPREI
Signal generator	DS 360	61227	01-Apr-2018	CEPREI
Digital multi-meter	34401A	US36087050	25-Apr-2018	CEPREI
Audio analyzer	8903B	GB41300350	21-Apr-2018	CEPREI
Universal counter	53132A	MY40003662	22-Apr-2018	CEPREI

Ambient conditions

Temperature: 21 ± 1 °C
Relative humidity: 50 ± 10 %
Air pressure: 1010 ± 5 hPa

Test specifications

- The Sound Calibrator has been calibrated in accordance with the requirements as specified in IEC 60942: 1997 Annex B and the lab calibration procedure SMTP004-CA-156.
- The calibrator was tested with its axis vertical facing downwards at the specific frequency using insert voltage technique.
- The results are rounded to the nearest 0.01 dB and 0.1 Hz and have not been corrected for variations from a reference pressure of 1013.25 hectoPascals as the maker's information indicates that the instrument is insensitive to pressure changes.

Test results

This is to certify that the sound calibrator conforms to the requirements of annex B of IEC 60942: 1997 for the conditions under which the test was performed. This does not imply that the sound calibrator meets IEC 60942 under any other conditions.

Details of the performed measurements are presented on **page 2** of this certificate.

Approved Signatory:


Huang Jun Min / Feng Jun Qi

Date: 15-Nov-2017

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 17CA1110 02

Page: 2 of 2

1. Measured Sound Pressure Level

The output Sound Pressure Level in the calibrator head was measured at the setting and frequency shown using a calibrated laboratory standard microphone and insert voltage technique. The results are given in below with the estimated uncertainties.

Frequency Shown Hz	Output Sound Pressure Level Setting dB	Measured Output Sound Pressure Level dB	(Output level in dB re 20 µPa)
			Estimated Expanded Uncertainty dB
1000	94.00	93.93	0.10

2. Sound Pressure Level Stability - Short Term Fluctuations

The Short Term Fluctuations was determined by measuring the maximum and minimum of the fast weighted DC output of the B&K 2610 measuring amplifier over a 20 second time interval as required in the standard. The Short Term Fluctuation was found to be:

At 1000 Hz **STF = 0.008 dB**

Estimated expanded uncertainty 0.005 dB

3. Actual Output Frequency

The determination of actual output frequency was made using a B&K 4180 microphone together with a B&K 2673 preamplifier connected to a B&K 2610 measuring amplifier. The AC output of the B&K 2610 was taken to an universal counter which was used to determine the frequency averaged over 20 second of operation as required by the standard. The actual output frequency at 1 KHz was:

At 1000 Hz **Actual Frequency = 991.5 Hz**

Estimated expanded uncertainty 0.1 Hz Coverage factor k = 2.2

4. Total Noise and Distortion

For the Total Noise and Distortion measurement, the unfiltered AC output of the B&K 2610 measuring amplifier was connected to an Agilent Type 8903 B distortion analyser. The TND result at 1 KHz was:

At 1000 Hz **TND = 0.3 %**

Estimated expanded uncertainty 0.7 %

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

Calibrated by:


Li Sheng Jie
Date: 14-Nov-2017

- End -

Checked by:


Fung Chi Yip
Date: 15-Nov-2017

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



CERTIFICATE OF CALIBRATION

Certificate No.: 17CA0320 03

Page: 1 of 2

Item tested

Description: Acoustical Calibrator (Class 1)
Manufacturer: Larson Davis
Type/Model No.: CAL200
Serial/Equipment No.: 13098
Adaptors used: -

Item submitted by

Customer: Lam Environmental Service Ltd.
Address of Customer: -
Request No.: -
Date of receipt: 20-Mar-2017

Date of test: 23-Mar-2017

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Lab standard microphone	B&K 4180	2412857	14-Apr-2017	SCL
Preamplifier	B&K 2673	2239857	28-Apr-2017	CEPREI
Measuring amplifier	B&K 2610	2346941	26-Apr-2017	CEPREI
Signal generator	DS 360	61227	18-Apr-2017	CEPREI
Digital multi-meter	34401A	US36087050	18-Apr-2017	CEPREI
Audio analyzer	8903B	GB41300350	19-Apr-2017	CEPREI
Universal counter	53132A	MY40003662	19-Apr-2017	CEPREI

Ambient conditions

Temperature: 21 ± 1 °C
Relative humidity: 60 ± 10 %
Air pressure: 1010 ± 5 hPa

Test specifications

- The Sound Calibrator has been calibrated in accordance with the requirements as specified in IEC 60942 1997 Annex B and the lab calibration procedure SMTP004-CA-156.
- The calibrator was tested with its axis vertical facing downwards at the specific frequency using insert voltage technique.
- The results are rounded to the nearest 0.01 dB and 0.1 Hz and have not been corrected for variations from a reference pressure of 1013.25 hectoPascals as the maker's information indicates that the instrument is insensitive to pressure changes.

Test results

This is to certify that the sound calibrator conforms to the requirements of annex B of IEC 60942: 1997 for the conditions under which the test was performed. This does not imply that the sound calibrator meets IEC 60942 under any other conditions.

Details of the performed measurements are presented on **page 2** of this certificate.

Approved Signatory:

Huang Jian Min/Feng Jun Qi

Date: 24-Mar-2017

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 17CA0320 03 Page: 2 of 2

1. Measured Sound Pressure Level

The output Sound Pressure Level in the calibrator head was measured at the setting and frequency shown using a calibrated laboratory standard microphone and insert voltage technique. The results are given in below with the estimated uncertainties.

Frequency Shown Hz	Output Sound Pressure Level Setting dB	Measured Output Sound Pressure Level dB	Estimated Expanded Uncertainty dB
1000	94.00	93.98	0.10

(Output level in dB re 20 µPa)

2. Sound Pressure Level Stability - Short Term Fluctuations

The Short Term Fluctuations was determined by measuring the maximum and minimum of the fast weighted DC output of the B&K 2610 measuring amplifier over a 20 second time interval as required in the standard. The Short Term Fluctuation was found to be:

At 1000 Hz **STF = 0.002 dB**
 Estimated expanded uncertainty 0.005 dB

3. Actual Output Frequency

The determination of actual output frequency was made using a B&K 4180 microphone together with a B&K 2673 preamplifier connected to a B&K 2610 measuring amplifier. The AC output of the B&K 2610 was taken to an universal counter which was used to determine the frequency averaged over 20 second of operation as required by the standard. The actual output frequency at 1 KHz was:

At 1000 Hz **Actual Frequency = 1000.2 Hz**
 Estimated expanded uncertainty 0.1 Hz Coverage factor k = 2.2

4. Total Noise and Distortion

For the Total Noise and Distortion measurement, the unfiltered AC output of the B&K 2610 measuring amplifier was connected to an Agilent Type 8903 B distortion analyser. The TND result at 1 KHz was:

At 1000 Hz **TND = 0.5 %**
 Estimated expanded uncertainty 0.7 %

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

- End -

Calibrated by: 
 Date: 23-Mar-2017

Checked by: 
 Date: 24-Mar-2017

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



CERTIFICATE OF CALIBRATION

Certificate No.: 18CA0309 02

Page: 1 of 2

Item tested

Description: Acoustical Calibrator (Class 1)
Manufacturer: Larson Davis
Type/Model No.: CAL200
Serial/Equipment No.: 13098
Adaptors used: -

Item submitted by

Customer: Lam Environmental Service Ltd.
Address of Customer: -
Request No.: -
Date of receipt: 09-Mar-2018

Date of test: 12-Mar-2018

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Lab standard microphone	B&K 4180	2341427	11-Apr-2018	SCL
Preamplifier	B&K 2673	2239857	05-May-2018	CEPREI
Measuring amplifier	B&K 2610	2346941	03-May-2018	CEPREI
Signal generator	DS 360	61227	01-Apr-2018	CEPREI
Digital multi-meter	34401A	US36087050	25-Apr-2018	CEPREI
Audio analyzer	8903B	GB41300350	21-Apr-2018	CEPREI
Universal counter	53132A	MY40003662	22-Apr-2018	CEPREI

Ambient conditions

Temperature: 21 ± 1 °C
Relative humidity: 50 ± 10 %
Air pressure: 1000 ± 5 hPa

Test specifications

- The Sound Calibrator has been calibrated in accordance with the requirements as specified in IEC 60942 1997 Annex B and the lab calibration procedure SMTP004-CA-156.
- The calibrator was tested with its axis vertical facing downwards at the specific frequency using insert voltage technique.
- The results are rounded to the nearest 0.01 dB and 0.1 Hz and have not been corrected for variations from a reference pressure of 1013.25 hectoPascals as the maker's information indicates that the instrument is insensitive to pressure changes.

Test results

This is to certify that the sound calibrator conforms to the requirements of annex B of IEC 60942: 1997 for the conditions under which the test was performed. This does not imply that the sound calibrator meets IEC 60942 under any other conditions.

Details of the performed measurements are presented on **page 2** of this certificate.

Approved Signatory:


Feng Jun Qi

Date: 12-Mar-2018

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long term stability of the instrument.



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 18CA0309 02

Page: 2 of 2

1. Measured Sound Pressure Level

The output Sound Pressure Level in the calibrator head was measured at the setting and frequency shown using a calibrated laboratory standard microphone and insert voltage technique. The results are given in below with the estimated uncertainties.

Frequency Shown Hz	Output Sound Pressure Level Setting dB	Measured Output Sound Pressure Level dB	(Output level in dB re 20 µPa)	
			Estimated Uncertainty dB	Expanded Uncertainty dB
1000	94.0	93.81	0.10	

2. Sound Pressure Level Stability - Short Term Fluctuations

The Short Term Fluctuations was determined by measuring the maximum and minimum of the fast weighted DC output of the B&K 2610 measuring amplifier over a 20 second time interval as required in the standard. The Short Term Fluctuation was found to be:

At 1000 Hz **STF = 0.011 dB**

Estimated expanded uncertainty 0.005 dB

3. Actual Output Frequency

The determination of actual output frequency was made using a B&K 4180 microphone together with a B&K 2673 preamplifier connected to a B&K 2610 measuring amplifier. The AC output of the B&K 2610 was taken to an universal counter which was used to determine the frequency averaged over 20 second of operation as required by the standard. The actual output frequency at 1 KHz was:

At 1000 Hz **Actual Frequency = 1000.0 Hz**

Estimated expanded uncertainty 0.1 Hz Coverage factor k = 2.2

4. Total Noise and Distortion

For the Total Noise and Distortion measurement, the unfiltered AC output of the B&K 2610 measuring amplifier was connected to an Agilent Type 8903 B distortion analyser. The TND result at 1 KHz was:

At 1000 Hz **TND = 0.6 %**

Estimated expanded uncertainty 0.7 %

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

- End -

Calibrated by:

Date:

Fung Chi Yip
12-Mar-2018

Checked by:

Date:

Lam Tze Wai
12-Mar-2018

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



Appendix 5.1

Monitoring Schedules for Reporting Month and Coming Reporting Month

Contract No. HK/2015/01
Wan Chai Development Phase II and Central-Wan Chai Bypass
Sampling, Field Measurement and Testing Works (Stage 3)

Environmental Monitoring Schedule
March 2018

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		27-Feb	28-Feb	1-Mar	2-Mar	3-Mar
		Noise (daytime) (M7e, M7w)	Noise (daytime) (M1a, M8)	Noise (daytime) (M2b, M3a, M4, M5b, M6)	24hr TSP	1hr TSP
4-Mar	5-Mar	6-Mar	7-Mar	8-Mar	9-Mar	10-Mar
Noise (daytime) (M7e, M7w, M8)	Noise (daytime) (M1a, M2b, M3a, M4b, M5b, M6)	24hr TSP	1hr TSP			
11-Mar	12-Mar	13-Mar	14-Mar	15-Mar	16-Mar	17-Mar
Noise (daytime) (M1a, M5b, M7e, M7w, M8)	24hr TSP Noise (daytime) (M2b, M3a)	1hr TSP Noise (daytime) (M4b, M6)				
18-Mar	19-Mar	20-Mar	21-Mar	22-Mar	23-Mar	24-Mar
24hr TSP Noise (daytime) (M7e, M7w, M8)	1hr TSP	Noise (daytime) (M1a, M2b)	Noise (daytime) (M3a, M4b, M5b, M6)	24hr TSP	1hr TSP	
25-Mar	26-Mar	27-Mar	28-Mar	29-Mar		
Noise (daytime) (M2b)	Noise (daytime) (M3a, M4b, M5b, M6, M7e, M7w)	Noise (daytime) (M1a, M8)				

Contract No. HK/2015/01
 Wan Chai Development Phase II and Central-Wan Chai Bypass
 Sampling, Field Measurement and Testing Works (Stage 3)

Tentative Environmental Monitoring Schedule
 April 2018

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
25-Mar		27-Mar	28-Mar	29-Mar	30-Mar	31-Mar
			24hr TSP	1hr TSP		
1-Apr	2-Apr	3-Apr	4-Apr	5-Apr	6-Apr	7-Apr
		24hr TSP Noise (daytime)	1hr TSP		Noise (daytime)	
8-Apr	9-Apr	10-Apr	11-Apr	12-Apr	13-Apr	14-Apr
24hr TSP Noise (daytime)		1hr TSP Noise (daytime)				24hr TSP
15-Apr	16-Apr	17-Apr	18-Apr	19-Apr	20-Apr	21-Apr
1hr TSP		Noise (daytime)	Noise (daytime)		24hr TSP	1hr TSP
22-Apr	23-Apr	24-Apr	25-Apr	26-Apr	27-Apr	
Noise (daytime)		Noise (daytime)		24hr TSP	1hr TSP	



Appendix 5.2

Noise Monitoring Results and Graphical Presentations



Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)

Location: M1a - Footbridge at EX-Wanchai Harbour Road Sports Centre

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
Unit: dB(A), (30-min)								
28/2/18	13:35	Fine	77.0	80.4	74.6	72	75	75
6/3/18	14:00	Fine	75.9	78.0	69.7	72	73	75
12/3/18	11:00	Fine	71.1	73.5	67.2	72	71	75
21/3/18	09:00	Fine	74.2	75.9	71.6	72	70	75
28/3/18	15:20	Fine	72.6	74.8	70.0	72	62	75



Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)

Location: M2b - Noon-day gun area

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
Unit: dB(A), (30-min)								
1/3/18	10:05	Fine	67.3	69.1	64.9	68	67	75
6/3/18	14:45	Fine	67.6	69.3	65.5	68	68	75
13/3/18	14:50	Fine	67.9	70.2	65.1	68	56	75
21/3/18	09:45	Fine	66.9	68.4	64.6	68	67	75
26/3/18	13:10	Fine	68.9	70.6	66.5	68	63	75

Location: M3a - Tung Lo Wan Fire Station

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
Unit: dB(A), (30-min)								
1/3/18	13:40	Fine	65.6	67.0	63.9	69	66	75
6/3/18	09:30	Fine	65.1	66.8	62.8	69	65	75
13/3/18	15:40	Fine	66.3	68.6	63.7	69	66	75
22/3/18	08:20	Fine	66.5	68.7	64.9	69	67	75
27/3/18	08:50	Fine	65.2	67.1	62.3	69	65	75



Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)

Location: M4b - Victoria Centre

Date	Time	Weather	Measurement Noise Level			Baseline Noise Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
Unit: dB(A), (30min)								
1/3/18	10:50	Fine	64.8	66.3	62.8	67	65	75
6/3/18	10:10	Fine	65.8	67.6	63.5	67	66	75
14/3/18	10:45	Cloudy	66.0	67.6	63.8	67	66	75
22/3/18	09:00	Fine	64.2	65.8	62.0	67	64	75
27/3/18	09:35	Fine	66.3	67.4	63.5	67	66	75

Location: M5b - City Garden

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
Unit: dB(A), (30min)								
1/3/18	14:30	Fine	72.8	77.1	67.4	68	71	75
6/3/18	11:05	Fine	74.6	76.7	67.0	68	74	75
12/3/18	09:55	Fine	71.8	74.6	67.5	68	69	75
22/3/18	09:50	Fine	68.8	72.0	65.2	68	61	75
27/3/18	10:30	Fine	69.3	70.2	67.0	68	63	75

Location: M6 - HK Baptist Church Henrietta Secondary School

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
Unit: dB(A), (30-min)								
1/3/18	15:10	Fine	70.1	72.2	67.8	71	70	70
6/3/18	15:35	Fine	78.2	83.5	67.5	71	77	70
14/3/18	09:15	Cloudy	65.4	66.9	63.4	71	65	70
22/3/18	10:30	Fine	70.4	74.1	67.1	71	70	70
27/3/18	11:10	Fine	67.8	69.0	66.3	71	68	70



Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)

Location: M7e - International Finance Centre (Eastern End of Podium) (Reference Station)

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
Unit: dB(A), (30-min)								
27/2/18	13:25	Fine	65.7	68.0	62.3	67	66	N/A
5/3/18	13:30	Fine	66.1	67.6	62.9	67	66	N/A
12/3/18	13:25	Fine	69.8	71.8	66.0	67	67	N/A
19/3/18	13:25	Fine	68.7	70.5	65.7	67	64	N/A
27/3/18	13:00	Fine	68.0	69.7	66.0	67	62	N/A

Location: M7w - International Finance Centre (Western End of Podium)


Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
Unit: dB(A), (30-min)								
27/2/18	14:00	Fine	65.6	67.1	62.4	69	66	75
5/3/18	14:05	Fine	64.5	66.1	62.2	69	65	75
12/3/18	14:00	Fine	64.9	66.7	62.3	69	65	75
19/3/18	14:05	Fine	65.3	66.9	63.2	69	65	75
27/3/18	13:35	Fine	66.7	68.2	64.4	69	67	75

Location: M8 - City Hall

Date	Time	Weather	Measurement Noise Level			Baseline Level	Construction Noise Level	Limit Level
			Leq	L10	L90	Leq	Leq	Leq
Unit: dB(A), (30-min)								
28/2/18	10:00	Cloudy	61.5	62.5	57.8	64	62	70
5/3/18	14:50	Fine	59.6	61.8	55.5	64	60	70
12/3/18	14:50	Fine	59.9	61.5	57.5	64	60	70
19/3/18	15:05	Fine	60.5	62.7	56.8	64	61	70
28/3/18	13:30	Fine	60.9	62.0	58.3	64	61	70






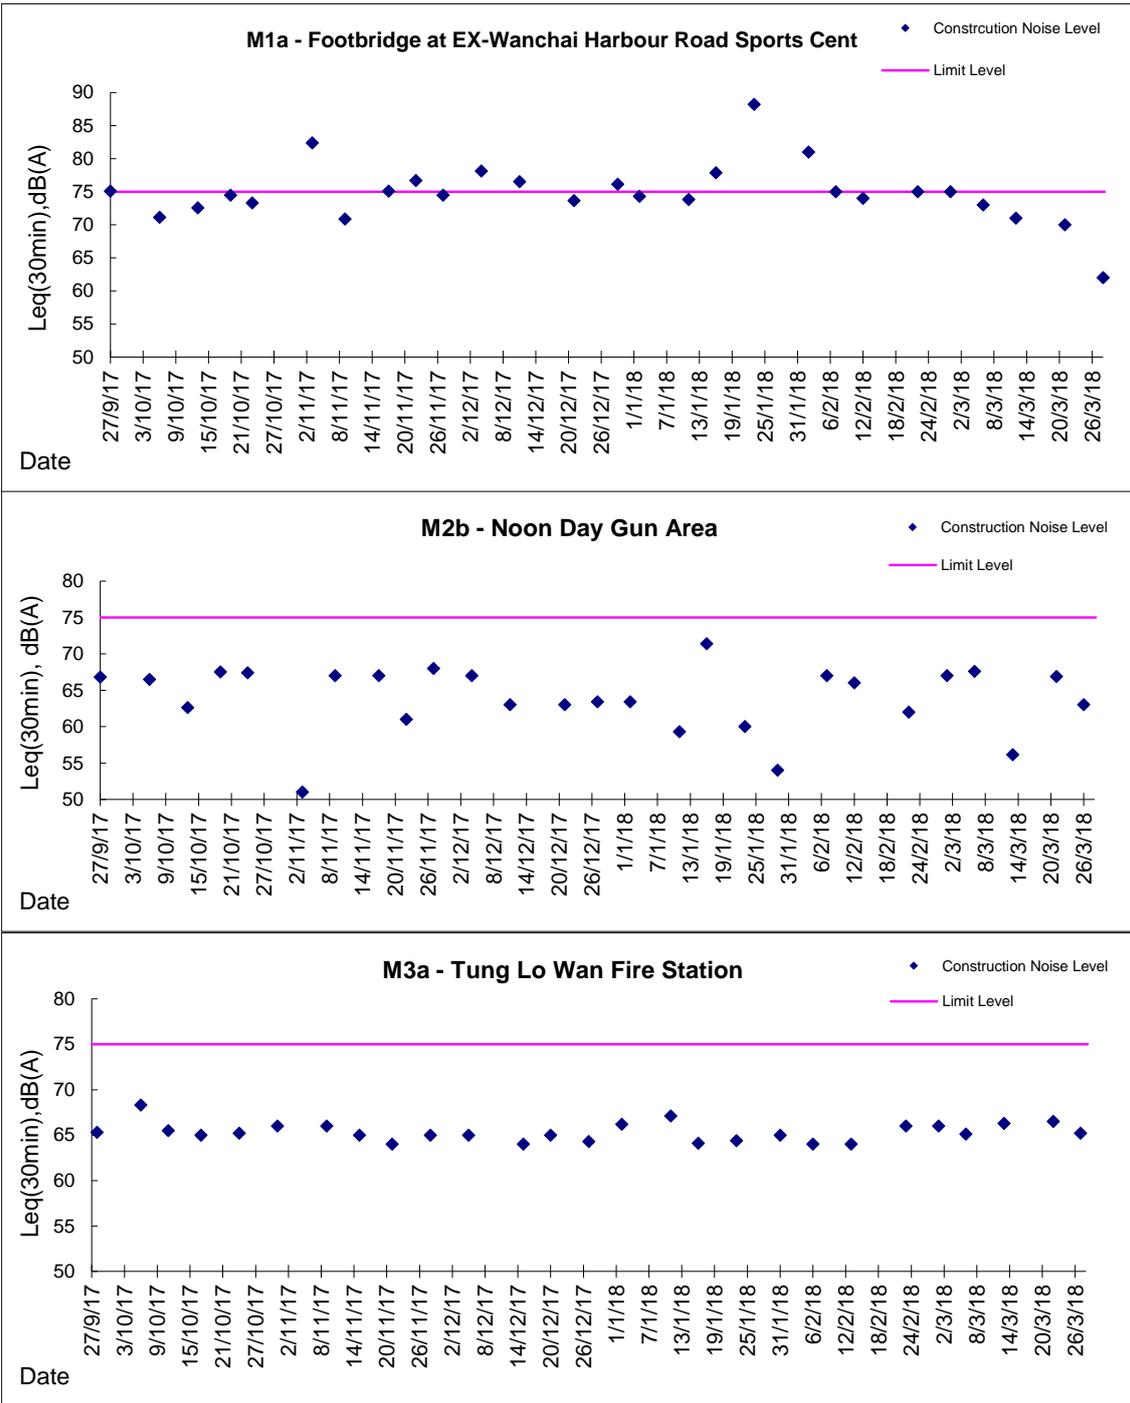Graphic Presentation of Noise Monitoring Result
Day Time (0700 - 1900hrs on normal weekdays)






Graphic Presentation of Noise Monitoring Result

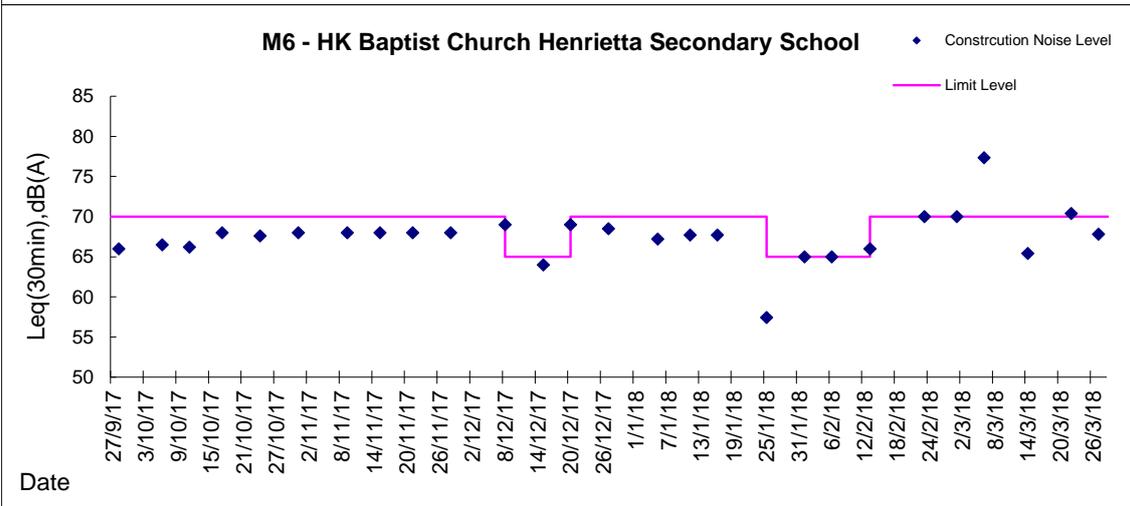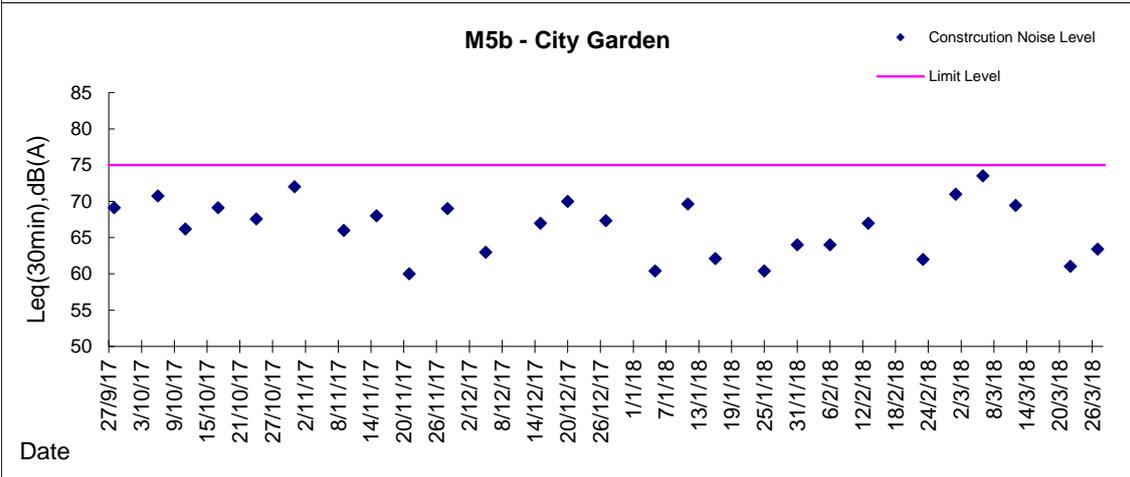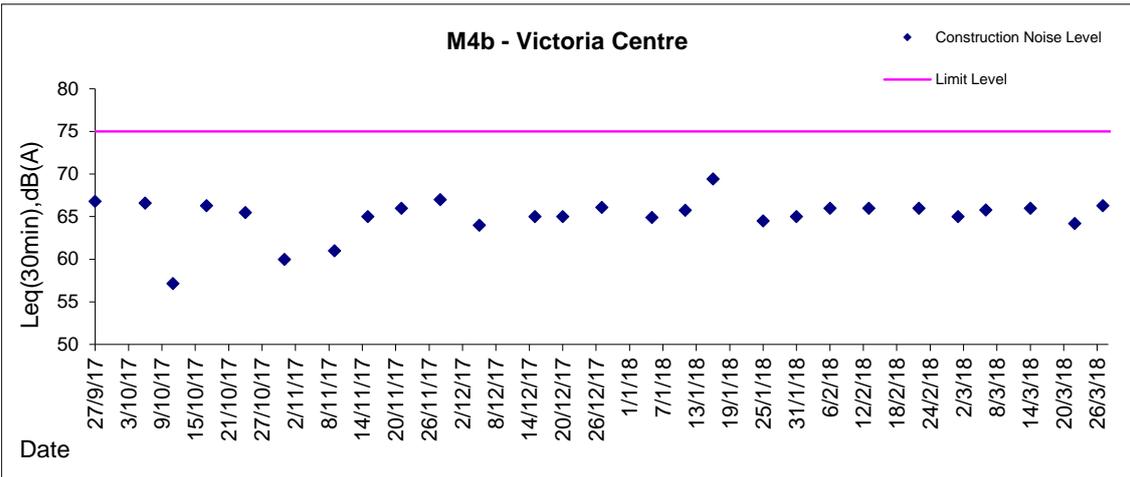Day Time (0700 - 1900hrs on normal weekdays)



Graphic Presentation of Noise Monitoring Result

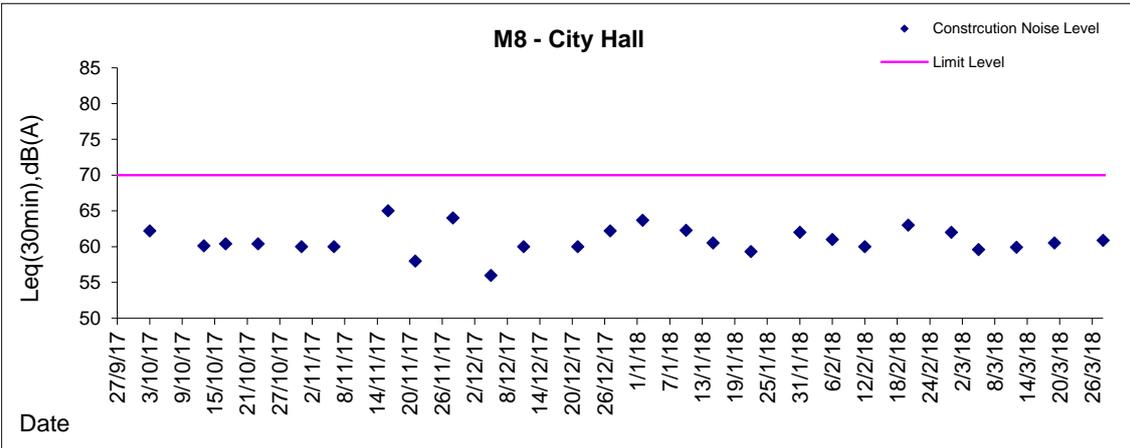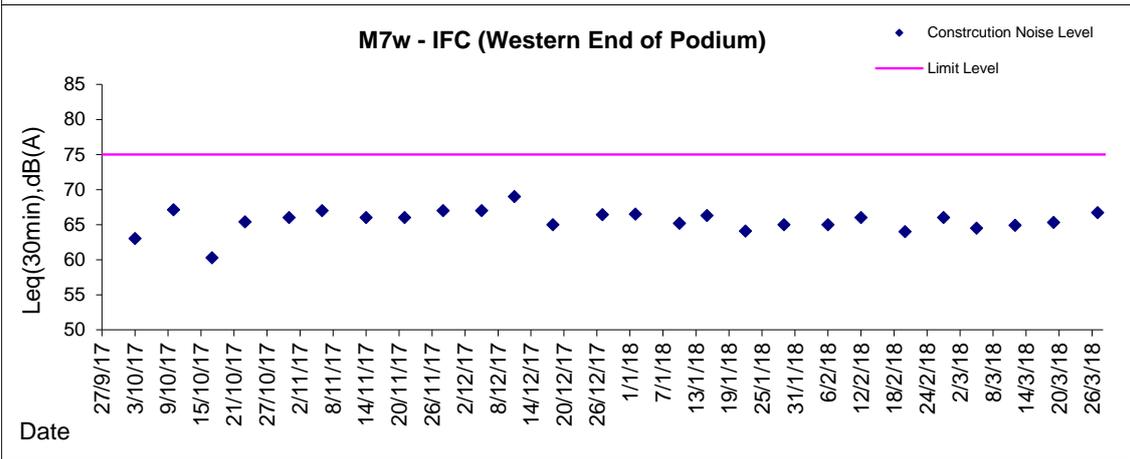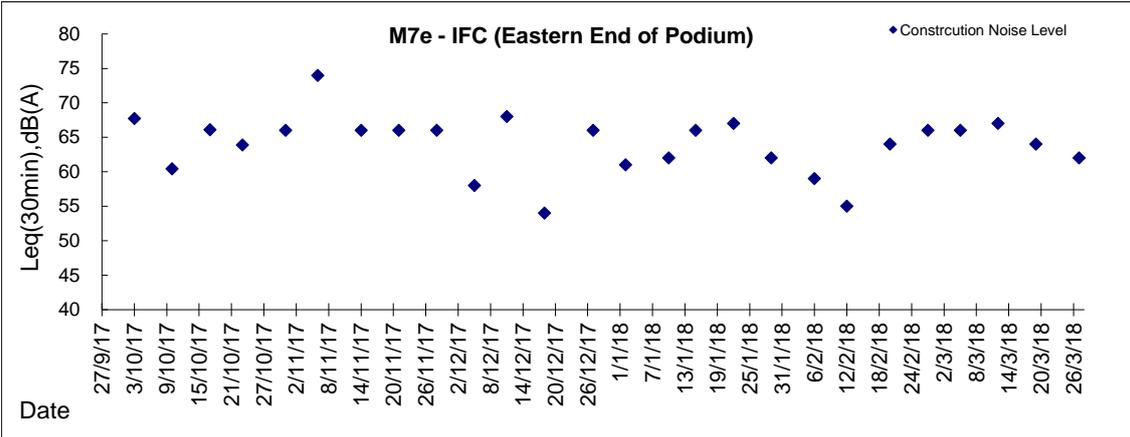Day Time (0700 - 1900hrs on normal weekdays)



* Remark: M7e - IFC (Eastern End of Podium) is a reference monitoring station



Appendix 5.3

Air Quality Monitoring Results and Graphical Presentations



Location: CMA1b - Harbour Grand Hotel Boundary Wall

Report on 24-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 176.7

Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
2-Mar-18	8:00	Cloudy	24565	2.6961	2.8105	11390.49	11414.49	24.00	1.15	1.15	1.15	1656	69.1
7-Mar-18	8:00	Cloudy	24536	2.6792	2.7534	11417.49	11441.49	24.00	1.16	1.17	1.16	1672	44.4
13-Mar-18	8:00	Cloudy	24656	2.6696	2.7849	11444.49	11468.49	24.00	1.15	1.15	1.15	1662	69.4
19-Mar-18	8:00	Cloudy	24740	2.6572	2.7598	11471.49	11495.49	24.00	1.15	1.15	1.15	1655	62.0
23-Mar-18	8:00	Sunny	24804	2.6515	2.8059	11498.49	11522.49	24.00	1.15	1.15	1.15	1663	92.9

Report on 1-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 320.1

Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
3-Mar-18	10:35	Cloudy	24572	2.6858	2.6951	11414.49	11415.49	1.00	1.15	1.15	1.15	69	134.9
3-Mar-18	13:00	Cloudy	24528	2.6789	2.6837	11415.49	11416.49	1.00	1.15	1.15	1.15	69	69.6
3-Mar-18	14:05	Cloudy	24532	2.6832	2.6933	11416.49	11417.49	1.00	1.15	1.15	1.15	69	146.5
8-Mar-18	9:00	Rainy	24658	2.6701	2.6736	11441.49	11442.49	1.00	1.17	1.17	1.17	70	50.1
8-Mar-18	10:30	Rainy	24663	2.6836	2.6861	11442.49	11443.49	1.00	1.17	1.17	1.17	70	35.8
8-Mar-18	13:30	Rainy	24616	2.6759	2.6829	11443.49	11444.49	1.00	1.17	1.17	1.17	70	100.1
14-Mar-18	8:50	Cloudy	24758	2.6619	2.6673	11468.49	11469.49	1.00	1.15	1.15	1.15	69	78.0
14-Mar-18	10:45	Cloudy	24752	2.6760	2.6793	11469.49	11470.49	1.00	1.15	1.15	1.15	69	47.6
14-Mar-18	13:00	Cloudy	24629	2.6665	2.6700	11470.49	11471.49	1.00	1.15	1.15	1.15	69	50.5
20-Mar-18	8:57	Cloudy	24854	2.6597	2.6721	11495.49	11496.49	1.00	1.15	1.15	1.15	69	179.6
20-Mar-18	10:10	Cloudy	24719	2.6649	2.6705	11496.49	11497.49	1.00	1.15	1.15	1.15	69	81.1
20-Mar-18	13:00	Cloudy	24712	2.6648	2.6683	11497.49	11498.49	1.00	1.15	1.15	1.15	69	50.7
24-Mar-18	9:20	Cloudy	23526	2.6159	2.6235	11522.49	11523.49	1.00	1.15	1.15	1.15	69	109.7
24-Mar-18	10:46	Cloudy	23938	2.6676	2.6736	11523.49	11524.49	1.00	1.15	1.15	1.15	69	86.6
24-Mar-18	13:00	Cloudy	24848	2.6376	2.6463	11524.49	11525.49	1.00	1.15	1.15	1.15	69	125.5

Location: CMA2a - Causeway Bay Community Centre

Report on 24-hour TSP monitoring
Action Level ($\mu\text{g}/\text{m}^3$) - 169.5
Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
2-Mar-18	8:00	Cloudy	24564	2.6858	2.7958	20962.30	20986.30	24.00	1.05	1.05	1.05	1511	72.8
7-Mar-18	8:00	Cloudy	24535	2.6899	2.7871	20989.30	21013.30	24.00	1.18	1.19	1.18	1704	57.0
13-Mar-18	8:00	Cloudy	24657	2.6722	2.7860	21016.30	21040.30	24.00	1.14	1.15	1.14	1648	69.0
19-Mar-18	8:00	Cloudy	24631	2.6687	2.7714	21043.30	21067.30	24.00	1.13	1.13	1.13	1626	63.2
23-Mar-18	8:00	Sunny	24803	2.6761	2.8462	21070.30	21094.30	24.00	1.13	1.13	1.13	1634	104.1

Report on 1-hour TSP monitoring
Action Level ($\mu\text{g}/\text{m}^3$) - 323.4
Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
3-Mar-18	10:20	Cloudy	24573	2.6777	2.6882	20986.30	20987.30	1.00	1.05	1.05	1.05	63	166.9
3-Mar-18	13:00	Cloudy	24526	2.6755	2.6814	20987.30	20988.30	1.00	1.05	1.05	1.05	63	93.8
3-Mar-18	14:05	Cloudy	24531	2.6765	2.6919	20988.30	20989.30	1.00	1.05	1.05	1.05	63	244.8
8-Mar-18	9:10	Rainy	24609	2.6791	2.6816	21013.30	21014.30	1.00	1.19	1.19	1.19	71	35.1
8-Mar-18	10:30	Rainy	24664	2.6771	2.6795	21014.30	21015.30	1.00	1.19	1.19	1.19	71	33.7
8-Mar-18	13:30	Rainy	24615	2.6897	2.6934	21015.30	21016.30	1.00	1.16	1.19	1.17	70	52.6
14-Mar-18	8:55	Cloudy	24759	2.6679	2.6711	21040.30	21041.30	1.00	1.18	1.18	1.18	71	45.4
14-Mar-18	10:50	Cloudy	24751	2.6690	2.6736	21041.30	21042.30	1.00	1.18	1.18	1.18	71	65.2
14-Mar-18	13:00	Cloudy	24743	2.6313	2.6346	21042.30	21043.30	1.00	1.18	1.18	1.18	71	46.8
20-Mar-18	8:55	Cloudy	24724	2.6555	2.6625	21067.30	21068.30	1.00	1.13	1.13	1.13	68	103.2
20-Mar-18	10:15	Cloudy	24720	2.6500	2.6552	21068.30	21069.30	1.00	1.13	1.13	1.13	68	76.7
20-Mar-18	13:00	Cloudy	24711	2.6622	2.6653	21069.30	21070.30	1.00	1.13	1.13	1.13	68	45.7
24-Mar-18	9:25	Cloudy	24850	2.6424	2.6498	21094.30	21095.30	1.00	1.13	1.13	1.13	68	108.7
24-Mar-18	10:50	Cloudy	24849	2.6511	2.6588	21095.30	21096.30	1.00	1.19	1.19	1.19	71	107.9
24-Mar-18	13:00	Cloudy	24847	2.6397	2.6482	21096.30	21097.30	1.00	1.19	1.19	1.19	71	119.1



Location: CMA3a - CWB PRE Site Office Area

Report on 24-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 171

Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
2-Mar-18	8:00	Cloudy	24411	2.6541	2.7729	8456.33	8480.33	24.00	1.05	1.04	1.04	1505	79.0
7-Mar-18	8:00	Cloudy	24559	2.6950	2.7732	8483.33	8507.33	24.00	1.05	1.06	1.06	1526	51.2
13-Mar-18	8:00	Cloudy	24659	2.6585	2.7781	8510.33	8534.33	24.00	1.05	1.05	1.05	1512	79.1
19-Mar-18	8:00	Cloudy	24630	2.6702	2.7841	8537.33	8561.33	24.00	1.04	1.04	1.04	1502	75.8
23-Mar-18	8:00	Sunny	24800	2.6459	2.8164	8564.33	8588.33	24.00	1.05	1.05	1.05	1513	112.7

Report on 1-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 311.3

Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
3-Mar-18	8:40	Cloudy	24579	2.6795	2.6838	8480.33	8481.33	1.00	0.98	0.98	0.98	59	73.5
3-Mar-18	10:00	Cloudy	24574	2.6784	2.6821	8481.33	8482.33	1.00	0.91	0.91	0.91	54	67.9
3-Mar-18	13:00	Cloudy	24567	2.6797	2.6817	8482.33	8483.33	1.00	0.91	0.91	0.91	54	36.7
8-Mar-18	8:50	Rainy	24608	2.6684	2.6702	8507.33	8508.33	1.00	1.06	1.06	1.06	64	28.2
8-Mar-18	10:15	Rainy	24611	2.6773	2.6790	8508.33	8509.33	1.00	1.06	1.06	1.06	64	26.6
8-Mar-18	13:15	Rainy	24660	2.6604	2.6622	8509.33	8510.33	1.00	1.06	1.06	1.06	64	28.2
14-Mar-18	8:45	Cloudy	24760	2.6532	2.6587	8534.33	8535.33	1.00	1.05	1.05	1.05	63	87.2
14-Mar-18	10:30	Cloudy	24753	2.6592	2.6642	8535.33	8536.33	1.00	1.05	1.05	1.05	63	79.3
14-Mar-18	13:00	Cloudy	24742	2.6385	2.6428	8536.33	8537.33	1.00	1.05	1.05	1.05	63	68.2
20-Mar-18	8:35	Cloudy	24727	2.6674	2.6747	8561.33	8562.33	1.00	1.04	1.04	1.04	63	116.4
20-Mar-18	10:00	Cloudy	24722	2.6558	2.6614	8562.33	8563.33	1.00	1.04	1.04	1.04	63	89.3
20-Mar-18	13:00	Cloudy	24714	2.6825	2.6896	8563.33	8564.33	1.00	1.04	1.04	1.04	63	113.3
24-Mar-18	8:05	Cloudy	24336	2.6612	2.6666	8588.33	8589.33	1.00	0.91	0.91	0.91	55	98.4
24-Mar-18	9:12	Cloudy	24335	2.6649	2.6723	8589.33	8590.33	1.00	1.05	1.05	1.05	63	117.3
24-Mar-18	10:15	Cloudy	23937	2.6572	2.6630	8590.33	8591.33	1.00	0.91	0.91	0.91	55	105.7

Location: CMA4a - SPCA

Report on 24-hour TSP monitoring
Action Level ($\mu\text{g}/\text{m}^3$) - 171.2
Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
2-Mar-18	8:00	Cloudy	24403	2.6507	2.7281	25282.52	25306.52	24.00	1.21	1.21	1.21	1739	44.5
7-Mar-18	8:00	Cloudy	24560	2.6972	2.7689	25309.52	25333.52	24.00	1.21	1.22	1.22	1753	40.9
13-Mar-18	8:00	Cloudy	24620	2.6757	2.7725	25336.52	25360.52	24.00	1.21	1.21	1.21	1744	55.5
19-Mar-18	8:00	Cloudy	24741	2.6305	2.7259	25363.52	25387.52	24.00	0.96	0.97	0.97	1391	68.6
23-Mar-18	8:00	Sunny	24801	2.6684	2.8074	25390.52	25414.52	24.00	0.97	0.97	0.97	1400	99.3

Report on 1-hour TSP monitoring
Action Level ($\mu\text{g}/\text{m}^3$) - 312.5
Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
3-Mar-18	8:30	Cloudy	24580	2.6709	2.6757	25306.52	25307.52	1.00	1.21	1.21	1.21	72	66.3
3-Mar-18	9:53	Cloudy	24575	2.6707	2.6781	25307.52	25308.52	1.00	1.21	1.21	1.21	72	102.2
3-Mar-18	13:00	Cloudy	24568	2.6772	2.6804	25308.52	25309.52	1.00	1.31	1.31	1.31	78	40.8
8-Mar-18	8:55	Rainy	24667	2.6681	2.6717	25333.52	25334.52	1.00	1.27	1.27	1.27	76	47.2
8-Mar-18	10:15	Rainy	24612	2.6821	2.6838	25334.52	25335.52	1.00	1.22	1.22	1.22	73	23.2
8-Mar-18	13:20	Rainy	24614	2.6878	2.6897	25335.52	25336.52	1.00	1.22	1.22	1.22	73	25.9
14-Mar-18	8:40	Cloudy	24761	2.6493	2.6539	25360.52	25361.52	1.00	1.21	1.21	1.21	73	63.3
14-Mar-18	10:30	Cloudy	24754	2.6684	2.6721	25361.52	25362.52	1.00	1.21	1.21	1.21	73	50.9
14-Mar-18	13:00	Cloudy	24744	2.6404	2.6448	25362.52	25363.52	1.00	1.24	1.21	1.22	73	59.9
20-Mar-18	8:40	Cloudy	24728	2.6683	2.6733	25387.52	25388.52	1.00	0.97	0.97	0.97	58	86.2
20-Mar-18	9:55	Cloudy	24723	2.6578	2.6619	25388.52	25389.52	1.00	0.97	0.97	0.97	58	70.7
20-Mar-18	11:00	Cloudy	24715	2.6581	2.6644	25389.52	25390.52	1.00	0.97	0.97	0.97	58	108.6
24-Mar-18	8:15	Cloudy	24337	2.6502	2.6564	25414.52	25415.52	1.00	0.97	0.97	0.97	58	106.3
24-Mar-18	9:18	Cloudy	24080	2.6655	2.6711	25415.52	25416.52	1.00	0.97	0.97	0.97	58	96.0
24-Mar-18	10:21	Cloudy	23939	2.6738	2.6820	25416.52	25417.52	1.00	0.97	0.97	0.97	58	140.5



Location: CMA5b - Pedestrian Plaza

Report on 24-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 181

Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
2-Mar-18	8:00	Cloudy	24406	2.6617	2.8501	9876.36	9900.36	24.00	0.86	0.86	0.86	1238	152.2
7-Mar-18	8:00	Cloudy	24527	2.6689	2.8177	9903.36	9927.36	24.00	0.87	0.88	0.87	1256	118.5
13-Mar-18	8:00	Cloudy	24621	2.6645	2.8145	9930.36	9954.36	24.00	0.75	0.75	0.75	1076	139.3
19-Mar-18	8:00	Cloudy	24408	2.6588	2.8051	9957.36	9981.36	24.00	1.02	1.02	1.02	1467	99.7
23-Mar-18	8:00	Sunny	24710	2.6685	2.9117	9984.36	10008.36	24.00	1.02	1.03	1.02	1476	164.8

Report on 1-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 332

Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
3-Mar-18	8:10	Cloudy	24581	2.6835	2.6905	9900.36	9901.36	1.00	0.74	0.74	0.74	45	157.2
3-Mar-18	9:13	Cloudy	24578	2.6902	2.6969	9901.36	9902.36	1.00	0.74	0.74	0.74	45	150.4
3-Mar-18	10:50	Cloudy	24571	2.6817	2.6860	9902.36	9903.36	1.00	0.74	0.74	0.74	45	96.6
8-Mar-18	8:30	Rainy	24537	2.6837	2.6860	9927.36	9928.36	1.00	0.88	0.88	0.88	53	43.7
8-Mar-18	13:00	Rainy	24613	2.6786	2.6871	9928.36	9929.36	1.00	0.76	0.76	0.76	46	186.7
8-Mar-18	14:20	Rainy	24648	2.6738	2.6781	9929.36	9930.36	1.00	0.76	0.76	0.76	46	94.4
14-Mar-18	8:20	Cloudy	24762	2.6503	2.6572	9954.36	9955.36	1.00	0.75	0.75	0.75	45	153.8
14-Mar-18	10:05	Cloudy	24757	2.6719	2.6763	9955.36	9956.36	1.00	0.75	0.75	0.75	45	98.1
14-Mar-18	13:00	Cloudy	24747	2.6739	2.6763	9956.36	9957.36	1.00	0.75	0.75	0.75	45	53.5
20-Mar-18	8:15	Cloudy	24731	2.6393	2.6461	9981.36	9982.36	1.00	1.02	1.02	1.02	61	111.1
20-Mar-18	9:30	Cloudy	24725	2.6484	2.6528	9982.36	9983.36	1.00	1.02	1.02	1.02	61	71.9
20-Mar-18	10:35	Cloudy	24718	2.6677	2.6755	9983.36	9984.36	1.00	1.02	1.02	1.02	61	127.5
24-Mar-18	8:35	Cloudy	23527	2.6024	2.6128	10008.36	10009.36	1.00	1.03	1.03	1.03	62	169.1
24-Mar-18	13:00	Cloudy	24857	2.6487	2.6628	10009.36	10010.36	1.00	1.03	1.03	1.03	62	229.3
24-Mar-18	14:24	Cloudy	24836	2.6564	2.6679	10010.36	10011.36	1.00	1.03	1.03	1.03	62	187.0



Location: MA1e - International Finance Centre (Eastern Wing)

Report on 24-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 173.4
 Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
2-Mar-18	8:00	Cloudy	24216	2.6518	2.7394	22159.99	22183.99	24.00	1.10	1.10	1.10	1587	55.2
7-Mar-18	8:00	Cloudy	24558	2.6915	2.7509	22186.99	22210.99	24.00	1.17	1.18	1.18	1693	35.1
13-Mar-18	8:00	Cloudy	24676	2.6498	2.7130	22213.99	22237.99	24.00	1.11	1.11	1.11	1594	39.7
19-Mar-18	8:00	Cloudy	24775	2.6562	2.7333	22240.99	22264.99	24.00	1.09	1.09	1.09	1570	49.1
23-Mar-18	8:00	Sunny	24869	2.6541	2.7494	22267.99	22291.99	24.00	1.10	1.10	1.10	1578	60.4

Report on 1-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 325.1
 Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
3-Mar-18	8:42	Cloudy	24471	2.6669	2.6731	22183.99	22184.99	1.00	1.10	1.16	1.13	68	91.3
3-Mar-18	9:46	Cloudy	24550	2.6596	2.6630	22184.99	22185.99	1.00	1.10	1.10	1.10	66	51.5
3-Mar-18	10:49	Cloudy	24547	2.6897	2.7065	22185.99	22186.99	1.00	1.10	1.10	1.10	66	254.3
8-Mar-18	8:48	Rainy	24679	2.6606	2.6622	22210.99	22211.99	1.00	1.12	1.12	1.12	67	23.8
8-Mar-18	9:55	Rainy	24542	2.6825	2.6841	22211.99	22212.99	1.00	1.12	1.12	1.12	67	23.8
8-Mar-18	11:00	Rainy	24539	2.6877	2.6887	22212.99	22213.99	1.00	1.12	1.12	1.12	67	14.9
14-Mar-18	8:28	Cloudy	24673	2.6706	2.6754	22237.99	22238.99	1.00	1.11	1.11	1.11	66	72.3
14-Mar-18	9:50	Cloudy	24669	2.6497	2.6518	22238.99	22239.99	1.00	1.11	1.11	1.11	66	31.6
14-Mar-18	10:59	Cloudy	24764	2.6637	2.6666	22239.99	22240.99	1.00	1.11	1.11	1.11	66	43.7
20-Mar-18	8:42	Cloudy	24772	2.6503	2.6528	22264.99	22265.99	1.00	1.09	1.09	1.09	65	38.2
20-Mar-18	9:47	Cloudy	24769	2.6461	2.6500	22265.99	22266.99	1.00	1.09	1.09	1.09	65	59.6
20-Mar-18	10:50	Cloudy	24765	2.6631	2.6666	22266.99	22267.99	1.00	1.09	1.09	1.09	65	53.4
24-Mar-18	8:46	Cloudy	24926	2.6499	2.6544	22291.99	22292.99	1.00	1.10	1.10	1.10	66	68.4
24-Mar-18	9:53	Cloudy	24865	2.6403	2.6444	22292.99	22293.99	1.00	1.10	1.10	1.10	66	62.3
24-Mar-18	10:56	Cloudy	24862	2.6595	2.6630	22293.99	22294.99	1.00	1.10	1.10	1.10	66	53.2



Location: MA1w - International Finance Centre (Western Wing)

Report on 24-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 173.4
 Limit Level ($\mu\text{g}/\text{m}^3$) - 260

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
2-Mar-18	8:00	Cloudy	24217	2.6633	2.8010	21948.86	21972.86	24.00	1.37	1.37	1.37	1969	69.9
7-Mar-18	8:00	Cloudy	24556	2.6773	2.7579	21975.86	21999.86	24.00	1.46	1.47	1.46	2106	38.3
13-Mar-18	8:00	Cloudy	24677	2.6576	2.7886	22002.86	22026.86	24.00	1.45	1.45	1.45	2095	62.5
19-Mar-18	8:00	Cloudy	24776	2.6625	2.7918	22029.86	22053.86	24.00	1.39	1.39	1.39	1996	64.8
23-Mar-18	8:00	Sunny	24868	2.6449	2.8085	22056.86	22080.86	24.00	1.33	1.34	1.33	1922	85.1




Report on 1-hour TSP monitoring

Action Level ($\mu\text{g}/\text{m}^3$) - 325.1
 Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Sampling Time	Weather Condition	Filter paper no.	Filter Weight, g		Elapse Time, hr		Sampling Time, hr	Flow Rate, m^3/min			Total Volume, m^3	TSP Level, $\mu\text{g}/\text{m}^3$
				Initial	Final	Initial	Final		Initial, Q_{si}	Final, Q_{sf}	Average		
3-Mar-18	8:36	Cloudy	24472	2.6514	2.6627	21972.86	21973.86	1.00	1.34	1.34	1.34	80	140.7
3-Mar-18	9:39	Cloudy	24551	2.6731	2.6818	21973.86	21974.86	1.00	1.39	1.42	1.41	84	103.0
3-Mar-18	10:42	Cloudy	24548	2.6790	2.6964	21974.86	21975.86	1.00	1.39	1.37	1.38	83	210.2
8-Mar-18	8:40	Rainy	24545	2.6854	2.6888	21999.86	22000.86	1.00	1.35	1.35	1.35	81	41.8
8-Mar-18	9:50	Rainy	24543	2.6732	2.6764	22000.86	22001.86	1.00	1.41	1.44	1.42	85	37.4
8-Mar-18	10:55	Rainy	24540	2.6877	2.6904	22001.86	22002.86	1.00	1.41	1.41	1.41	85	31.9
14-Mar-18	8:41	Cloudy	24674	2.6726	2.6784	22026.86	22027.86	1.00	1.40	1.40	1.40	84	69.1
14-Mar-18	9:45	Cloudy	24671	2.6621	2.6661	22027.86	22028.86	1.00	1.40	1.40	1.40	84	47.6
14-Mar-18	10:48	Cloudy	24670	2.6542	2.6593	22028.86	22029.86	1.00	1.40	1.40	1.40	84	60.7
20-Mar-18	8:35	Cloudy	24773	2.6490	2.6568	22053.86	22054.86	1.00	1.39	1.39	1.39	83	93.7
20-Mar-18	9:39	Cloudy	24770	2.6459	2.6519	22054.86	22055.86	1.00	1.36	1.36	1.36	82	73.6
20-Mar-18	10:42	Cloudy	24767	2.6567	2.6631	22055.86	22056.86	1.00	1.36	1.36	1.36	82	78.5
24-Mar-18	8:38	Cloudy	24927	2.6613	2.6678	22080.86	22081.86	1.00	1.34	1.34	1.34	80	81.1
24-Mar-18	9:41	Cloudy	24866	2.6517	2.6589	22081.86	22082.86	1.00	1.34	1.34	1.34	80	89.9
24-Mar-18	10:49	Cloudy	24863	2.6434	2.6500	22082.86	22083.86	1.00	1.34	1.34	1.34	80	82.4






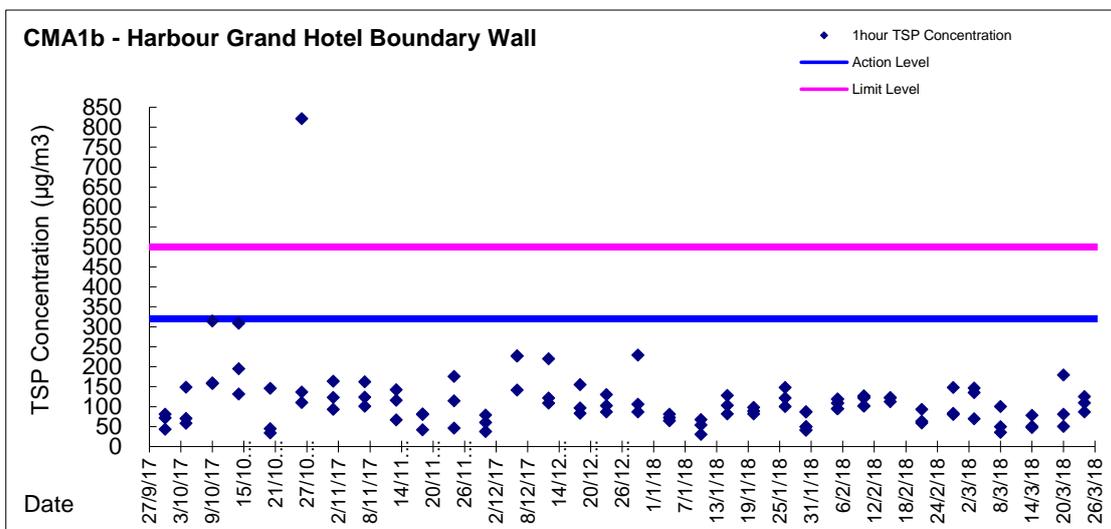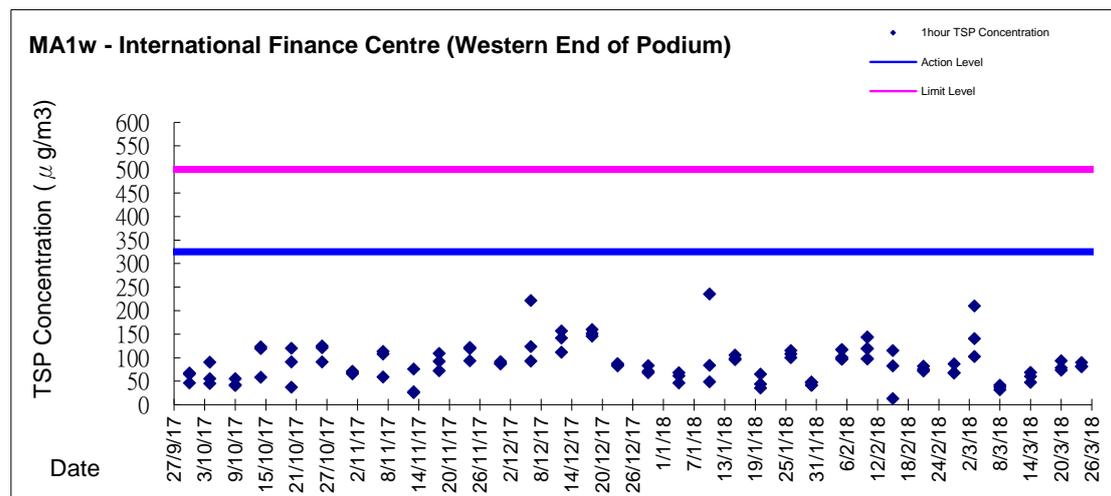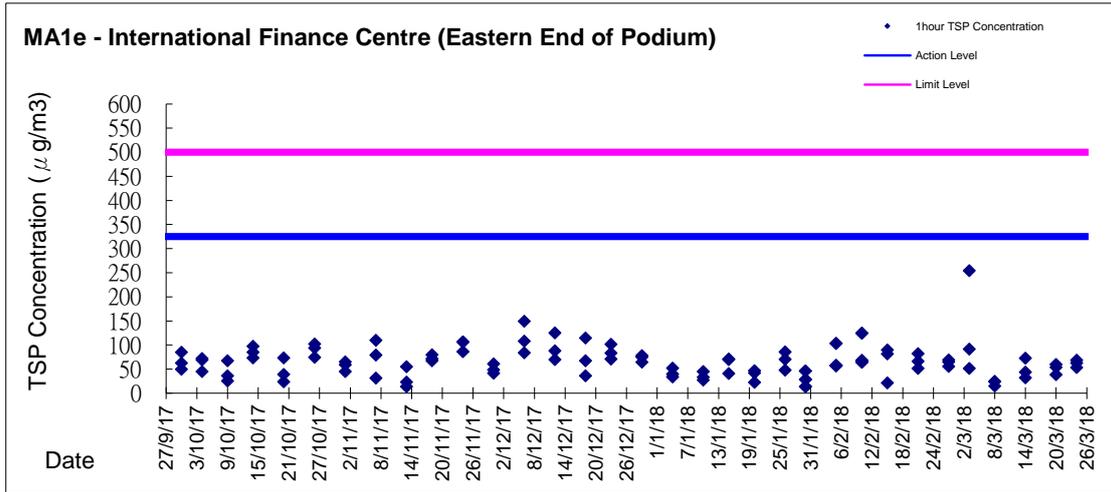Graphic Presentation of 1 hour TSP Result






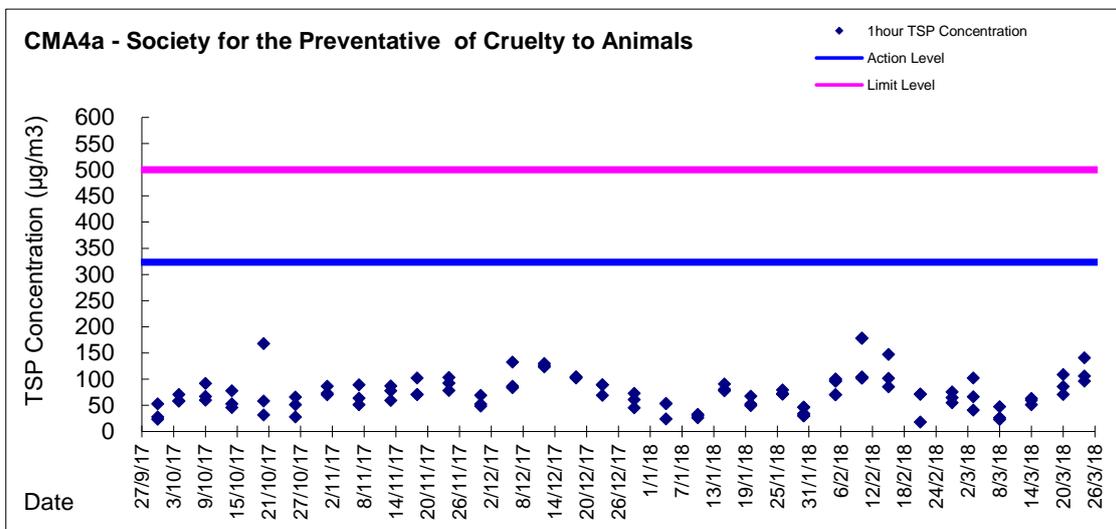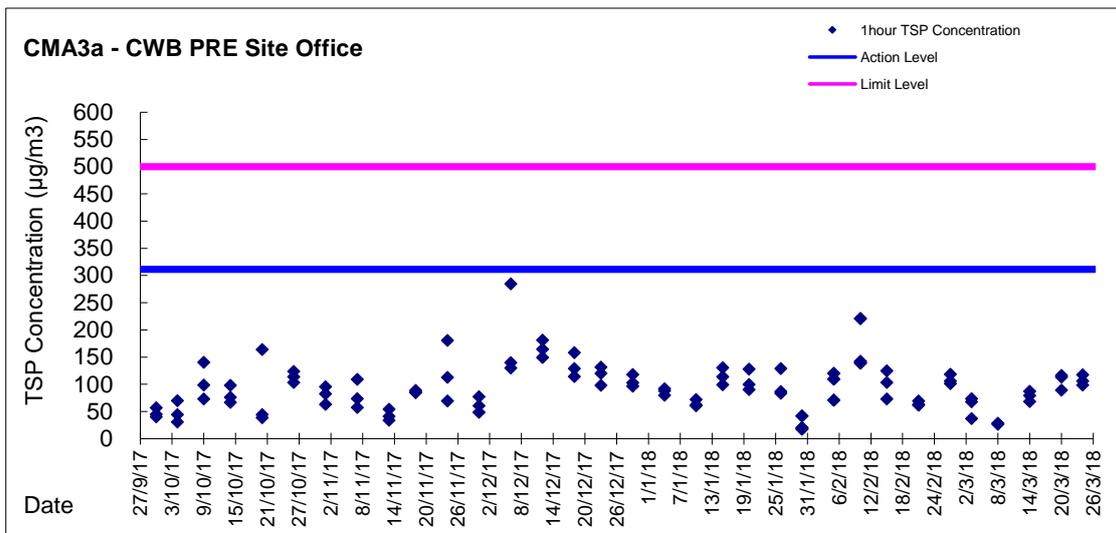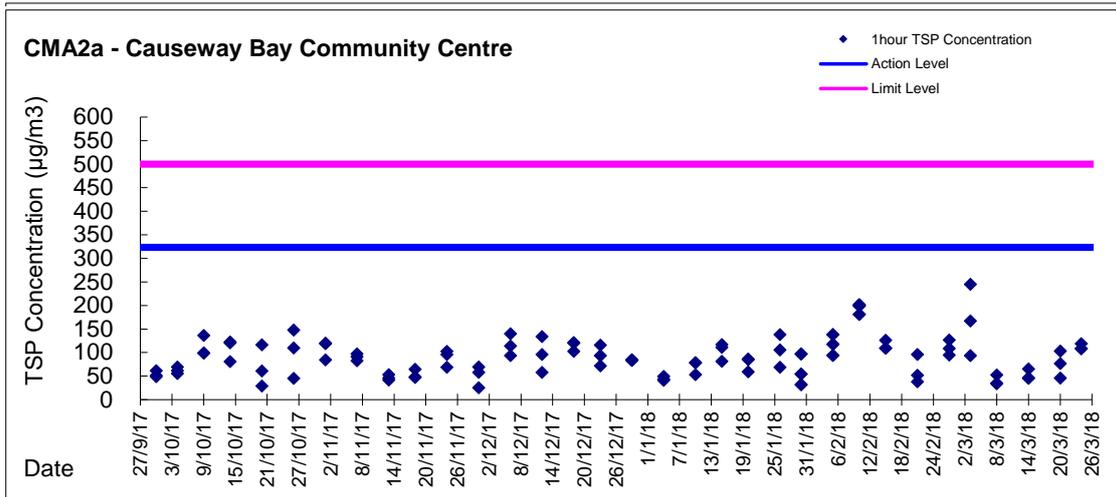Graphic Presentation of 1 hour TSP Result










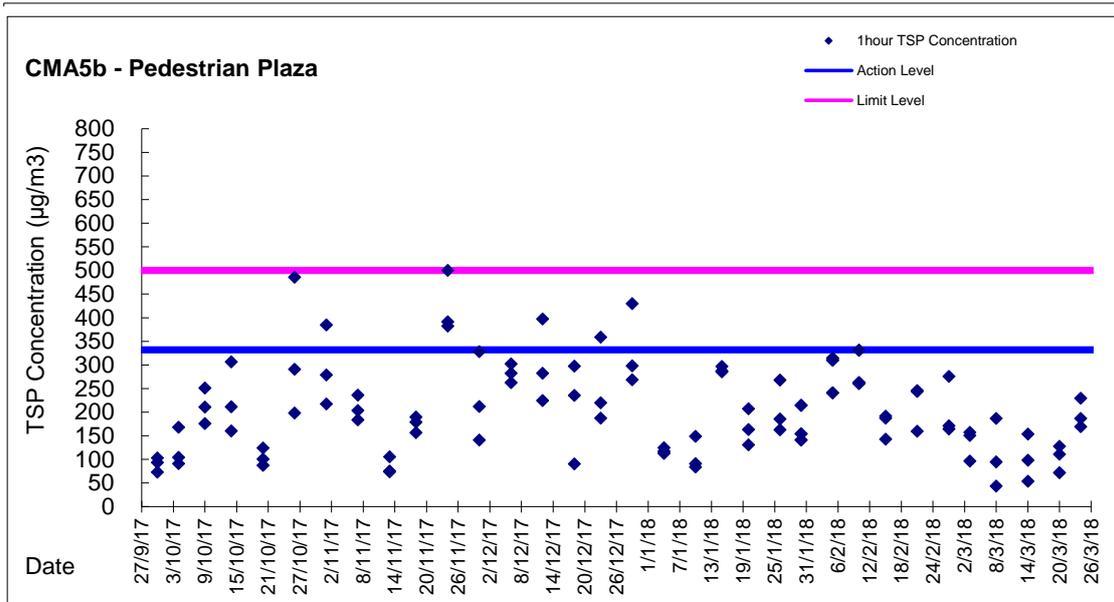
Graphic Presentation of 1 hour TSP Result



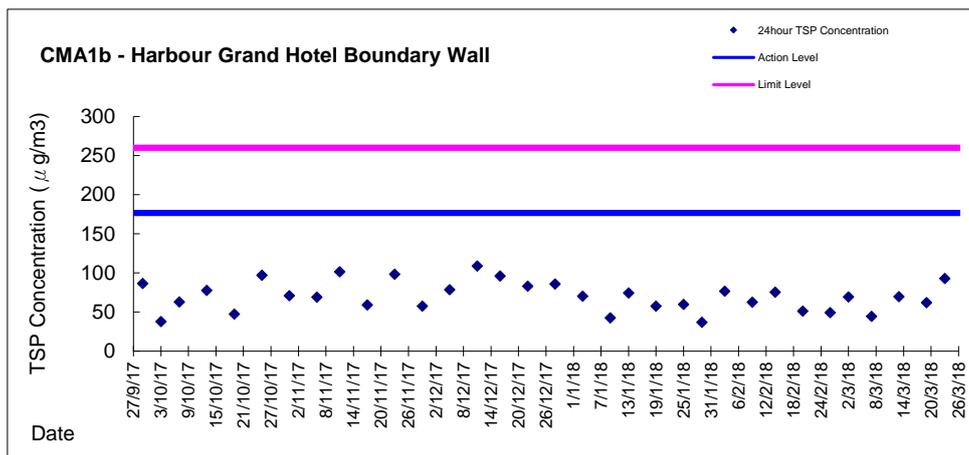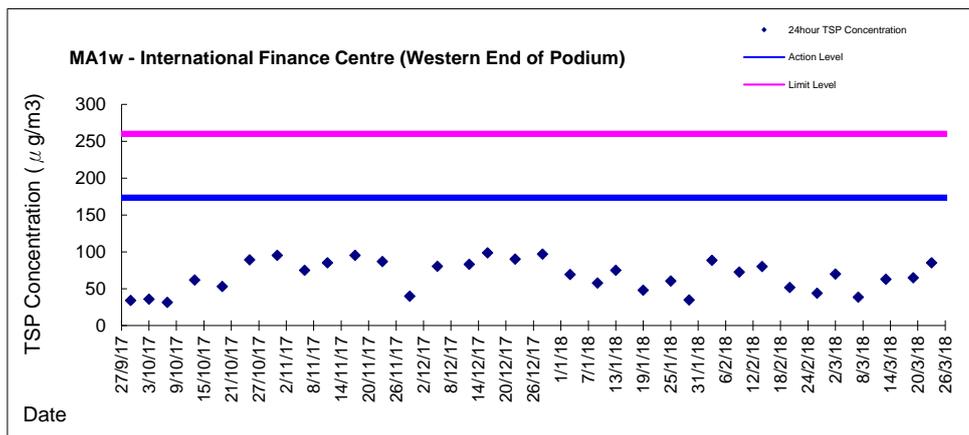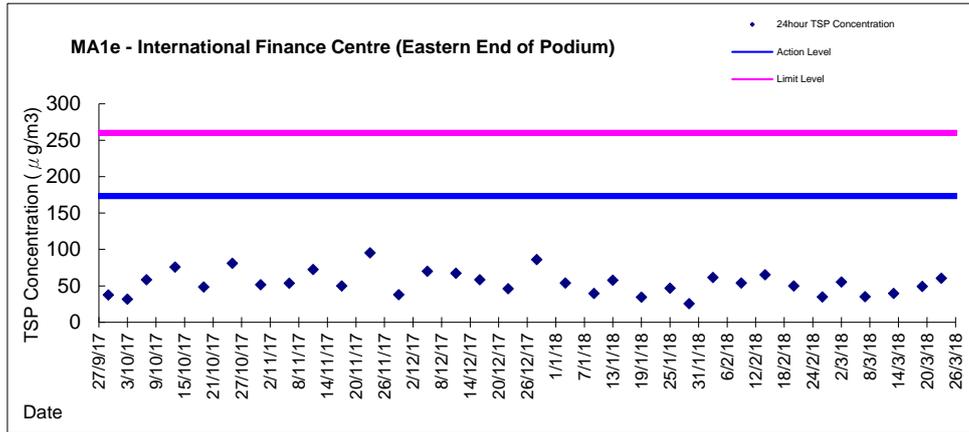
Graphic Presentation of 24 hour TSP Result



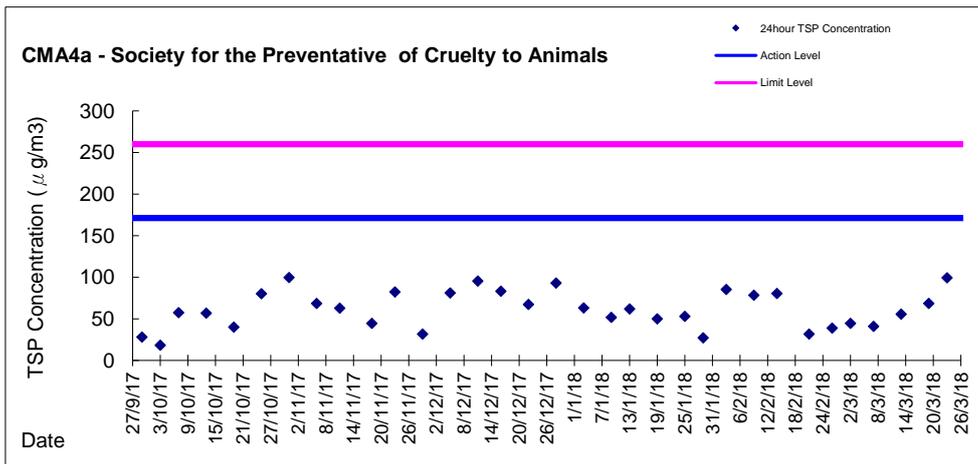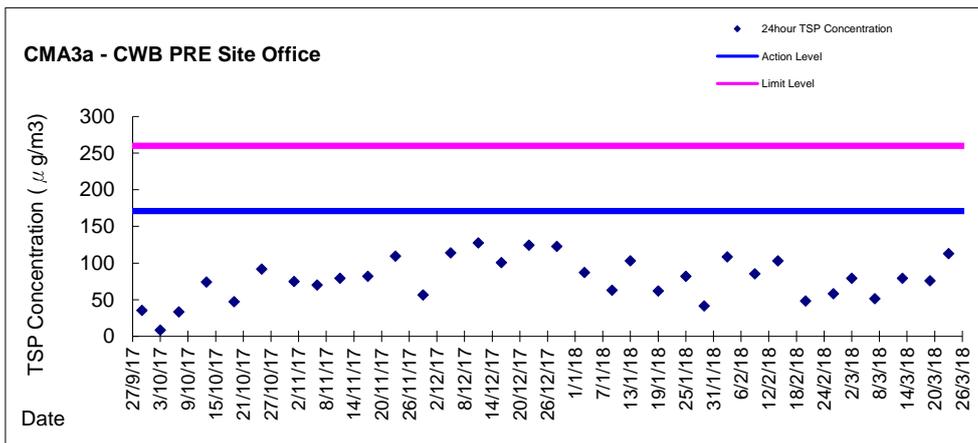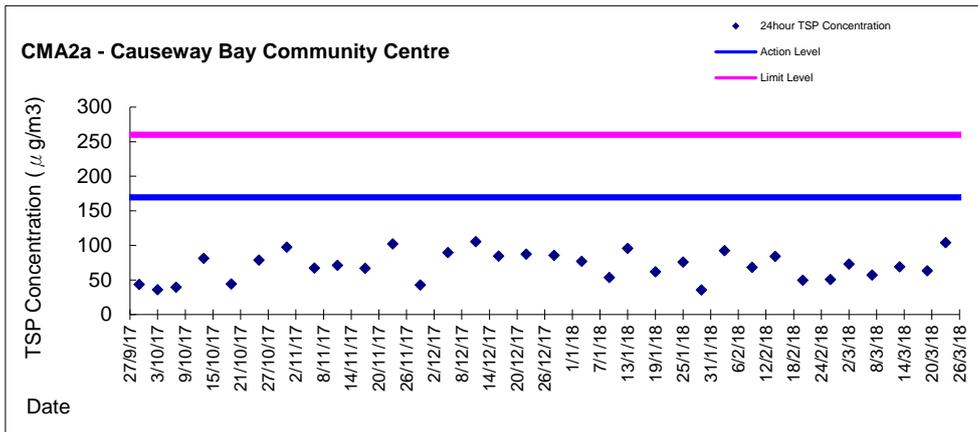Graphic Presentation of 24 hour TSP Result



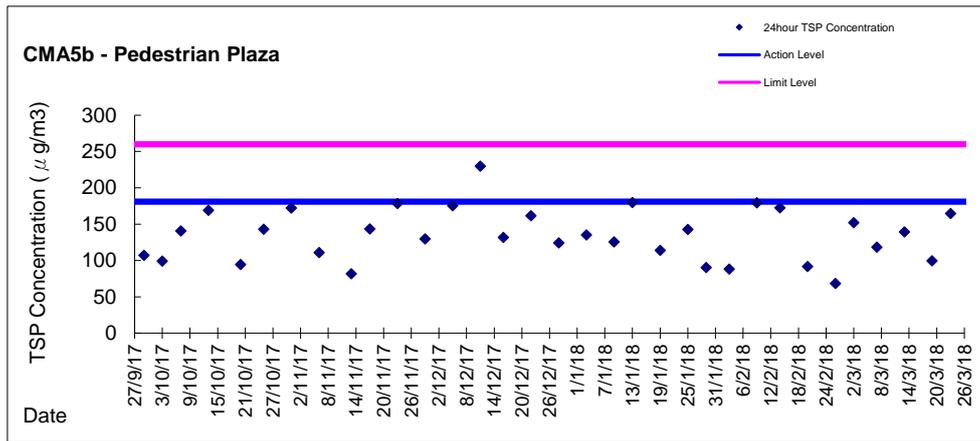Graphic Presentation of 24 hour TSP Result





Appendix 5.4
Real Time Noise Monitoring Results and Graphical Presentations

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)									
28/2/18 20:56	67	2/3/18 22:01	67	4/3/18 11:06	67	4/3/18 20:11	67	6/3/18 21:16	67	8/3/18 22:21	68
28/2/18 21:01	67	2/3/18 22:06	67	4/3/18 11:11	67	4/3/18 20:16	68	6/3/18 21:21	66	8/3/18 22:26	69
28/2/18 21:06	67	2/3/18 22:11	67	4/3/18 11:16	67	4/3/18 20:21	66	6/3/18 21:26	66	8/3/18 22:31	68
28/2/18 21:11	66	2/3/18 22:16	67	4/3/18 11:21	67	4/3/18 20:26	66	6/3/18 21:31	66	8/3/18 22:36	68
28/2/18 21:16	66	2/3/18 22:21	67	4/3/18 11:26	68	4/3/18 20:31	67	6/3/18 21:36	67	8/3/18 22:41	68
28/2/18 21:21	67	2/3/18 22:26	67	4/3/18 11:31	68	4/3/18 20:36	66	6/3/18 21:41	67	8/3/18 22:46	67
28/2/18 21:26	67	2/3/18 22:31	67	4/3/18 11:36	69	4/3/18 20:41	67	6/3/18 21:46	67	8/3/18 22:51	68
28/2/18 21:31	67	2/3/18 22:36	67	4/3/18 11:41	68	4/3/18 20:46	67	6/3/18 21:51	67	8/3/18 22:56	69
28/2/18 21:36	67	2/3/18 22:41	67	4/3/18 11:46	67	4/3/18 20:51	67	6/3/18 21:56	67	9/3/18 19:01	69
28/2/18 21:41	67	2/3/18 22:46	67	4/3/18 11:51	67	4/3/18 20:56	66	6/3/18 22:01	66	9/3/18 19:06	69
28/2/18 21:46	67	2/3/18 22:51	67	4/3/18 11:56	67	4/3/18 21:01	67	6/3/18 22:06	66	9/3/18 19:11	45
28/2/18 21:51	67	2/3/18 22:56	67	4/3/18 12:01	68	4/3/18 21:06	67	6/3/18 22:11	66	9/3/18 19:16	57
28/2/18 21:56	67	3/3/18 19:01	67	4/3/18 12:06	67	4/3/18 21:11	66	6/3/18 22:16	67	9/3/18 19:21	53
28/2/18 22:01	67	3/3/18 19:06	68	4/3/18 12:11	68	4/3/18 21:16	66	6/3/18 22:21	67	9/3/18 19:26	64
28/2/18 22:06	67	3/3/18 19:11	68	4/3/18 12:16	68	4/3/18 21:21	66	6/3/18 22:26	67	9/3/18 19:31	68
28/2/18 22:11	67	3/3/18 19:16	68	4/3/18 12:21	68	4/3/18 21:26	66	6/3/18 22:31	67	9/3/18 19:36	68
28/2/18 22:16	67	3/3/18 19:21	68	4/3/18 12:26	68	4/3/18 21:31	67	6/3/18 22:36	66	9/3/18 19:41	67
28/2/18 22:21	67	3/3/18 19:26	67	4/3/18 12:31	68	4/3/18 21:36	67	6/3/18 22:41	67	9/3/18 19:46	68
28/2/18 22:26	67	3/3/18 19:31	67	4/3/18 12:36	69	4/3/18 21:41	66	6/3/18 22:46	66	9/3/18 19:51	54
28/2/18 22:31	67	3/3/18 19:36	68	4/3/18 12:41	68	4/3/18 21:46	66	6/3/18 22:51	68	9/3/18 19:56	68
28/2/18 22:36	67	3/3/18 19:41	68	4/3/18 12:46	67	4/3/18 21:51	66	6/3/18 22:56	67	9/3/18 20:01	62
28/2/18 22:41	67	3/3/18 19:46	67	4/3/18 12:51	68	4/3/18 21:56	66	7/3/18 19:01	69	9/3/18 20:06	69
28/2/18 22:46	67	3/3/18 19:51	67	4/3/18 12:56	68	4/3/18 22:01	66	7/3/18 19:06	69	9/3/18 20:11	67
28/2/18 22:51	66	3/3/18 19:56	67	4/3/18 13:01	68	4/3/18 22:06	66	7/3/18 19:11	69	9/3/18 20:16	68
28/2/18 22:56	66	3/3/18 20:01	67	4/3/18 13:06	68	4/3/18 22:11	66	7/3/18 19:16	66	9/3/18 20:21	67
1/3/18 19:01	56	3/3/18 20:06	67	4/3/18 13:11	68	4/3/18 22:16	66	7/3/18 19:21	69	9/3/18 20:26	67
1/3/18 19:06	60	3/3/18 20:11	67	4/3/18 13:16	68	4/3/18 22:21	66	7/3/18 19:26	68	9/3/18 20:31	68
1/3/18 19:11	54	3/3/18 20:16	67	4/3/18 13:21	68	4/3/18 22:26	66	7/3/18 19:31	68	9/3/18 20:36	67
1/3/18 19:16	53	3/3/18 20:21	67	4/3/18 13:26	67	4/3/18 22:31	66	7/3/18 19:36	66	9/3/18 20:41	67
1/3/18 19:21	54	3/3/18 20:26	67	4/3/18 13:31	67	4/3/18 22:36	66	7/3/18 19:41	67	9/3/18 20:46	69
1/3/18 19:26	69	3/3/18 20:31	67	4/3/18 13:36	67	4/3/18 22:41	66	7/3/18 19:46	68	9/3/18 20:51	67
1/3/18 19:31	68	3/3/18 20:36	67	4/3/18 13:41	68	4/3/18 22:46	65	7/3/18 19:51	67	9/3/18 20:56	67
1/3/18 19:36	67	3/3/18 20:41	68	4/3/18 13:46	67	4/3/18 22:51	65	7/3/18 19:56	67	9/3/18 21:01	67
1/3/18 19:41	68	3/3/18 20:46	67	4/3/18 13:51	68	4/3/18 22:56	66	7/3/18 20:01	67	9/3/18 21:06	67
1/3/18 19:46	67	3/3/18 20:51	66	4/3/18 13:56	67	5/3/18 19:01	56	7/3/18 20:06	67	9/3/18 21:11	67
1/3/18 19:51	68	3/3/18 20:56	67	4/3/18 14:01	67	5/3/18 19:06	59	7/3/18 20:11	67	9/3/18 21:16	68
1/3/18 19:56	68	3/3/18 21:01	66	4/3/18 14:06	68	5/3/18 19:11	50	7/3/18 20:16	67	9/3/18 21:21	67
1/3/18 20:01	67	3/3/18 21:06	66	4/3/18 14:11	67	5/3/18 19:16	57	7/3/18 20:21	67	9/3/18 21:26	67
1/3/18 20:06	67	3/3/18 21:11	67	4/3/18 14:16	67	5/3/18 19:21	61	7/3/18 20:26	67	9/3/18 21:31	67
1/3/18 20:11	68	3/3/18 21:16	67	4/3/18 14:21	68	5/3/18 19:26	55	7/3/18 20:31	67	9/3/18 21:36	67
1/3/18 20:16	67	3/3/18 21:21	67	4/3/18 14:26	67	5/3/18 19:31	68	7/3/18 20:36	67	9/3/18 21:41	67
1/3/18 20:21	67	3/3/18 21:26	66	4/3/18 14:31	67	5/3/18 19:36	68	7/3/18 20:41	67	9/3/18 21:46	67
1/3/18 20:26	67	3/3/18 21:31	66	4/3/18 14:36	67	5/3/18 19:41	68	7/3/18 20:46	67	9/3/18 21:51	67
1/3/18 20:31	68	3/3/18 21:36	67	4/3/18 14:41	68	5/3/18 19:46	68	7/3/18 20:51	67	9/3/18 21:56	67
1/3/18 20:36	67	3/3/18 21:41	66	4/3/18 14:46	67	5/3/18 19:51	68	7/3/18 20:56	67	9/3/18 22:01	68
1/3/18 20:41	67	3/3/18 21:46	67	4/3/18 14:51	67	5/3/18 19:56	67	7/3/18 21:01	66	9/3/18 22:06	67
1/3/18 20:46	68	3/3/18 21:51	67	4/3/18 14:56	67	5/3/18 20:01	67	7/3/18 21:06	67	9/3/18 22:11	68
1/3/18 20:51	67	3/3/18 21:56	67	4/3/18 15:01	68	5/3/18 20:06	67	7/3/18 21:11	66	9/3/18 22:16	68
1/3/18 20:56	67	3/3/18 22:01	67	4/3/18 15:06	68	5/3/18 20:11	67	7/3/18 21:16	67	9/3/18 22:21	67
1/3/18 21:01	67	3/3/18 22:06	66	4/3/18 15:11	67	5/3/18 20:16	67	7/3/18 21:21	67	9/3/18 22:26	67
1/3/18 21:06	68	3/3/18 22:11	67	4/3/18 15:16	68	5/3/18 20:21	67	7/3/18 21:26	66	9/3/18 22:31	67
1/3/18 21:11	67	3/3/18 22:16	67	4/3/18 15:21	68	5/3/18 20:26	67	7/3/18 21:31	67	9/3/18 22:36	67
1/3/18 21:16	67	3/3/18 22:21	67	4/3/18 15:26	67	5/3/18 20:31	67	7/3/18 21:36	67	9/3/18 22:41	67
1/3/18 21:21	67	3/3/18 22:26	67	4/3/18 15:31	59	5/3/18 20:36	68	7/3/18 21:41	67	9/3/18 22:46	68
1/3/18 21:26	67	3/3/18 22:31	67	4/3/18 15:36	68	5/3/18 20:41	67	7/3/18 21:46	67	9/3/18 22:51	67
1/3/18 21:31	67	3/3/18 22:36	67	4/3/18 15:41	67	5/3/18 20:46	66	7/3/18 21:51	67	9/3/18 22:56	67
1/3/18 21:36	67	3/3/18 22:41	67	4/3/18 15:46	67	5/3/18 20:51	67	7/3/18 21:56	68	10/3/18 19:01	69
1/3/18 21:41	67	3/3/18 22:46	67	4/3/18 15:51	67	5/3/18 20:56	67	7/3/18 22:01	67	10/3/18 19:06	69
1/3/18 21:46	67	3/3/18 22:51	67	4/3/18 15:56	68	5/3/18 21:01	67	7/3/18 22:06	67	10/3/18 19:11	69
1/3/18 21:51	67	3/3/18 22:56	67	4/3/18 16:01	68	5/3/18 21:06	67	7/3/18 22:11	67	10/3/18 19:16	69
1/3/18 21:56	66	4/3/18 7:01	66	4/3/18 16:06	67	5/3/18 21:11	66	7/3/18 22:16	66	10/3/18 19:21	69
1/3/18 22:01	67	4/3/18 7:06	65	4/3/18 16:11	68	5/3/18 21:16	67	7/3/18 22:21	67	10/3/18 19:26	68
1/3/18 22:06	67	4/3/18 7:11	65	4/3/18 16:16	68	5/3/18 21:21	66	7/3/18 22:26	67	10/3/18 19:31	68
1/3/18 22:11	67	4/3/18 7:16	65	4/3/18 16:21	67	5/3/18 21:26	67	7/3/18 22:31	67	10/3/18 19:36	68
1/3/18 22:16	67	4/3/18 7:21	65	4/3/18 16:26	67	5/3/18 21:31	67	7/3/18 22:36	66	10/3/18 19:41	68
1/3/18 22:21	67	4/3/18 7:26	66	4/3/18 16:31	68	5/3/18 21:36	67	7/3/18 22:41	66	10/3/18 19:46	67
1/3/18 22:26	67	4/3/18 7:31	66	4/3/18 16:36	68	5/3/18 21:41	67	7/3/18 22:46	67	10/3/18 19:51	67
1/3/18 22:31	67	4/3/18 7:36	66	4/3/18 16:41	68	5/3/18 21:46	67	7/3/18 22:51	66	10/3/18 19:56	67
1/3/18 22:36	67	4/3/18 7:41	66	4/3/18 16:46	68	5/3/18 21:51	67	7/3/18 22:56	66	10/3/18 20:01	67
1/3/18 22:41	68	4/3/18 7:46	66	4/3/18 16:51	68	5/3/18 21:56	67	8/3/18 19:01	69	10/3/18 20:06	67
1/3/18 22:46	66	4/3/18 7:51	66	4/3/18 16:56	67	5/3/18 22:01	67	8/3/18 19:06	68	10/3/18 20:11	67
1/3/18 22:51	67	4/3/18 7:56	67	4/3/18 17:01	68	5/3/18 22:06	66	8/3/18 19:11	68	10/3/18 20:16	68
1/3/18 22:56	67	4/3/18 8:01	66	4/3/18 17:06	69	5/3/18 22:11	67	8/3/18 19:16	68	10/3/18 20:21	67
2/3/18 19:01	56	4/3/18 8:06	67	4/3/18 17:11	69	5/3/18 22:16	67	8/3/18 19:21	68	10/3/18 20:26	68
2/3/18 19:06	69	4/3/18 8:11	67	4/3/18 17:16	69	5/3/18 22:21	67	8/3/18 19:26	68	10/3/18 20:31	68
2/3/18 19:11	69	4/3/18 8:16	61	4/3/18 17:21	62	5/3/18 22:26	67	8/3/18 19:31	67	10/3/18 20:36	66
2/3/18 19:16	47	4/3/18 8:21	68	4/3/18 17:26	68	5/3/18 22:31	67	8/3/18 19:36	65	10/3/18 20:41	66
2/3/18 19:21	51	4/3/18 8:26	68	4/3/18 17:31	68	5/3/18 22:36	67	8/3/18 19:41	67	10/3/18 20:46	68
2/3/18 19:26	69	4/3/18 8:31	68	4/3/18 17:36	67	5/3/18 22:41	66	8/3/18 19:46	68	10/3/18 20:51	67
2/3/18 19:31	69	4/3/18 8:36	67	4/3/18 17:41	68	5/3/18 22:46	66	8/3/18 19:51	68	10/3/18 20:56	66
2/3/18 19:36	68	4/3/18 8:41	67	4/3/18 17:46	67	5/3/18 22:51	66	8/3/18 19:56	69	10/3/18 21:01	68
2/3/18 19:41	69	4/3/18 8:46	68	4/3/18 17:51	68	5/3/18 22:56	66	8/3/18 20:01	67	10/3/18 21:06	67
2/3/18 19:46	67	4/3/18 8:51	68								

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)									
11/3/18 7:26	65	11/3/18 16:31	69	12/3/18 21:36	67	14/3/18 22:41	67	17/3/18 19:46	68	18/3/18 12:51	68
11/3/18 7:31	66	11/3/18 16:36	69	12/3/18 21:41	67	14/3/18 22:46	67	17/3/18 19:51	68	18/3/18 12:56	68
11/3/18 7:36	66	11/3/18 16:41	69	12/3/18 21:46	67	14/3/18 22:51	67	17/3/18 19:56	69	18/3/18 13:01	69
11/3/18 7:41	66	11/3/18 16:46	69	12/3/18 21:51	66	14/3/18 22:56	67	17/3/18 20:01	69	18/3/18 13:06	69
11/3/18 7:46	67	11/3/18 16:51	68	12/3/18 21:56	68	15/3/18 19:01	64	17/3/18 20:06	67	18/3/18 13:11	69
11/3/18 7:51	67	11/3/18 16:56	68	12/3/18 22:01	66	15/3/18 19:06	64	17/3/18 20:11	68	18/3/18 13:16	68
11/3/18 7:56	67	11/3/18 17:01	68	12/3/18 22:06	67	15/3/18 19:11	63	17/3/18 20:16	68	18/3/18 13:21	69
11/3/18 8:01	66	11/3/18 17:06	69	12/3/18 22:11	67	15/3/18 19:16	63	17/3/18 20:21	68	18/3/18 13:26	69
11/3/18 8:06	68	11/3/18 17:11	55	12/3/18 22:16	67	15/3/18 19:21	51	17/3/18 20:26	68	18/3/18 13:31	56
11/3/18 8:11	67	11/3/18 17:16	68	12/3/18 22:21	67	15/3/18 19:26	51	17/3/18 20:31	67	18/3/18 13:36	69
11/3/18 8:16	67	11/3/18 17:21	68	12/3/18 22:26	66	15/3/18 19:31	69	17/3/18 20:36	67	18/3/18 13:41	68
11/3/18 8:21	67	11/3/18 17:26	69	12/3/18 22:31	66	15/3/18 19:36	68	17/3/18 20:41	68	18/3/18 13:46	68
11/3/18 8:26	67	11/3/18 17:31	69	12/3/18 22:36	67	15/3/18 19:41	68	17/3/18 20:46	67	18/3/18 13:51	54
11/3/18 8:31	69	11/3/18 17:36	68	12/3/18 22:41	67	15/3/18 19:46	68	17/3/18 20:51	68	18/3/18 13:56	67
11/3/18 8:36	67	11/3/18 17:41	56	12/3/18 22:46	66	15/3/18 19:51	68	17/3/18 20:56	67	18/3/18 14:01	63
11/3/18 8:41	67	11/3/18 17:46	69	12/3/18 22:51	66	15/3/18 19:56	67	17/3/18 21:01	67	18/3/18 14:06	60
11/3/18 8:46	68	11/3/18 17:51	69	12/3/18 22:56	67	15/3/18 20:01	67	17/3/18 21:06	67	18/3/18 14:11	64
11/3/18 8:51	67	11/3/18 17:56	68	13/3/18 19:01	69	15/3/18 20:06	68	17/3/18 21:11	68	18/3/18 14:16	69
11/3/18 8:56	67	11/3/18 18:01	67	13/3/18 19:06	69	15/3/18 20:11	67	17/3/18 21:16	68	18/3/18 14:21	68
11/3/18 9:01	67	11/3/18 18:06	68	13/3/18 19:11	69	15/3/18 20:16	67	17/3/18 21:21	67	18/3/18 14:26	69
11/3/18 9:06	67	11/3/18 18:11	68	13/3/18 19:16	69	15/3/18 20:21	67	17/3/18 21:26	67	18/3/18 14:31	68
11/3/18 9:11	68	11/3/18 18:16	68	13/3/18 19:21	69	15/3/18 20:26	68	17/3/18 21:31	68	18/3/18 14:36	68
11/3/18 9:16	68	11/3/18 18:21	68	13/3/18 19:26	55	15/3/18 20:31	68	17/3/18 21:36	68	18/3/18 14:41	68
11/3/18 9:21	68	11/3/18 18:26	68	13/3/18 19:31	69	15/3/18 20:36	67	17/3/18 21:41	68	18/3/18 14:46	69
11/3/18 9:26	68	11/3/18 18:31	68	13/3/18 19:36	69	15/3/18 20:41	67	17/3/18 21:46	68	18/3/18 14:51	69
11/3/18 9:31	69	11/3/18 18:36	68	13/3/18 19:41	69	15/3/18 20:46	67	17/3/18 21:51	68	18/3/18 14:56	69
11/3/18 9:36	68	11/3/18 18:41	68	13/3/18 19:46	69	15/3/18 20:51	68	17/3/18 21:56	68	18/3/18 15:01	69
11/3/18 9:41	68	11/3/18 18:46	68	13/3/18 19:51	69	15/3/18 20:56	67	17/3/18 22:01	68	18/3/18 15:06	69
11/3/18 9:46	67	11/3/18 18:51	67	13/3/18 19:56	69	15/3/18 21:01	67	17/3/18 22:06	68	18/3/18 15:11	68
11/3/18 9:51	67	11/3/18 18:56	68	13/3/18 20:01	69	15/3/18 21:06	67	17/3/18 22:11	68	18/3/18 15:16	68
11/3/18 9:56	67	11/3/18 19:01	67	13/3/18 20:06	68	15/3/18 21:11	67	17/3/18 22:16	68	18/3/18 15:21	68
11/3/18 10:01	68	11/3/18 19:06	67	13/3/18 20:11	68	15/3/18 21:16	67	17/3/18 22:21	68	18/3/18 15:26	67
11/3/18 10:06	68	11/3/18 19:11	68	13/3/18 20:16	69	15/3/18 21:21	67	17/3/18 22:26	68	18/3/18 15:31	68
11/3/18 10:11	68	11/3/18 19:16	67	13/3/18 20:21	69	15/3/18 21:26	67	17/3/18 22:31	67	18/3/18 15:36	69
11/3/18 10:16	68	11/3/18 19:21	67	13/3/18 20:26	68	15/3/18 21:31	67	17/3/18 22:36	66	18/3/18 15:41	69
11/3/18 10:21	67	11/3/18 19:26	68	13/3/18 20:31	68	15/3/18 21:36	69	17/3/18 22:41	67	18/3/18 15:46	64
11/3/18 10:26	68	11/3/18 19:31	67	13/3/18 20:36	68	15/3/18 21:41	67	17/3/18 22:46	67	18/3/18 15:51	61
11/3/18 10:31	69	11/3/18 19:36	67	13/3/18 20:41	68	15/3/18 21:46	68	17/3/18 22:51	66	18/3/18 15:56	64
11/3/18 10:36	68	11/3/18 19:41	67	13/3/18 20:46	68	15/3/18 21:51	67	17/3/18 22:56	67	18/3/18 16:01	57
11/3/18 10:41	67	11/3/18 19:46	67	13/3/18 20:51	68	15/3/18 21:56	67	18/3/18 7:01	67	18/3/18 16:06	69
11/3/18 10:46	67	11/3/18 19:51	68	13/3/18 20:56	68	15/3/18 22:01	67	18/3/18 7:06	65	18/3/18 16:11	69
11/3/18 10:51	67	11/3/18 19:56	67	13/3/18 21:01	68	15/3/18 22:06	67	18/3/18 7:11	67	18/3/18 16:16	65
11/3/18 10:56	68	11/3/18 20:01	67	13/3/18 21:06	68	15/3/18 22:11	68	18/3/18 7:16	65	18/3/18 16:21	69
11/3/18 11:01	67	11/3/18 20:06	67	13/3/18 21:11	69	15/3/18 22:16	67	18/3/18 7:21	66	18/3/18 16:26	66
11/3/18 11:06	67	11/3/18 20:11	67	13/3/18 21:16	68	15/3/18 22:21	68	18/3/18 7:26	65	18/3/18 16:31	69
11/3/18 11:11	66	11/3/18 20:16	67	13/3/18 21:21	69	15/3/18 22:26	67	18/3/18 7:31	66	18/3/18 16:36	69
11/3/18 11:16	67	11/3/18 20:21	67	13/3/18 21:26	69	15/3/18 22:31	67	18/3/18 7:36	66	18/3/18 16:41	62
11/3/18 11:21	66	11/3/18 20:26	66	13/3/18 21:31	68	15/3/18 22:36	68	18/3/18 7:41	67	18/3/18 16:46	68
11/3/18 11:26	67	11/3/18 20:31	66	13/3/18 21:36	69	15/3/18 22:41	67	18/3/18 7:46	67	18/3/18 16:51	68
11/3/18 11:31	67	11/3/18 20:36	66	13/3/18 21:41	68	15/3/18 22:46	69	18/3/18 7:51	67	18/3/18 16:56	68
11/3/18 11:36	66	11/3/18 20:41	67	13/3/18 21:46	69	15/3/18 22:51	67	18/3/18 7:56	68	18/3/18 17:01	67
11/3/18 11:41	67	11/3/18 20:46	67	13/3/18 21:51	68	15/3/18 22:56	67	18/3/18 8:01	67	18/3/18 17:06	68
11/3/18 11:46	67	11/3/18 20:51	67	13/3/18 21:56	68	16/3/18 19:01	68	18/3/18 8:06	67	18/3/18 17:11	67
11/3/18 11:51	67	11/3/18 20:56	68	13/3/18 22:01	68	16/3/18 19:06	67	18/3/18 8:11	67	18/3/18 17:16	68
11/3/18 11:56	67	11/3/18 21:01	66	13/3/18 22:06	68	16/3/18 19:11	68	18/3/18 8:16	67	18/3/18 17:21	68
11/3/18 12:01	68	11/3/18 21:06	68	13/3/18 22:11	68	16/3/18 19:16	56	18/3/18 8:21	67	18/3/18 17:26	68
11/3/18 12:06	68	11/3/18 21:11	67	13/3/18 22:16	69	16/3/18 19:21	68	18/3/18 8:26	72	18/3/18 17:31	68
11/3/18 12:11	68	11/3/18 21:16	66	13/3/18 22:21	69	16/3/18 19:26	68	18/3/18 8:31	69	18/3/18 17:36	68
11/3/18 12:16	68	11/3/18 21:21	67	13/3/18 22:26	69	16/3/18 19:31	65	18/3/18 8:36	68	18/3/18 17:41	68
11/3/18 12:21	67	11/3/18 21:26	67	13/3/18 22:31	68	16/3/18 19:36	66	18/3/18 8:41	67	18/3/18 17:46	68
11/3/18 12:26	67	11/3/18 21:31	67	13/3/18 22:36	69	16/3/18 19:41	66	18/3/18 8:46	67	18/3/18 17:51	68
11/3/18 12:31	67	11/3/18 21:36	67	13/3/18 22:41	68	16/3/18 19:46	67	18/3/18 8:51	68	18/3/18 17:56	69
11/3/18 12:36	68	11/3/18 21:41	66	13/3/18 22:46	68	16/3/18 19:51	68	18/3/18 8:56	68	18/3/18 18:01	67
11/3/18 12:41	68	11/3/18 21:46	66	13/3/18 22:51	68	16/3/18 19:56	67	18/3/18 9:01	67	18/3/18 18:06	68
11/3/18 12:46	67	11/3/18 21:51	68	13/3/18 22:56	68	16/3/18 20:01	68	18/3/18 9:06	68	18/3/18 18:11	68
11/3/18 12:51	68	11/3/18 21:56	67	14/3/18 19:01	69	16/3/18 20:06	67	18/3/18 9:11	67	18/3/18 18:16	68
11/3/18 12:56	68	11/3/18 22:01	67	14/3/18 19:06	68	16/3/18 20:11	68	18/3/18 9:16	68	18/3/18 18:21	68
11/3/18 13:01	68	11/3/18 22:06	67	14/3/18 19:11	50	16/3/18 20:16	67	18/3/18 9:21	52	18/3/18 18:26	68
11/3/18 13:06	68	11/3/18 22:11	67	14/3/18 19:16	59	16/3/18 20:21	67	18/3/18 9:26	68	18/3/18 18:31	68
11/3/18 13:11	68	11/3/18 22:16	66	14/3/18 19:21	62	16/3/18 20:26	67	18/3/18 9:31	68	18/3/18 18:36	69
11/3/18 13:16	68	11/3/18 22:21	67	14/3/18 19:26	58	16/3/18 20:31	67	18/3/18 9:36	68	18/3/18 18:41	68
11/3/18 13:21	68	11/3/18 22:26	66	14/3/18 19:31	68	16/3/18 20:36	66	18/3/18 9:41	69	18/3/18 18:46	68
11/3/18 13:26	67	11/3/18 22:31	67	14/3/18 19:36	69	16/3/18 20:41	68	18/3/18 9:46	67	18/3/18 18:51	67
11/3/18 13:31	68	11/3/18 22:36	66	14/3/18 19:41	68	16/3/18 20:46	66	18/3/18 9:51	68	18/3/18 18:56	67
11/3/18 13:36	68	11/3/18 22:41	66	14/3/18 19:46	68	16/3/18 20:51	67	18/3/18 9:56	60	18/3/18 19:01	68
11/3/18 13:41	67	11/3/18 22:46	67	14/3/18 19:51	68	16/3/18 20:56	67	18/3/18 10:01	62	18/3/18 19:06	67
11/3/18 13:46	67	11/3/18 22:51	66	14/3/18 19:56	68	16/3/18 21:01	67	18/3/18 10:06	68	18/3/18 19:11	68
11/3/18 13:51	67	11/3/18 22:56	66	14/3/18 20:01	68	16/3/18 21:06	67	18/3/18 10:11	68	18/3/18 19:16	67
11/3/18 13:56	67	12/3/18 19:01	69	14/3/18 20:06	68	16/3/18 21:11	67	18/3/18 10:16	53	18/3/18 19:21	67
11/3/18 14:01	67	12/3/18 19:06	51	14/3/18 20:11	68	16/3/18 21:16					

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)									
18/3/18 21:56	66	21/3/18 19:01	68	23/3/18 20:06	67	25/3/18 9:11	68	25/3/18 18:16	68	27/2/18 0:06	62
18/3/18 22:01	66	21/3/18 19:06	69	23/3/18 20:11	68	25/3/18 9:16	68	25/3/18 18:21	68	27/2/18 0:11	62
18/3/18 22:06	66	21/3/18 19:11	68	23/3/18 20:16	67	25/3/18 9:21	68	25/3/18 18:26	68	27/2/18 0:16	64
18/3/18 22:11	66	21/3/18 19:16	68	23/3/18 20:21	67	25/3/18 9:26	71	25/3/18 18:31	67	27/2/18 0:21	63
18/3/18 22:16	66	21/3/18 19:21	68	23/3/18 20:26	67	25/3/18 9:31	58	25/3/18 18:36	67	27/2/18 0:26	64
18/3/18 22:21	66	21/3/18 19:26	68	23/3/18 20:31	67	25/3/18 9:36	68	25/3/18 18:41	67	27/2/18 0:31	62
18/3/18 22:26	67	21/3/18 19:31	68	23/3/18 20:36	66	25/3/18 9:41	68	25/3/18 18:46	67	27/2/18 0:36	61
18/3/18 22:31	67	21/3/18 19:36	68	23/3/18 20:41	67	25/3/18 9:46	67	25/3/18 18:51	68	27/2/18 0:41	61
18/3/18 22:36	66	21/3/18 19:41	69	23/3/18 20:46	67	25/3/18 9:51	68	25/3/18 18:56	67	27/2/18 0:46	61
18/3/18 22:41	66	21/3/18 19:46	56	23/3/18 20:51	67	25/3/18 9:56	68	25/3/18 19:01	68	27/2/18 0:51	62
18/3/18 22:46	66	21/3/18 19:51	68	23/3/18 20:56	67	25/3/18 10:01	68	25/3/18 19:06	67	27/2/18 0:56	63
18/3/18 22:51	67	21/3/18 19:56	68	23/3/18 21:01	67	25/3/18 10:06	68	25/3/18 19:11	67	27/2/18 1:01	59
18/3/18 22:56	66	21/3/18 20:01	69	23/3/18 21:06	68	25/3/18 10:11	68	25/3/18 19:16	67	27/2/18 1:06	60
19/3/18 19:01	67	21/3/18 20:06	68	23/3/18 21:11	67	25/3/18 10:16	68	25/3/18 19:21	67	27/2/18 1:11	60
19/3/18 19:06	67	21/3/18 20:11	69	23/3/18 21:16	67	25/3/18 10:21	68	25/3/18 19:26	68	27/2/18 1:16	60
19/3/18 19:11	68	21/3/18 20:16	68	23/3/18 21:21	67	25/3/18 10:26	68	25/3/18 19:31	67	27/2/18 1:21	60
19/3/18 19:16	68	21/3/18 20:21	69	23/3/18 21:26	67	25/3/18 10:31	67	25/3/18 19:36	67	27/2/18 1:26	61
19/3/18 19:21	68	21/3/18 20:26	69	23/3/18 21:31	67	25/3/18 10:36	67	25/3/18 19:41	66	27/2/18 1:31	58
19/3/18 19:26	69	21/3/18 20:31	69	23/3/18 21:36	66	25/3/18 10:41	67	25/3/18 19:46	67	27/2/18 1:36	59
19/3/18 19:31	67	21/3/18 20:36	69	23/3/18 21:41	67	25/3/18 10:46	68	25/3/18 19:51	67	27/2/18 1:41	58
19/3/18 19:36	69	21/3/18 20:41	69	23/3/18 21:46	67	25/3/18 10:51	69	25/3/18 19:56	66	27/2/18 1:46	57
19/3/18 19:41	68	21/3/18 20:46	69	23/3/18 21:51	68	25/3/18 10:56	67	25/3/18 20:01	67	27/2/18 1:51	58
19/3/18 19:46	68	21/3/18 20:51	69	23/3/18 21:56	67	25/3/18 11:01	68	25/3/18 20:06	67	27/2/18 1:56	59
19/3/18 19:51	68	21/3/18 20:56	69	23/3/18 22:01	67	25/3/18 11:06	67	25/3/18 20:11	66	27/2/18 2:01	57
19/3/18 19:56	68	21/3/18 21:01	68	23/3/18 22:06	67	25/3/18 11:11	67	25/3/18 20:16	69	27/2/18 2:06	56
19/3/18 20:01	67	21/3/18 21:06	68	23/3/18 22:11	67	25/3/18 11:16	67	25/3/18 20:21	67	27/2/18 2:11	55
19/3/18 20:06	66	21/3/18 21:11	68	23/3/18 22:16	67	25/3/18 11:21	68	25/3/18 20:26	66	27/2/18 2:16	47
19/3/18 20:11	67	21/3/18 21:16	68	23/3/18 22:21	67	25/3/18 11:26	69	25/3/18 20:31	66	27/2/18 2:21	47
19/3/18 20:16	67	21/3/18 21:21	68	23/3/18 22:26	68	25/3/18 11:31	68	25/3/18 20:36	67	27/2/18 2:26	52
19/3/18 20:21	67	21/3/18 21:26	68	23/3/18 22:31	67	25/3/18 11:36	68	25/3/18 20:41	67	27/2/18 2:31	57
19/3/18 20:26	66	21/3/18 21:31	68	23/3/18 22:36	67	25/3/18 11:41	68	25/3/18 20:46	66	27/2/18 2:36	57
19/3/18 20:31	66	21/3/18 21:36	68	23/3/18 22:41	67	25/3/18 11:46	68	25/3/18 20:51	69	27/2/18 2:41	55
19/3/18 20:36	67	21/3/18 21:41	68	23/3/18 22:46	67	25/3/18 11:51	68	25/3/18 20:56	66	27/2/18 2:46	43
19/3/18 20:41	66	21/3/18 21:46	68	23/3/18 22:51	67	25/3/18 11:56	67	25/3/18 21:01	66	27/2/18 2:51	47
19/3/18 20:46	66	21/3/18 21:51	68	23/3/18 22:56	67	25/3/18 12:01	68	25/3/18 21:06	66	27/2/18 2:56	54
19/3/18 20:51	67	21/3/18 21:56	68	24/3/18 19:01	68	25/3/18 12:06	68	25/3/18 21:11	67	27/2/18 3:01	54
19/3/18 20:56	67	21/3/18 22:01	68	24/3/18 19:06	67	25/3/18 12:11	68	25/3/18 21:16	67	27/2/18 3:06	55
19/3/18 21:01	66	21/3/18 22:06	68	24/3/18 19:11	68	25/3/18 12:16	68	25/3/18 21:21	67	27/2/18 3:11	55
19/3/18 21:06	66	21/3/18 22:11	69	24/3/18 19:16	68	25/3/18 12:21	68	25/3/18 21:26	67	27/2/18 3:16	61
19/3/18 21:11	66	21/3/18 22:16	68	24/3/18 19:21	68	25/3/18 12:26	69	25/3/18 21:31	67	27/2/18 3:21	62
19/3/18 21:16	66	21/3/18 22:21	68	24/3/18 19:26	67	25/3/18 12:31	68	25/3/18 21:36	66	27/2/18 3:26	62
19/3/18 21:21	67	21/3/18 22:26	68	24/3/18 19:31	67	25/3/18 12:36	68	25/3/18 21:41	67	27/2/18 3:31	51
19/3/18 21:26	66	21/3/18 22:31	68	24/3/18 19:36	67	25/3/18 12:41	68	25/3/18 21:46	66	27/2/18 3:36	56
19/3/18 21:31	66	21/3/18 22:36	68	24/3/18 19:41	69	25/3/18 12:46	68	25/3/18 21:51	67	27/2/18 3:41	61
19/3/18 21:36	66	21/3/18 22:41	68	24/3/18 19:46	65	25/3/18 12:51	67	25/3/18 21:56	66	27/2/18 3:46	48
19/3/18 21:41	66	21/3/18 22:46	69	24/3/18 19:51	67	25/3/18 12:56	68	25/3/18 22:01	67	27/2/18 3:51	60
19/3/18 21:46	66	21/3/18 22:51	68	24/3/18 19:56	67	25/3/18 13:01	68	25/3/18 22:06	67	27/2/18 3:56	61
19/3/18 21:51	66	21/3/18 22:56	68	24/3/18 20:01	67	25/3/18 13:06	68	25/3/18 22:11	67	27/2/18 4:01	61
19/3/18 21:56	66	22/3/18 19:01	68	24/3/18 20:06	66	25/3/18 13:11	67	25/3/18 22:16	66	27/2/18 4:06	61
19/3/18 22:01	66	22/3/18 19:06	68	24/3/18 20:11	68	25/3/18 13:16	67	25/3/18 22:21	66	27/2/18 4:11	61
19/3/18 22:06	66	22/3/18 19:11	67	24/3/18 20:16	67	25/3/18 13:21	68	25/3/18 22:26	66	27/2/18 4:16	61
19/3/18 22:11	66	22/3/18 19:16	68	24/3/18 20:21	67	25/3/18 13:26	67	25/3/18 22:31	67	27/2/18 4:21	61
19/3/18 22:16	66	22/3/18 19:21	68	24/3/18 20:26	66	25/3/18 13:31	68	25/3/18 22:36	66	27/2/18 4:26	50
19/3/18 22:21	66	22/3/18 19:26	68	24/3/18 20:31	66	25/3/18 13:36	67	25/3/18 22:41	66	27/2/18 4:31	61
19/3/18 22:26	66	22/3/18 19:31	65	24/3/18 20:36	66	25/3/18 13:41	68	25/3/18 22:46	66	27/2/18 4:36	60
19/3/18 22:31	66	22/3/18 19:36	65	24/3/18 20:41	66	25/3/18 13:46	68	25/3/18 22:51	66	27/2/18 4:41	60
19/3/18 22:36	67	22/3/18 19:41	67	24/3/18 20:46	68	25/3/18 13:51	68	25/3/18 22:56	66	27/2/18 4:46	61
19/3/18 22:41	66	22/3/18 19:46	68	24/3/18 20:51	66	25/3/18 13:56	68	26/3/18 19:01	67	27/2/18 4:51	53
19/3/18 22:46	66	22/3/18 19:51	67	24/3/18 20:56	66	25/3/18 14:01	68	26/3/18 19:06	67	27/2/18 4:56	50
19/3/18 22:51	66	22/3/18 19:56	67	24/3/18 21:01	66	25/3/18 14:06	68	26/3/18 19:11	68	27/2/18 5:01	61
19/3/18 22:56	66	22/3/18 20:01	67	24/3/18 21:06	66	25/3/18 14:11	69	26/3/18 19:16	68	27/2/18 5:06	62
20/3/18 19:01	68	22/3/18 20:06	68	24/3/18 21:11	66	25/3/18 14:16	68	26/3/18 19:21	69	27/2/18 5:11	61
20/3/18 19:06	69	22/3/18 20:11	67	24/3/18 21:16	66	25/3/18 14:21	67	26/3/18 19:26	69	27/2/18 5:16	62
20/3/18 19:11	69	22/3/18 20:16	67	24/3/18 21:21	67	25/3/18 14:26	67	26/3/18 19:31	68	27/2/18 5:21	45
20/3/18 19:16	68	22/3/18 20:21	67	24/3/18 21:26	67	25/3/18 14:31	67	26/3/18 19:36	68	27/2/18 5:26	62
20/3/18 19:21	69	22/3/18 20:26	67	24/3/18 21:31	67	25/3/18 14:36	68	26/3/18 19:41	67	27/2/18 5:31	53
20/3/18 19:26	68	22/3/18 20:31	67	24/3/18 21:36	68	25/3/18 14:41	67	26/3/18 19:46	68	27/2/18 5:36	53
20/3/18 19:31	67	22/3/18 20:36	67	24/3/18 21:41	67	25/3/18 14:46	68	26/3/18 19:51	68	27/2/18 5:41	57
20/3/18 19:36	67	22/3/18 20:41	67	24/3/18 21:46	66	25/3/18 14:51	68	26/3/18 19:56	68	27/2/18 5:46	55
20/3/18 19:41	68	22/3/18 20:46	67	24/3/18 21:51	67	25/3/18 14:56	68	26/3/18 20:01	67	27/2/18 5:51	57
20/3/18 19:46	66	22/3/18 20:51	67	24/3/18 21:56	67	25/3/18 15:01	68	26/3/18 20:06	67	27/2/18 5:56	59
20/3/18 19:51	68	22/3/18 20:56	66	24/3/18 22:01	67	25/3/18 15:06	68	26/3/18 20:11	67	27/2/18 6:01	59
20/3/18 19:56	69	22/3/18 21:01	67	24/3/18 22:06	66	25/3/18 15:11	68	26/3/18 20:16	67	27/2/18 6:06	59
20/3/18 20:01	68	22/3/18 21:06	67	24/3/18 22:11	67	25/3/18 15:16	67	26/3/18 20:21	68	27/2/18 6:11	60
20/3/18 20:06	67	22/3/18 21:11	67	24/3/18 22:16	66	25/3/18 15:21	68	26/3/18 20:26	67	27/2/18 6:16	64
20/3/18 20:11	67	22/3/18 21:16	67	24/3/18 22:21	67	25/3/18 15:26	67	26/3/18 20:31	68	27/2/18 6:21	62
20/3/18 20:16	68	22/3/18 21:21	67	24/3/18 22:26	66	25/3/18 15:31	68	26/3/18 20:36	68	27/2/18 6:26	63
20/3/18 20:21	67	22/3/18 21:26	67	24/3/18 22:31	67	25/3/18 15:36	68	26/3/18 20:41	67	27/2/18 6:31	65
20/3/18 20:26	67	22/3/18 21:31	67	24/3/18 22:36	67	25/3/18 15:41	68	26/3/18 20:46	67	27/2/18 6:36	65
20/3/18 20:31	67	22/3/18 21:36	67	24/3/18 22:41	66	25/3/18 15:46	67	26/3/18 20:51			

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)									
28/2/18 1:11	59	1/3/18 2:11	55	2/3/18 3:21	62	3/3/18 4:26	51	4/3/18 5:31	59	5/3/18 6:36	65
28/2/18 1:16	60	1/3/18 2:21	55	2/3/18 3:26	39	3/3/18 4:31	54	4/3/18 5:36	53	5/3/18 6:41	64
28/2/18 1:21	59	1/3/18 2:26	50	2/3/18 3:31	61	3/3/18 4:36	47	4/3/18 5:41	57	5/3/18 6:46	65
28/2/18 1:26	60	1/3/18 2:31	57	2/3/18 3:36	61	3/3/18 4:41	62	4/3/18 5:46	56	5/3/18 6:51	65
28/2/18 1:31	55	1/3/18 2:36	48	2/3/18 3:41	61	3/3/18 4:46	53	4/3/18 5:51	54	5/3/18 6:56	66
28/2/18 1:36	59	1/3/18 2:41	62	2/3/18 3:46	43	3/3/18 4:51	46	4/3/18 5:56	60	5/3/18 23:01	64
28/2/18 1:41	56	1/3/18 2:46	61	2/3/18 3:51	60	3/3/18 4:56	62	4/3/18 6:01	56	5/3/18 23:06	63
28/2/18 1:46	60	1/3/18 2:51	61	2/3/18 3:56	60	3/3/18 5:01	52	4/3/18 6:06	59	5/3/18 23:11	64
28/2/18 1:51	55	1/3/18 2:56	54	2/3/18 4:01	60	3/3/18 5:06	56	4/3/18 6:11	59	5/3/18 23:16	63
28/2/18 1:56	50	1/3/18 3:01	62	2/3/18 4:06	61	3/3/18 5:11	50	4/3/18 6:16	61	5/3/18 23:21	63
28/2/18 2:01	54	1/3/18 3:06	52	2/3/18 4:11	55	3/3/18 5:16	62	4/3/18 6:21	65	5/3/18 23:26	63
28/2/18 2:06	54	1/3/18 3:11	61	2/3/18 4:16	60	3/3/18 5:21	52	4/3/18 6:26	63	5/3/18 23:31	63
28/2/18 2:11	57	1/3/18 3:16	61	2/3/18 4:21	61	3/3/18 5:26	55	4/3/18 6:31	63	5/3/18 23:36	62
28/2/18 2:16	45	1/3/18 3:21	61	2/3/18 4:26	60	3/3/18 5:31	54	4/3/18 6:36	62	5/3/18 23:41	62
28/2/18 2:21	55	1/3/18 3:26	62	2/3/18 4:31	60	3/3/18 5:36	52	4/3/18 6:41	63	5/3/18 23:46	64
28/2/18 2:26	61	1/3/18 3:31	51	2/3/18 4:36	61	3/3/18 5:41	58	4/3/18 6:46	62	5/3/18 23:51	63
28/2/18 2:31	62	1/3/18 3:36	52	2/3/18 4:41	61	3/3/18 5:46	56	4/3/18 6:51	63	5/3/18 23:56	62
28/2/18 2:36	62	1/3/18 3:41	61	2/3/18 4:46	36	3/3/18 5:51	59	4/3/18 6:56	61	6/3/18 0:01	61
28/2/18 2:41	62	1/3/18 3:46	61	2/3/18 4:51	60	3/3/18 5:56	57	4/3/18 23:01	62	6/3/18 0:06	61
28/2/18 2:46	61	1/3/18 3:51	61	2/3/18 4:56	61	3/3/18 6:01	60	4/3/18 23:06	63	6/3/18 0:11	61
28/2/18 2:51	48	1/3/18 3:56	62	2/3/18 5:01	51	3/3/18 6:06	57	4/3/18 23:11	63	6/3/18 0:16	60
28/2/18 2:56	56	1/3/18 4:01	60	2/3/18 5:06	61	3/3/18 6:11	58	4/3/18 23:16	63	6/3/18 0:21	60
28/2/18 3:01	61	1/3/18 4:06	60	2/3/18 5:11	61	3/3/18 6:16	60	4/3/18 23:21	62	6/3/18 0:26	62
28/2/18 3:06	61	1/3/18 4:11	61	2/3/18 5:16	61	3/3/18 6:21	61	4/3/18 23:26	62	6/3/18 0:31	60
28/2/18 3:11	61	1/3/18 4:16	61	2/3/18 5:21	61	3/3/18 6:26	62	4/3/18 23:31	62	6/3/18 0:36	60
28/2/18 3:16	61	1/3/18 4:21	62	2/3/18 5:26	52	3/3/18 6:31	62	4/3/18 23:36	61	6/3/18 0:41	67
28/2/18 3:21	61	1/3/18 4:26	61	2/3/18 5:31	46	3/3/18 6:36	63	4/3/18 23:41	62	6/3/18 0:46	61
28/2/18 3:26	62	1/3/18 4:31	62	2/3/18 5:36	51	3/3/18 6:41	64	4/3/18 23:46	61	6/3/18 0:51	60
28/2/18 3:31	62	1/3/18 4:36	61	2/3/18 5:41	55	3/3/18 6:46	64	4/3/18 23:51	59	6/3/18 0:56	58
28/2/18 3:36	61	1/3/18 4:41	62	2/3/18 5:46	53	3/3/18 6:51	64	4/3/18 23:56	63	6/3/18 1:01	61
28/2/18 3:41	61	1/3/18 4:46	61	2/3/18 5:51	56	3/3/18 6:56	63	5/3/18 0:01	60	6/3/18 1:06	60
28/2/18 3:46	62	1/3/18 4:51	61	2/3/18 5:56	60	3/3/18 23:01	64	5/3/18 0:06	61	6/3/18 1:11	59
28/2/18 3:51	60	1/3/18 4:56	57	2/3/18 6:01	60	3/3/18 23:06	65	5/3/18 0:11	58	6/3/18 1:16	58
28/2/18 3:56	62	1/3/18 5:01	62	2/3/18 6:06	62	3/3/18 23:11	65	5/3/18 0:16	59	6/3/18 1:21	57
28/2/18 4:01	61	1/3/18 5:06	49	2/3/18 6:11	62	3/3/18 23:16	65	5/3/18 0:21	59	6/3/18 1:26	54
28/2/18 4:06	61	1/3/18 5:11	62	2/3/18 6:16	61	3/3/18 23:21	64	5/3/18 0:26	58	6/3/18 1:31	56
28/2/18 4:11	60	1/3/18 5:16	49	2/3/18 6:21	62	3/3/18 23:26	65	5/3/18 0:31	60	6/3/18 1:36	55
28/2/18 4:16	61	1/3/18 5:21	54	2/3/18 6:26	63	3/3/18 23:31	65	5/3/18 0:36	61	6/3/18 1:41	53
28/2/18 4:21	61	1/3/18 5:26	57	2/3/18 6:31	64	3/3/18 23:36	64	5/3/18 0:41	59	6/3/18 1:46	55
28/2/18 4:26	61	1/3/18 5:31	54	2/3/18 6:36	65	3/3/18 23:41	65	5/3/18 0:46	57	6/3/18 1:51	56
28/2/18 4:31	60	1/3/18 5:36	56	2/3/18 6:41	65	3/3/18 23:46	64	5/3/18 0:51	56	6/3/18 1:56	49
28/2/18 4:36	61	1/3/18 5:41	54	2/3/18 6:46	66	3/3/18 23:51	63	5/3/18 0:56	57	6/3/18 2:01	55
28/2/18 4:41	60	1/3/18 5:46	59	2/3/18 6:51	66	3/3/18 23:56	63	5/3/18 1:01	57	6/3/18 2:06	53
28/2/18 4:46	60	1/3/18 5:51	59	2/3/18 6:56	66	4/3/18 0:01	63	5/3/18 1:06	57	6/3/18 2:11	61
28/2/18 4:51	62	1/3/18 5:56	58	2/3/18 23:01	65	4/3/18 0:06	63	5/3/18 1:11	62	6/3/18 2:16	61
28/2/18 4:56	62	1/3/18 6:01	60	2/3/18 23:06	65	4/3/18 0:11	64	5/3/18 1:16	62	6/3/18 2:21	52
28/2/18 5:01	61	1/3/18 6:06	62	2/3/18 23:11	64	4/3/18 0:16	63	5/3/18 1:21	60	6/3/18 2:26	61
28/2/18 5:06	60	1/3/18 6:11	61	2/3/18 23:16	64	4/3/18 0:21	63	5/3/18 1:26	62	6/3/18 2:31	52
28/2/18 5:11	61	1/3/18 6:16	63	2/3/18 23:21	64	4/3/18 0:26	62	5/3/18 1:31	62	6/3/18 2:36	53
28/2/18 5:16	62	1/3/18 6:21	62	2/3/18 23:26	64	4/3/18 0:31	63	5/3/18 1:36	47	6/3/18 2:41	61
28/2/18 5:21	57	1/3/18 6:26	64	2/3/18 23:31	65	4/3/18 0:36	61	5/3/18 1:41	46	6/3/18 2:46	61
28/2/18 5:26	58	1/3/18 6:31	64	2/3/18 23:36	64	4/3/18 0:41	62	5/3/18 1:46	61	6/3/18 2:51	52
28/2/18 5:31	64	1/3/18 6:36	65	2/3/18 23:41	64	4/3/18 0:46	63	5/3/18 1:51	61	6/3/18 2:56	61
28/2/18 5:36	54	1/3/18 6:41	66	2/3/18 23:46	64	4/3/18 0:51	61	5/3/18 1:56	61	6/3/18 3:01	62
28/2/18 5:41	55	1/3/18 6:46	66	2/3/18 23:51	64	4/3/18 0:56	60	5/3/18 2:01	62	6/3/18 3:06	61
28/2/18 5:46	56	1/3/18 6:51	66	2/3/18 23:56	64	4/3/18 1:01	62	5/3/18 2:06	62	6/3/18 3:11	50
28/2/18 5:51	58	1/3/18 6:56	66	3/3/18 0:01	64	4/3/18 1:06	60	5/3/18 2:11	61	6/3/18 3:16	61
28/2/18 5:56	59	1/3/18 23:01	66	3/3/18 0:06	64	4/3/18 1:11	62	5/3/18 2:16	60	6/3/18 3:21	62
28/2/18 6:01	58	1/3/18 23:06	64	3/3/18 0:11	65	4/3/18 1:16	62	5/3/18 2:21	62	6/3/18 3:26	61
28/2/18 6:06	63	1/3/18 23:11	65	3/3/18 0:16	63	4/3/18 1:21	56	5/3/18 2:26	60	6/3/18 3:31	53
28/2/18 6:11	61	1/3/18 23:16	65	3/3/18 0:21	63	4/3/18 1:26	56	5/3/18 2:31	61	6/3/18 3:36	61
28/2/18 6:16	62	1/3/18 23:21	65	3/3/18 0:26	63	4/3/18 1:31	52	5/3/18 2:36	60	6/3/18 3:41	62
28/2/18 6:21	62	1/3/18 23:26	64	3/3/18 0:31	63	4/3/18 1:36	62	5/3/18 2:41	62	6/3/18 3:46	61
28/2/18 6:26	63	1/3/18 23:31	64	3/3/18 0:36	63	4/3/18 1:41	53	5/3/18 2:46	60	6/3/18 3:51	61
28/2/18 6:31	65	1/3/18 23:36	63	3/3/18 0:41	63	4/3/18 1:46	56	5/3/18 2:51	47	6/3/18 3:56	60
28/2/18 6:36	64	1/3/18 23:41	63	3/3/18 0:46	62	4/3/18 1:51	53	5/3/18 2:56	60	6/3/18 4:01	59
28/2/18 6:41	65	1/3/18 23:46	62	3/3/18 0:51	62	4/3/18 1:56	55	5/3/18 3:01	61	6/3/18 4:06	60
28/2/18 6:46	65	1/3/18 23:51	62	3/3/18 0:56	63	4/3/18 2:01	58	5/3/18 3:06	60	6/3/18 4:11	60
28/2/18 6:51	66	1/3/18 23:56	63	3/3/18 1:01	63	4/3/18 2:06	48	5/3/18 3:11	60	6/3/18 4:16	61
28/2/18 6:56	66	2/3/18 0:01	62	3/3/18 1:06	62	4/3/18 2:11	62	5/3/18 3:16	60	6/3/18 4:21	61
28/2/18 23:01	65	2/3/18 0:06	63	3/3/18 1:11	61	4/3/18 2:16	61	5/3/18 3:21	60	6/3/18 4:26	62
28/2/18 23:06	64	2/3/18 0:11	62	3/3/18 1:16	61	4/3/18 2:21	61	5/3/18 3:26	60	6/3/18 4:31	61
28/2/18 23:11	64	2/3/18 0:16	63	3/3/18 1:21	61	4/3/18 2:26	62	5/3/18 3:31	61	6/3/18 4:36	62
28/2/18 23:16	64	2/3/18 0:21	62	3/3/18 1:26	62	4/3/18 2:31	61	5/3/18 3:36	61	6/3/18 4:41	60
28/2/18 23:21	64	2/3/18 0:26	63	3/3/18 1:31	60	4/3/18 2:36	62	5/3/18 3:41	60	6/3/18 4:46	61
28/2/18 23:26	65	2/3/18 0:31	62	3/3/18 1:36	65	4/3/18 2:41	61	5/3/18 3:46	60	6/3/18 4:51	61
28/2/18 23:31	64	2/3/18 0:36	61	3/3/18 1:41	61	4/3/18 2:46	61	5/3/18 3:51	60	6/3/18 4:56	36
28/2/18 23:36	64	2/3/18 0:41	62	3/3/18 1:46	61	4/3/18 2:51	62	5/3/18 3:56	61	6/3/18 5:01	61
28/2/18 23:41	63	2/3/18 0:46	62	3/3/18 1:51	62	4/3/18 2:56	61	5/3/18 4:01	61	6/3/18 5:06	55
28/2/18 23:46	64	2/3/18 0:51	60	3/3/18 1:56	58	4/3/18 3:01	62	5/3/18 4:06	60	6/3/18 5:11	62
28/2/18 23:51	63	2/3/18 0:56	60	3/3/18 2:01	62	4/3/18 3:06	53	5/3/18 4:11	60	6/3/18 5:16	62
28/2/18 23:56	63	2/3/18 1:01	61	3/3/18 2:06	59	4/3/18 3:11	61	5/3/18 4:16	60	6/3/18 5:21	42
1/3/18 0:01	62	2/3/18 1:06	58	3/3/18 2:11	58	4/3/18 3:16	61	5/3/18 4:21	60	6/3/18 5:26	36
1/3/18 0:06	62	2/3/18 1:11	60	3/3/18 2:16	58	4/3/18 3:21	61	5/3/18 4:26	60	6/3/18 5:31	56
1/3/18 0:11	63	2/3/18 1:16	60	3/3/18 2:21	66	4/3/18 3:26	61	5/3/18 4:31	60	6/3/18 5:36	

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)									
6/3/18 23:41	64	8/3/18 0:46	61	9/3/18 1:51	62	10/3/18 2:56	59	11/3/18 4:01	54	12/3/18 5:06	62
6/3/18 23:46	63	8/3/18 0:51	59	9/3/18 1:56	60	10/3/18 3:01	60	11/3/18 4:06	62	12/3/18 5:11	61
6/3/18 23:51	62	8/3/18 0:56	59	9/3/18 2:01	60	10/3/18 3:06	60	11/3/18 4:11	58	12/3/18 5:16	61
6/3/18 23:56	63	8/3/18 1:01	60	9/3/18 2:06	59	10/3/18 3:11	60	11/3/18 4:16	52	12/3/18 5:21	61
7/3/18 0:01	62	8/3/18 1:06	61	9/3/18 2:11	59	10/3/18 3:16	57	11/3/18 4:21	62	12/3/18 5:26	54
7/3/18 0:06	62	8/3/18 1:11	57	9/3/18 2:16	57	10/3/18 3:21	57	11/3/18 4:26	53	12/3/18 5:31	51
7/3/18 0:11	61	8/3/18 1:16	58	9/3/18 2:21	60	10/3/18 3:26	58	11/3/18 4:31	55	12/3/18 5:36	56
7/3/18 0:16	62	8/3/18 1:21	58	9/3/18 2:26	56	10/3/18 3:31	59	11/3/18 4:36	55	12/3/18 5:41	58
7/3/18 0:21	63	8/3/18 1:26	57	9/3/18 2:31	58	10/3/18 3:36	59	11/3/18 4:41	53	12/3/18 5:46	62
7/3/18 0:26	61	8/3/18 1:31	56	9/3/18 2:36	55	10/3/18 3:41	58	11/3/18 4:46	58	12/3/18 5:51	60
7/3/18 0:31	62	8/3/18 1:36	54	9/3/18 2:41	55	10/3/18 3:46	57	11/3/18 4:51	54	12/3/18 5:56	59
7/3/18 0:36	61	8/3/18 1:41	55	9/3/18 2:46	54	10/3/18 3:51	55	11/3/18 4:56	53	12/3/18 6:01	61
7/3/18 0:41	61	8/3/18 1:46	56	9/3/18 2:51	58	10/3/18 3:56	54	11/3/18 5:01	56	12/3/18 6:06	60
7/3/18 0:46	61	8/3/18 1:51	53	9/3/18 2:56	56	10/3/18 4:01	62	11/3/18 5:06	54	12/3/18 6:11	63
7/3/18 0:51	62	8/3/18 1:56	58	9/3/18 3:01	51	10/3/18 4:06	61	11/3/18 5:11	55	12/3/18 6:16	62
7/3/18 0:56	58	8/3/18 2:01	62	9/3/18 3:06	56	10/3/18 4:11	55	11/3/18 5:16	56	12/3/18 6:21	62
7/3/18 1:01	59	8/3/18 2:06	39	9/3/18 3:11	47	10/3/18 4:16	58	11/3/18 5:21	54	12/3/18 6:26	64
7/3/18 1:06	59	8/3/18 2:11	61	9/3/18 3:16	53	10/3/18 4:21	59	11/3/18 5:26	60	12/3/18 6:31	65
7/3/18 1:11	60	8/3/18 2:16	62	9/3/18 3:21	49	10/3/18 4:26	55	11/3/18 5:31	57	12/3/18 6:36	65
7/3/18 1:16	59	8/3/18 2:21	62	9/3/18 3:26	51	10/3/18 4:31	54	11/3/18 5:36	59	12/3/18 6:41	65
7/3/18 1:21	62	8/3/18 2:26	61	9/3/18 3:31	54	10/3/18 4:36	56	11/3/18 5:41	58	12/3/18 6:46	67
7/3/18 1:26	58	8/3/18 2:31	62	9/3/18 3:36	56	10/3/18 4:41	56	11/3/18 5:46	60	12/3/18 6:51	66
7/3/18 1:31	59	8/3/18 2:36	62	9/3/18 3:41	53	10/3/18 4:46	55	11/3/18 5:51	65	12/3/18 6:56	67
7/3/18 1:36	55	8/3/18 2:41	61	9/3/18 3:46	62	10/3/18 4:51	56	11/3/18 5:56	58	12/3/18 7:01	64
7/3/18 1:41	57	8/3/18 2:46	49	9/3/18 3:51	47	10/3/18 4:56	58	11/3/18 6:01	60	12/3/18 7:06	64
7/3/18 1:46	60	8/3/18 2:51	61	9/3/18 3:56	61	10/3/18 5:01	52	11/3/18 6:06	61	12/3/18 7:11	64
7/3/18 1:51	57	8/3/18 2:56	53	9/3/18 4:01	43	10/3/18 5:06	57	11/3/18 6:11	60	12/3/18 7:16	64
7/3/18 1:56	53	8/3/18 3:01	61	9/3/18 4:06	62	10/3/18 5:11	56	11/3/18 6:16	61	12/3/18 7:21	63
7/3/18 2:01	54	8/3/18 3:06	62	9/3/18 4:11	39	10/3/18 5:16	52	11/3/18 6:21	63	12/3/18 7:26	64
7/3/18 2:06	57	8/3/18 3:11	50	9/3/18 4:16	61	10/3/18 5:21	54	11/3/18 6:26	63	12/3/18 7:31	64
7/3/18 2:11	54	8/3/18 3:16	61	9/3/18 4:21	54	10/3/18 5:26	57	11/3/18 6:31	64	12/3/18 7:36	63
7/3/18 2:16	50	8/3/18 3:21	47	9/3/18 4:26	42	10/3/18 5:31	55	11/3/18 6:36	63	12/3/18 7:41	63
7/3/18 2:21	51	8/3/18 3:26	56	9/3/18 4:31	54	10/3/18 5:36	55	11/3/18 6:41	63	12/3/18 7:46	63
7/3/18 2:26	50	8/3/18 3:31	53	9/3/18 4:36	55	10/3/18 5:41	57	11/3/18 6:46	64	12/3/18 7:51	62
7/3/18 2:31	46	8/3/18 3:36	56	9/3/18 4:41	57	10/3/18 5:46	60	11/3/18 6:51	64	12/3/18 7:56	61
7/3/18 2:36	45	8/3/18 3:41	61	9/3/18 4:46	56	10/3/18 5:51	60	11/3/18 6:56	63	13/3/18 0:01	62
7/3/18 2:41	62	8/3/18 3:46	58	9/3/18 4:51	54	10/3/18 5:56	59	11/3/18 7:01	63	13/3/18 0:06	61
7/3/18 2:46	61	8/3/18 3:51	60	9/3/18 4:56	55	10/3/18 6:01	57	11/3/18 7:06	63	13/3/18 0:11	63
7/3/18 2:51	62	8/3/18 3:56	57	9/3/18 5:01	55	10/3/18 6:06	59	11/3/18 7:11	65	13/3/18 0:16	61
7/3/18 2:56	61	8/3/18 4:01	62	9/3/18 5:06	49	10/3/18 6:11	62	11/3/18 7:16	64	13/3/18 0:21	60
7/3/18 3:01	61	8/3/18 4:06	62	9/3/18 5:11	59	10/3/18 6:16	62	11/3/18 7:21	62	13/3/18 0:26	62
7/3/18 3:06	60	8/3/18 4:11	62	9/3/18 5:16	55	10/3/18 6:21	63	11/3/18 7:26	63	13/3/18 0:31	61
7/3/18 3:11	53	8/3/18 4:16	54	9/3/18 5:21	58	10/3/18 6:26	64	11/3/18 7:31	62	13/3/18 0:36	62
7/3/18 3:16	61	8/3/18 4:21	57	9/3/18 5:26	58	10/3/18 6:31	63	11/3/18 7:36	62	13/3/18 0:41	59
7/3/18 3:21	61	8/3/18 4:26	56	9/3/18 5:31	57	10/3/18 6:36	64	11/3/18 7:41	62	13/3/18 0:46	60
7/3/18 3:26	61	8/3/18 4:31	53	9/3/18 5:36	57	10/3/18 6:41	65	11/3/18 7:46	63	13/3/18 0:51	59
7/3/18 3:31	61	8/3/18 4:36	62	9/3/18 5:41	59	10/3/18 6:46	65	11/3/18 7:51	60	13/3/18 0:56	59
7/3/18 3:36	51	8/3/18 4:41	61	9/3/18 5:46	60	10/3/18 6:51	65	11/3/18 7:56	60	13/3/18 1:01	57
7/3/18 3:41	61	8/3/18 4:46	62	9/3/18 5:51	60	10/3/18 6:56	65	12/3/18 0:01	61	13/3/18 1:06	61
7/3/18 3:46	61	8/3/18 4:51	47	9/3/18 5:56	61	10/3/18 7:01	66	12/3/18 0:06	62	13/3/18 1:11	61
7/3/18 3:51	61	8/3/18 4:56	49	9/3/18 6:01	61	10/3/18 7:06	65	12/3/18 0:11	61	13/3/18 1:16	60
7/3/18 3:56	50	8/3/18 5:01	57	9/3/18 6:06	61	10/3/18 7:11	65	12/3/18 0:16	60	13/3/18 1:21	59
7/3/18 4:01	61	8/3/18 5:06	56	9/3/18 6:11	62	10/3/18 7:16	65	12/3/18 0:21	61	13/3/18 1:26	60
7/3/18 4:06	61	8/3/18 5:11	54	9/3/18 6:16	63	10/3/18 7:21	65	12/3/18 0:26	59	13/3/18 1:31	58
7/3/18 4:11	61	8/3/18 5:16	57	9/3/18 6:21	64	10/3/18 7:26	65	12/3/18 0:31	59	13/3/18 1:36	58
7/3/18 4:16	61	8/3/18 5:21	55	9/3/18 6:26	64	10/3/18 7:31	64	12/3/18 0:36	60	13/3/18 1:41	58
7/3/18 4:21	48	8/3/18 5:26	58	9/3/18 6:31	65	10/3/18 7:36	64	12/3/18 0:41	60	13/3/18 1:46	57
7/3/18 4:26	61	8/3/18 5:31	57	9/3/18 6:36	65	10/3/18 7:41	64	12/3/18 0:46	59	13/3/18 1:51	57
7/3/18 4:31	61	8/3/18 5:36	59	9/3/18 6:41	66	10/3/18 7:46	64	12/3/18 0:51	58	13/3/18 1:56	52
7/3/18 4:36	54	8/3/18 5:41	59	9/3/18 6:46	66	10/3/18 7:51	63	12/3/18 0:56	59	13/3/18 2:01	52
7/3/18 4:41	60	8/3/18 5:46	58	9/3/18 6:51	67	10/3/18 7:56	64	12/3/18 1:01	58	13/3/18 2:06	51
7/3/18 4:46	61	8/3/18 5:51	62	9/3/18 6:56	67	11/3/18 0:01	64	12/3/18 1:06	56	13/3/18 2:11	54
7/3/18 4:51	52	8/3/18 5:56	60	9/3/18 7:01	66	11/3/18 0:06	63	12/3/18 1:11	51	13/3/18 2:16	46
7/3/18 4:56	62	8/3/18 6:01	63	9/3/18 7:06	65	11/3/18 0:11	63	12/3/18 1:16	58	13/3/18 2:21	54
7/3/18 5:01	61	8/3/18 6:06	63	9/3/18 7:11	65	11/3/18 0:16	63	12/3/18 1:21	55	13/3/18 2:26	54
7/3/18 5:06	62	8/3/18 6:11	63	9/3/18 7:16	66	11/3/18 0:21	63	12/3/18 1:26	62	13/3/18 2:31	47
7/3/18 5:11	53	8/3/18 6:16	63	9/3/18 7:21	65	11/3/18 0:26	62	12/3/18 1:31	55	13/3/18 2:36	62
7/3/18 5:16	49	8/3/18 6:21	66	9/3/18 7:26	67	11/3/18 0:31	64	12/3/18 1:36	53	13/3/18 2:41	61
7/3/18 5:21	49	8/3/18 6:26	65	9/3/18 7:31	65	11/3/18 0:36	62	12/3/18 1:41	62	13/3/18 2:46	61
7/3/18 5:26	45	8/3/18 6:31	66	9/3/18 7:36	66	11/3/18 0:41	63	12/3/18 1:46	56	13/3/18 2:51	55
7/3/18 5:31	52	8/3/18 6:36	65	9/3/18 7:41	65	11/3/18 0:46	63	12/3/18 1:51	43	13/3/18 2:56	51
7/3/18 5:36	55	8/3/18 6:41	66	9/3/18 7:46	65	11/3/18 0:51	61	12/3/18 1:56	48	13/3/18 3:01	62
7/3/18 5:41	55	8/3/18 6:46	68	9/3/18 7:51	66	11/3/18 0:56	62	12/3/18 2:01	49	13/3/18 3:06	62
7/3/18 5:46	53	8/3/18 6:51	70	9/3/18 7:56	64	11/3/18 1:01	62	12/3/18 2:06	60	13/3/18 3:11	61
7/3/18 5:51	55	8/3/18 6:56	69	10/3/18 0:01	65	11/3/18 1:06	62	12/3/18 2:11	60	13/3/18 3:16	61
7/3/18 5:56	58	8/3/18 7:01	66	10/3/18 0:06	66	11/3/18 1:11	63	12/3/18 2:16	61	13/3/18 3:21	61
7/3/18 6:01	57	8/3/18 7:06	67	10/3/18 0:11	64	11/3/18 1:16	62	12/3/18 2:21	61	13/3/18 3:26	62
7/3/18 6:06	60	8/3/18 7:11	66	10/3/18 0:16	64	11/3/18 1:21	64	12/3/18 2:26	61	13/3/18 3:31	61
7/3/18 6:11	59	8/3/18 7:16	67	10/3/18 0:21	64	11/3/18 1:26	61	12/3/18 2:31	60	13/3/18 3:36	61
7/3/18 6:16	62	8/3/18 7:21	66	10/3/18 0:26	64	11/3/18 1:31	60	12/3/18 2:36	61	13/3/18 3:41	61
7/3/18 6:21	62	8/3/18 7:26	66	10/3/18 0:31	63	11/3/18 1:36	60	12/3/18 2:41	61	13/3/18 3:46	61
7/3/18 6:26	62	8/3/18 7:31	66	10/3/18 0:36	64	11/3/18 1:41	61	12/3/18 2:46	61	13/3/18 3:51	40
7/3/18 6:31	64	8/3/18 7:36	65	10/3/18 0:41	63	11/3/18 1:46	61	12/3/18 2:51	61	13/3/18 3:56	60
7/3/18 6:36	65	8/3/18 7:41	65	10/3/18 0:46	63	11/3/18 1:51	60	12/3/18 2:56	60	13/3/18 4:01	60
7/3/18 6:41	6										

Real-time Noise Data		RTN1 (Food and Environmental Hygiene Department Depot)									
13/3/18 6:11	62	14/3/18 23:16	64	16/3/18 0:21	64	17/3/18 1:26	62	18/3/18 2:31	58	19/3/18 3:36	61
13/3/18 6:16	62	14/3/18 23:21	65	16/3/18 0:26	63	17/3/18 1:31	60	18/3/18 2:36	58	19/3/18 3:41	60
13/3/18 6:21	62	14/3/18 23:26	65	16/3/18 0:31	63	17/3/18 1:36	61	18/3/18 2:41	57	19/3/18 3:46	60
13/3/18 6:26	64	14/3/18 23:31	65	16/3/18 0:36	63	17/3/18 1:41	61	18/3/18 2:46	55	19/3/18 3:51	60
13/3/18 6:31	65	14/3/18 23:36	65	16/3/18 0:41	63	17/3/18 1:46	61	18/3/18 2:51	57	19/3/18 3:56	59
13/3/18 6:36	65	14/3/18 23:41	64	16/3/18 0:46	61	17/3/18 1:51	60	18/3/18 2:56	55	19/3/18 4:01	59
13/3/18 6:41	65	14/3/18 23:46	64	16/3/18 0:51	62	17/3/18 1:56	60	18/3/18 3:01	57	19/3/18 4:06	61
13/3/18 6:46	67	14/3/18 23:51	63	16/3/18 0:56	62	17/3/18 2:01	60	18/3/18 3:06	64	19/3/18 4:11	60
13/3/18 6:51	66	14/3/18 23:56	63	16/3/18 1:01	61	17/3/18 2:06	59	18/3/18 3:11	55	19/3/18 4:16	60
13/3/18 6:56	66	15/3/18 0:01	64	16/3/18 1:06	62	17/3/18 2:11	61	18/3/18 3:16	54	19/3/18 4:21	59
13/3/18 23:01	66	15/3/18 0:06	63	16/3/18 1:11	60	17/3/18 2:16	59	18/3/18 3:21	56	19/3/18 4:26	60
13/3/18 23:06	67	15/3/18 0:11	63	16/3/18 1:16	62	17/3/18 2:21	58	18/3/18 3:26	55	19/3/18 4:31	61
13/3/18 23:11	66	15/3/18 0:16	63	16/3/18 1:21	60	17/3/18 2:26	59	18/3/18 3:31	58	19/3/18 4:36	59
13/3/18 23:16	67	15/3/18 0:21	63	16/3/18 1:26	58	17/3/18 2:31	58	18/3/18 3:36	57	19/3/18 4:41	61
13/3/18 23:21	67	15/3/18 0:26	63	16/3/18 1:31	60	17/3/18 2:36	60	18/3/18 3:41	58	19/3/18 4:46	60
13/3/18 23:26	67	15/3/18 0:31	62	16/3/18 1:36	56	17/3/18 2:41	61	18/3/18 3:46	52	19/3/18 4:51	60
13/3/18 23:31	66	15/3/18 0:36	62	16/3/18 1:41	57	17/3/18 2:46	57	18/3/18 3:51	58	19/3/18 4:56	61
13/3/18 23:36	66	15/3/18 0:41	61	16/3/18 1:46	58	17/3/18 2:51	59	18/3/18 3:56	47	19/3/18 5:01	61
13/3/18 23:41	66	15/3/18 0:46	62	16/3/18 1:51	51	17/3/18 2:56	60	18/3/18 4:01	56	19/3/18 5:06	56
13/3/18 23:46	66	15/3/18 0:51	63	16/3/18 1:56	58	17/3/18 3:01	57	18/3/18 4:06	61	19/3/18 5:11	62
13/3/18 23:51	66	15/3/18 0:56	61	16/3/18 2:01	58	17/3/18 3:06	56	18/3/18 4:11	62	19/3/18 5:16	46
13/3/18 23:56	65	15/3/18 1:01	61	16/3/18 2:06	55	17/3/18 3:11	58	18/3/18 4:16	49	19/3/18 5:21	54
14/3/18 0:01	66	15/3/18 1:06	59	16/3/18 2:11	52	17/3/18 3:16	54	18/3/18 4:21	44	19/3/18 5:26	62
14/3/18 0:06	66	15/3/18 1:11	59	16/3/18 2:16	56	17/3/18 3:21	55	18/3/18 4:26	62	19/3/18 5:31	51
14/3/18 0:11	65	15/3/18 1:16	61	16/3/18 2:21	55	17/3/18 3:26	58	18/3/18 4:31	54	19/3/18 5:36	55
14/3/18 0:16	66	15/3/18 1:21	58	16/3/18 2:26	57	17/3/18 3:31	59	18/3/18 4:36	62	19/3/18 5:41	57
14/3/18 0:21	65	15/3/18 1:26	59	16/3/18 2:31	54	17/3/18 3:36	54	18/3/18 4:41	62	19/3/18 5:46	59
14/3/18 0:26	65	15/3/18 1:31	59	16/3/18 2:36	54	17/3/18 3:41	46	18/3/18 4:46	62	19/3/18 5:51	60
14/3/18 0:31	65	15/3/18 1:36	59	16/3/18 2:41	53	17/3/18 3:46	51	18/3/18 4:51	61	19/3/18 5:56	58
14/3/18 0:36	65	15/3/18 1:41	60	16/3/18 2:46	57	17/3/18 3:51	55	18/3/18 4:56	52	19/3/18 6:01	58
14/3/18 0:41	65	15/3/18 1:46	62	16/3/18 2:51	51	17/3/18 3:56	51	18/3/18 5:01	49	19/3/18 6:06	63
14/3/18 0:46	65	15/3/18 1:51	55	16/3/18 2:56	55	17/3/18 4:01	53	18/3/18 5:06	48	19/3/18 6:11	60
14/3/18 0:51	65	15/3/18 1:56	58	16/3/18 3:01	61	17/3/18 4:06	46	18/3/18 5:11	62	19/3/18 6:16	63
14/3/18 0:56	65	15/3/18 2:01	62	16/3/18 3:06	52	17/3/18 4:11	61	18/3/18 5:16	62	19/3/18 6:21	61
14/3/18 1:01	64	15/3/18 2:06	53	16/3/18 3:11	62	17/3/18 4:16	53	18/3/18 5:21	54	19/3/18 6:26	63
14/3/18 1:06	65	15/3/18 2:11	55	16/3/18 3:16	62	17/3/18 4:21	61	18/3/18 5:26	58	19/3/18 6:31	65
14/3/18 1:11	64	15/3/18 2:16	43	16/3/18 3:21	62	17/3/18 4:26	54	18/3/18 5:31	56	19/3/18 6:36	65
14/3/18 1:16	64	15/3/18 2:21	55	16/3/18 3:26	61	17/3/18 4:31	62	18/3/18 5:36	54	19/3/18 6:41	65
14/3/18 1:21	65	15/3/18 2:26	51	16/3/18 3:31	52	17/3/18 4:36	62	18/3/18 5:41	56	19/3/18 6:46	66
14/3/18 1:26	65	15/3/18 2:31	53	16/3/18 3:36	52	17/3/18 4:41	62	18/3/18 5:46	59	19/3/18 6:51	66
14/3/18 1:31	64	15/3/18 2:36	50	16/3/18 3:41	61	17/3/18 4:46	61	18/3/18 5:51	57	19/3/18 6:56	66
14/3/18 1:36	64	15/3/18 2:41	46	16/3/18 3:46	60	17/3/18 4:51	56	18/3/18 5:56	55	19/3/18 23:01	64
14/3/18 1:41	64	15/3/18 2:46	62	16/3/18 3:51	61	17/3/18 4:56	52	18/3/18 6:01	58	19/3/18 23:06	64
14/3/18 1:46	64	15/3/18 2:51	56	16/3/18 3:56	61	17/3/18 5:01	57	18/3/18 6:06	60	19/3/18 23:11	63
14/3/18 1:51	64	15/3/18 2:56	51	16/3/18 4:01	61	17/3/18 5:06	50	18/3/18 6:11	60	19/3/18 23:16	63
14/3/18 1:56	63	15/3/18 3:01	61	16/3/18 4:06	44	17/3/18 5:11	51	18/3/18 6:16	60	19/3/18 23:21	64
14/3/18 2:01	65	15/3/18 3:06	62	16/3/18 4:11	60	17/3/18 5:16	46	18/3/18 6:21	64	19/3/18 23:26	63
14/3/18 2:06	63	15/3/18 3:11	62	16/3/18 4:16	62	17/3/18 5:21	50	18/3/18 6:26	63	19/3/18 23:31	62
14/3/18 2:11	63	15/3/18 3:16	61	16/3/18 4:21	62	17/3/18 5:26	54	18/3/18 6:31	62	19/3/18 23:36	62
14/3/18 2:16	63	15/3/18 3:21	52	16/3/18 4:26	61	17/3/18 5:31	51	18/3/18 6:36	63	19/3/18 23:41	63
14/3/18 2:21	63	15/3/18 3:26	62	16/3/18 4:31	60	17/3/18 5:36	55	18/3/18 6:41	63	19/3/18 23:46	62
14/3/18 2:26	63	15/3/18 3:31	61	16/3/18 4:36	53	17/3/18 5:41	57	18/3/18 6:46	64	19/3/18 23:51	62
14/3/18 2:31	62	15/3/18 3:36	61	16/3/18 4:41	60	17/3/18 5:46	59	18/3/18 6:51	63	19/3/18 23:56	62
14/3/18 2:36	63	15/3/18 3:41	47	16/3/18 4:46	61	17/3/18 5:51	65	18/3/18 6:56	64	20/3/18 0:01	62
14/3/18 2:41	63	15/3/18 3:46	61	16/3/18 4:51	61	17/3/18 5:56	54	18/3/18 23:01	63	20/3/18 0:06	62
14/3/18 2:46	62	15/3/18 3:51	60	16/3/18 4:56	61	17/3/18 6:01	59	18/3/18 23:06	65	20/3/18 0:11	62
14/3/18 2:51	62	15/3/18 3:56	62	16/3/18 5:01	61	17/3/18 6:06	59	18/3/18 23:11	64	20/3/18 0:16	62
14/3/18 2:56	63	15/3/18 4:01	61	16/3/18 5:06	62	17/3/18 6:11	60	18/3/18 23:16	63	20/3/18 0:21	62
14/3/18 3:01	62	15/3/18 4:06	61	16/3/18 5:11	62	17/3/18 6:16	59	18/3/18 23:21	63	20/3/18 0:26	61
14/3/18 3:06	63	15/3/18 4:11	61	16/3/18 5:16	62	17/3/18 6:21	61	18/3/18 23:26	61	20/3/18 0:31	60
14/3/18 3:11	62	15/3/18 4:16	61	16/3/18 5:21	56	17/3/18 6:26	62	18/3/18 23:31	61	20/3/18 0:36	60
14/3/18 3:16	62	15/3/18 4:21	61	16/3/18 5:26	53	17/3/18 6:31	63	18/3/18 23:36	65	20/3/18 0:41	61
14/3/18 3:21	63	15/3/18 4:26	61	16/3/18 5:31	55	17/3/18 6:36	63	18/3/18 23:41	62	20/3/18 0:46	61
14/3/18 3:26	63	15/3/18 4:31	61	16/3/18 5:36	54	17/3/18 6:41	65	18/3/18 23:46	62	20/3/18 0:51	61
14/3/18 3:31	62	15/3/18 4:36	62	16/3/18 5:41	55	17/3/18 6:46	64	18/3/18 23:51	60	20/3/18 0:56	62
14/3/18 3:36	62	15/3/18 4:41	62	16/3/18 5:46	57	17/3/18 6:51	64	18/3/18 23:56	61	20/3/18 1:01	57
14/3/18 3:41	62	15/3/18 4:46	61	16/3/18 5:51	58	17/3/18 6:56	65	19/3/18 0:01	61	20/3/18 1:06	59
14/3/18 3:46	62	15/3/18 4:51	62	16/3/18 5:56	59	17/3/18 23:01	64	19/3/18 0:06	63	20/3/18 1:11	58
14/3/18 3:51	62	15/3/18 4:56	62	16/3/18 6:01	58	17/3/18 23:06	66	19/3/18 0:11	59	20/3/18 1:16	60
14/3/18 3:56	62	15/3/18 5:01	53	16/3/18 6:06	61	17/3/18 23:11	64	19/3/18 0:16	58	20/3/18 1:21	55
14/3/18 4:01	62	15/3/18 5:06	49	16/3/18 6:11	59	17/3/18 23:16	65	19/3/18 0:21	61	20/3/18 1:26	58
14/3/18 4:06	62	15/3/18 5:11	62	16/3/18 6:16	63	17/3/18 23:21	64	19/3/18 0:26	60	20/3/18 1:31	57
14/3/18 4:11	62	15/3/18 5:16	50	16/3/18 6:21	64	17/3/18 23:26	63	19/3/18 0:31	59	20/3/18 1:36	48
14/3/18 4:16	62	15/3/18 5:21	62	16/3/18 6:26	64	17/3/18 23:31	63	19/3/18 0:36	58	20/3/18 1:41	55
14/3/18 4:21	62	15/3/18 5:26	55	16/3/18 6:31	65	17/3/18 23:36	65	19/3/18 0:41	55	20/3/18 1:46	50
14/3/18 4:26	62	15/3/18 5:31	55	16/3/18 6:36	65	17/3/18 23:41	64	19/3/18 0:46	46	20/3/18 1:51	43
14/3/18 4:31	63	15/3/18 5:36	53	16/3/18 6:41	66	17/3/18 23:46	63	19/3/18 0:51	57	20/3/18 1:56	46
14/3/18 4:36	61	15/3/18 5:41	58	16/3/18 6:46	67	17/3/18 23:51	62	19/3/18 0:56	55	20/3/18 2:01	45
14/3/18 4:41	61	15/3/18 5:46	60	16/3/18 6:51	66	17/3/18 23:56	62	19/3/18 1:01	46	20/3/18 2:06	54
14/3/18 4:46	62	15/3/18 5:51	57	16/3/18 6:56	66	18/3/18 0:01	63	19/3/18 1:06	58	20/3/18 2:11	62
14/3/18 4:51	63	15/3/18 5:56	59	16/3/18 23:01	65	18/3/18 0:06	64	19/3/18 1:11	59	20/3/18 2:16	61
14/3/18 4:56	62	15/3/18 6:01	61	16/3/18 23:06	65	18/3/18 0:11	64	19/3/18 1:16	62	20/3/18 2:21	62
14/3/18 5:01											

Real-time Noise Data	RTN1 (Food and Environmental Hygiene Department Depot)										
20/3/18 4:41	61	21/3/18 5:46	54	22/3/18 6:51	68	23/3/18 23:56	64	25/3/18 1:01	59	26/3/18 2:06	61
20/3/18 4:46	50	21/3/18 5:51	58	22/3/18 6:56	68	24/3/18 0:01	64	25/3/18 1:06	60	26/3/18 2:11	61
20/3/18 4:51	46	21/3/18 5:56	61	22/3/18 23:01	64	24/3/18 0:06	64	25/3/18 1:11	60	26/3/18 2:16	61
20/3/18 4:56	53	21/3/18 6:01	61	22/3/18 23:06	64	24/3/18 0:11	64	25/3/18 1:16	60	26/3/18 2:21	61
20/3/18 5:01	53	21/3/18 6:06	62	22/3/18 23:11	65	24/3/18 0:16	64	25/3/18 1:21	60	26/3/18 2:26	61
20/3/18 5:06	61	21/3/18 6:11	62	22/3/18 23:16	65	24/3/18 0:21	63	25/3/18 1:26	60	26/3/18 2:31	60
20/3/18 5:11	62	21/3/18 6:16	62	22/3/18 23:21	64	24/3/18 0:26	63	25/3/18 1:31	59	26/3/18 2:36	60
20/3/18 5:16	62	21/3/18 6:21	64	22/3/18 23:26	65	24/3/18 0:31	63	25/3/18 1:36	59	26/3/18 2:41	60
20/3/18 5:21	65	21/3/18 6:26	65	22/3/18 23:31	65	24/3/18 0:36	63	25/3/18 1:41	58	26/3/18 2:46	61
20/3/18 5:26	58	21/3/18 6:31	65	22/3/18 23:36	64	24/3/18 0:41	62	25/3/18 1:46	56	26/3/18 2:51	60
20/3/18 5:31	55	21/3/18 6:36	66	22/3/18 23:41	64	24/3/18 0:46	63	25/3/18 1:51	56	26/3/18 2:56	61
20/3/18 5:36	58	21/3/18 6:41	66	22/3/18 23:46	65	24/3/18 0:51	63	25/3/18 1:56	57	26/3/18 3:01	60
20/3/18 5:41	60	21/3/18 6:46	67	22/3/18 23:51	63	24/3/18 0:56	62	25/3/18 2:01	58	26/3/18 3:06	61
20/3/18 5:46	60	21/3/18 6:51	67	22/3/18 23:56	63	24/3/18 1:01	63	25/3/18 2:06	61	26/3/18 3:11	60
20/3/18 5:51	59	21/3/18 6:56	66	23/3/18 0:01	63	24/3/18 1:06	61	25/3/18 2:11	57	26/3/18 3:16	60
20/3/18 5:56	61	21/3/18 23:01	67	23/3/18 0:06	63	24/3/18 1:11	62	25/3/18 2:16	57	26/3/18 3:21	60
20/3/18 6:01	61	21/3/18 23:06	67	23/3/18 0:11	64	24/3/18 1:16	62	25/3/18 2:21	60	26/3/18 3:26	60
20/3/18 6:06	62	21/3/18 23:11	67	23/3/18 0:16	62	24/3/18 1:21	62	25/3/18 2:26	58	26/3/18 3:31	60
20/3/18 6:11	63	21/3/18 23:16	66	23/3/18 0:21	62	24/3/18 1:26	60	25/3/18 2:31	60	26/3/18 3:36	60
20/3/18 6:16	64	21/3/18 23:21	67	23/3/18 0:26	62	24/3/18 1:31	60	25/3/18 2:36	57	26/3/18 3:41	61
20/3/18 6:21	64	21/3/18 23:26	66	23/3/18 0:31	62	24/3/18 1:36	62	25/3/18 2:41	56	26/3/18 3:46	60
20/3/18 6:26	65	21/3/18 23:31	66	23/3/18 0:36	63	24/3/18 1:41	62	25/3/18 2:46	57	26/3/18 3:51	61
20/3/18 6:31	66	21/3/18 23:36	66	23/3/18 0:41	60	24/3/18 1:46	62	25/3/18 2:51	55	26/3/18 3:56	61
20/3/18 6:36	65	21/3/18 23:41	66	23/3/18 0:46	61	24/3/18 1:51	63	25/3/18 2:56	56	26/3/18 4:01	59
20/3/18 6:41	66	21/3/18 23:46	66	23/3/18 0:51	60	24/3/18 1:56	60	25/3/18 3:01	57	26/3/18 4:06	60
20/3/18 6:46	67	21/3/18 23:51	69	23/3/18 0:56	61	24/3/18 2:01	60	25/3/18 3:06	63	26/3/18 4:11	60
20/3/18 6:51	67	21/3/18 23:56	66	23/3/18 1:01	62	24/3/18 2:06	60	25/3/18 3:11	54	26/3/18 4:16	58
20/3/18 6:56	66	22/3/18 0:01	66	23/3/18 1:06	61	24/3/18 2:11	56	25/3/18 3:16	56	26/3/18 4:21	60
20/3/18 23:01	64	22/3/18 0:06	66	23/3/18 1:11	58	24/3/18 2:16	60	25/3/18 3:21	62	26/3/18 4:26	61
20/3/18 23:06	65	22/3/18 0:11	65	23/3/18 1:16	59	24/3/18 2:21	57	25/3/18 3:26	56	26/3/18 4:31	60
20/3/18 23:11	64	22/3/18 0:16	66	23/3/18 1:21	60	24/3/18 2:26	60	25/3/18 3:31	59	26/3/18 4:36	60
20/3/18 23:16	64	22/3/18 0:21	66	23/3/18 1:26	60	24/3/18 2:31	58	25/3/18 3:36	53	26/3/18 4:41	62
20/3/18 23:21	64	22/3/18 0:26	66	23/3/18 1:31	57	24/3/18 2:36	59	25/3/18 3:41	50	26/3/18 4:46	61
20/3/18 23:26	64	22/3/18 0:31	65	23/3/18 1:36	58	24/3/18 2:41	59	25/3/18 3:46	62	26/3/18 4:51	61
20/3/18 23:31	64	22/3/18 0:36	64	23/3/18 1:41	59	24/3/18 2:46	56	25/3/18 3:51	62	26/3/18 4:56	60
20/3/18 23:36	64	22/3/18 0:41	65	23/3/18 1:46	56	24/3/18 2:51	60	25/3/18 3:56	62	26/3/18 5:01	61
20/3/18 23:41	64	22/3/18 0:46	65	23/3/18 1:51	58	24/3/18 2:56	59	25/3/18 4:01	61	26/3/18 5:06	62
20/3/18 23:46	64	22/3/18 0:51	64	23/3/18 1:56	52	24/3/18 3:01	58	25/3/18 4:06	62	26/3/18 5:11	62
20/3/18 23:51	64	22/3/18 0:56	65	23/3/18 2:01	55	24/3/18 3:06	57	25/3/18 4:11	61	26/3/18 5:16	61
20/3/18 23:56	62	22/3/18 1:01	65	23/3/18 2:06	57	24/3/18 3:11	60	25/3/18 4:16	45	26/3/18 5:21	61
21/3/18 0:01	64	22/3/18 1:06	65	23/3/18 2:11	53	24/3/18 3:16	60	25/3/18 4:21	61	26/3/18 5:26	62
21/3/18 0:06	63	22/3/18 1:11	64	23/3/18 2:16	49	24/3/18 3:21	56	25/3/18 4:26	62	26/3/18 5:31	62
21/3/18 0:11	63	22/3/18 1:16	64	23/3/18 2:21	55	24/3/18 3:26	58	25/3/18 4:31	51	26/3/18 5:36	49
21/3/18 0:16	63	22/3/18 1:21	65	23/3/18 2:26	61	24/3/18 3:31	58	25/3/18 4:36	53	26/3/18 5:41	58
21/3/18 0:21	61	22/3/18 1:26	64	23/3/18 2:31	48	24/3/18 3:36	56	25/3/18 4:41	62	26/3/18 5:46	53
21/3/18 0:26	62	22/3/18 1:31	65	23/3/18 2:36	50	24/3/18 3:41	58	25/3/18 4:46	56	26/3/18 5:51	59
21/3/18 0:31	63	22/3/18 1:36	65	23/3/18 2:41	51	24/3/18 3:46	52	25/3/18 4:51	61	26/3/18 5:56	58
21/3/18 0:36	63	22/3/18 1:41	64	23/3/18 2:46	62	24/3/18 3:51	54	25/3/18 4:56	61	26/3/18 6:01	58
21/3/18 0:41	59	22/3/18 1:46	64	23/3/18 2:51	62	24/3/18 3:56	52	25/3/18 5:01	62	26/3/18 6:06	60
21/3/18 0:46	60	22/3/18 1:51	64	23/3/18 2:56	61	24/3/18 4:01	62	25/3/18 5:06	49	26/3/18 6:11	60
21/3/18 0:51	60	22/3/18 1:56	63	23/3/18 3:01	53	24/3/18 4:06	52	25/3/18 5:11	53	26/3/18 6:16	63
21/3/18 0:56	60	22/3/18 2:01	64	23/3/18 3:06	58	24/3/18 4:11	62	25/3/18 5:16	50	26/3/18 6:21	65
21/3/18 1:01	61	22/3/18 2:06	64	23/3/18 3:11	61	24/3/18 4:16	45	25/3/18 5:21	61	26/3/18 6:26	64
21/3/18 1:06	59	22/3/18 2:11	64	23/3/18 3:16	61	24/3/18 4:21	53	25/3/18 5:26	53	26/3/18 6:31	64
21/3/18 1:11	60	22/3/18 2:16	63	23/3/18 3:21	61	24/3/18 4:26	54	25/3/18 5:31	60	26/3/18 6:36	65
21/3/18 1:16	60	22/3/18 2:21	63	23/3/18 3:26	61	24/3/18 4:31	62	25/3/18 5:36	55	26/3/18 6:41	66
21/3/18 1:21	59	22/3/18 2:26	64	23/3/18 3:31	48	24/3/18 4:36	55	25/3/18 5:41	57	26/3/18 6:46	66
21/3/18 1:26	59	22/3/18 2:31	64	23/3/18 3:36	61	24/3/18 4:41	62	25/3/18 5:46	53	26/3/18 6:51	67
21/3/18 1:31	55	22/3/18 2:36	62	23/3/18 3:41	61	24/3/18 4:46	62	25/3/18 5:51	57	26/3/18 6:56	67
21/3/18 1:36	53	22/3/18 2:41	63	23/3/18 3:46	62	24/3/18 4:51	61	25/3/18 5:56	56	26/3/18 23:01	65
21/3/18 1:41	57	22/3/18 2:46	63	23/3/18 3:51	61	24/3/18 4:56	50	25/3/18 6:01	55	26/3/18 23:06	65
21/3/18 1:46	58	22/3/18 2:51	63	23/3/18 3:56	62	24/3/18 5:01	53	25/3/18 6:06	60	26/3/18 23:11	64
21/3/18 1:51	54	22/3/18 2:56	63	23/3/18 4:01	61	24/3/18 5:06	56	25/3/18 6:11	64	26/3/18 23:16	65
21/3/18 1:56	48	22/3/18 3:01	62	23/3/18 4:06	61	24/3/18 5:11	45	25/3/18 6:16	61	26/3/18 23:21	65
21/3/18 2:01	53	22/3/18 3:06	63	23/3/18 4:11	61	24/3/18 5:16	62	25/3/18 6:21	62	26/3/18 23:26	64
21/3/18 2:06	54	22/3/18 3:11	63	23/3/18 4:16	60	24/3/18 5:21	58	25/3/18 6:26	62	26/3/18 23:31	63
21/3/18 2:11	56	22/3/18 3:16	64	23/3/18 4:21	61	24/3/18 5:26	59	25/3/18 6:31	62	26/3/18 23:36	65
21/3/18 2:16	55	22/3/18 3:21	63	23/3/18 4:26	61	24/3/18 5:31	52	25/3/18 6:36	64	26/3/18 23:41	63
21/3/18 2:21	55	22/3/18 3:26	62	23/3/18 4:31	61	24/3/18 5:36	57	25/3/18 6:41	63	26/3/18 23:46	63
21/3/18 2:26	58	22/3/18 3:31	63	23/3/18 4:36	61	24/3/18 5:41	57	25/3/18 6:46	63	26/3/18 23:51	63
21/3/18 2:31	62	22/3/18 3:36	62	23/3/18 4:41	61	24/3/18 5:46	56	25/3/18 6:51	62	26/3/18 23:56	64
21/3/18 2:36	52	22/3/18 3:41	63	23/3/18 4:46	60	24/3/18 5:51	59	25/3/18 6:56	63		
21/3/18 2:41	62	22/3/18 3:46	62	23/3/18 4:51	62	24/3/18 5:56	61	25/3/18 23:01	64		
21/3/18 2:46	61	22/3/18 3:51	63	23/3/18 4:56	61	24/3/18 6:01	57	25/3/18 23:06	63		
21/3/18 2:51	62	22/3/18 3:56	62	23/3/18 5:01	61	24/3/18 6:06	63	25/3/18 23:11	63		
21/3/18 2:56	46	22/3/18 4:01	62	23/3/18 5:06	61	24/3/18 6:11	59	25/3/18 23:16	62		
21/3/18 3:01	61	22/3/18 4:06	62	23/3/18 5:11	58	24/3/18 6:16	62	25/3/18 23:21	63		
21/3/18 3:06	52	22/3/18 4:11	61	23/3/18 5:16	54	24/3/18 6:21	62	25/3/18 23:26	63		
21/3/18 3:11	61	22/3/18 4:16	62	23/3/18 5:21	61	24/3/18 6:26	63	25/3/18 23:31	62		
21/3/18 3:16	62	22/3/18 4:21	63	23/3/18 5:26	48	24/3/18 6:31	64	25/3/18 23:36	62		
21/3/18 3:21	57	22/3/18 4:26	62	23/3/18 5:31	55	24/3/18 6:36	65	25/3/18 23:41	62		
21/3/18 3:26	62	22/3/18 4:31	62	23/3/18 5:36	51	24/3/18 6:41	64	25/3/18 23:46	62		
21/3/18 3:31	61	22/3/18 4:36	62	23/3/18 5:41	59	24/3/18 6:46	65	25/3/18 23:51	62		
21/3/18 3:36	61	22/3/18 4:41	63	23/3/18 5:46							

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)									
Normal Day 07:00-19:00											
27/2/18 7:01	60	3/3/18 12:31	63	9/3/18 7:01	60	14/3/18 13:31	67	20/3/18 8:01	66	24/3/18 14:31	78
27/2/18 7:31	62	3/3/18 13:01	66	9/3/18 7:31	61	14/3/18 14:01	63	20/3/18 8:31	67	24/3/18 15:01	74
27/2/18 8:01	65	3/3/18 13:31	64	9/3/18 8:01	63	14/3/18 14:31	62	20/3/18 9:01	57	24/3/18 15:31	71
27/2/18 8:31	67	3/3/18 14:01	62	9/3/18 8:31	66	14/3/18 15:01	63	20/3/18 9:31	64	24/3/18 16:01	71
27/2/18 9:01	67	3/3/18 14:31	59	9/3/18 9:01	59	14/3/18 15:31	55	20/3/18 10:01	67	24/3/18 16:31	70
27/2/18 9:31	61	3/3/18 15:01	66	9/3/18 9:31	64	14/3/18 16:01	60	20/3/18 10:31	62	24/3/18 17:01	56
27/2/18 10:01	61	3/3/18 15:31	66	9/3/18 10:01	62	14/3/18 16:31	53	20/3/18 11:01	65	24/3/18 17:31	63
27/2/18 10:31	67	3/3/18 16:01	67	9/3/18 10:31	63	14/3/18 17:01	66	20/3/18 11:31	67	24/3/18 18:01	64
27/2/18 11:01	67	3/3/18 16:31	65	9/3/18 11:01	67	14/3/18 17:31	65	20/3/18 12:01	61	24/3/18 18:31	65
27/2/18 11:31	65	3/3/18 17:01	64	9/3/18 11:31	57	14/3/18 18:01	64	20/3/18 12:31	59	26/3/18 7:01	63
27/2/18 12:01	62	3/3/18 17:31	62	9/3/18 12:01	63	14/3/18 18:31	65	20/3/18 13:01	67	26/3/18 7:31	64
27/2/18 12:31	62	3/3/18 18:01	63	9/3/18 12:31	63	15/3/18 7:01	62	20/3/18 13:31	58	26/3/18 8:01	65
27/2/18 13:01	62	5/3/18 7:01	60	9/3/18 13:01	65	15/3/18 7:31	63	20/3/18 14:01	65	26/3/18 8:31	66
27/2/18 13:31	62	5/3/18 7:31	61	9/3/18 13:31	62	15/3/18 8:01	65	20/3/18 14:31	67	26/3/18 9:01	67
27/2/18 14:01	59	5/3/18 8:01	63	9/3/18 14:01	67	15/3/18 8:31	66	20/3/18 15:01	67	26/3/18 9:31	62
27/2/18 14:31	57	5/3/18 8:31	64	9/3/18 14:31	67	15/3/18 9:01	64	20/3/18 15:31	64	26/3/18 10:01	64
27/2/18 15:01	53	5/3/18 9:01	65	9/3/18 15:01	59	15/3/18 9:31	65	20/3/18 16:01	63	26/3/18 10:31	69
27/2/18 15:31	54	5/3/18 9:31	67	9/3/18 15:31	66	15/3/18 10:01	64	20/3/18 16:31	63	26/3/18 11:01	64
27/2/18 16:01	66	5/3/18 10:01	67	9/3/18 16:01	66	15/3/18 10:31	63	20/3/18 17:01	62	26/3/18 11:31	65
27/2/18 16:31	66	5/3/18 10:31	67	9/3/18 16:31	66	15/3/18 11:01	63	20/3/18 17:31	66	26/3/18 12:01	64
27/2/18 17:01	61	5/3/18 11:01	67	9/3/18 17:01	64	15/3/18 11:31	59	20/3/18 18:01	64	26/3/18 12:31	63
27/2/18 17:31	63	5/3/18 11:31	65	9/3/18 17:31	63	15/3/18 12:01	66	20/3/18 18:31	64	26/3/18 13:01	66
27/2/18 18:01	62	5/3/18 12:01	62	9/3/18 18:01	63	15/3/18 12:31	66	21/3/18 7:01	61	26/3/18 13:31	67
28/2/18 7:01	61	5/3/18 12:31	66	9/3/18 18:31	63	15/3/18 13:01	67	21/3/18 7:31	62	26/3/18 14:01	59
28/2/18 7:31	61	5/3/18 13:01	66	10/3/18 7:01	61	15/3/18 13:31	62	21/3/18 8:01	64	26/3/18 14:31	59
28/2/18 8:01	64	5/3/18 13:31	67	10/3/18 7:31	61	15/3/18 14:01	66	21/3/18 8:31	65	26/3/18 15:01	61
28/2/18 8:31	66	5/3/18 14:01	60	10/3/18 8:01	63	15/3/18 14:31	65	21/3/18 9:01	65	26/3/18 15:31	67
28/2/18 9:01	42	5/3/18 14:31	67	10/3/18 8:31	64	15/3/18 15:01	63	21/3/18 9:31	65	26/3/18 16:01	61
28/2/18 9:31	67	5/3/18 15:01	67	10/3/18 9:01	65	15/3/18 15:31	50	21/3/18 10:01	63	26/3/18 16:31	67
28/2/18 10:01	54	5/3/18 15:31	66	10/3/18 9:31	70	15/3/18 16:01	57	21/3/18 10:31	66	26/3/18 17:01	64
28/2/18 10:31	70	5/3/18 16:01	66	10/3/18 10:01	64	15/3/18 16:31	67	21/3/18 11:01	61	26/3/18 17:31	64
28/2/18 11:01	65	5/3/18 16:31	66	10/3/18 10:31	63	15/3/18 17:01	65	21/3/18 11:31	61	26/3/18 18:01	64
28/2/18 11:31	65	5/3/18 17:01	65	10/3/18 11:01	60	15/3/18 17:31	64	21/3/18 12:01	67	26/3/18 18:31	63
28/2/18 12:01	63	5/3/18 17:31	64	10/3/18 11:31	67	15/3/18 18:01	65	21/3/18 12:31	58		
28/2/18 12:31	66	5/3/18 18:01	63	10/3/18 12:01	65	15/3/18 18:31	64	21/3/18 13:01	64		
28/2/18 13:01	68	5/3/18 18:31	63	10/3/18 12:31	65	16/3/18 7:01	62	21/3/18 13:31	51		
28/2/18 13:31	65	5/3/18 18:01	63	10/3/18 13:01	66	16/3/18 7:31	63	21/3/18 14:01	47		
28/2/18 14:01	65	6/3/18 7:01	61	10/3/18 13:31	58	16/3/18 8:01	65	21/3/18 14:31	58		
28/2/18 14:31	66	6/3/18 7:31	62	10/3/18 14:01	66	16/3/18 8:31	67	21/3/18 15:01	67		
28/2/18 15:01	66	6/3/18 8:01	64	10/3/18 14:31	65	16/3/18 9:01	67	21/3/18 15:31	65		
28/2/18 15:31	57	6/3/18 8:31	65	10/3/18 15:01	66	16/3/18 9:31	59	21/3/18 16:01	67		
28/2/18 16:01	55	6/3/18 9:01	65	10/3/18 15:31	65	16/3/18 10:01	60	21/3/18 16:31	67		
28/2/18 16:31	66	6/3/18 9:31	66	10/3/18 16:01	65	16/3/18 10:31	62	21/3/18 17:01	67		
28/2/18 17:01	65	6/3/18 10:01	67	10/3/18 16:31	65	16/3/18 11:01	56	21/3/18 17:31	65		
28/2/18 17:31	64	6/3/18 10:31	59	10/3/18 17:01	64	16/3/18 11:31	66	21/3/18 18:01	64		
28/2/18 18:01	65	6/3/18 11:01	54	10/3/18 17:31	63	16/3/18 12:01	63	21/3/18 18:31	64		
28/2/18 18:31	63	6/3/18 11:31	66	10/3/18 18:01	63	16/3/18 12:31	63	22/3/18 7:01	61		
1/3/18 7:01	61	6/3/18 12:01	65	10/3/18 18:31	62	16/3/18 13:01	59	22/3/18 7:31	62		
1/3/18 7:31	62	6/3/18 12:31	65	12/3/18 7:01	61	16/3/18 13:31	66	22/3/18 8:01	64		
1/3/18 8:01	65	6/3/18 13:01	66	12/3/18 7:31	63	16/3/18 14:01	65	22/3/18 8:31	67		
1/3/18 8:31	66	6/3/18 13:31	66	12/3/18 8:01	64	16/3/18 14:31	67	22/3/18 9:01	54		
1/3/18 9:01	61	6/3/18 14:01	52	12/3/18 8:31	65	16/3/18 15:01	64	22/3/18 9:31	67		
1/3/18 9:31	62	6/3/18 14:31	67	12/3/18 9:01	65	16/3/18 15:31	67	22/3/18 10:01	56		
1/3/18 10:01	50	6/3/18 15:01	67	12/3/18 9:31	64	16/3/18 16:01	63	22/3/18 10:31	57		
1/3/18 10:31	57	6/3/18 15:31	66	12/3/18 10:01	67	16/3/18 16:31	68	22/3/18 11:01	78		
1/3/18 11:01	67	6/3/18 16:01	66	12/3/18 10:31	57	16/3/18 17:01	67	22/3/18 11:31	76		
1/3/18 11:31	64	6/3/18 16:31	65	12/3/18 11:01	67	16/3/18 17:31	64	22/3/18 12:01	78		
1/3/18 12:01	61	6/3/18 17:01	64	12/3/18 11:31	65	16/3/18 18:01	64	22/3/18 12:31	76		
1/3/18 12:31	62	6/3/18 17:31	63	12/3/18 12:01	63	16/3/18 18:31	65	22/3/18 13:01	77		
1/3/18 13:01	65	6/3/18 18:01	63	12/3/18 12:31	63	16/3/18 19:01	62	22/3/18 13:31	73		
1/3/18 13:31	65	6/3/18 18:31	62	12/3/18 13:01	67	16/3/18 19:31	64	22/3/18 14:01	71		
1/3/18 14:01	67	6/3/18 18:01	63	12/3/18 13:31	63	16/3/18 20:01	68	22/3/18 14:31	76		
1/3/18 14:31	66	6/3/18 19:01	55	12/3/18 14:01	67	16/3/18 20:31	67	22/3/18 15:01	77		
1/3/18 15:01	66	6/3/18 19:31	70	12/3/18 14:31	67	16/3/18 21:01	65	22/3/18 15:31	76		
1/3/18 15:31	65	6/3/18 20:01	67	12/3/18 15:01	67	16/3/18 21:31	68	22/3/18 16:01	73		
1/3/18 16:01	66	6/3/18 20:31	66	12/3/18 15:31	67	16/3/18 22:01	62	22/3/18 16:31	73		
1/3/18 16:31	65	6/3/18 21:01	51	12/3/18 16:01	66	16/3/18 22:31	63	22/3/18 17:01	78		
1/3/18 17:01	64	6/3/18 21:31	62	12/3/18 16:31	64	16/3/18 23:01	65	22/3/18 17:31	74		
1/3/18 17:31	63	6/3/18 22:01	63	12/3/18 17:01	64	16/3/18 23:31	62	22/3/18 18:01	65		
1/3/18 18:01	63	6/3/18 22:31	64	12/3/18 17:31	63	16/3/18 24:01	64	22/3/18 18:31	64		
1/3/18 18:31	63	6/3/18 23:01	60	12/3/18 18:01	64	16/3/18 24:31	65	22/3/18 19:01	61		
2/3/18 7:01	61	6/3/18 23:31	56	12/3/18 18:31	61	16/3/18 25:01	62	22/3/18 19:31	76		
2/3/18 7:31	61	6/3/18 24:01	61	12/3/18 19:01	65	16/3/18 25:31	65	22/3/18 20:01	76		
2/3/18 8:01	64	6/3/18 24:31	57	12/3/18 19:31	67	16/3/18 26:01	65	22/3/18 20:31	77		
2/3/18 8:31	65	6/3/18 25:01	68	12/3/18 20:01	65	16/3/18 26:31	66	22/3/18 21:01	76		
2/3/18 9:01	66	6/3/18 25:31	65	12/3/18 20:31	65	16/3/18 27:01	66	22/3/18 21:31	75		
2/3/18 9:31	58	6/3/18 26:01	66	12/3/18 21:01	59	16/3/18 27:31	66	22/3/18 22:01	75		
2/3/18 10:01	63	6/3/18 26:31	66	12/3/18 21:31	66	16/3/18 28:01	64	22/3/18 22:31	73		
2/3/18 10:31	50	6/3/18 27:01	65	12/3/18 22:01	66	16/3/18 28:31	65	22/3/18 23:01	74		
2/3/18 11:01	54	6/3/18 27:31	67	12/3/18 22:31	66	16/3/18 29:01	62	22/3/18 23:31	74		
2/3/18 11:31	65	6/3/18 28:01	63	12/3/18 23:01	65	16/3/18 29:31	65	22/3/18 24:01	65		
2/3/18 12:01	63	6/3/18 28:31	62	12/3/18 23:31	65	16/3/18 30:01	65	22/3/18 24:31	65		
2/3/18 12:31	63	6/3/18 29:01	64	12/3/18 24:01	61	16/3/18 30:31	62	22/3/18 25:01	65		
2/3/18 13:01	56	6/3/18 29:31	65	12/3/18 24:31	64	16/3/18 31:01	60	22/3/18 25:31	64		
2/3/18 13:31	71	6/3/18 30:01	65	12/3/18 25:01	49	16/3/18 31:31	65	22/3/18 26:01	65		
2/3/18 14:01	74	6/3/18 30:31	65	12/3/18 25:31	67	16/3/18 32:01	65	22/3/18 26:31	65		
2/3											

Real-time Noise Data	RTN2a (Hong Kong Electric Centre)										
28/2/18 20:56	61	2/3/18 22:01	60	4/3/18 11:06	61	4/3/18 20:11	61	6/3/18 21:16	59	8/3/18 22:21	60
28/2/18 21:01	59	2/3/18 22:06	60	4/3/18 11:11	61	4/3/18 20:16	60	6/3/18 21:21	59	8/3/18 22:26	54
28/2/18 21:06	61	2/3/18 22:11	59	4/3/18 11:16	61	4/3/18 20:21	60	6/3/18 21:26	61	8/3/18 22:31	61
28/2/18 21:11	60	2/3/18 22:16	59	4/3/18 11:21	61	4/3/18 20:26	62	6/3/18 21:31	59	8/3/18 22:36	61
28/2/18 21:16	61	2/3/18 22:21	61	4/3/18 11:26	51	4/3/18 20:31	36	6/3/18 21:36	61	8/3/18 22:41	59
28/2/18 21:21	60	2/3/18 22:26	51	4/3/18 11:31	54	4/3/18 20:36	61	6/3/18 21:41	60	8/3/18 22:46	59
28/2/18 21:26	61	2/3/18 22:31	61	4/3/18 11:36	61	4/3/18 20:41	61	6/3/18 21:46	61	8/3/18 22:51	62
28/2/18 21:31	61	2/3/18 22:36	59	4/3/18 11:41	62	4/3/18 20:46	60	6/3/18 21:51	60	8/3/18 22:56	59
28/2/18 21:36	59	2/3/18 22:41	59	4/3/18 11:46	61	4/3/18 20:51	61	6/3/18 21:56	60	9/3/18 19:01	57
28/2/18 21:41	61	2/3/18 22:46	59	4/3/18 11:51	62	4/3/18 20:56	59	6/3/18 22:01	59	9/3/18 19:06	61
28/2/18 21:46	62	2/3/18 22:51	59	4/3/18 11:56	62	4/3/18 21:01	60	6/3/18 22:06	60	9/3/18 19:11	61
28/2/18 21:51	60	2/3/18 22:56	59	4/3/18 12:01	57	4/3/18 21:06	61	6/3/18 22:11	59	9/3/18 19:16	60
28/2/18 21:56	61	3/3/18 19:01	61	4/3/18 12:06	61	4/3/18 21:11	59	6/3/18 22:16	61	9/3/18 19:21	60
28/2/18 22:01	62	3/3/18 19:06	59	4/3/18 12:11	43	4/3/18 21:16	60	6/3/18 22:21	59	9/3/18 19:26	62
28/2/18 22:06	60	3/3/18 19:11	59	4/3/18 12:16	60	4/3/18 21:21	60	6/3/18 22:26	60	9/3/18 19:31	61
28/2/18 22:11	62	3/3/18 19:16	62	4/3/18 12:21	61	4/3/18 21:26	59	6/3/18 22:31	61	9/3/18 19:36	56
28/2/18 22:16	61	3/3/18 19:21	62	4/3/18 12:26	54	4/3/18 21:31	59	6/3/18 22:36	61	9/3/18 19:41	61
28/2/18 22:21	62	3/3/18 19:26	61	4/3/18 12:31	57	4/3/18 21:36	60	6/3/18 22:41	61	9/3/18 19:46	61
28/2/18 22:26	61	3/3/18 19:31	61	4/3/18 12:36	60	4/3/18 21:41	61	6/3/18 22:46	59	9/3/18 19:51	48
28/2/18 22:31	62	3/3/18 19:36	61	4/3/18 12:41	62	4/3/18 21:46	59	6/3/18 22:51	59	9/3/18 19:56	61
28/2/18 22:36	61	3/3/18 19:41	54	4/3/18 12:46	61	4/3/18 21:51	59	6/3/18 22:56	61	9/3/18 20:01	61
28/2/18 22:41	61	3/3/18 19:46	61	4/3/18 12:51	61	4/3/18 21:56	60	7/3/18 19:01	57	9/3/18 20:06	63
28/2/18 22:46	52	3/3/18 19:51	61	4/3/18 12:56	61	4/3/18 22:01	61	7/3/18 19:06	61	9/3/18 20:11	60
28/2/18 22:51	60	3/3/18 19:56	57	4/3/18 13:01	62	4/3/18 22:06	60	7/3/18 19:11	61	9/3/18 20:16	54
28/2/18 22:56	60	3/3/18 20:01	61	4/3/18 13:06	53	4/3/18 22:11	59	7/3/18 19:16	56	9/3/18 20:21	53
1/3/18 19:01	61	3/3/18 20:06	53	4/3/18 13:11	56	4/3/18 22:16	60	7/3/18 19:21	60	9/3/18 20:26	60
1/3/18 19:06	57	3/3/18 20:11	61	4/3/18 13:16	61	4/3/18 22:21	60	7/3/18 19:26	60	9/3/18 20:31	51
1/3/18 19:11	48	3/3/18 20:16	62	4/3/18 13:21	56	4/3/18 22:26	59	7/3/18 19:31	60	9/3/18 20:36	62
1/3/18 19:16	61	3/3/18 20:21	62	4/3/18 13:26	62	4/3/18 22:31	61	7/3/18 19:36	61	9/3/18 20:41	61
1/3/18 19:21	61	3/3/18 20:26	61	4/3/18 13:31	62	4/3/18 22:36	60	7/3/18 19:41	60	9/3/18 20:46	61
1/3/18 19:26	60	3/3/18 20:31	60	4/3/18 13:36	61	4/3/18 22:41	61	7/3/18 19:46	62	9/3/18 20:51	60
1/3/18 19:31	51	3/3/18 20:36	60	4/3/18 13:41	61	4/3/18 22:46	60	7/3/18 19:51	61	9/3/18 20:56	60
1/3/18 19:36	60	3/3/18 20:41	61	4/3/18 13:46	61	4/3/18 22:51	59	7/3/18 19:56	60	9/3/18 21:01	60
1/3/18 19:41	60	3/3/18 20:46	61	4/3/18 13:51	61	4/3/18 22:56	58	7/3/18 20:01	62	9/3/18 21:06	61
1/3/18 19:46	60	3/3/18 20:51	60	4/3/18 13:56	61	5/3/18 19:01	55	7/3/18 20:06	61	9/3/18 21:11	61
1/3/18 19:51	61	3/3/18 20:56	61	4/3/18 14:01	61	5/3/18 19:06	53	7/3/18 20:11	61	9/3/18 21:16	59
1/3/18 19:56	56	3/3/18 21:01	61	4/3/18 14:06	61	5/3/18 19:11	61	7/3/18 20:16	62	9/3/18 21:21	57
1/3/18 20:01	60	3/3/18 21:06	60	4/3/18 14:11	56	5/3/18 19:16	56	7/3/18 20:21	60	9/3/18 21:26	60
1/3/18 20:06	60	3/3/18 21:11	60	4/3/18 14:16	61	5/3/18 19:21	53	7/3/18 20:26	62	9/3/18 21:31	60
1/3/18 20:11	54	3/3/18 21:16	62	4/3/18 14:21	62	5/3/18 19:26	52	7/3/18 20:31	60	9/3/18 21:36	61
1/3/18 20:16	61	3/3/18 21:21	59	4/3/18 14:26	62	5/3/18 19:31	61	7/3/18 20:36	54	9/3/18 21:41	59
1/3/18 20:21	61	3/3/18 21:26	60	4/3/18 14:31	62	5/3/18 19:36	62	7/3/18 20:41	60	9/3/18 21:46	59
1/3/18 20:26	60	3/3/18 21:31	59	4/3/18 14:36	62	5/3/18 19:41	61	7/3/18 20:46	61	9/3/18 21:51	59
1/3/18 20:31	52	3/3/18 21:36	60	4/3/18 14:41	62	5/3/18 19:46	62	7/3/18 20:51	54	9/3/18 21:56	59
1/3/18 20:36	61	3/3/18 21:41	61	4/3/18 14:46	61	5/3/18 19:51	62	7/3/18 20:56	60	9/3/18 22:01	59
1/3/18 20:41	51	3/3/18 21:46	60	4/3/18 14:51	62	5/3/18 19:56	61	7/3/18 21:01	60	9/3/18 22:06	61
1/3/18 20:46	60	3/3/18 21:51	60	4/3/18 14:56	62	5/3/18 20:01	43	7/3/18 21:06	60	9/3/18 22:11	62
1/3/18 20:51	61	3/3/18 21:56	60	4/3/18 15:01	61	5/3/18 20:06	60	7/3/18 21:11	60	9/3/18 22:16	53
1/3/18 20:56	60	3/3/18 22:01	60	4/3/18 15:06	61	5/3/18 20:11	60	7/3/18 21:16	60	9/3/18 22:21	60
1/3/18 21:01	59	3/3/18 22:06	60	4/3/18 15:11	61	5/3/18 20:16	48	7/3/18 21:21	59	9/3/18 22:26	59
1/3/18 21:06	60	3/3/18 22:11	59	4/3/18 15:16	56	5/3/18 20:21	62	7/3/18 21:26	60	9/3/18 22:31	59
1/3/18 21:11	59	3/3/18 22:16	59	4/3/18 15:21	62	5/3/18 20:26	61	7/3/18 21:31	60	9/3/18 22:36	61
1/3/18 21:16	61	3/3/18 22:21	61	4/3/18 15:26	61	5/3/18 20:31	62	7/3/18 21:36	59	9/3/18 22:41	59
1/3/18 21:21	47	3/3/18 22:26	59	4/3/18 15:31	42	5/3/18 20:36	53	7/3/18 21:41	60	9/3/18 22:46	62
1/3/18 21:26	61	3/3/18 22:31	60	4/3/18 15:36	52	5/3/18 20:41	61	7/3/18 21:46	59	9/3/18 22:51	60
1/3/18 21:31	59	3/3/18 22:36	60	4/3/18 15:41	58	5/3/18 20:46	61	7/3/18 21:51	55	9/3/18 22:56	59
1/3/18 21:36	60	3/3/18 22:41	60	4/3/18 15:46	51	5/3/18 20:51	61	7/3/18 21:56	52	10/3/18 19:01	61
1/3/18 21:41	48	3/3/18 22:46	60	4/3/18 15:51	62	5/3/18 20:56	61	7/3/18 22:01	61	10/3/18 19:06	61
1/3/18 21:46	60	3/3/18 22:51	61	4/3/18 15:56	61	5/3/18 21:01	61	7/3/18 22:06	61	10/3/18 19:11	61
1/3/18 21:51	61	3/3/18 22:56	59	4/3/18 16:01	62	5/3/18 21:06	60	7/3/18 22:11	60	10/3/18 19:16	59
1/3/18 21:56	60	4/3/18 7:01	59	4/3/18 16:06	61	5/3/18 21:11	60	7/3/18 22:16	60	10/3/18 19:21	59
1/3/18 22:01	59	4/3/18 7:06	60	4/3/18 16:11	54	5/3/18 21:16	61	7/3/18 22:21	43	10/3/18 19:26	61
1/3/18 22:06	60	4/3/18 7:11	59	4/3/18 16:16	61	5/3/18 21:21	60	7/3/18 22:26	61	10/3/18 19:31	62
1/3/18 22:11	60	4/3/18 7:16	61	4/3/18 16:21	49	5/3/18 21:26	61	7/3/18 22:31	59	10/3/18 19:36	61
1/3/18 22:16	60	4/3/18 7:21	59	4/3/18 16:26	61	5/3/18 21:31	61	7/3/18 22:36	61	10/3/18 19:41	61
1/3/18 22:21	61	4/3/18 7:26	59	4/3/18 16:31	60	5/3/18 21:36	60	7/3/18 22:41	59	10/3/18 19:46	60
1/3/18 22:26	60	4/3/18 7:31	60	4/3/18 16:36	61	5/3/18 21:41	61	7/3/18 22:46	59	10/3/18 19:51	44
1/3/18 22:31	60	4/3/18 7:36	60	4/3/18 16:41	62	5/3/18 21:46	60	7/3/18 22:51	59	10/3/18 19:56	61
1/3/18 22:36	62	4/3/18 7:41	60	4/3/18 16:46	62	5/3/18 21:51	60	7/3/18 22:56	62	10/3/18 20:01	59
1/3/18 22:41	62	4/3/18 7:46	60	4/3/18 16:51	62	5/3/18 21:56	60	8/3/18 19:01	62	10/3/18 20:06	60
1/3/18 22:46	60	4/3/18 7:51	60	4/3/18 16:56	47	5/3/18 22:01	60	8/3/18 19:06	54	10/3/18 20:11	60
1/3/18 22:51	59	4/3/18 7:56	61	4/3/18 17:01	58	5/3/18 22:06	60	8/3/18 19:11	61	10/3/18 20:16	62
1/3/18 22:56	61	4/3/18 8:01	60	4/3/18 17:06	49	5/3/18 22:11	60	8/3/18 19:16	60	10/3/18 20:21	60
2/3/18 19:01	62	4/3/18 8:06	61	4/3/18 17:11	52	5/3/18 22:16	61	8/3/18 19:21	61	10/3/18 20:26	60
2/3/18 19:06	61	4/3/18 8:11	60	4/3/18 17:16	61	5/3/18 22:21	62	8/3/18 19:26	58	10/3/18 20:31	62
2/3/18 19:11	61	4/3/18 8:16	61	4/3/18 17:21	60	5/3/18 22:26	56	8/3/18 19:31	60	10/3/18 20:36	60
2/3/18 19:16	60	4/3/18 8:21	62	4/3/18 17:26	60	5/3/18 22:31	60	8/3/18 19:36	61	10/3/18 20:41	59
2/3/18 19:21	61	4/3/18 8:26	58	4/3/18 17:31	60	5/3/18 22:36	61	8/3/18 19:41	60	10/3/18 20:46	61
2/3/18 19:26	61	4/3/18 8:31	60	4/3/18 17:36	61	5/3/18 22:41	60	8/3/18 19:46	60	10/3/18 20:51	61
2/3/18 19:31	60	4/3/18 8:36	57	4/3/18 17:41	61	5/3/18 22:46	60	8/3/18 19:51	62	10/3/18 20:56	60
2/3/18 19:36	60	4/3/18 8:41	61	4/3/18 17:46	61	5/3/18 22:51	60	8/3/18 19:56	60	10/3/18 21:01	55
2/3/18 19:41	51	4/3/18 8:46	62	4/3/18 17:51	61	5/3/18 22:56	59	8/3/18 20:01	60	10/3/18 21:06	60
2/3/18 19:46	55	4/3/18 8:51									

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)									
11/3/18 7:26	59	11/3/18 16:31	49	12/3/18 21:36	61	14/3/18 22:41	61	17/3/18 19:46	62	18/3/18 12:51	48
11/3/18 7:31	58	11/3/18 16:36	61	12/3/18 21:41	62	14/3/18 22:46	62	17/3/18 19:51	49	18/3/18 12:56	57
11/3/18 7:36	59	11/3/18 16:41	61	12/3/18 21:46	61	14/3/18 22:51	50	17/3/18 19:56	53	18/3/18 13:01	59
11/3/18 7:41	59	11/3/18 16:46	61	12/3/18 21:51	61	14/3/18 22:56	61	17/3/18 20:01	54	18/3/18 13:06	60
11/3/18 7:46	60	11/3/18 16:51	61	12/3/18 21:56	52	15/3/18 19:01	58	17/3/18 20:06	61	18/3/18 13:11	56
11/3/18 7:51	61	11/3/18 16:56	62	12/3/18 22:01	61	15/3/18 19:06	59	17/3/18 20:11	61	18/3/18 13:16	59
11/3/18 7:56	59	11/3/18 17:01	60	12/3/18 22:06	61	15/3/18 19:11	57	17/3/18 20:16	50	18/3/18 13:21	58
11/3/18 8:01	60	11/3/18 17:06	61	12/3/18 22:11	43	15/3/18 19:16	61	17/3/18 20:21	59	18/3/18 13:26	58
11/3/18 8:06	60	11/3/18 17:11	61	12/3/18 22:16	61	15/3/18 19:21	62	17/3/18 20:26	49	18/3/18 13:31	59
11/3/18 8:11	60	11/3/18 17:16	60	12/3/18 22:21	61	15/3/18 19:26	58	17/3/18 20:31	61	18/3/18 13:36	67
11/3/18 8:16	61	11/3/18 17:21	60	12/3/18 22:26	61	15/3/18 19:31	55	17/3/18 20:36	61	18/3/18 13:41	57
11/3/18 8:21	61	11/3/18 17:26	62	12/3/18 22:31	61	15/3/18 19:36	60	17/3/18 20:41	51	18/3/18 13:46	60
11/3/18 8:26	60	11/3/18 17:31	60	12/3/18 22:36	55	15/3/18 19:41	56	17/3/18 20:46	62	18/3/18 13:51	59
11/3/18 8:31	60	11/3/18 17:36	61	12/3/18 22:41	62	15/3/18 19:46	59	17/3/18 20:51	39	18/3/18 13:56	63
11/3/18 8:36	61	11/3/18 17:41	60	12/3/18 22:46	61	15/3/18 19:51	59	17/3/18 20:56	62	18/3/18 14:01	58
11/3/18 8:41	61	11/3/18 17:46	60	12/3/18 22:51	61	15/3/18 19:56	54	17/3/18 21:01	61	18/3/18 14:06	55
11/3/18 8:46	52	11/3/18 17:51	61	12/3/18 22:56	62	15/3/18 20:01	62	17/3/18 21:06	61	18/3/18 14:11	55
11/3/18 8:51	61	11/3/18 17:56	61	13/3/18 19:01	59	15/3/18 20:06	57	17/3/18 21:11	61	18/3/18 14:16	57
11/3/18 8:56	61	11/3/18 18:01	61	13/3/18 19:06	58	15/3/18 20:11	53	17/3/18 21:16	62	18/3/18 14:21	55
11/3/18 9:01	61	11/3/18 18:06	61	13/3/18 19:11	52	15/3/18 20:16	58	17/3/18 21:21	61	18/3/18 14:26	58
11/3/18 9:06	61	11/3/18 18:11	49	13/3/18 19:16	51	15/3/18 20:21	57	17/3/18 21:26	62	18/3/18 14:31	59
11/3/18 9:11	61	11/3/18 18:16	62	13/3/18 19:21	58	15/3/18 20:26	54	17/3/18 21:31	49	18/3/18 14:36	57
11/3/18 9:16	61	11/3/18 18:21	53	13/3/18 19:26	50	15/3/18 20:31	56	17/3/18 21:36	55	18/3/18 14:41	57
11/3/18 9:21	62	11/3/18 18:26	61	13/3/18 19:31	54	15/3/18 20:36	55	17/3/18 21:41	61	18/3/18 14:46	60
11/3/18 9:26	60	11/3/18 18:31	60	13/3/18 19:36	58	15/3/18 20:41	57	17/3/18 21:46	62	18/3/18 14:51	63
11/3/18 9:31	60	11/3/18 18:36	61	13/3/18 19:41	58	15/3/18 20:46	62	17/3/18 21:51	62	18/3/18 14:56	53
11/3/18 9:36	61	11/3/18 18:41	46	13/3/18 19:46	57	15/3/18 20:51	56	17/3/18 21:56	62	18/3/18 15:01	54
11/3/18 9:41	60	11/3/18 18:46	60	13/3/18 19:51	53	15/3/18 20:56	57	17/3/18 22:01	62	18/3/18 15:06	61
11/3/18 9:46	60	11/3/18 18:51	61	13/3/18 19:56	48	15/3/18 21:01	52	17/3/18 22:06	62	18/3/18 15:11	56
11/3/18 9:51	61	11/3/18 18:56	55	13/3/18 20:01	62	15/3/18 21:06	62	17/3/18 22:11	61	18/3/18 15:16	44
11/3/18 9:56	61	11/3/18 19:01	60	13/3/18 20:06	62	15/3/18 21:11	49	17/3/18 22:16	62	18/3/18 15:21	57
11/3/18 10:01	61	11/3/18 19:06	43	13/3/18 20:11	60	15/3/18 21:16	61	17/3/18 22:21	61	18/3/18 15:26	56
11/3/18 10:06	60	11/3/18 19:11	60	13/3/18 20:16	58	15/3/18 21:21	54	17/3/18 22:26	51	18/3/18 15:31	55
11/3/18 10:11	61	11/3/18 19:16	62	13/3/18 20:21	62	15/3/18 21:26	54	17/3/18 22:31	61	18/3/18 15:36	62
11/3/18 10:16	61	11/3/18 19:21	61	13/3/18 20:26	58	15/3/18 21:31	62	17/3/18 22:36	62	18/3/18 15:41	57
11/3/18 10:21	62	11/3/18 19:26	52	13/3/18 20:31	57	15/3/18 21:36	64	17/3/18 22:41	49	18/3/18 15:46	54
11/3/18 10:26	60	11/3/18 19:31	56	13/3/18 20:36	50	15/3/18 21:41	48	17/3/18 22:46	47	18/3/18 15:51	55
11/3/18 10:31	61	11/3/18 19:36	50	13/3/18 20:41	57	15/3/18 21:46	61	17/3/18 22:51	62	18/3/18 15:56	58
11/3/18 10:36	50	11/3/18 19:41	61	13/3/18 20:46	56	15/3/18 21:51	62	17/3/18 22:56	62	18/3/18 16:01	50
11/3/18 10:41	60	11/3/18 19:46	61	13/3/18 20:51	62	15/3/18 21:56	58	18/3/18 7:01	61	18/3/18 16:06	60
11/3/18 10:46	60	11/3/18 19:51	62	13/3/18 20:56	55	15/3/18 22:01	51	18/3/18 7:06	60	18/3/18 16:11	58
11/3/18 10:51	59	11/3/18 19:56	61	13/3/18 21:01	56	15/3/18 22:06	59	18/3/18 7:11	61	18/3/18 16:16	56
11/3/18 10:56	47	11/3/18 20:01	40	13/3/18 21:06	62	15/3/18 22:11	54	18/3/18 7:16	61	18/3/18 16:21	57
11/3/18 11:01	60	11/3/18 20:06	60	13/3/18 21:11	61	15/3/18 22:16	58	18/3/18 7:21	59	18/3/18 16:26	47
11/3/18 11:06	60	11/3/18 20:11	60	13/3/18 21:16	50	15/3/18 22:21	58	18/3/18 7:26	61	18/3/18 16:31	57
11/3/18 11:11	60	11/3/18 20:16	61	13/3/18 21:21	49	15/3/18 22:26	55	18/3/18 7:31	54	18/3/18 16:36	56
11/3/18 11:16	45	11/3/18 20:21	61	13/3/18 21:26	61	15/3/18 22:31	54	18/3/18 7:36	62	18/3/18 16:41	59
11/3/18 11:21	61	11/3/18 20:26	60	13/3/18 21:31	36	15/3/18 22:36	57	18/3/18 7:41	62	18/3/18 16:46	54
11/3/18 11:26	61	11/3/18 20:31	60	13/3/18 21:36	55	15/3/18 22:41	59	18/3/18 7:46	48	18/3/18 16:51	56
11/3/18 11:31	46	11/3/18 20:36	59	13/3/18 21:41	61	15/3/18 22:46	63	18/3/18 7:51	62	18/3/18 16:56	59
11/3/18 11:36	61	11/3/18 20:41	59	13/3/18 21:46	53	15/3/18 22:51	57	18/3/18 7:56	60	18/3/18 17:01	54
11/3/18 11:41	43	11/3/18 20:46	59	13/3/18 21:51	56	15/3/18 22:56	56	18/3/18 8:01	63	18/3/18 17:06	59
11/3/18 11:46	61	11/3/18 20:51	61	13/3/18 21:56	45	16/3/18 19:01	58	18/3/18 8:06	60	18/3/18 17:11	48
11/3/18 11:51	60	11/3/18 20:56	60	13/3/18 22:01	61	16/3/18 19:06	58	18/3/18 8:11	58	18/3/18 17:16	54
11/3/18 11:56	61	11/3/18 21:01	59	13/3/18 22:06	42	16/3/18 19:11	58	18/3/18 8:16	47	18/3/18 17:21	57
11/3/18 12:01	60	11/3/18 21:06	61	13/3/18 22:11	53	16/3/18 19:16	65	18/3/18 8:21	62	18/3/18 17:26	62
11/3/18 12:06	62	11/3/18 21:11	60	13/3/18 22:16	57	16/3/18 19:21	58	18/3/18 8:26	58	18/3/18 17:31	59
11/3/18 12:11	61	11/3/18 21:16	59	13/3/18 22:21	55	16/3/18 19:26	55	18/3/18 8:31	57	18/3/18 17:36	62
11/3/18 12:16	62	11/3/18 21:21	60	13/3/18 22:26	56	16/3/18 19:31	59	18/3/18 8:36	60	18/3/18 17:41	59
11/3/18 12:21	61	11/3/18 21:26	60	13/3/18 22:31	61	16/3/18 19:36	55	18/3/18 8:41	55	18/3/18 17:46	53
11/3/18 12:26	60	11/3/18 21:31	60	13/3/18 22:36	58	16/3/18 19:41	59	18/3/18 8:46	55	18/3/18 17:51	46
11/3/18 12:31	60	11/3/18 21:36	60	13/3/18 22:41	61	16/3/18 19:46	61	18/3/18 8:51	55	18/3/18 17:56	63
11/3/18 12:36	60	11/3/18 21:41	60	13/3/18 22:46	49	16/3/18 19:51	64	18/3/18 8:56	59	18/3/18 18:01	55
11/3/18 12:41	61	11/3/18 21:46	59	13/3/18 22:51	55	16/3/18 19:56	56	18/3/18 9:01	58	18/3/18 18:06	60
11/3/18 12:46	60	11/3/18 21:51	61	13/3/18 22:56	57	16/3/18 20:01	61	18/3/18 9:06	56	18/3/18 18:11	51
11/3/18 12:51	61	11/3/18 21:56	61	14/3/18 19:01	57	16/3/18 20:06	55	18/3/18 9:11	57	18/3/18 18:16	52
11/3/18 12:56	60	11/3/18 22:01	60	14/3/18 19:06	61	16/3/18 20:11	60	18/3/18 9:16	57	18/3/18 18:21	63
11/3/18 13:01	61	11/3/18 22:06	60	14/3/18 19:11	59	16/3/18 20:16	58	18/3/18 9:21	55	18/3/18 18:26	55
11/3/18 13:06	60	11/3/18 22:11	60	14/3/18 19:16	57	16/3/18 20:21	62	18/3/18 9:26	58	18/3/18 18:31	59
11/3/18 13:11	61	11/3/18 22:16	59	14/3/18 19:21	60	16/3/18 20:26	43	18/3/18 9:31	58	18/3/18 18:36	59
11/3/18 13:16	60	11/3/18 22:21	60	14/3/18 19:26	63	16/3/18 20:31	54	18/3/18 9:36	55	18/3/18 18:41	57
11/3/18 13:21	61	11/3/18 22:26	59	14/3/18 19:31	59	16/3/18 20:36	52	18/3/18 9:41	59	18/3/18 18:46	56
11/3/18 13:26	60	11/3/18 22:31	59	14/3/18 19:36	60	16/3/18 20:41	56	18/3/18 9:46	53	18/3/18 18:51	62
11/3/18 13:31	61	11/3/18 22:36	59	14/3/18 19:41	59	16/3/18 20:46	54	18/3/18 9:51	57	18/3/18 18:56	53
11/3/18 13:36	62	11/3/18 22:41	60	14/3/18 19:46	58	16/3/18 20:51	52	18/3/18 9:56	61	18/3/18 19:01	62
11/3/18 13:41	61	11/3/18 22:46	60	14/3/18 19:51	59	16/3/18 20:56	51	18/3/18 10:01	57	18/3/18 19:06	61
11/3/18 13:46	60	11/3/18 22:51	60	14/3/18 19:56	53	16/3/18 21:01	62	18/3/18 10:06	59	18/3/18 19:11	55
11/3/18 13:51	60	11/3/18 22:56	58	14/3/18 20:01	58	16/3/18 21:06	62	18/3/18 10:11	60	18/3/18 19:16	49
11/3/18 13:56	61	12/3/18 19:01	56	14/3/18 20:06	62	16/3/18 21:11	49	18/3/18 10:16	63	18/3/18 19:21	55
11/3/18 14:01	61	12/3/18 19:06	54	14/3/18 20:11	57	16/3/18 21:1					

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)									
18/3/18 21:56	62	21/3/18 19:01	57	23/3/18 20:06	56	25/3/18 9:11	58	25/3/18 18:16	55	27/2/18 0:06	57
18/3/18 22:01	59	21/3/18 19:06	63	23/3/18 20:11	58	25/3/18 9:16	55	25/3/18 18:21	61	27/2/18 0:11	57
18/3/18 22:06	54	21/3/18 19:11	56	23/3/18 20:16	58	25/3/18 9:21	52	25/3/18 18:26	59	27/2/18 0:16	46
18/3/18 22:11	61	21/3/18 19:16	57	23/3/18 20:21	54	25/3/18 9:26	59	25/3/18 18:31	50	27/2/18 0:21	58
18/3/18 22:16	50	21/3/18 19:21	57	23/3/18 20:26	56	25/3/18 9:31	55	25/3/18 18:36	60	27/2/18 0:26	58
18/3/18 22:21	61	21/3/18 19:26	58	23/3/18 20:31	60	25/3/18 9:36	52	25/3/18 18:41	62	27/2/18 0:31	57
18/3/18 22:26	61	21/3/18 19:31	55	23/3/18 20:36	59	25/3/18 9:41	56	25/3/18 18:46	52	27/2/18 0:36	47
18/3/18 22:31	61	21/3/18 19:36	55	23/3/18 20:41	53	25/3/18 9:46	52	25/3/18 18:51	60	27/2/18 0:41	48
18/3/18 22:36	47	21/3/18 19:41	57	23/3/18 20:46	57	25/3/18 9:51	56	25/3/18 18:56	57	27/2/18 0:46	58
18/3/18 22:41	61	21/3/18 19:46	59	23/3/18 20:51	55	25/3/18 9:56	57	25/3/18 19:01	60	27/2/18 0:51	57
18/3/18 22:46	61	21/3/18 19:51	52	23/3/18 20:56	51	25/3/18 10:01	62	25/3/18 19:06	59	27/2/18 0:56	57
18/3/18 22:51	56	21/3/18 19:56	54	23/3/18 21:01	39	25/3/18 10:06	64	25/3/18 19:11	51	27/2/18 1:01	57
18/3/18 22:56	54	21/3/18 20:01	55	23/3/18 21:06	61	25/3/18 10:11	56	25/3/18 19:16	54	27/2/18 1:06	57
19/3/18 19:01	57	21/3/18 20:06	51	23/3/18 21:11	49	25/3/18 10:16	59	25/3/18 19:21	53	27/2/18 1:11	57
19/3/18 19:06	59	21/3/18 20:11	55	23/3/18 21:16	54	25/3/18 10:21	53	25/3/18 19:26	56	27/2/18 1:16	57
19/3/18 19:11	45	21/3/18 20:16	51	23/3/18 21:21	51	25/3/18 10:26	55	25/3/18 19:31	53	27/2/18 1:21	57
19/3/18 19:16	48	21/3/18 20:21	55	23/3/18 21:26	46	25/3/18 10:31	56	25/3/18 19:36	55	27/2/18 1:26	58
19/3/18 19:21	55	21/3/18 20:26	57	23/3/18 21:31	61	25/3/18 10:36	60	25/3/18 19:41	57	27/2/18 1:31	56
19/3/18 19:26	55	21/3/18 20:31	55	23/3/18 21:36	61	25/3/18 10:41	56	25/3/18 19:46	55	27/2/18 1:36	57
19/3/18 19:31	45	21/3/18 20:36	61	23/3/18 21:41	56	25/3/18 10:46	55	25/3/18 19:51	58	27/2/18 1:41	57
19/3/18 19:36	55	21/3/18 20:41	62	23/3/18 21:46	51	25/3/18 10:51	57	25/3/18 19:56	61	27/2/18 1:46	56
19/3/18 19:41	67	21/3/18 20:46	62	23/3/18 21:51	49	25/3/18 10:56	52	25/3/18 20:01	59	27/2/18 1:51	56
19/3/18 19:46	59	21/3/18 20:51	62	23/3/18 21:56	58	25/3/18 11:01	55	25/3/18 20:06	59	27/2/18 1:56	57
19/3/18 19:51	62	21/3/18 20:56	61	23/3/18 22:01	53	25/3/18 11:06	55	25/3/18 20:11	61	27/2/18 2:01	56
19/3/18 19:56	53	21/3/18 21:01	61	23/3/18 22:06	55	25/3/18 11:11	46	25/3/18 20:16	67	27/2/18 2:06	57
19/3/18 20:01	54	21/3/18 21:06	61	23/3/18 22:11	55	25/3/18 11:16	57	25/3/18 20:21	62	27/2/18 2:11	56
19/3/18 20:06	62	21/3/18 21:11	61	23/3/18 22:16	57	25/3/18 11:21	56	25/3/18 20:26	53	27/2/18 2:16	57
19/3/18 20:11	49	21/3/18 21:16	61	23/3/18 22:21	56	25/3/18 11:26	64	25/3/18 20:31	46	27/2/18 2:21	57
19/3/18 20:16	57	21/3/18 21:21	53	23/3/18 22:26	56	25/3/18 11:31	58	25/3/18 20:36	58	27/2/18 2:26	56
19/3/18 20:21	55	21/3/18 21:26	62	23/3/18 22:31	62	25/3/18 11:36	58	25/3/18 20:41	54	27/2/18 2:31	56
19/3/18 20:26	52	21/3/18 21:31	61	23/3/18 22:36	53	25/3/18 11:41	52	25/3/18 20:46	61	27/2/18 2:36	56
19/3/18 20:31	53	21/3/18 21:36	44	23/3/18 22:41	46	25/3/18 11:46	46	25/3/18 20:51	59	27/2/18 2:41	56
19/3/18 20:36	61	21/3/18 21:41	61	23/3/18 22:46	62	25/3/18 11:51	54	25/3/18 20:56	62	27/2/18 2:46	56
19/3/18 20:41	61	21/3/18 21:46	61	23/3/18 22:51	47	25/3/18 11:56	62	25/3/18 21:01	62	27/2/18 2:51	56
19/3/18 20:46	61	21/3/18 21:51	50	23/3/18 22:56	44	25/3/18 12:01	51	25/3/18 21:06	62	27/2/18 2:56	56
19/3/18 20:51	57	21/3/18 21:56	61	24/3/18 19:01	59	25/3/18 12:06	56	25/3/18 21:11	46	27/2/18 3:01	55
19/3/18 20:56	51	21/3/18 22:01	62	24/3/18 19:06	57	25/3/18 12:11	58	25/3/18 21:16	46	27/2/18 3:06	56
19/3/18 21:01	62	21/3/18 22:06	61	24/3/18 19:11	46	25/3/18 12:16	47	25/3/18 21:21	59	27/2/18 3:11	55
19/3/18 21:06	61	21/3/18 22:11	61	24/3/18 19:16	54	25/3/18 12:21	56	25/3/18 21:26	62	27/2/18 3:16	55
19/3/18 21:11	62	21/3/18 22:16	61	24/3/18 19:21	56	25/3/18 12:26	62	25/3/18 21:31	51	27/2/18 3:21	56
19/3/18 21:16	61	21/3/18 22:21	62	24/3/18 19:26	62	25/3/18 12:31	60	25/3/18 21:36	54	27/2/18 3:26	56
19/3/18 21:21	62	21/3/18 22:26	61	24/3/18 19:31	57	25/3/18 12:36	56	25/3/18 21:41	61	27/2/18 3:31	56
19/3/18 21:26	62	21/3/18 22:31	42	24/3/18 19:36	43	25/3/18 12:41	59	25/3/18 21:46	61	27/2/18 3:36	57
19/3/18 21:31	62	21/3/18 22:36	61	24/3/18 19:41	61	25/3/18 12:46	59	25/3/18 21:51	55	27/2/18 3:41	56
19/3/18 21:36	44	21/3/18 22:41	61	24/3/18 19:46	57	25/3/18 12:51	62	25/3/18 21:56	61	27/2/18 3:46	56
19/3/18 21:41	61	21/3/18 22:46	57	24/3/18 19:51	59	25/3/18 12:56	53	25/3/18 22:01	62	27/2/18 3:51	57
19/3/18 21:46	61	21/3/18 22:51	62	24/3/18 19:56	54	25/3/18 13:01	50	25/3/18 22:06	53	27/2/18 3:56	55
19/3/18 21:51	61	21/3/18 22:56	57	24/3/18 20:01	43	25/3/18 13:06	58	25/3/18 22:11	61	27/2/18 4:01	55
19/3/18 21:56	61	22/3/18 19:01	59	24/3/18 20:06	46	25/3/18 13:11	51	25/3/18 22:16	46	27/2/18 4:06	57
19/3/18 22:01	61	22/3/18 19:06	59	24/3/18 20:11	61	25/3/18 13:16	55	25/3/18 22:21	62	27/2/18 4:11	56
19/3/18 22:06	61	22/3/18 19:11	59	24/3/18 20:16	59	25/3/18 13:21	60	25/3/18 22:26	55	27/2/18 4:16	62
19/3/18 22:11	61	22/3/18 19:16	56	24/3/18 20:21	59	25/3/18 13:26	59	25/3/18 22:31	61	27/2/18 4:21	55
19/3/18 22:16	61	22/3/18 19:21	58	24/3/18 20:26	36	25/3/18 13:31	60	25/3/18 22:36	61	27/2/18 4:26	57
19/3/18 22:21	61	22/3/18 19:26	56	24/3/18 20:31	56	25/3/18 13:36	56	25/3/18 22:41	61	27/2/18 4:31	56
19/3/18 22:26	61	22/3/18 19:31	58	24/3/18 20:36	61	25/3/18 13:41	58	25/3/18 22:46	42	27/2/18 4:36	55
19/3/18 22:31	61	22/3/18 19:36	57	24/3/18 20:41	62	25/3/18 13:46	58	25/3/18 22:51	48	27/2/18 4:41	56
19/3/18 22:36	61	22/3/18 19:41	58	24/3/18 20:46	52	25/3/18 13:51	60	25/3/18 22:56	61	27/2/18 4:46	56
19/3/18 22:41	61	22/3/18 19:46	60	24/3/18 20:51	61	25/3/18 13:56	57	26/3/18 19:01	57	27/2/18 4:51	56
19/3/18 22:46	61	22/3/18 19:51	55	24/3/18 20:56	62	25/3/18 14:01	56	26/3/18 19:06	57	27/2/18 4:56	56
19/3/18 22:51	61	22/3/18 19:56	54	24/3/18 21:01	61	25/3/18 14:06	55	26/3/18 19:11	51	27/2/18 5:01	57
19/3/18 22:56	61	22/3/18 20:01	59	24/3/18 21:06	61	25/3/18 14:11	62	26/3/18 19:16	53	27/2/18 5:06	56
20/3/18 19:01	59	22/3/18 20:06	63	24/3/18 21:11	62	25/3/18 14:16	52	26/3/18 19:21	55	27/2/18 5:11	56
20/3/18 19:06	59	22/3/18 20:11	61	24/3/18 21:16	62	25/3/18 14:21	60	26/3/18 19:26	52	27/2/18 5:16	56
20/3/18 19:11	59	22/3/18 20:16	56	24/3/18 21:21	61	25/3/18 14:26	58	26/3/18 19:31	50	27/2/18 5:21	56
20/3/18 19:16	54	22/3/18 20:21	49	24/3/18 21:26	48	25/3/18 14:31	56	26/3/18 19:36	62	27/2/18 5:26	56
20/3/18 19:21	51	22/3/18 20:26	56	24/3/18 21:31	42	25/3/18 14:36	53	26/3/18 19:41	58	27/2/18 5:31	56
20/3/18 19:26	62	22/3/18 20:31	62	24/3/18 21:36	62	25/3/18 14:41	44	26/3/18 19:46	57	27/2/18 5:36	56
20/3/18 19:31	62	22/3/18 20:36	59	24/3/18 21:41	49	25/3/18 14:46	56	26/3/18 19:51	61	27/2/18 5:41	56
20/3/18 19:36	59	22/3/18 20:41	57	24/3/18 21:46	61	25/3/18 14:51	62	26/3/18 19:56	60	27/2/18 5:46	56
20/3/18 19:41	54	22/3/18 20:46	46	24/3/18 21:51	62	25/3/18 14:56	55	26/3/18 20:01	56	27/2/18 5:51	56
20/3/18 19:46	54	22/3/18 20:51	53	24/3/18 21:56	62	25/3/18 15:01	57	26/3/18 20:06	54	27/2/18 5:56	56
20/3/18 19:51	57	22/3/18 20:56	61	24/3/18 22:01	61	25/3/18 15:06	57	26/3/18 20:11	48	27/2/18 6:01	56
20/3/18 19:56	65	22/3/18 21:01	48	24/3/18 22:06	61	25/3/18 15:11	58	26/3/18 20:16	53	27/2/18 6:06	57
20/3/18 20:01	53	22/3/18 21:06	62	24/3/18 22:11	62	25/3/18 15:16	55	26/3/18 20:21	60	27/2/18 6:11	56
20/3/18 20:06	54	22/3/18 21:11	54	24/3/18 22:16	62	25/3/18 15:21	57	26/3/18 20:26	55	27/2/18 6:16	57
20/3/18 20:11	56	22/3/18 21:16	50	24/3/18 22:21	61	25/3/18 15:26	46	26/3/18 20:31	57	27/2/18 6:21	57
20/3/18 20:16	59	22/3/18 21:21	61	24/3/18 22:26	62	25/3/18 15:31	57	26/3/18 20:36	58	27/2/18 6:26	57
20/3/18 20:21	62	22/3/18 21:26	56	24/3/18 22:31	62	25/3/18 15:36	51	26/3/18 20:41	62	27/2/18 6:31	57
20/3/18 20:26	53	22/3/18 21:31	53	24/3/18 22:36	61	25/3/18 15:41	58	26/3/18 20:46	51	27/2/18 6:36	58
20/3/18 20:31	39	22/3/18 21:36	62	24/3/18 22:41	61	25/3/18 15:46	52	26/3/18 2			

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)									
28/2/18 1:11	58	1/3/18 2:16	58	2/3/18 3:21	56	3/3/18 4:26	56	4/3/18 5:31	57	5/3/18 6:36	42
28/2/18 1:16	57	1/3/18 2:21	58	2/3/18 3:26	56	3/3/18 4:31	56	4/3/18 5:36	56	5/3/18 6:41	38
28/2/18 1:21	57	1/3/18 2:26	58	2/3/18 3:31	55	3/3/18 4:36	56	4/3/18 5:41	56	5/3/18 6:46	50
28/2/18 1:26	57	1/3/18 2:31	56	2/3/18 3:36	56	3/3/18 4:41	56	4/3/18 5:46	56	5/3/18 6:51	47
28/2/18 1:31	57	1/3/18 2:36	58	2/3/18 3:41	56	3/3/18 4:46	57	4/3/18 5:51	56	5/3/18 6:56	49
28/2/18 1:36	57	1/3/18 2:41	57	2/3/18 3:46	58	3/3/18 4:51	56	4/3/18 5:56	56	5/3/18 23:01	52
28/2/18 1:41	57	1/3/18 2:46	57	2/3/18 3:51	56	3/3/18 4:56	55	4/3/18 6:01	56	5/3/18 23:06	51
28/2/18 1:46	58	1/3/18 2:51	56	2/3/18 3:56	56	3/3/18 5:01	58	4/3/18 6:06	57	5/3/18 23:11	52
28/2/18 1:51	58	1/3/18 2:56	57	2/3/18 4:01	56	3/3/18 5:06	58	4/3/18 6:11	57	5/3/18 23:16	49
28/2/18 1:56	57	1/3/18 3:01	57	2/3/18 4:06	56	3/3/18 5:11	50	4/3/18 6:16	58	5/3/18 23:21	47
28/2/18 2:01	57	1/3/18 3:06	57	2/3/18 4:11	57	3/3/18 5:16	57	4/3/18 6:21	50	5/3/18 23:26	50
28/2/18 2:06	57	1/3/18 3:11	43	2/3/18 4:16	61	3/3/18 5:21	57	4/3/18 6:26	58	5/3/18 23:31	52
28/2/18 2:11	57	1/3/18 3:16	57	2/3/18 4:21	57	3/3/18 5:26	56	4/3/18 6:31	58	5/3/18 23:36	58
28/2/18 2:16	57	1/3/18 3:21	56	2/3/18 4:26	57	3/3/18 5:31	56	4/3/18 6:36	39	5/3/18 23:41	58
28/2/18 2:21	56	1/3/18 3:26	56	2/3/18 4:31	56	3/3/18 5:36	56	4/3/18 6:41	57	5/3/18 23:46	45
28/2/18 2:26	57	1/3/18 3:31	56	2/3/18 4:36	56	3/3/18 5:41	57	4/3/18 6:46	39	5/3/18 23:51	48
28/2/18 2:31	57	1/3/18 3:36	57	2/3/18 4:41	61	3/3/18 5:46	57	4/3/18 6:51	53	5/3/18 23:56	43
28/2/18 2:36	57	1/3/18 3:41	57	2/3/18 4:46	50	3/3/18 5:51	57	4/3/18 6:56	58	6/3/18 0:01	58
28/2/18 2:41	56	1/3/18 3:46	57	2/3/18 4:51	57	3/3/18 5:56	57	4/3/18 23:01	58	6/3/18 0:06	48
28/2/18 2:46	56	1/3/18 3:51	56	2/3/18 4:56	56	3/3/18 6:01	57	4/3/18 23:06	39	6/3/18 0:11	58
28/2/18 2:51	57	1/3/18 3:56	57	2/3/18 5:01	56	3/3/18 6:06	57	4/3/18 23:11	48	6/3/18 0:16	40
28/2/18 2:56	56	1/3/18 4:01	57	2/3/18 5:06	56	3/3/18 6:11	58	4/3/18 23:16	57	6/3/18 0:21	58
28/2/18 3:01	56	1/3/18 4:06	57	2/3/18 5:11	55	3/3/18 6:16	45	4/3/18 23:21	58	6/3/18 0:26	47
28/2/18 3:06	55	1/3/18 4:11	57	2/3/18 5:16	56	3/3/18 6:21	45	4/3/18 23:26	43	6/3/18 0:31	58
28/2/18 3:11	55	1/3/18 4:16	56	2/3/18 5:21	55	3/3/18 6:26	58	4/3/18 23:31	39	6/3/18 0:36	54
28/2/18 3:16	55	1/3/18 4:21	56	2/3/18 5:26	55	3/3/18 6:31	58	4/3/18 23:36	58	6/3/18 0:41	56
28/2/18 3:21	55	1/3/18 4:26	57	2/3/18 5:31	55	3/3/18 6:36	57	4/3/18 23:41	37	6/3/18 0:46	48
28/2/18 3:26	56	1/3/18 4:31	58	2/3/18 5:36	56	3/3/18 6:41	58	4/3/18 23:46	58	6/3/18 0:51	58
28/2/18 3:31	56	1/3/18 4:36	57	2/3/18 5:41	58	3/3/18 6:46	45	4/3/18 23:51	57	6/3/18 0:56	57
28/2/18 3:36	56	1/3/18 4:41	57	2/3/18 5:46	56	3/3/18 6:51	50	4/3/18 23:56	46	6/3/18 1:01	58
28/2/18 3:41	55	1/3/18 4:46	57	2/3/18 5:51	57	3/3/18 6:56	46	5/3/18 0:01	32	6/3/18 1:06	58
28/2/18 3:46	55	1/3/18 4:51	57	2/3/18 5:56	57	3/3/18 23:01	53	5/3/18 0:06	52	6/3/18 1:11	58
28/2/18 3:51	55	1/3/18 4:56	57	2/3/18 6:01	57	3/3/18 23:06	48	5/3/18 0:11	57	6/3/18 1:16	58
28/2/18 3:56	56	1/3/18 5:01	57	2/3/18 6:06	58	3/3/18 23:11	59	5/3/18 0:16	57	6/3/18 1:21	57
28/2/18 4:01	56	1/3/18 5:06	57	2/3/18 6:11	57	3/3/18 23:16	55	5/3/18 0:21	58	6/3/18 1:26	57
28/2/18 4:06	55	1/3/18 5:11	57	2/3/18 6:16	56	3/3/18 23:21	55	5/3/18 0:26	48	6/3/18 1:31	57
28/2/18 4:11	54	1/3/18 5:16	57	2/3/18 6:21	57	3/3/18 23:26	51	5/3/18 0:31	51	6/3/18 1:36	58
28/2/18 4:16	55	1/3/18 5:21	58	2/3/18 6:26	57	3/3/18 23:31	52	5/3/18 0:36	54	6/3/18 1:41	57
28/2/18 4:21	55	1/3/18 5:26	58	2/3/18 6:31	58	3/3/18 23:36	52	5/3/18 0:41	57	6/3/18 1:46	57
28/2/18 4:26	55	1/3/18 5:31	56	2/3/18 6:36	58	3/3/18 23:41	50	5/3/18 0:46	57	6/3/18 1:51	57
28/2/18 4:31	56	1/3/18 5:36	57	2/3/18 6:41	58	3/3/18 23:46	44	5/3/18 0:51	58	6/3/18 1:56	57
28/2/18 4:36	55	1/3/18 5:41	57	2/3/18 6:46	50	3/3/18 23:51	43	5/3/18 0:56	57	6/3/18 2:01	57
28/2/18 4:41	55	1/3/18 5:46	57	2/3/18 6:51	52	3/3/18 23:56	44	5/3/18 1:01	57	6/3/18 2:06	57
28/2/18 4:46	55	1/3/18 5:51	57	2/3/18 6:56	58	4/3/18 0:01	58	5/3/18 1:06	57	6/3/18 2:11	58
28/2/18 4:51	55	1/3/18 5:56	57	2/3/18 23:01	54	4/3/18 0:06	57	5/3/18 1:11	56	6/3/18 2:16	57
28/2/18 4:56	56	1/3/18 6:01	57	2/3/18 23:06	48	4/3/18 0:11	58	5/3/18 1:16	56	6/3/18 2:21	57
28/2/18 5:01	55	1/3/18 6:06	58	2/3/18 23:11	52	4/3/18 0:16	58	5/3/18 1:21	57	6/3/18 2:26	56
28/2/18 5:06	55	1/3/18 6:11	58	2/3/18 23:16	54	4/3/18 0:21	50	5/3/18 1:26	56	6/3/18 2:31	57
28/2/18 5:11	55	1/3/18 6:16	52	2/3/18 23:21	55	4/3/18 0:26	58	5/3/18 1:31	57	6/3/18 2:36	56
28/2/18 5:16	55	1/3/18 6:21	52	2/3/18 23:26	50	4/3/18 0:31	58	5/3/18 1:36	56	6/3/18 2:41	56
28/2/18 5:21	56	1/3/18 6:26	43	2/3/18 23:31	50	4/3/18 0:36	57	5/3/18 1:41	56	6/3/18 2:46	56
28/2/18 5:26	55	1/3/18 6:31	49	2/3/18 23:36	47	4/3/18 0:41	58	5/3/18 1:46	56	6/3/18 2:51	56
28/2/18 5:31	57	1/3/18 6:36	46	2/3/18 23:41	50	4/3/18 0:46	58	5/3/18 1:51	56	6/3/18 2:56	56
28/2/18 5:36	56	1/3/18 6:41	44	2/3/18 23:46	51	4/3/18 0:51	57	5/3/18 1:56	56	6/3/18 3:01	57
28/2/18 5:41	56	1/3/18 6:46	56	2/3/18 23:51	55	4/3/18 0:56	57	5/3/18 2:01	56	6/3/18 3:06	57
28/2/18 5:46	56	1/3/18 6:51	54	2/3/18 23:56	48	4/3/18 1:01	58	5/3/18 2:06	57	6/3/18 3:11	57
28/2/18 5:51	56	1/3/18 6:56	55	3/3/18 0:01	45	4/3/18 1:06	58	5/3/18 2:11	56	6/3/18 3:16	56
28/2/18 5:56	57	1/3/18 23:01	57	3/3/18 0:06	58	4/3/18 1:11	58	5/3/18 2:16	56	6/3/18 3:21	57
28/2/18 6:01	57	1/3/18 23:06	58	3/3/18 0:11	43	4/3/18 1:16	56	5/3/18 2:21	57	6/3/18 3:26	56
28/2/18 6:06	57	1/3/18 23:11	46	3/3/18 0:16	58	4/3/18 1:21	57	5/3/18 2:26	56	6/3/18 3:31	56
28/2/18 6:11	57	1/3/18 23:16	54	3/3/18 0:21	58	4/3/18 1:26	57	5/3/18 2:31	56	6/3/18 3:36	56
28/2/18 6:16	43	1/3/18 23:21	51	3/3/18 0:26	58	4/3/18 1:31	57	5/3/18 2:36	56	6/3/18 3:41	56
28/2/18 6:21	58	1/3/18 23:26	43	3/3/18 0:31	58	4/3/18 1:36	57	5/3/18 2:41	56	6/3/18 3:46	56
28/2/18 6:26	58	1/3/18 23:31	46	3/3/18 0:36	35	4/3/18 1:41	56	5/3/18 2:46	55	6/3/18 3:51	56
28/2/18 6:31	58	1/3/18 23:36	58	3/3/18 0:41	58	4/3/18 1:46	56	5/3/18 2:51	56	6/3/18 3:56	56
28/2/18 6:36	58	1/3/18 23:41	50	3/3/18 0:46	58	4/3/18 1:51	57	5/3/18 2:56	56	6/3/18 4:01	56
28/2/18 6:41	43	1/3/18 23:46	58	3/3/18 0:51	57	4/3/18 1:56	57	5/3/18 3:01	55	6/3/18 4:06	56
28/2/18 6:46	58	1/3/18 23:51	43	3/3/18 0:56	57	4/3/18 2:01	57	5/3/18 3:06	56	6/3/18 4:11	56
28/2/18 6:51	52	1/3/18 23:56	57	3/3/18 1:01	58	4/3/18 2:06	57	5/3/18 3:11	55	6/3/18 4:16	56
28/2/18 6:56	51	2/3/18 0:01	58	3/3/18 1:06	48	4/3/18 2:11	56	5/3/18 3:16	55	6/3/18 4:21	56
28/2/18 23:01	59	2/3/18 0:06	41	3/3/18 1:11	57	4/3/18 2:16	56	5/3/18 3:21	55	6/3/18 4:26	57
28/2/18 23:06	55	2/3/18 0:11	57	3/3/18 1:16	57	4/3/18 2:21	56	5/3/18 3:26	56	6/3/18 4:31	56
28/2/18 23:11	53	2/3/18 0:16	57	3/3/18 1:21	57	4/3/18 2:26	56	5/3/18 3:31	55	6/3/18 4:36	56
28/2/18 23:16	60	2/3/18 0:21	58	3/3/18 1:26	58	4/3/18 2:31	56	5/3/18 3:36	56	6/3/18 4:41	55
28/2/18 23:21	54	2/3/18 0:26	58	3/3/18 1:31	57	4/3/18 2:36	56	5/3/18 3:41	55	6/3/18 4:46	57
28/2/18 23:26	55	2/3/18 0:31	58	3/3/18 1:36	58	4/3/18 2:41	55	5/3/18 3:46	55	6/3/18 4:51	56
28/2/18 23:31	53	2/3/18 0:36	58	3/3/18 1:41	43	4/3/18 2:46	56	5/3/18 3:51	54	6/3/18 4:56	57
28/2/18 23:36	52	2/3/18 0:41	57	3/3/18 1:46	58	4/3/18 2:51	57	5/3/18 3:56	55	6/3/18 5:01	57
28/2/18 23:41	54	2/3/18 0:46	57	3/3/18 1:51	58	4/3/18 2:56	56	5/3/18 4:01	56	6/3/18 5:06	57
28/2/18 23:46	54	2/3/18 0:51	58	3/3/18 1:56	57	4/3/18 3:01	56	5/3/18 4:06	56	6/3/18 5:11	56
28/2/18 23:51	53	2/3/18 0:56	57	3/3/18 2:01	58	4/3/18 3:06	57	5/3/18 4:11	55	6/3/18 5:16	57
28/2/18 23:56	51	2/3/18 1:01	57	3/3/18 2:06	58	4/3/18 3:11	57	5/3/18 4:16	55	6/3/18 5:21	57
1/3/18 0:01	57	2/3/18 1:06	57	3/3/18 2:11	47	4/3/18 3:16	56	5/3/18 4:21	55	6/3/18 5:26	57
1/3/18 0:06	50	2/3/18 1:11	57	3/3/18 2:16	57	4/3/18 3:21	55	5/3/18 4:26	56	6/3/18 5:31	57
1/3/18 0:11	58	2/3/18 1:16	57	3/3/18 2:21	58	4/3/18 3:26	56	5/3/18			

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)									
6/3/18 23:41	58	8/3/18 0:46	57	9/3/18 1:51	56	10/3/18 2:56	57	11/3/18 4:01	56	12/3/18 5:06	55
6/3/18 23:46	49	8/3/18 0:51	57	9/3/18 1:56	56	10/3/18 3:01	58	11/3/18 4:06	56	12/3/18 5:11	55
6/3/18 23:51	58	8/3/18 0:56	56	9/3/18 2:01	57	10/3/18 3:06	57	11/3/18 4:11	56	12/3/18 5:16	56
6/3/18 23:56	58	8/3/18 1:01	57	9/3/18 2:06	56	10/3/18 3:11	57	11/3/18 4:16	57	12/3/18 5:21	56
7/3/18 0:01	40	8/3/18 1:06	57	9/3/18 2:11	55	10/3/18 3:16	57	11/3/18 4:21	56	12/3/18 5:26	55
7/3/18 0:06	45	8/3/18 1:11	59	9/3/18 2:16	56	10/3/18 3:21	56	11/3/18 4:26	56	12/3/18 5:31	56
7/3/18 0:11	54	8/3/18 1:16	56	9/3/18 2:21	57	10/3/18 3:26	57	11/3/18 4:31	57	12/3/18 5:36	55
7/3/18 0:16	46	8/3/18 1:21	56	9/3/18 2:26	57	10/3/18 3:31	57	11/3/18 4:36	56	12/3/18 5:41	56
7/3/18 0:21	58	8/3/18 1:26	57	9/3/18 2:31	56	10/3/18 3:36	56	11/3/18 4:41	57	12/3/18 5:46	57
7/3/18 0:26	40	8/3/18 1:31	56	9/3/18 2:36	56	10/3/18 3:41	55	11/3/18 4:46	56	12/3/18 5:51	56
7/3/18 0:31	53	8/3/18 1:36	56	9/3/18 2:41	56	10/3/18 3:46	56	11/3/18 4:51	55	12/3/18 5:56	56
7/3/18 0:36	45	8/3/18 1:41	56	9/3/18 2:46	56	10/3/18 3:51	56	11/3/18 4:56	57	12/3/18 6:01	56
7/3/18 0:41	48	8/3/18 1:46	56	9/3/18 2:51	56	10/3/18 3:56	55	11/3/18 5:01	57	12/3/18 6:06	56
7/3/18 0:46	58	8/3/18 1:51	57	9/3/18 2:56	55	10/3/18 4:01	56	11/3/18 5:06	57	12/3/18 6:11	58
7/3/18 0:51	58	8/3/18 1:56	55	9/3/18 3:01	56	10/3/18 4:06	56	11/3/18 5:11	57	12/3/18 6:16	55
7/3/18 0:56	58	8/3/18 2:01	56	9/3/18 3:06	56	10/3/18 4:11	57	11/3/18 5:16	56	12/3/18 6:21	56
7/3/18 1:01	57	8/3/18 2:06	57	9/3/18 3:11	55	10/3/18 4:16	56	11/3/18 5:21	56	12/3/18 6:26	55
7/3/18 1:06	53	8/3/18 2:11	56	9/3/18 3:16	56	10/3/18 4:21	57	11/3/18 5:26	57	12/3/18 6:31	58
7/3/18 1:11	58	8/3/18 2:16	57	9/3/18 3:21	57	10/3/18 4:26	56	11/3/18 5:31	58	12/3/18 6:36	35
7/3/18 1:16	46	8/3/18 2:21	56	9/3/18 3:26	56	10/3/18 4:31	56	11/3/18 5:36	57	12/3/18 6:41	48
7/3/18 1:21	58	8/3/18 2:26	55	9/3/18 3:31	56	10/3/18 4:36	56	11/3/18 5:41	57	12/3/18 6:46	48
7/3/18 1:26	49	8/3/18 2:31	56	9/3/18 3:36	55	10/3/18 4:41	56	11/3/18 5:46	57	12/3/18 6:51	54
7/3/18 1:31	48	8/3/18 2:36	55	9/3/18 3:41	54	10/3/18 4:46	56	11/3/18 5:51	58	12/3/18 6:56	53
7/3/18 1:36	42	8/3/18 2:41	56	9/3/18 3:46	55	10/3/18 4:51	56	11/3/18 5:56	57	12/3/18 7:01	56
7/3/18 1:41	57	8/3/18 2:46	56	9/3/18 3:51	55	10/3/18 4:56	56	11/3/18 6:01	56	12/3/18 7:06	56
7/3/18 1:46	58	8/3/18 2:51	55	9/3/18 3:56	55	10/3/18 5:01	58	11/3/18 6:06	57	12/3/18 7:11	58
7/3/18 1:51	57	8/3/18 2:56	55	9/3/18 4:01	55	10/3/18 5:06	56	11/3/18 6:11	57	12/3/18 7:16	57
7/3/18 1:56	58	8/3/18 3:01	55	9/3/18 4:06	55	10/3/18 5:11	56	11/3/18 6:16	58	12/3/18 7:21	55
7/3/18 2:01	58	8/3/18 3:06	56	9/3/18 4:11	55	10/3/18 5:16	56	11/3/18 6:21	53	12/3/18 7:26	57
7/3/18 2:06	58	8/3/18 3:11	55	9/3/18 4:16	55	10/3/18 5:21	57	11/3/18 6:26	57	12/3/18 7:31	58
7/3/18 2:11	58	8/3/18 3:16	55	9/3/18 4:21	55	10/3/18 5:26	56	11/3/18 6:31	58	12/3/18 7:36	56
7/3/18 2:16	58	8/3/18 3:21	55	9/3/18 4:26	54	10/3/18 5:31	55	11/3/18 6:36	47	12/3/18 7:41	56
7/3/18 2:21	48	8/3/18 3:26	55	9/3/18 4:31	55	10/3/18 5:36	56	11/3/18 6:41	49	12/3/18 7:46	56
7/3/18 2:26	53	8/3/18 3:31	55	9/3/18 4:36	56	10/3/18 5:41	57	11/3/18 6:46	53	12/3/18 7:51	56
7/3/18 2:31	58	8/3/18 3:36	57	9/3/18 4:41	55	10/3/18 5:46	57	11/3/18 6:51	56	12/3/18 7:56	56
7/3/18 2:36	58	8/3/18 3:41	56	9/3/18 4:46	55	10/3/18 5:51	58	11/3/18 6:56	50	13/3/18 0:01	57
7/3/18 2:41	39	8/3/18 3:46	56	9/3/18 4:51	54	10/3/18 5:56	56	11/3/18 7:01	46	13/3/18 0:06	55
7/3/18 2:46	55	8/3/18 3:51	56	9/3/18 4:56	56	10/3/18 6:01	56	11/3/18 7:06	58	13/3/18 0:11	56
7/3/18 2:51	58	8/3/18 3:56	55	9/3/18 5:01	56	10/3/18 6:06	57	11/3/18 7:11	57	13/3/18 0:16	59
7/3/18 2:56	56	8/3/18 4:01	55	9/3/18 5:06	55	10/3/18 6:11	48	11/3/18 7:16	54	13/3/18 0:21	55
7/3/18 3:01	57	8/3/18 4:06	55	9/3/18 5:11	54	10/3/18 6:16	58	11/3/18 7:21	58	13/3/18 0:26	57
7/3/18 3:06	58	8/3/18 4:11	56	9/3/18 5:16	55	10/3/18 6:21	58	11/3/18 7:26	58	13/3/18 0:31	54
7/3/18 3:11	56	8/3/18 4:16	56	9/3/18 5:21	56	10/3/18 6:26	48	11/3/18 7:31	38	13/3/18 0:36	56
7/3/18 3:16	57	8/3/18 4:21	56	9/3/18 5:26	56	10/3/18 6:31	57	11/3/18 7:36	58	13/3/18 0:41	54
7/3/18 3:21	57	8/3/18 4:26	55	9/3/18 5:31	54	10/3/18 6:36	58	11/3/18 7:41	58	13/3/18 0:46	54
7/3/18 3:26	56	8/3/18 4:31	56	9/3/18 5:36	55	10/3/18 6:41	58	11/3/18 7:46	58	13/3/18 0:51	54
7/3/18 3:31	57	8/3/18 4:36	56	9/3/18 5:41	56	10/3/18 6:46	48	11/3/18 7:51	47	13/3/18 0:56	52
7/3/18 3:36	56	8/3/18 4:41	58	9/3/18 5:46	55	10/3/18 6:51	50	11/3/18 7:56	58	13/3/18 1:01	55
7/3/18 3:41	57	8/3/18 4:46	55	9/3/18 5:51	56	10/3/18 6:56	48	12/3/18 0:01	58	13/3/18 1:06	55
7/3/18 3:46	57	8/3/18 4:51	56	9/3/18 5:56	56	10/3/18 7:01	49	12/3/18 0:06	57	13/3/18 1:11	56
7/3/18 3:51	44	8/3/18 4:56	55	9/3/18 6:01	56	10/3/18 7:06	54	12/3/18 0:11	57	13/3/18 1:16	53
7/3/18 3:56	57	8/3/18 5:01	56	9/3/18 6:06	56	10/3/18 7:11	58	12/3/18 0:16	57	13/3/18 1:21	53
7/3/18 4:01	57	8/3/18 5:06	55	9/3/18 6:11	57	10/3/18 7:16	53	12/3/18 0:21	58	13/3/18 1:26	56
7/3/18 4:06	57	8/3/18 5:11	55	9/3/18 6:16	58	10/3/18 7:21	56	12/3/18 0:26	57	13/3/18 1:31	53
7/3/18 4:11	57	8/3/18 5:16	55	9/3/18 6:21	57	10/3/18 7:26	51	12/3/18 0:31	57	13/3/18 1:36	52
7/3/18 4:16	58	8/3/18 5:21	55	9/3/18 6:26	57	10/3/18 7:31	57	12/3/18 0:36	57	13/3/18 1:41	50
7/3/18 4:21	58	8/3/18 5:26	55	9/3/18 6:31	57	10/3/18 7:36	58	12/3/18 0:41	56	13/3/18 1:46	52
7/3/18 4:26	54	8/3/18 5:31	56	9/3/18 6:36	58	10/3/18 7:41	48	12/3/18 0:46	57	13/3/18 1:51	53
7/3/18 4:31	45	8/3/18 5:36	56	9/3/18 6:41	58	10/3/18 7:46	35	12/3/18 0:51	57	13/3/18 1:56	50
7/3/18 4:36	57	8/3/18 5:41	56	9/3/18 6:46	47	10/3/18 7:51	38	12/3/18 0:56	57	13/3/18 2:01	49
7/3/18 4:41	57	8/3/18 5:46	56	9/3/18 6:51	53	10/3/18 7:56	58	12/3/18 1:01	57	13/3/18 2:06	51
7/3/18 4:46	58	8/3/18 5:51	58	9/3/18 6:56	52	11/3/18 0:01	51	12/3/18 1:06	56	13/3/18 2:11	50
7/3/18 4:51	57	8/3/18 5:56	56	9/3/18 7:01	58	11/3/18 0:06	58	12/3/18 1:11	56	13/3/18 2:16	52
7/3/18 4:56	57	8/3/18 6:01	58	9/3/18 7:06	49	11/3/18 0:11	58	12/3/18 1:16	57	13/3/18 2:21	51
7/3/18 5:01	57	8/3/18 6:06	57	9/3/18 7:11	58	11/3/18 0:16	58	12/3/18 1:21	56	13/3/18 2:26	55
7/3/18 5:06	56	8/3/18 6:11	57	9/3/18 7:16	53	11/3/18 0:21	58	12/3/18 1:26	57	13/3/18 2:31	50
7/3/18 5:11	58	8/3/18 6:16	58	9/3/18 7:21	53	11/3/18 0:26	49	12/3/18 1:31	56	13/3/18 2:36	49
7/3/18 5:16	57	8/3/18 6:21	58	9/3/18 7:26	52	11/3/18 0:31	58	12/3/18 1:36	58	13/3/18 2:41	47
7/3/18 5:21	57	8/3/18 6:26	58	9/3/18 7:31	52	11/3/18 0:36	58	12/3/18 1:41	57	13/3/18 2:46	51
7/3/18 5:26	56	8/3/18 6:31	58	9/3/18 7:36	52	11/3/18 0:41	58	12/3/18 1:46	56	13/3/18 2:51	51
7/3/18 5:31	57	8/3/18 6:36	45	9/3/18 7:41	51	11/3/18 0:46	58	12/3/18 1:51	56	13/3/18 2:56	53
7/3/18 5:36	57	8/3/18 6:41	55	9/3/18 7:46	57	11/3/18 0:51	58	12/3/18 1:56	56	13/3/18 3:01	53
7/3/18 5:41	56	8/3/18 6:46	60	9/3/18 7:51	46	11/3/18 0:56	57	12/3/18 2:01	56	13/3/18 3:06	51
7/3/18 5:46	57	8/3/18 6:51	59	9/3/18 7:56	46	11/3/18 1:01	57	12/3/18 2:06	55	13/3/18 3:11	49
7/3/18 5:51	57	8/3/18 6:56	56	10/3/18 0:01	49	11/3/18 1:06	57	12/3/18 2:11	55	13/3/18 3:16	45
7/3/18 5:56	57	8/3/18 7:01	52	10/3/18 0:06	47	11/3/18 1:11	57	12/3/18 2:16	56	13/3/18 3:21	50
7/3/18 6:01	57	8/3/18 7:06	50	10/3/18 0:11	58	11/3/18 1:16	58	12/3/18 2:21	55	13/3/18 3:26	51
7/3/18 6:06	57	8/3/18 7:11	56	10/3/18 0:16	50	11/3/18 1:21	58	12/3/18 2:26	56	13/3/18 3:31	48
7/3/18 6:11	56	8/3/18 7:16	51	10/3/18 0:21	58	11/3/18 1:26	58	12/3/18 2:31	55	13/3/18 3:36	53
7/3/18 6:16	56	8/3/18 7:21	46	10/3/18 0:26	47	11/3/18 1:31	57	12/3/18 2:36	55	13/3/18 3:41	47
7/3/18 6:21	58	8/3/18 7:26	44	10/3/18 0:31	58	11/3/18 1:36	57	12/3/18 2:41	55	13/3/18 3:46	45
7/3/18 6:26	57	8/3/18 7:31	58	10/3/18 0:36	58	11/3/18 1:41	57	12/3/18 2:46	55	13/3/18 3:51	50
7/3/18 6:31	58	8/3/18 7:36	43	10/3/18 0:41	58	11/3/18 1:46	57	12/3/18 2:51	56	13/3/18 3:56	47
7/3/18 6:36	58	8/3/18 7:41	58	10/3/18 0:46	58	11/3/18 1:51	57	12/3/18 2:56	57	13/3/18 4:01	

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)									
13/3/18 6:11	54	14/3/18 23:16	58	16/3/18 0:21	57	17/3/18 1:26	58	18/3/18 2:31	56	19/3/18 3:36	51
13/3/18 6:16	56	14/3/18 23:21	57	16/3/18 0:26	58	17/3/18 1:31	57	18/3/18 2:36	57	19/3/18 3:41	53
13/3/18 6:21	54	14/3/18 23:26	60	16/3/18 0:31	59	17/3/18 1:36	56	18/3/18 2:41	58	19/3/18 3:46	54
13/3/18 6:26	53	14/3/18 23:31	60	16/3/18 0:36	58	17/3/18 1:41	58	18/3/18 2:46	56	19/3/18 3:51	54
13/3/18 6:31	55	14/3/18 23:36	58	16/3/18 0:41	59	17/3/18 1:46	58	18/3/18 2:51	59	19/3/18 3:56	53
13/3/18 6:36	56	14/3/18 23:41	58	16/3/18 0:46	56	17/3/18 1:51	59	18/3/18 2:56	58	19/3/18 4:01	55
13/3/18 6:41	56	14/3/18 23:46	59	16/3/18 0:51	56	17/3/18 1:56	58	18/3/18 3:01	56	19/3/18 4:06	56
13/3/18 6:46	56	14/3/18 23:51	56	16/3/18 0:56	56	17/3/18 2:01	55	18/3/18 3:06	56	19/3/18 4:11	57
13/3/18 6:51	57	14/3/18 23:56	56	16/3/18 1:01	57	17/3/18 2:06	56	18/3/18 3:11	53	19/3/18 4:16	58
13/3/18 6:56	58	15/3/18 0:01	57	16/3/18 1:06	58	17/3/18 2:11	54	18/3/18 3:16	55	19/3/18 4:21	54
13/3/18 23:01	57	15/3/18 0:06	57	16/3/18 1:11	57	17/3/18 2:16	58	18/3/18 3:21	57	19/3/18 4:26	54
13/3/18 23:06	58	15/3/18 0:11	57	16/3/18 1:16	57	17/3/18 2:21	59	18/3/18 3:26	58	19/3/18 4:31	51
13/3/18 23:11	59	15/3/18 0:16	59	16/3/18 1:21	55	17/3/18 2:26	59	18/3/18 3:31	56	19/3/18 4:36	55
13/3/18 23:16	59	15/3/18 0:21	57	16/3/18 1:26	55	17/3/18 2:31	58	18/3/18 3:36	52	19/3/18 4:41	57
13/3/18 23:21	60	15/3/18 0:26	58	16/3/18 1:31	58	17/3/18 2:36	56	18/3/18 3:41	51	19/3/18 4:46	54
13/3/18 23:26	61	15/3/18 0:31	55	16/3/18 1:36	58	17/3/18 2:41	57	18/3/18 3:46	53	19/3/18 4:51	54
13/3/18 23:31	60	15/3/18 0:36	55	16/3/18 1:41	57	17/3/18 2:46	58	18/3/18 3:51	55	19/3/18 4:56	56
13/3/18 23:36	59	15/3/18 0:41	56	16/3/18 1:46	53	17/3/18 2:51	58	18/3/18 3:56	53	19/3/18 5:01	56
13/3/18 23:41	59	15/3/18 0:46	59	16/3/18 1:51	54	17/3/18 2:56	58	18/3/18 4:01	55	19/3/18 5:06	54
13/3/18 23:46	58	15/3/18 0:51	57	16/3/18 1:56	57	17/3/18 3:01	56	18/3/18 4:06	55	19/3/18 5:11	52
13/3/18 23:51	57	15/3/18 0:56	57	16/3/18 2:01	58	17/3/18 3:06	56	18/3/18 4:11	56	19/3/18 5:16	57
13/3/18 23:56	56	15/3/18 1:01	56	16/3/18 2:06	58	17/3/18 3:11	55	18/3/18 4:16	55	19/3/18 5:21	57
14/3/18 0:01	58	15/3/18 1:06	57	16/3/18 2:11	56	17/3/18 3:16	54	18/3/18 4:21	52	19/3/18 5:26	58
14/3/18 0:06	58	15/3/18 1:11	54	16/3/18 2:16	58	17/3/18 3:21	54	18/3/18 4:26	54	19/3/18 5:31	51
14/3/18 0:11	59	15/3/18 1:16	56	16/3/18 2:21	56	17/3/18 3:26	55	18/3/18 4:31	53	19/3/18 5:36	51
14/3/18 0:16	59	15/3/18 1:21	55	16/3/18 2:26	57	17/3/18 3:31	57	18/3/18 4:36	52	19/3/18 5:41	56
14/3/18 0:21	58	15/3/18 1:26	55	16/3/18 2:31	53	17/3/18 3:36	57	18/3/18 4:41	55	19/3/18 5:46	54
14/3/18 0:26	57	15/3/18 1:31	56	16/3/18 2:36	57	17/3/18 3:41	58	18/3/18 4:46	51	19/3/18 5:51	56
14/3/18 0:31	57	15/3/18 1:36	58	16/3/18 2:41	57	17/3/18 3:46	55	18/3/18 4:51	54	19/3/18 5:56	54
14/3/18 0:36	56	15/3/18 1:41	56	16/3/18 2:46	55	17/3/18 3:51	53	18/3/18 4:56	55	19/3/18 6:01	57
14/3/18 0:41	58	15/3/18 1:46	56	16/3/18 2:51	53	17/3/18 3:56	55	18/3/18 5:01	55	19/3/18 6:06	56
14/3/18 0:46	57	15/3/18 1:51	54	16/3/18 2:56	57	17/3/18 4:01	58	18/3/18 5:06	55	19/3/18 6:11	57
14/3/18 0:51	56	15/3/18 1:56	54	16/3/18 3:01	55	17/3/18 4:06	58	18/3/18 5:11	55	19/3/18 6:16	58
14/3/18 0:56	56	15/3/18 2:01	50	16/3/18 3:06	56	17/3/18 4:11	57	18/3/18 5:16	55	19/3/18 6:21	58
14/3/18 1:01	56	15/3/18 2:06	52	16/3/18 3:11	53	17/3/18 4:16	56	18/3/18 5:21	53	19/3/18 6:26	57
14/3/18 1:06	55	15/3/18 2:11	52	16/3/18 3:16	55	17/3/18 4:21	57	18/3/18 5:26	54	19/3/18 6:31	58
14/3/18 1:11	57	15/3/18 2:16	53	16/3/18 3:21	53	17/3/18 4:26	55	18/3/18 5:31	55	19/3/18 6:36	58
14/3/18 1:16	56	15/3/18 2:21	54	16/3/18 3:26	54	17/3/18 4:31	55	18/3/18 5:36	54	19/3/18 6:41	58
14/3/18 1:21	56	15/3/18 2:26	51	16/3/18 3:31	54	17/3/18 4:36	54	18/3/18 5:41	56	19/3/18 6:46	59
14/3/18 1:26	55	15/3/18 2:31	54	16/3/18 3:36	55	17/3/18 4:41	55	18/3/18 5:46	58	19/3/18 6:51	59
14/3/18 1:31	53	15/3/18 2:36	54	16/3/18 3:41	55	17/3/18 4:46	57	18/3/18 5:51	55	19/3/18 6:56	59
14/3/18 1:36	55	15/3/18 2:41	53	16/3/18 3:46	55	17/3/18 4:51	59	18/3/18 5:56	56	19/3/18 23:01	57
14/3/18 1:41	57	15/3/18 2:46	51	16/3/18 3:51	55	17/3/18 4:56	54	18/3/18 6:01	56	19/3/18 23:06	58
14/3/18 1:46	55	15/3/18 2:51	52	16/3/18 3:56	53	17/3/18 5:01	55	18/3/18 6:06	57	19/3/18 23:11	58
14/3/18 1:51	52	15/3/18 2:56	53	16/3/18 4:01	54	17/3/18 5:06	58	18/3/18 6:11	58	19/3/18 23:16	58
14/3/18 1:56	56	15/3/18 3:01	51	16/3/18 4:06	52	17/3/18 5:11	57	18/3/18 6:16	56	19/3/18 23:21	59
14/3/18 2:01	53	15/3/18 3:06	54	16/3/18 4:11	53	17/3/18 5:16	56	18/3/18 6:21	58	19/3/18 23:26	57
14/3/18 2:06	59	15/3/18 3:11	50	16/3/18 4:16	56	17/3/18 5:21	54	18/3/18 6:26	56	19/3/18 23:31	59
14/3/18 2:11	53	15/3/18 3:16	50	16/3/18 4:21	56	17/3/18 5:26	56	18/3/18 6:31	57	19/3/18 23:36	58
14/3/18 2:16	52	15/3/18 3:21	51	16/3/18 4:26	52	17/3/18 5:31	55	18/3/18 6:36	59	19/3/18 23:41	58
14/3/18 2:21	49	15/3/18 3:26	50	16/3/18 4:31	52	17/3/18 5:36	58	18/3/18 6:41	56	19/3/18 23:46	57
14/3/18 2:26	53	15/3/18 3:31	53	16/3/18 4:36	54	17/3/18 5:41	57	18/3/18 6:46	56	19/3/18 23:51	57
14/3/18 2:31	53	15/3/18 3:36	51	16/3/18 4:41	55	17/3/18 5:46	56	18/3/18 6:51	56	19/3/18 23:56	57
14/3/18 2:36	56	15/3/18 3:41	52	16/3/18 4:46	57	17/3/18 5:51	60	18/3/18 6:56	59	20/3/18 0:01	57
14/3/18 2:41	54	15/3/18 3:46	53	16/3/18 4:51	56	17/3/18 5:56	57	18/3/18 23:01	56	20/3/18 0:06	58
14/3/18 2:46	52	15/3/18 3:51	53	16/3/18 4:56	55	17/3/18 6:01	57	18/3/18 23:06	59	20/3/18 0:11	57
14/3/18 2:51	52	15/3/18 3:56	53	16/3/18 5:01	56	17/3/18 6:06	52	18/3/18 23:11	59	20/3/18 0:16	58
14/3/18 2:56	51	15/3/18 4:01	51	16/3/18 5:06	55	17/3/18 6:11	57	18/3/18 23:16	58	20/3/18 0:21	57
14/3/18 3:01	46	15/3/18 4:06	52	16/3/18 5:11	52	17/3/18 6:16	57	18/3/18 23:21	59	20/3/18 0:26	58
14/3/18 3:06	44	15/3/18 4:11	52	16/3/18 5:16	55	17/3/18 6:21	58	18/3/18 23:26	58	20/3/18 0:31	58
14/3/18 3:11	54	15/3/18 4:16	54	16/3/18 5:21	57	17/3/18 6:26	56	18/3/18 23:31	57	20/3/18 0:36	56
14/3/18 3:16	44	15/3/18 4:21	51	16/3/18 5:26	59	17/3/18 6:31	56	18/3/18 23:36	60	20/3/18 0:41	55
14/3/18 3:21	53	15/3/18 4:26	52	16/3/18 5:31	56	17/3/18 6:36	57	18/3/18 23:41	58	20/3/18 0:46	56
14/3/18 3:26	47	15/3/18 4:31	50	16/3/18 5:36	53	17/3/18 6:41	59	18/3/18 23:46	57	20/3/18 0:51	56
14/3/18 3:31	51	15/3/18 4:36	51	16/3/18 5:41	55	17/3/18 6:46	58	18/3/18 23:51	57	20/3/18 0:56	56
14/3/18 3:36	50	15/3/18 4:41	52	16/3/18 5:46	55	17/3/18 6:51	58	18/3/18 23:56	58	20/3/18 1:01	55
14/3/18 3:41	53	15/3/18 4:46	52	16/3/18 5:51	59	17/3/18 6:56	57	19/3/18 0:01	57	20/3/18 1:06	55
14/3/18 3:46	38	15/3/18 4:51	54	16/3/18 5:56	58	17/3/18 23:01	58	19/3/18 0:06	56	20/3/18 1:11	56
14/3/18 3:51	51	15/3/18 4:56	55	16/3/18 6:01	57	17/3/18 23:06	59	19/3/18 0:11	58	20/3/18 1:16	56
14/3/18 3:56	45	15/3/18 5:01	52	16/3/18 6:06	57	17/3/18 23:11	58	19/3/18 0:16	57	20/3/18 1:21	55
14/3/18 4:01	51	15/3/18 5:06	55	16/3/18 6:11	57	17/3/18 23:16	57	19/3/18 0:21	57	20/3/18 1:26	58
14/3/18 4:06	53	15/3/18 5:11	53	16/3/18 6:16	59	17/3/18 23:21	58	19/3/18 0:26	57	20/3/18 1:31	55
14/3/18 4:11	52	15/3/18 5:16	53	16/3/18 6:21	59	17/3/18 23:26	58	19/3/18 0:31	57	20/3/18 1:36	54
14/3/18 4:16	55	15/3/18 5:21	53	16/3/18 6:26	59	17/3/18 23:31	58	19/3/18 0:36	56	20/3/18 1:41	55
14/3/18 4:21	38	15/3/18 5:26	54	16/3/18 6:31	59	17/3/18 23:36	57	19/3/18 0:41	55	20/3/18 1:46	54
14/3/18 4:26	51	15/3/18 5:31	57	16/3/18 6:36	58	17/3/18 23:41	57	19/3/18 0:46	54	20/3/18 1:51	54
14/3/18 4:31	46	15/3/18 5:36	56	16/3/18 6:41	58	17/3/18 23:46	57	19/3/18 0:51	58	20/3/18 1:56	54
14/3/18 4:36	47	15/3/18 5:41	56	16/3/18 6:46	59	17/3/18 23:51	57	19/3/18 0:56	57	20/3/18 2:01	54
14/3/18 4:41	48	15/3/18 5:46	53	16/3/18 6:51	59	17/3/18 23:56	58	19/3/18 1:01	57	20/3/18 2:06	54
14/3/18 4:46	48	15/3/18 5:51	54	16/3/18 6:56	61	18/3/18 0:01	56	19/3/18 1:06	60	20/3/18 2:11	55
14/3/18 4:51	54	15/3/18 5:56	54	16/3/18 23:01	58	18/3/18 0:06	58	19/3/18 1:11	58	20/3/18 2:16	54
14/3/18 4:56	56	15/3/18 6:01	54	16/3/18 23:06	58	18/3/18 0:11	58	19/3/18 1:16	59	20/3/18 2:21	

Real-time Noise Data		RTN2a (Hong Kong Electric Centre)									
20/3/18 4:41	58	21/3/18 5:46	48	22/3/18 6:51	56	23/3/18 23:56	58	25/3/18 1:01	56	26/3/18 2:06	53
20/3/18 4:46	58	21/3/18 5:51	46	22/3/18 6:56	55	24/3/18 0:01	59	25/3/18 1:06	57	26/3/18 2:11	55
20/3/18 4:51	58	21/3/18 5:56	47	22/3/18 23:01	59	24/3/18 0:06	60	25/3/18 1:11	57	26/3/18 2:16	55
20/3/18 4:56	55	21/3/18 6:01	55	22/3/18 23:06	58	24/3/18 0:11	58	25/3/18 1:16	56	26/3/18 2:21	53
20/3/18 5:01	55	21/3/18 6:06	54	22/3/18 23:11	59	24/3/18 0:16	59	25/3/18 1:21	56	26/3/18 2:26	56
20/3/18 5:06	54	21/3/18 6:11	56	22/3/18 23:16	55	24/3/18 0:21	58	25/3/18 1:26	56	26/3/18 2:31	55
20/3/18 5:11	55	21/3/18 6:16	55	22/3/18 23:21	57	24/3/18 0:26	57	25/3/18 1:31	58	26/3/18 2:36	54
20/3/18 5:16	56	21/3/18 6:21	56	22/3/18 23:26	57	24/3/18 0:31	56	25/3/18 1:36	55	26/3/18 2:41	54
20/3/18 5:21	59	21/3/18 6:26	55	22/3/18 23:31	59	24/3/18 0:36	58	25/3/18 1:41	56	26/3/18 2:46	56
20/3/18 5:26	58	21/3/18 6:31	55	22/3/18 23:36	57	24/3/18 0:41	58	25/3/18 1:46	57	26/3/18 2:51	57
20/3/18 5:31	57	21/3/18 6:36	53	22/3/18 23:41	57	24/3/18 0:46	57	25/3/18 1:51	56	26/3/18 2:56	55
20/3/18 5:36	56	21/3/18 6:41	59	22/3/18 23:46	56	24/3/18 0:51	58	25/3/18 1:56	55	26/3/18 3:01	56
20/3/18 5:41	57	21/3/18 6:46	57	22/3/18 23:51	58	24/3/18 0:56	58	25/3/18 2:01	56	26/3/18 3:06	56
20/3/18 5:46	54	21/3/18 6:51	57	22/3/18 23:56	56	24/3/18 1:01	58	25/3/18 2:06	56	26/3/18 3:11	53
20/3/18 5:51	57	21/3/18 6:56	55	23/3/18 0:01	56	24/3/18 1:06	58	25/3/18 2:11	56	26/3/18 3:16	48
20/3/18 5:56	56	21/3/18 23:01	58	23/3/18 0:06	57	24/3/18 1:11	61	25/3/18 2:16	58	26/3/18 3:21	51
20/3/18 6:01	58	21/3/18 23:06	55	23/3/18 0:11	59	24/3/18 1:16	57	25/3/18 2:21	55	26/3/18 3:26	55
20/3/18 6:06	59	21/3/18 23:11	58	23/3/18 0:16	56	24/3/18 1:21	60	25/3/18 2:26	57	26/3/18 3:31	56
20/3/18 6:11	62	21/3/18 23:16	57	23/3/18 0:21	57	24/3/18 1:26	58	25/3/18 2:31	56	26/3/18 3:36	55
20/3/18 6:16	60	21/3/18 23:21	59	23/3/18 0:26	55	24/3/18 1:31	58	25/3/18 2:36	56	26/3/18 3:41	55
20/3/18 6:21	56	21/3/18 23:26	60	23/3/18 0:31	57	24/3/18 1:36	58	25/3/18 2:41	55	26/3/18 3:46	54
20/3/18 6:26	58	21/3/18 23:31	59	23/3/18 0:36	57	24/3/18 1:41	56	25/3/18 2:46	58	26/3/18 3:51	53
20/3/18 6:31	59	21/3/18 23:36	58	23/3/18 0:41	52	24/3/18 1:46	59	25/3/18 2:51	56	26/3/18 3:56	51
20/3/18 6:36	57	21/3/18 23:41	57	23/3/18 0:46	54	24/3/18 1:51	57	25/3/18 2:56	54	26/3/18 4:01	55
20/3/18 6:41	58	21/3/18 23:46	62	23/3/18 0:51	54	24/3/18 1:56	55	25/3/18 3:01	63	26/3/18 4:06	51
20/3/18 6:46	59	21/3/18 23:51	65	23/3/18 0:56	55	24/3/18 2:01	56	25/3/18 3:06	61	26/3/18 4:11	51
20/3/18 6:51	59	21/3/18 23:56	54	23/3/18 1:01	54	24/3/18 2:06	56	25/3/18 3:11	55	26/3/18 4:16	53
20/3/18 6:56	61	22/3/18 0:01	62	23/3/18 1:06	51	24/3/18 2:11	55	25/3/18 3:16	55	26/3/18 4:21	53
20/3/18 23:01	58	22/3/18 0:06	56	23/3/18 1:11	52	24/3/18 2:16	57	25/3/18 3:21	52	26/3/18 4:26	54
20/3/18 23:06	57	22/3/18 0:11	55	23/3/18 1:16	48	24/3/18 2:21	58	25/3/18 3:26	54	26/3/18 4:31	54
20/3/18 23:11	58	22/3/18 0:16	55	23/3/18 1:21	54	24/3/18 2:26	57	25/3/18 3:31	56	26/3/18 4:36	55
20/3/18 23:16	60	22/3/18 0:21	54	23/3/18 1:26	51	24/3/18 2:31	59	25/3/18 3:36	54	26/3/18 4:41	55
20/3/18 23:21	60	22/3/18 0:26	57	23/3/18 1:31	53	24/3/18 2:36	56	25/3/18 3:41	60	26/3/18 4:46	50
20/3/18 23:26	56	22/3/18 0:31	55	23/3/18 1:36	54	24/3/18 2:41	57	25/3/18 3:46	55	26/3/18 4:51	52
20/3/18 23:31	55	22/3/18 0:36	55	23/3/18 1:41	55	24/3/18 2:46	57	25/3/18 3:51	56	26/3/18 4:56	54
20/3/18 23:36	60	22/3/18 0:41	56	23/3/18 1:46	52	24/3/18 2:51	58	25/3/18 3:56	56	26/3/18 5:01	55
20/3/18 23:41	55	22/3/18 0:46	56	23/3/18 1:51	52	24/3/18 2:56	57	25/3/18 4:01	52	26/3/18 5:06	57
20/3/18 23:46	54	22/3/18 0:51	54	23/3/18 1:56	51	24/3/18 3:01	58	25/3/18 4:06	54	26/3/18 5:11	57
20/3/18 23:51	55	22/3/18 0:56	55	23/3/18 2:01	45	24/3/18 3:06	59	25/3/18 4:11	53	26/3/18 5:16	53
20/3/18 23:56	56	22/3/18 1:01	52	23/3/18 2:06	48	24/3/18 3:11	56	25/3/18 4:16	53	26/3/18 5:21	52
21/3/18 0:01	54	22/3/18 1:06	53	23/3/18 2:11	43	24/3/18 3:16	56	25/3/18 4:21	53	26/3/18 5:26	56
21/3/18 0:06	54	22/3/18 1:11	54	23/3/18 2:16	48	24/3/18 3:21	58	25/3/18 4:26	52	26/3/18 5:31	55
21/3/18 0:11	56	22/3/18 1:16	54	23/3/18 2:21	48	24/3/18 3:26	57	25/3/18 4:31	53	26/3/18 5:36	56
21/3/18 0:16	54	22/3/18 1:21	52	23/3/18 2:26	58	24/3/18 3:31	56	25/3/18 4:36	52	26/3/18 5:41	56
21/3/18 0:21	54	22/3/18 1:26	47	23/3/18 2:31	47	24/3/18 3:36	58	25/3/18 4:41	53	26/3/18 5:46	56
21/3/18 0:26	55	22/3/18 1:31	56	23/3/18 2:36	37	24/3/18 3:41	56	25/3/18 4:46	55	26/3/18 5:51	56
21/3/18 0:31	54	22/3/18 1:36	50	23/3/18 2:41	49	24/3/18 3:46	55	25/3/18 4:51	53	26/3/18 5:56	57
21/3/18 0:36	55	22/3/18 1:41	54	23/3/18 2:46	58	24/3/18 3:51	57	25/3/18 4:56	56	26/3/18 6:01	57
21/3/18 0:41	53	22/3/18 1:46	58	23/3/18 2:51	50	24/3/18 3:56	56	25/3/18 5:01	53	26/3/18 6:06	55
21/3/18 0:46	53	22/3/18 1:51	58	23/3/18 2:56	38	24/3/18 4:01	57	25/3/18 5:06	53	26/3/18 6:11	57
21/3/18 0:51	52	22/3/18 1:56	53	23/3/18 3:01	46	24/3/18 4:06	56	25/3/18 5:11	56	26/3/18 6:16	57
21/3/18 0:56	52	22/3/18 2:01	55	23/3/18 3:06	51	24/3/18 4:11	57	25/3/18 5:16	55	26/3/18 6:21	58
21/3/18 1:01	53	22/3/18 2:06	55	23/3/18 3:11	58	24/3/18 4:16	57	25/3/18 5:21	57	26/3/18 6:26	58
21/3/18 1:06	39	22/3/18 2:11	51	23/3/18 3:16	58	24/3/18 4:21	55	25/3/18 5:26	55	26/3/18 6:31	57
21/3/18 1:11	53	22/3/18 2:16	58	23/3/18 3:21	48	24/3/18 4:26	59	25/3/18 5:31	55	26/3/18 6:36	58
21/3/18 1:16	45	22/3/18 2:21	48	23/3/18 3:26	58	24/3/18 4:31	57	25/3/18 5:36	55	26/3/18 6:41	59
21/3/18 1:21	52	22/3/18 2:26	44	23/3/18 3:31	58	24/3/18 4:36	56	25/3/18 5:41	53	26/3/18 6:46	58
21/3/18 1:26	53	22/3/18 2:31	58	23/3/18 3:36	49	24/3/18 4:41	57	25/3/18 5:46	51	26/3/18 6:51	58
21/3/18 1:31	48	22/3/18 2:36	45	23/3/18 3:41	52	24/3/18 4:46	55	25/3/18 5:51	53	26/3/18 6:56	58
21/3/18 1:36	49	22/3/18 2:41	48	23/3/18 3:46	50	24/3/18 4:51	56	25/3/18 5:56	54	26/3/18 23:01	60
21/3/18 1:41	51	22/3/18 2:46	51	23/3/18 3:51	58	24/3/18 4:56	57	25/3/18 6:01	58	26/3/18 23:06	59
21/3/18 1:46	49	22/3/18 2:51	42	23/3/18 3:56	48	24/3/18 5:01	56	25/3/18 6:06	58	26/3/18 23:11	58
21/3/18 1:51	51	22/3/18 2:56	43	23/3/18 4:01	58	24/3/18 5:06	57	25/3/18 6:11	57	26/3/18 23:16	60
21/3/18 1:56	51	22/3/18 3:01	46	23/3/18 4:06	58	24/3/18 5:11	58	25/3/18 6:16	58	26/3/18 23:21	61
21/3/18 2:01	58	22/3/18 3:06	51	23/3/18 4:11	58	24/3/18 5:16	57	25/3/18 6:21	60	26/3/18 23:26	59
21/3/18 2:06	49	22/3/18 3:11	58	23/3/18 4:16	43	24/3/18 5:21	57	25/3/18 6:26	55	26/3/18 23:31	59
21/3/18 2:11	43	22/3/18 3:16	58	23/3/18 4:21	38	24/3/18 5:26	57	25/3/18 6:31	57	26/3/18 23:36	58
21/3/18 2:16	58	22/3/18 3:21	58	23/3/18 4:26	58	24/3/18 5:31	56	25/3/18 6:36	57	26/3/18 23:41	59
21/3/18 2:21	58	22/3/18 3:26	42	23/3/18 4:31	58	24/3/18 5:36	54	25/3/18 6:41	56	26/3/18 23:46	59
21/3/18 2:26	48	22/3/18 3:31	58	23/3/18 4:36	42	24/3/18 5:41	56	25/3/18 6:46	57	26/3/18 23:51	59
21/3/18 2:31	47	22/3/18 3:36	58	23/3/18 4:41	32	24/3/18 5:46	57	25/3/18 6:51	56	26/3/18 23:56	58
21/3/18 2:36	47	22/3/18 3:41	58	23/3/18 4:46	58	24/3/18 5:51	61	25/3/18 6:56	57		
21/3/18 2:41	58	22/3/18 3:46	58	23/3/18 4:51	58	24/3/18 5:56	59	25/3/18 23:01	59		
21/3/18 2:46	58	22/3/18 3:51	58	23/3/18 4:56	47	24/3/18 6:01	59	25/3/18 23:06	58		
21/3/18 2:51	58	22/3/18 3:56	48	23/3/18 5:01	47	24/3/18 6:06	57	25/3/18 23:11	57		
21/3/18 2:56	58	22/3/18 4:01	53	23/3/18 5:06	52	24/3/18 6:11	58	25/3/18 23:16	60		
21/3/18 3:01	58	22/3/18 4:06	54	23/3/18 5:11	43	24/3/18 6:16	59	25/3/18 23:21	58		
21/3/18 3:06	37	22/3/18 4:11	47	23/3/18 5:16	47	24/3/18 6:21	59	25/3/18 23:26	57		
21/3/18 3:11	57	22/3/18 4:16	58	23/3/18 5:21	52	24/3/18 6:26	60	25/3/18 23:31	57		
21/3/18 3:16	58	22/3/18 4:21	57	23/3/18 5:26	45	24/3/18 6:31	57	25/3/18 23:36	57		
21/3/18 3:21	45	22/3/18 4:26	58	23/3/18 5:31	46	24/3/18 6:36	58	25/3/18 23:41	58		
21/3/18 3:26	58	22/3/18 4:31	58	23/3/18 5:36	58	24/3/18 6:41	59	25/3/18 23:46	58		
21/3/18 3:31	58	22/3/18 4:36	58	23/3/18 5:41	55	24/3/18 6:46	59	25/3/18 23:51	57		
21/3/18 3:36	58	22/3/1									

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)									
28/2/18 20:56	65	2/3/18 22:01	65	4/3/18 11:06	65	4/3/18 20:11	68	6/3/18 21:16	65	8/3/18 22:21	69
28/2/18 21:01	61	2/3/18 22:06	65	4/3/18 11:11	66	4/3/18 20:16	62	6/3/18 21:21	63	8/3/18 22:26	68
28/2/18 21:06	62	2/3/18 22:11	65	4/3/18 11:16	66	4/3/18 20:21	69	6/3/18 21:26	63	8/3/18 22:31	67
28/2/18 21:11	66	2/3/18 22:16	65	4/3/18 11:21	65	4/3/18 20:26	64	6/3/18 21:31	65	8/3/18 22:36	67
28/2/18 21:16	61	2/3/18 22:21	66	4/3/18 11:26	66	4/3/18 20:31	63	6/3/18 21:36	64	8/3/18 22:41	67
28/2/18 21:21	63	2/3/18 22:26	64	4/3/18 11:31	66	4/3/18 20:36	62	6/3/18 21:41	65	8/3/18 22:46	66
28/2/18 21:26	62	2/3/18 22:31	66	4/3/18 11:36	65	4/3/18 20:41	63	6/3/18 21:46	66	8/3/18 22:51	68
28/2/18 21:31	64	2/3/18 22:36	64	4/3/18 11:41	66	4/3/18 20:46	63	6/3/18 21:51	65	8/3/18 22:56	66
28/2/18 21:36	65	2/3/18 22:41	65	4/3/18 11:46	66	4/3/18 20:51	63	6/3/18 21:56	65	9/3/18 19:01	66
28/2/18 21:41	63	2/3/18 22:46	64	4/3/18 11:51	66	4/3/18 20:56	63	6/3/18 22:01	65	9/3/18 19:06	66
28/2/18 21:46	62	2/3/18 22:51	64	4/3/18 11:56	66	4/3/18 21:01	63	6/3/18 22:06	64	9/3/18 19:11	66
28/2/18 21:51	66	2/3/18 22:56	64	4/3/18 12:01	67	4/3/18 21:06	62	6/3/18 22:11	64	9/3/18 19:16	66
28/2/18 21:56	64	3/3/18 19:01	66	4/3/18 12:06	67	4/3/18 21:11	62	6/3/18 22:16	65	9/3/18 19:21	66
28/2/18 22:01	64	3/3/18 19:06	65	4/3/18 12:11	66	4/3/18 21:16	62	6/3/18 22:21	64	9/3/18 19:26	69
28/2/18 22:06	64	3/3/18 19:11	65	4/3/18 12:16	67	4/3/18 21:21	59	6/3/18 22:26	65	9/3/18 19:31	67
28/2/18 22:11	64	3/3/18 19:16	67	4/3/18 12:21	66	4/3/18 21:26	64	6/3/18 22:31	65	9/3/18 19:36	65
28/2/18 22:16	64	3/3/18 19:21	65	4/3/18 12:26	65	4/3/18 21:31	60	6/3/18 22:36	64	9/3/18 19:41	66
28/2/18 22:21	64	3/3/18 19:26	64	4/3/18 12:31	65	4/3/18 21:36	63	6/3/18 22:41	65	9/3/18 19:46	65
28/2/18 22:26	64	3/3/18 19:31	64	4/3/18 12:36	67	4/3/18 21:41	61	6/3/18 22:46	67	9/3/18 19:51	66
28/2/18 22:31	65	3/3/18 19:36	66	4/3/18 12:41	66	4/3/18 21:46	64	6/3/18 22:51	66	9/3/18 19:56	66
28/2/18 22:36	63	3/3/18 19:41	66	4/3/18 12:46	66	4/3/18 21:51	61	6/3/18 22:56	65	9/3/18 20:01	66
28/2/18 22:41	65	3/3/18 19:46	65	4/3/18 12:51	66	4/3/18 21:56	62	7/3/18 19:01	67	9/3/18 20:06	68
28/2/18 22:46	64	3/3/18 19:51	64	4/3/18 12:56	66	4/3/18 22:01	61	7/3/18 19:06	67	9/3/18 20:11	68
28/2/18 22:51	64	3/3/18 19:56	65	4/3/18 13:01	66	4/3/18 22:06	62	7/3/18 19:11	67	9/3/18 20:16	65
28/2/18 22:56	63	3/3/18 20:01	65	4/3/18 13:06	65	4/3/18 22:11	63	7/3/18 19:16	68	9/3/18 20:21	66
1/3/18 19:01	66	3/3/18 20:06	64	4/3/18 13:11	67	4/3/18 22:16	62	7/3/18 19:21	68	9/3/18 20:26	66
1/3/18 19:06	66	3/3/18 20:11	62	4/3/18 13:16	66	4/3/18 22:21	61	7/3/18 19:26	66	9/3/18 20:31	65
1/3/18 19:11	66	3/3/18 20:16	63	4/3/18 13:21	66	4/3/18 22:26	63	7/3/18 19:31	68	9/3/18 20:36	66
1/3/18 19:16	66	3/3/18 20:21	62	4/3/18 13:26	64	4/3/18 22:31	62	7/3/18 19:36	67	9/3/18 20:41	66
1/3/18 19:21	66	3/3/18 20:26	63	4/3/18 13:31	64	4/3/18 22:36	62	7/3/18 19:41	69	9/3/18 20:46	68
1/3/18 19:26	66	3/3/18 20:31	65	4/3/18 13:36	64	4/3/18 22:41	62	7/3/18 19:46	67	9/3/18 20:51	65
1/3/18 19:31	65	3/3/18 20:36	65	4/3/18 13:41	64	4/3/18 22:46	60	7/3/18 19:51	67	9/3/18 20:56	64
1/3/18 19:36	66	3/3/18 20:41	66	4/3/18 13:46	64	4/3/18 22:51	62	7/3/18 19:56	67	9/3/18 21:01	65
1/3/18 19:41	66	3/3/18 20:46	63	4/3/18 13:51	64	4/3/18 22:56	59	7/3/18 20:01	67	9/3/18 21:06	65
1/3/18 19:46	66	3/3/18 20:51	63	4/3/18 13:56	66	5/3/18 19:01	66	7/3/18 20:06	66	9/3/18 21:11	65
1/3/18 19:51	66	3/3/18 20:56	64	4/3/18 14:01	64	5/3/18 19:06	67	7/3/18 20:11	65	9/3/18 21:16	65
1/3/18 19:56	65	3/3/18 21:01	62	4/3/18 14:06	65	5/3/18 19:11	67	7/3/18 20:16	67	9/3/18 21:21	68
1/3/18 20:01	66	3/3/18 21:06	63	4/3/18 14:11	65	5/3/18 19:16	65	7/3/18 20:21	66	9/3/18 21:26	66
1/3/18 20:06	65	3/3/18 21:11	60	4/3/18 14:16	66	5/3/18 19:21	67	7/3/18 20:26	66	9/3/18 21:31	65
1/3/18 20:11	65	3/3/18 21:16	65	4/3/18 14:21	66	5/3/18 19:26	67	7/3/18 20:31	66	9/3/18 21:36	65
1/3/18 20:16	65	3/3/18 21:21	64	4/3/18 14:26	65	5/3/18 19:31	67	7/3/18 20:36	65	9/3/18 21:41	65
1/3/18 20:21	64	3/3/18 21:26	62	4/3/18 14:31	67	5/3/18 19:36	66	7/3/18 20:41	65	9/3/18 21:46	65
1/3/18 20:26	64	3/3/18 21:31	62	4/3/18 14:36	67	5/3/18 19:41	67	7/3/18 20:46	66	9/3/18 21:51	66
1/3/18 20:31	65	3/3/18 21:36	60	4/3/18 14:41	66	5/3/18 19:46	67	7/3/18 20:51	67	9/3/18 21:56	65
1/3/18 20:36	64	3/3/18 21:41	63	4/3/18 14:46	66	5/3/18 19:51	68	7/3/18 20:56	64	9/3/18 22:01	65
1/3/18 20:41	65	3/3/18 21:46	61	4/3/18 14:51	67	5/3/18 19:56	68	7/3/18 21:01	65	9/3/18 22:06	65
1/3/18 20:46	64	3/3/18 21:51	63	4/3/18 14:56	67	5/3/18 20:01	65	7/3/18 21:06	63	9/3/18 22:11	65
1/3/18 20:51	65	3/3/18 21:56	63	4/3/18 15:01	66	5/3/18 20:06	65	7/3/18 21:11	64	9/3/18 22:16	67
1/3/18 20:56	64	3/3/18 22:01	64	4/3/18 15:06	66	5/3/18 20:11	65	7/3/18 21:16	65	9/3/18 22:21	66
1/3/18 21:01	64	3/3/18 22:06	64	4/3/18 15:11	65	5/3/18 20:16	64	7/3/18 21:21	63	9/3/18 22:26	65
1/3/18 21:06	65	3/3/18 22:11	63	4/3/18 15:16	64	5/3/18 20:21	65	7/3/18 21:26	64	9/3/18 22:31	65
1/3/18 21:11	64	3/3/18 22:16	64	4/3/18 15:21	66	5/3/18 20:26	65	7/3/18 21:31	64	9/3/18 22:36	66
1/3/18 21:16	64	3/3/18 22:21	64	4/3/18 15:26	65	5/3/18 20:31	65	7/3/18 21:36	65	9/3/18 22:41	66
1/3/18 21:21	65	3/3/18 22:26	64	4/3/18 15:31	65	5/3/18 20:36	64	7/3/18 21:41	64	9/3/18 22:46	65
1/3/18 21:26	65	3/3/18 22:31	65	4/3/18 15:36	68	5/3/18 20:41	65	7/3/18 21:46	65	9/3/18 22:51	67
1/3/18 21:31	65	3/3/18 22:36	63	4/3/18 15:41	68	5/3/18 20:46	64	7/3/18 21:51	66	9/3/18 22:56	66
1/3/18 21:36	64	3/3/18 22:41	64	4/3/18 15:46	65	5/3/18 20:51	63	7/3/18 21:56	64	10/3/18 19:01	67
1/3/18 21:41	63	3/3/18 22:46	64	4/3/18 15:51	66	5/3/18 20:56	65	7/3/18 22:01	65	10/3/18 19:06	67
1/3/18 21:46	64	3/3/18 22:51	64	4/3/18 15:56	65	5/3/18 21:01	65	7/3/18 22:06	64	10/3/18 19:11	66
1/3/18 21:51	64	3/3/18 22:56	64	4/3/18 16:01	67	5/3/18 21:06	64	7/3/18 22:11	65	10/3/18 19:16	66
1/3/18 21:56	65	4/3/18 7:01	54	4/3/18 16:06	66	5/3/18 21:11	64	7/3/18 22:16	64	10/3/18 19:21	66
1/3/18 22:01	65	4/3/18 7:06	68	4/3/18 16:11	66	5/3/18 21:16	64	7/3/18 22:21	65	10/3/18 19:26	66
1/3/18 22:06	64	4/3/18 7:11	66	4/3/18 16:16	66	5/3/18 21:21	65	7/3/18 22:26	64	10/3/18 19:31	67
1/3/18 22:11	64	4/3/18 7:16	76	4/3/18 16:21	65	5/3/18 21:26	64	7/3/18 22:31	66	10/3/18 19:36	67
1/3/18 22:16	65	4/3/18 7:21	76	4/3/18 16:26	68	5/3/18 21:31	65	7/3/18 22:36	65	10/3/18 19:41	66
1/3/18 22:21	65	4/3/18 7:26	73	4/3/18 16:31	65	5/3/18 21:36	66	7/3/18 22:41	63	10/3/18 19:46	66
1/3/18 22:26	64	4/3/18 7:31	67	4/3/18 16:36	65	5/3/18 21:41	61	7/3/18 22:46	64	10/3/18 19:51	67
1/3/18 22:31	65	4/3/18 7:36	59	4/3/18 16:41	65	5/3/18 21:46	65	7/3/18 22:51	65	10/3/18 19:56	66
1/3/18 22:36	64	4/3/18 7:41	60	4/3/18 16:46	65	5/3/18 21:51	65	7/3/18 22:56	63	10/3/18 20:01	66
1/3/18 22:41	65	4/3/18 7:46	64	4/3/18 16:51	65	5/3/18 21:56	63	8/3/18 19:01	67	10/3/18 20:06	64
1/3/18 22:46	65	4/3/18 7:51	64	4/3/18 16:56	66	5/3/18 22:01	62	8/3/18 19:06	68	10/3/18 20:11	64
1/3/18 22:51	63	4/3/18 7:56	64	4/3/18 17:01	65	5/3/18 22:06	63	8/3/18 19:11	68	10/3/18 20:16	66
1/3/18 22:56	65	4/3/18 8:01	63	4/3/18 17:06	66	5/3/18 22:11	64	8/3/18 19:16	67	10/3/18 20:21	67
2/3/18 19:01	66	4/3/18 8:06	69	4/3/18 17:11	65	5/3/18 22:16	66	8/3/18 19:21	67	10/3/18 20:26	64
2/3/18 19:06	65	4/3/18 8:11	69	4/3/18 17:16	67	5/3/18 22:21	64	8/3/18 19:26	67	10/3/18 20:31	67
2/3/18 19:11	67	4/3/18 8:16	70	4/3/18 17:21	65	5/3/18 22:26	66	8/3/18 19:31	66	10/3/18 20:36	65
2/3/18 19:16	67	4/3/18 8:21	66	4/3/18 17:26	65	5/3/18 22:31	64	8/3/18 19:36	66	10/3/18 20:41	64
2/3/18 19:21	65	4/3/18 8:26	66	4/3/18 17:31	65	5/3/18 22:36	66	8/3/18 19:41	67	10/3/18 20:46	64
2/3/18 19:26	66	4/3/18 8:31	69	4/3/18 17:36	63	5/3/18 22:41	65	8/3/18 19:46	67	10/3/18 20:51	69
2/3/18 19:31	68	4/3/18 8:36	66	4/3/18 17:41	66	5/3/18 22:46	63	8/3/18 19:51	67	10/3/18 20:56	64
2/3/18 19:36	66	4/3/18 8:41	65	4/3/18 17:46	65	5/3/18 22:51	64	8/3/18 19:56	68	10/3/18 21:01	65
2/3/18 19:41	66	4/3/18 8:46	65	4/3/18 17:51	65	5/3/18 22:56	62	8/3/18 20:01	69	10/3/18 21:06	66
2/3/18 19:46	67	4/3/18 8:51	69								

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)									
11/3/18 7:26	59	11/3/18 16:31	66	12/3/18 21:36	65	14/3/18 22:41	66	17/3/18 19:46	63	18/3/18 12:51	66
11/3/18 7:31	61	11/3/18 16:36	66	12/3/18 21:41	63	14/3/18 22:46	65	17/3/18 19:51	66	18/3/18 12:56	67
11/3/18 7:36	65	11/3/18 16:41	67	12/3/18 21:46	65	14/3/18 22:51	66	17/3/18 19:56	65	18/3/18 13:01	67
11/3/18 7:41	62	11/3/18 16:46	66	12/3/18 21:51	64	14/3/18 22:56	65	17/3/18 20:01	65	18/3/18 13:06	67
11/3/18 7:46	65	11/3/18 16:51	68	12/3/18 21:56	63	15/3/18 19:01	67	17/3/18 20:06	64	18/3/18 13:11	66
11/3/18 7:51	67	11/3/18 16:56	67	12/3/18 22:01	70	15/3/18 19:06	66	17/3/18 20:11	66	18/3/18 13:16	67
11/3/18 7:56	66	11/3/18 17:01	67	12/3/18 22:06	64	15/3/18 19:11	68	17/3/18 20:16	65	18/3/18 13:21	66
11/3/18 8:01	65	11/3/18 17:06	66	12/3/18 22:11	64	15/3/18 19:16	67	17/3/18 20:21	67	18/3/18 13:26	67
11/3/18 8:06	65	11/3/18 17:11	66	12/3/18 22:16	65	15/3/18 19:21	68	17/3/18 20:26	65	18/3/18 13:31	65
11/3/18 8:11	66	11/3/18 17:16	66	12/3/18 22:21	63	15/3/18 19:26	68	17/3/18 20:31	63	18/3/18 13:36	71
11/3/18 8:16	66	11/3/18 17:21	66	12/3/18 22:26	65	15/3/18 19:31	67	17/3/18 20:36	64	18/3/18 13:41	66
11/3/18 8:21	68	11/3/18 17:26	65	12/3/18 22:31	65	15/3/18 19:36	68	17/3/18 20:41	64	18/3/18 13:46	66
11/3/18 8:26	66	11/3/18 17:31	66	12/3/18 22:36	65	15/3/18 19:41	66	17/3/18 20:46	64	18/3/18 13:51	67
11/3/18 8:31	68	11/3/18 17:36	65	12/3/18 22:41	65	15/3/18 19:46	67	17/3/18 20:51	65	18/3/18 13:56	68
11/3/18 8:36	67	11/3/18 17:41	66	12/3/18 22:46	64	15/3/18 19:51	67	17/3/18 20:56	63	18/3/18 14:01	66
11/3/18 8:41	66	11/3/18 17:46	67	12/3/18 22:51	63	15/3/18 19:56	68	17/3/18 21:01	63	18/3/18 14:06	66
11/3/18 8:46	67	11/3/18 17:51	66	12/3/18 22:56	64	15/3/18 20:01	65	17/3/18 21:06	63	18/3/18 14:11	68
11/3/18 8:51	66	11/3/18 17:56	66	13/3/18 19:01	63	15/3/18 20:06	66	17/3/18 21:11	65	18/3/18 14:16	67
11/3/18 8:56	66	11/3/18 18:01	67	13/3/18 19:06	65	15/3/18 20:11	66	17/3/18 21:16	65	18/3/18 14:21	67
11/3/18 9:01	67	11/3/18 18:06	58	13/3/18 19:11	67	15/3/18 20:16	65	17/3/18 21:21	63	18/3/18 14:26	66
11/3/18 9:06	66	11/3/18 18:11	61	13/3/18 19:16	66	15/3/18 20:21	65	17/3/18 21:26	63	18/3/18 14:31	67
11/3/18 9:11	68	11/3/18 18:16	61	13/3/18 19:21	66	15/3/18 20:26	66	17/3/18 21:31	65	18/3/18 14:36	66
11/3/18 9:16	67	11/3/18 18:21	64	13/3/18 19:26	68	15/3/18 20:31	66	17/3/18 21:36	65	18/3/18 14:41	67
11/3/18 9:21	70	11/3/18 18:26	67	13/3/18 19:31	67	15/3/18 20:36	66	17/3/18 21:41	64	18/3/18 14:46	66
11/3/18 9:26	68	11/3/18 18:31	68	13/3/18 19:36	67	15/3/18 20:41	65	17/3/18 21:46	66	18/3/18 14:51	67
11/3/18 9:31	67	11/3/18 18:36	67	13/3/18 19:41	67	15/3/18 20:46	65	17/3/18 21:51	65	18/3/18 14:56	64
11/3/18 9:36	68	11/3/18 18:41	65	13/3/18 19:46	66	15/3/18 20:51	67	17/3/18 21:56	64	18/3/18 15:01	65
11/3/18 9:41	68	11/3/18 18:46	66	13/3/18 19:51	67	15/3/18 20:56	65	17/3/18 22:01	65	18/3/18 15:06	67
11/3/18 9:46	67	11/3/18 18:51	66	13/3/18 19:56	67	15/3/18 21:01	64	17/3/18 22:06	66	18/3/18 15:11	65
11/3/18 9:51	67	11/3/18 18:56	66	13/3/18 20:01	67	15/3/18 21:06	65	17/3/18 22:11	66	18/3/18 15:16	65
11/3/18 9:56	68	11/3/18 19:01	66	13/3/18 20:06	65	15/3/18 21:11	65	17/3/18 22:16	66	18/3/18 15:21	66
11/3/18 10:01	67	11/3/18 19:06	65	13/3/18 20:11	65	15/3/18 21:16	65	17/3/18 22:21	65	18/3/18 15:26	64
11/3/18 10:06	67	11/3/18 19:11	66	13/3/18 20:16	66	15/3/18 21:21	65	17/3/18 22:26	65	18/3/18 15:31	66
11/3/18 10:11	68	11/3/18 19:16	66	13/3/18 20:21	65	15/3/18 21:26	66	17/3/18 22:31	65	18/3/18 15:36	67
11/3/18 10:16	67	11/3/18 19:21	67	13/3/18 20:26	67	15/3/18 21:31	67	17/3/18 22:36	65	18/3/18 15:41	66
11/3/18 10:21	66	11/3/18 19:26	65	13/3/18 20:31	66	15/3/18 21:36	65	17/3/18 22:41	65	18/3/18 15:46	66
11/3/18 10:26	67	11/3/18 19:31	67	13/3/18 20:36	65	15/3/18 21:41	67	17/3/18 22:46	65	18/3/18 15:51	65
11/3/18 10:31	66	11/3/18 19:36	66	13/3/18 20:41	64	15/3/18 21:46	65	17/3/18 22:51	65	18/3/18 15:56	66
11/3/18 10:36	69	11/3/18 19:41	66	13/3/18 20:46	66	15/3/18 21:51	65	17/3/18 22:56	65	18/3/18 16:01	65
11/3/18 10:41	66	11/3/18 19:46	65	13/3/18 20:51	65	15/3/18 21:56	65	18/3/18 23:01	64	18/3/18 16:06	68
11/3/18 10:46	67	11/3/18 19:51	67	13/3/18 20:56	67	15/3/18 22:01	64	18/3/18 23:06	61	18/3/18 16:11	67
11/3/18 10:51	67	11/3/18 19:56	66	13/3/18 21:01	64	15/3/18 22:06	65	18/3/18 23:11	64	18/3/18 16:16	66
11/3/18 10:56	68	11/3/18 20:01	65	13/3/18 21:06	64	15/3/18 22:11	67	18/3/18 23:16	63	18/3/18 16:21	66
11/3/18 11:01	67	11/3/18 20:06	64	13/3/18 21:11	65	15/3/18 22:16	66	18/3/18 23:21	62	18/3/18 16:26	66
11/3/18 11:06	66	11/3/18 20:11	64	13/3/18 21:16	66	15/3/18 22:21	66	18/3/18 23:26	62	18/3/18 16:31	65
11/3/18 11:11	67	11/3/18 20:16	64	13/3/18 21:21	65	15/3/18 22:26	65	18/3/18 23:31	65	18/3/18 16:36	67
11/3/18 11:16	67	11/3/18 20:21	65	13/3/18 21:26	66	15/3/18 22:31	66	18/3/18 23:36	62	18/3/18 16:41	66
11/3/18 11:21	68	11/3/18 20:26	63	13/3/18 21:31	65	15/3/18 22:36	66	18/3/18 23:41	67	18/3/18 16:46	66
11/3/18 11:26	67	11/3/18 20:31	62	13/3/18 21:36	65	15/3/18 22:41	66	18/3/18 23:46	65	18/3/18 16:51	66
11/3/18 11:31	67	11/3/18 20:36	63	13/3/18 21:41	65	15/3/18 22:46	65	18/3/18 23:51	66	18/3/18 16:56	68
11/3/18 11:36	67	11/3/18 20:41	64	13/3/18 21:46	65	15/3/18 22:51	68	18/3/18 23:56	66	18/3/18 17:01	66
11/3/18 11:41	67	11/3/18 20:46	65	13/3/18 21:51	65	15/3/18 22:56	65	18/3/18 8:01	72	18/3/18 17:06	68
11/3/18 11:46	67	11/3/18 20:51	65	13/3/18 21:56	64	16/3/18 19:01	66	18/3/18 8:06	68	18/3/18 17:11	68
11/3/18 11:51	67	11/3/18 20:56	66	13/3/18 22:01	65	16/3/18 19:06	59	18/3/18 8:11	68	18/3/18 17:16	66
11/3/18 11:56	67	11/3/18 21:01	64	13/3/18 22:06	65	16/3/18 19:11	54	18/3/18 8:16	66	18/3/18 17:21	68
11/3/18 12:01	67	11/3/18 21:06	65	13/3/18 22:11	65	16/3/18 19:16	65	18/3/18 8:21	67	18/3/18 17:26	66
11/3/18 12:06	67	11/3/18 21:11	68	13/3/18 22:16	65	16/3/18 19:21	59	18/3/18 8:26	71	18/3/18 17:31	67
11/3/18 12:11	66	11/3/18 21:16	64	13/3/18 22:21	68	16/3/18 19:26	58	18/3/18 8:31	67	18/3/18 17:36	67
11/3/18 12:16	67	11/3/18 21:21	64	13/3/18 22:26	66	16/3/18 19:31	60	18/3/18 8:36	68	18/3/18 17:41	67
11/3/18 12:21	67	11/3/18 21:26	66	13/3/18 22:31	65	16/3/18 19:36	61	18/3/18 8:41	66	18/3/18 17:46	66
11/3/18 12:26	66	11/3/18 21:31	66	13/3/18 22:36	66	16/3/18 19:41	65	18/3/18 8:46	66	18/3/18 17:51	65
11/3/18 12:31	67	11/3/18 21:36	65	13/3/18 22:41	66	16/3/18 19:46	66	18/3/18 8:51	65	18/3/18 17:56	68
11/3/18 12:36	66	11/3/18 21:41	65	13/3/18 22:46	64	16/3/18 19:51	68	18/3/18 8:56	66	18/3/18 18:01	66
11/3/18 12:41	66	11/3/18 21:46	63	13/3/18 22:51	65	16/3/18 19:56	65	18/3/18 9:01	66	18/3/18 18:06	67
11/3/18 12:46	66	11/3/18 21:51	66	13/3/18 22:56	65	16/3/18 20:01	67	18/3/18 9:06	67	18/3/18 18:11	66
11/3/18 12:51	66	11/3/18 21:56	65	14/3/18 19:01	67	16/3/18 20:06	66	18/3/18 9:11	68	18/3/18 18:16	65
11/3/18 12:56	67	11/3/18 22:01	64	14/3/18 19:06	67	16/3/18 20:11	65	18/3/18 9:16	71	18/3/18 18:21	68
11/3/18 13:01	66	11/3/18 22:06	65	14/3/18 19:11	68	16/3/18 20:16	66	18/3/18 9:21	65	18/3/18 18:26	68
11/3/18 13:06	67	11/3/18 22:11	64	14/3/18 19:16	68	16/3/18 20:21	65	18/3/18 9:26	68	18/3/18 18:31	68
11/3/18 13:11	66	11/3/18 22:16	64	14/3/18 19:21	67	16/3/18 20:26	64	18/3/18 9:31	67	18/3/18 18:36	67
11/3/18 13:16	66	11/3/18 22:21	64	14/3/18 19:26	68	16/3/18 20:31	64	18/3/18 9:36	68	18/3/18 18:41	66
11/3/18 13:21	67	11/3/18 22:26	64	14/3/18 19:31	66	16/3/18 20:36	64	18/3/18 9:41	68	18/3/18 18:46	67
11/3/18 13:26	66	11/3/18 22:31	64	14/3/18 19:36	67	16/3/18 20:41	67	18/3/18 9:46	66	18/3/18 18:51	66
11/3/18 13:31	66	11/3/18 22:36	64	14/3/18 19:41	67	16/3/18 20:46	65	18/3/18 9:51	67	18/3/18 18:56	66
11/3/18 13:36	67	11/3/18 22:41	65	14/3/18 19:46	66	16/3/18 20:51	65	18/3/18 9:56	67	18/3/18 19:01	66
11/3/18 13:41	66	11/3/18 22:46	63	14/3/18 19:51	66	16/3/18 20:56	65	18/3/18 10:01	68	18/3/18 19:06	68
11/3/18 13:46	64	11/3/18 22:51	63	14/3/18 19:56	66	16/3/18 21:01	63	18/3/18 10:06	66	18/3/18 19:11	66
11/3/18 13:51	65	11/3/18 22:56	63	14/3/18 20:01	66	16/3/18 21:06	64	18/3/18 10:11	67	18/3/18 19:16	65
11/3/18 13:56	65	12/3/18 19:01	67	14/3/18 20:06	67	16/3/18 21:11	65	18/3/18 10:16	68	18/3/18 19:21	66
11/3/18 14:01	67	12/3/18 19:06	66	14/3/18 20:11	67	16/					

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)									
18/3/18 21:56	64	21/3/18 19:01	66	23/3/18 20:06	66	25/3/18 9:11	67	25/3/18 18:16	67	27/2/18 0:06	64
18/3/18 22:01	67	21/3/18 19:06	67	23/3/18 20:11	65	25/3/18 9:16	67	25/3/18 18:21	67	27/2/18 0:11	65
18/3/18 22:06	63	21/3/18 19:11	66	23/3/18 20:16	66	25/3/18 9:21	67	25/3/18 18:26	68	27/2/18 0:16	65
18/3/18 22:11	65	21/3/18 19:16	66	23/3/18 20:21	59	25/3/18 9:26	72	25/3/18 18:31	65	27/2/18 0:21	66
18/3/18 22:16	63	21/3/18 19:21	66	23/3/18 20:26	61	25/3/18 9:31	67	25/3/18 18:36	67	27/2/18 0:26	65
18/3/18 22:21	65	21/3/18 19:26	67	23/3/18 20:31	61	25/3/18 9:36	67	25/3/18 18:41	66	27/2/18 0:31	65
18/3/18 22:26	62	21/3/18 19:31	67	23/3/18 20:36	62	25/3/18 9:41	66	25/3/18 18:46	66	27/2/18 0:36	64
18/3/18 22:31	65	21/3/18 19:36	67	23/3/18 20:41	66	25/3/18 9:46	67	25/3/18 18:51	67	27/2/18 0:41	64
18/3/18 22:36	65	21/3/18 19:41	67	23/3/18 20:46	65	25/3/18 9:51	68	25/3/18 18:56	65	27/2/18 0:46	63
18/3/18 22:41	62	21/3/18 19:46	67	23/3/18 20:51	64	25/3/18 9:56	67	25/3/18 19:01	66	27/2/18 0:51	63
18/3/18 22:46	62	21/3/18 19:51	68	23/3/18 20:56	65	25/3/18 10:01	67	25/3/18 19:06	67	27/2/18 0:56	64
18/3/18 22:51	64	21/3/18 19:56	67	23/3/18 21:01	64	25/3/18 10:06	68	25/3/18 19:11	64	27/2/18 1:01	63
18/3/18 22:56	65	21/3/18 20:01	67	23/3/18 21:06	66	25/3/18 10:11	66	25/3/18 19:16	64	27/2/18 1:06	62
19/3/18 19:01	66	21/3/18 20:06	67	23/3/18 21:11	63	25/3/18 10:16	67	25/3/18 19:21	65	27/2/18 1:11	61
19/3/18 19:06	65	21/3/18 20:11	67	23/3/18 21:16	65	25/3/18 10:21	68	25/3/18 19:26	66	27/2/18 1:16	61
19/3/18 19:11	66	21/3/18 20:16	67	23/3/18 21:21	64	25/3/18 10:26	69	25/3/18 19:31	64	27/2/18 1:21	63
19/3/18 19:16	66	21/3/18 20:21	67	23/3/18 21:26	65	25/3/18 10:31	70	25/3/18 19:36	64	27/2/18 1:26	58
19/3/18 19:21	66	21/3/18 20:26	67	23/3/18 21:31	64	25/3/18 10:36	68	25/3/18 19:41	64	27/2/18 1:31	62
19/3/18 19:26	66	21/3/18 20:31	67	23/3/18 21:36	64	25/3/18 10:41	67	25/3/18 19:46	66	27/2/18 1:36	60
19/3/18 19:31	66	21/3/18 20:36	66	23/3/18 21:41	66	25/3/18 10:46	67	25/3/18 19:51	65	27/2/18 1:41	61
19/3/18 19:36	66	21/3/18 20:41	66	23/3/18 21:46	65	25/3/18 10:51	68	25/3/18 19:56	66	27/2/18 1:46	58
19/3/18 19:41	66	21/3/18 20:46	67	23/3/18 21:51	68	25/3/18 10:56	67	25/3/18 20:01	65	27/2/18 1:51	60
19/3/18 19:46	65	21/3/18 20:51	66	23/3/18 21:56	66	25/3/18 11:01	67	25/3/18 20:06	66	27/2/18 1:56	61
19/3/18 19:51	69	21/3/18 20:56	65	23/3/18 22:01	66	25/3/18 11:06	67	25/3/18 20:11	65	27/2/18 2:01	59
19/3/18 19:56	66	21/3/18 21:01	64	23/3/18 22:06	68	25/3/18 11:11	66	25/3/18 20:16	70	27/2/18 2:06	56
19/3/18 20:01	64	21/3/18 21:06	65	23/3/18 22:11	66	25/3/18 11:16	67	25/3/18 20:21	65	27/2/18 2:11	58
19/3/18 20:06	65	21/3/18 21:11	65	23/3/18 22:16	67	25/3/18 11:21	66	25/3/18 20:26	67	27/2/18 2:16	49
19/3/18 20:11	65	21/3/18 21:16	64	23/3/18 22:21	66	25/3/18 11:26	68	25/3/18 20:31	63	27/2/18 2:21	56
19/3/18 20:16	65	21/3/18 21:21	64	23/3/18 22:26	67	25/3/18 11:31	67	25/3/18 20:36	66	27/2/18 2:26	59
19/3/18 20:21	63	21/3/18 21:26	66	23/3/18 22:31	64	25/3/18 11:36	66	25/3/18 20:41	64	27/2/18 2:31	56
19/3/18 20:26	64	21/3/18 21:31	65	23/3/18 22:36	66	25/3/18 11:41	67	25/3/18 20:46	65	27/2/18 2:36	61
19/3/18 20:31	63	21/3/18 21:36	68	23/3/18 22:41	66	25/3/18 11:46	66	25/3/18 20:51	68	27/2/18 2:41	58
19/3/18 20:36	65	21/3/18 21:41	66	23/3/18 22:46	66	25/3/18 11:51	66	25/3/18 20:56	63	27/2/18 2:46	58
19/3/18 20:41	64	21/3/18 21:46	65	23/3/18 22:51	66	25/3/18 11:56	66	25/3/18 21:01	64	27/2/18 2:51	62
19/3/18 20:46	64	21/3/18 21:51	66	23/3/18 22:56	65	25/3/18 12:01	67	25/3/18 21:06	63	27/2/18 2:56	58
19/3/18 20:51	66	21/3/18 21:56	65	24/3/18 19:01	68	25/3/18 12:06	67	25/3/18 21:11	65	27/2/18 3:01	57
19/3/18 20:56	65	21/3/18 22:01	65	24/3/18 19:06	67	25/3/18 12:11	67	25/3/18 21:16	65	27/2/18 3:06	59
19/3/18 21:01	64	21/3/18 22:06	65	24/3/18 19:11	67	25/3/18 12:16	66	25/3/18 21:21	66	27/2/18 3:11	45
19/3/18 21:06	64	21/3/18 22:11	66	24/3/18 19:16	68	25/3/18 12:21	67	25/3/18 21:26	65	27/2/18 3:16	63
19/3/18 21:11	65	21/3/18 22:16	65	24/3/18 19:21	67	25/3/18 12:26	67	25/3/18 21:31	64	27/2/18 3:21	63
19/3/18 21:16	64	21/3/18 22:21	66	24/3/18 19:26	66	25/3/18 12:31	67	25/3/18 21:36	65	27/2/18 3:26	54
19/3/18 21:21	62	21/3/18 22:26	65	24/3/18 19:31	66	25/3/18 12:36	67	25/3/18 21:41	63	27/2/18 3:31	57
19/3/18 21:26	63	21/3/18 22:31	65	24/3/18 19:36	65	25/3/18 12:41	67	25/3/18 21:46	64	27/2/18 3:36	59
19/3/18 21:31	63	21/3/18 22:36	64	24/3/18 19:41	66	25/3/18 12:46	67	25/3/18 21:51	65	27/2/18 3:41	59
19/3/18 21:36	64	21/3/18 22:41	67	24/3/18 19:46	66	25/3/18 12:51	66	25/3/18 21:56	64	27/2/18 3:46	53
19/3/18 21:41	62	21/3/18 22:46	68	24/3/18 19:51	67	25/3/18 12:56	67	25/3/18 22:01	63	27/2/18 3:51	61
19/3/18 21:46	63	21/3/18 22:51	66	24/3/18 19:56	65	25/3/18 13:01	67	25/3/18 22:06	65	27/2/18 3:56	63
19/3/18 21:51	62	21/3/18 22:56	66	24/3/18 20:01	65	25/3/18 13:06	66	25/3/18 22:11	66	27/2/18 4:01	62
19/3/18 21:56	62	22/3/18 19:01	66	24/3/18 20:06	63	25/3/18 13:11	65	25/3/18 22:16	64	27/2/18 4:06	56
19/3/18 22:01	62	22/3/18 19:06	67	24/3/18 20:11	67	25/3/18 13:16	66	25/3/18 22:21	62	27/2/18 4:11	62
19/3/18 22:06	62	22/3/18 19:11	66	24/3/18 20:16	66	25/3/18 13:21	66	25/3/18 22:26	64	27/2/18 4:16	55
19/3/18 22:11	62	22/3/18 19:16	67	24/3/18 20:21	65	25/3/18 13:26	66	25/3/18 22:31	61	27/2/18 4:21	64
19/3/18 22:16	62	22/3/18 19:21	66	24/3/18 20:26	65	25/3/18 13:31	67	25/3/18 22:36	64	27/2/18 4:26	63
19/3/18 22:21	61	22/3/18 19:26	67	24/3/18 20:31	64	25/3/18 13:36	66	25/3/18 22:41	62	27/2/18 4:31	60
19/3/18 22:26	60	22/3/18 19:31	65	24/3/18 20:36	63	25/3/18 13:41	65	25/3/18 22:46	63	27/2/18 4:36	57
19/3/18 22:31	61	22/3/18 19:36	65	24/3/18 20:41	65	25/3/18 13:46	66	25/3/18 22:51	64	27/2/18 4:41	52
19/3/18 22:36	66	22/3/18 19:41	67	24/3/18 20:46	65	25/3/18 13:51	67	25/3/18 22:56	60	27/2/18 4:46	55
19/3/18 22:41	62	22/3/18 19:46	66	24/3/18 20:51	63	25/3/18 13:56	66	26/3/18 19:01	63	27/2/18 4:51	57
19/3/18 22:46	61	22/3/18 19:51	67	24/3/18 20:56	61	25/3/18 14:01	67	26/3/18 19:06	62	27/2/18 4:56	57
19/3/18 22:51	61	22/3/18 19:56	66	24/3/18 21:01	63	25/3/18 14:06	66	26/3/18 19:11	65	27/2/18 5:01	60
19/3/18 22:56	62	22/3/18 20:01	68	24/3/18 21:06	63	25/3/18 14:11	67	26/3/18 19:16	66	27/2/18 5:06	55
20/3/18 19:01	68	22/3/18 20:06	67	24/3/18 21:11	63	25/3/18 14:16	66	26/3/18 19:21	66	27/2/18 5:11	58
20/3/18 19:06	66	22/3/18 20:11	66	24/3/18 21:16	63	25/3/18 14:21	65	26/3/18 19:26	66	27/2/18 5:16	58
20/3/18 19:11	67	22/3/18 20:16	65	24/3/18 21:21	64	25/3/18 14:26	66	26/3/18 19:31	66	27/2/18 5:21	55
20/3/18 19:16	67	22/3/18 20:21	65	24/3/18 21:26	65	25/3/18 14:31	66	26/3/18 19:36	66	27/2/18 5:26	60
20/3/18 19:21	67	22/3/18 20:26	66	24/3/18 21:31	65	25/3/18 14:36	66	26/3/18 19:41	67	27/2/18 5:31	60
20/3/18 19:26	66	22/3/18 20:31	66	24/3/18 21:36	63	25/3/18 14:41	66	26/3/18 19:46	67	27/2/18 5:36	58
20/3/18 19:31	67	22/3/18 20:36	66	24/3/18 21:41	66	25/3/18 14:46	66	26/3/18 19:51	67	27/2/18 5:41	60
20/3/18 19:36	68	22/3/18 20:41	67	24/3/18 21:46	65	25/3/18 14:51	67	26/3/18 19:56	67	27/2/18 5:46	61
20/3/18 19:41	68	22/3/18 20:46	67	24/3/18 21:51	65	25/3/18 14:56	66	26/3/18 20:01	66	27/2/18 5:51	65
20/3/18 19:46	66	22/3/18 20:51	65	24/3/18 21:56	65	25/3/18 15:01	66	26/3/18 20:06	66	27/2/18 5:56	60
20/3/18 19:51	66	22/3/18 20:56	65	24/3/18 22:01	66	25/3/18 15:06	67	26/3/18 20:11	65	27/2/18 6:01	62
20/3/18 19:56	70	22/3/18 21:01	65	24/3/18 22:06	64	25/3/18 15:11	66	26/3/18 20:16	65	27/2/18 6:06	65
20/3/18 20:01	66	22/3/18 21:06	65	24/3/18 22:11	64	25/3/18 15:16	66	26/3/18 20:21	67	27/2/18 6:11	64
20/3/18 20:06	65	22/3/18 21:11	65	24/3/18 22:16	64	25/3/18 15:21	66	26/3/18 20:26	64	27/2/18 6:16	64
20/3/18 20:11	66	22/3/18 21:16	65	24/3/18 22:21	64	25/3/18 15:26	67	26/3/18 20:31	67	27/2/18 6:21	65
20/3/18 20:16	68	22/3/18 21:21	66	24/3/18 22:26	64	25/3/18 15:31	66	26/3/18 20:36	66	27/2/18 6:26	66
20/3/18 20:21	65	22/3/18 21:26	65	24/3/18 22:31	65	25/3/18 15:36	67	26/3/18 20:41	63	27/2/18 6:31	66
20/3/18 20:26	65	22/3/18 21:31	65	24/3/18 22:36	64	25/3/18 15:41	66	26/3/18 20:46	63	27/2/18 6:36	67
20/3/18 20:31	65	22/3/18 21:36	65	24/3/18 22:41	64	25/3/18 15:46	65	26/3/18 20:51	65	27/2/18 6:	

Real-time Noise Data RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)

28/2/18 1:11	63	1/3/18 2:16	58	2/3/18 3:21	62	3/3/18 4:26	59	4/3/18 5:31	57	5/3/18 6:36	67
28/2/18 1:16	61	1/3/18 2:21	56	2/3/18 3:26	47	3/3/18 4:31	56	4/3/18 5:36	58	5/3/18 6:41	67
28/2/18 1:21	62	1/3/18 2:26	60	2/3/18 3:31	54	3/3/18 4:36	57	4/3/18 5:41	60	5/3/18 6:46	67
28/2/18 1:26	60	1/3/18 2:31	51	2/3/18 3:36	53	3/3/18 4:41	58	4/3/18 5:46	61	5/3/18 6:51	67
28/2/18 1:31	59	1/3/18 2:36	59	2/3/18 3:41	63	3/3/18 4:46	54	4/3/18 5:51	59	5/3/18 6:56	68
28/2/18 1:36	57	1/3/18 2:41	55	2/3/18 3:46	62	3/3/18 4:51	58	4/3/18 5:56	63	5/3/18 23:01	66
28/2/18 1:41	61	1/3/18 2:46	47	2/3/18 3:51	54	3/3/18 4:56	51	4/3/18 6:01	58	5/3/18 23:06	66
28/2/18 1:46	59	1/3/18 2:51	63	2/3/18 3:56	62	3/3/18 5:01	56	4/3/18 6:06	60	5/3/18 23:11	66
28/2/18 1:51	65	1/3/18 2:56	63	2/3/18 4:01	62	3/3/18 5:06	57	4/3/18 6:11	63	5/3/18 23:16	65
28/2/18 1:56	59	1/3/18 3:01	55	2/3/18 4:06	62	3/3/18 5:11	59	4/3/18 6:16	63	5/3/18 23:21	65
28/2/18 2:01	58	1/3/18 3:06	49	2/3/18 4:11	49	3/3/18 5:16	52	4/3/18 6:21	62	5/3/18 23:26	65
28/2/18 2:06	57	1/3/18 3:11	44	2/3/18 4:16	64	3/3/18 5:21	58	4/3/18 6:26	63	5/3/18 23:31	65
28/2/18 2:11	58	1/3/18 3:16	62	2/3/18 4:21	62	3/3/18 5:26	61	4/3/18 6:31	63	5/3/18 23:36	65
28/2/18 2:16	58	1/3/18 3:21	53	2/3/18 4:26	58	3/3/18 5:31	58	4/3/18 6:36	65	5/3/18 23:41	64
28/2/18 2:21	57	1/3/18 3:26	63	2/3/18 4:31	62	3/3/18 5:36	57	4/3/18 6:41	65	5/3/18 23:46	65
28/2/18 2:26	54	1/3/18 3:31	52	2/3/18 4:36	62	3/3/18 5:41	62	4/3/18 6:46	64	5/3/18 23:51	65
28/2/18 2:31	55	1/3/18 3:36	59	2/3/18 4:41	63	3/3/18 5:46	59	4/3/18 6:51	65	5/3/18 23:56	65
28/2/18 2:36	59	1/3/18 3:41	63	2/3/18 4:46	62	3/3/18 5:51	61	4/3/18 6:56	66	6/3/18 0:01	64
28/2/18 2:41	57	1/3/18 3:46	52	2/3/18 4:51	60	3/3/18 5:56	63	4/3/18 23:01	64	6/3/18 0:06	64
28/2/18 2:46	62	1/3/18 3:51	56	2/3/18 4:56	63	3/3/18 6:01	65	4/3/18 23:06	66	6/3/18 0:11	63
28/2/18 2:51	49	1/3/18 3:56	48	2/3/18 5:01	56	3/3/18 6:06	61	4/3/18 23:11	66	6/3/18 0:16	63
28/2/18 2:56	62	1/3/18 4:01	62	2/3/18 5:06	58	3/3/18 6:11	62	4/3/18 23:16	66	6/3/18 0:21	64
28/2/18 3:01	63	1/3/18 4:06	62	2/3/18 5:11	62	3/3/18 6:16	63	4/3/18 23:21	66	6/3/18 0:26	63
28/2/18 3:06	47	1/3/18 4:11	62	2/3/18 5:16	63	3/3/18 6:21	63	4/3/18 23:26	64	6/3/18 0:31	64
28/2/18 3:11	62	1/3/18 4:16	54	2/3/18 5:21	63	3/3/18 6:26	66	4/3/18 23:31	65	6/3/18 0:36	63
28/2/18 3:16	61	1/3/18 4:21	62	2/3/18 5:26	55	3/3/18 6:31	64	4/3/18 23:36	65	6/3/18 0:41	72
28/2/18 3:21	61	1/3/18 4:26	52	2/3/18 5:31	56	3/3/18 6:36	64	4/3/18 23:41	65	6/3/18 0:46	63
28/2/18 3:26	63	1/3/18 4:31	42	2/3/18 5:36	58	3/3/18 6:41	64	4/3/18 23:46	65	6/3/18 0:51	62
28/2/18 3:31	63	1/3/18 4:36	56	2/3/18 5:41	60	3/3/18 6:46	66	4/3/18 23:51	63	6/3/18 0:56	62
28/2/18 3:36	62	1/3/18 4:41	53	2/3/18 5:46	60	3/3/18 6:51	67	4/3/18 23:56	64	6/3/18 1:01	59
28/2/18 3:41	62	1/3/18 4:46	62	2/3/18 5:51	56	3/3/18 6:56	67	5/3/18 0:01	65	6/3/18 1:06	61
28/2/18 3:46	62	1/3/18 4:51	49	2/3/18 5:56	63	3/3/18 23:01	67	5/3/18 0:06	64	6/3/18 1:11	62
28/2/18 3:51	62	1/3/18 4:56	57	2/3/18 6:01	61	3/3/18 23:06	66	5/3/18 0:11	64	6/3/18 1:16	62
28/2/18 3:56	62	1/3/18 5:01	59	2/3/18 6:06	63	3/3/18 23:11	66	5/3/18 0:16	62	6/3/18 1:21	61
28/2/18 4:01	62	1/3/18 5:06	59	2/3/18 6:11	64	3/3/18 23:16	67	5/3/18 0:21	61	6/3/18 1:26	60
28/2/18 4:06	61	1/3/18 5:11	55	2/3/18 6:16	64	3/3/18 23:21	67	5/3/18 0:26	61	6/3/18 1:31	60
28/2/18 4:11	61	1/3/18 5:16	59	2/3/18 6:21	64	3/3/18 23:26	66	5/3/18 0:31	61	6/3/18 1:36	59
28/2/18 4:16	61	1/3/18 5:21	63	2/3/18 6:26	66	3/3/18 23:31	67	5/3/18 0:36	61	6/3/18 1:41	56
28/2/18 4:21	53	1/3/18 5:26	61	2/3/18 6:31	65	3/3/18 23:36	66	5/3/18 0:41	67	6/3/18 1:46	60
28/2/18 4:26	61	1/3/18 5:31	63	2/3/18 6:36	66	3/3/18 23:41	66	5/3/18 0:46	62	6/3/18 1:51	60
28/2/18 4:31	61	1/3/18 5:36	59	2/3/18 6:41	67	3/3/18 23:46	67	5/3/18 0:51	59	6/3/18 1:56	53
28/2/18 4:36	62	1/3/18 5:41	59	2/3/18 6:46	68	3/3/18 23:51	67	5/3/18 0:56	57	6/3/18 2:01	57
28/2/18 4:41	61	1/3/18 5:46	61	2/3/18 6:51	68	3/3/18 23:56	64	5/3/18 1:01	59	6/3/18 2:06	58
28/2/18 4:46	60	1/3/18 5:51	60	2/3/18 6:56	69	4/3/18 0:01	65	5/3/18 1:06	57	6/3/18 2:11	56
28/2/18 4:51	62	1/3/18 5:56	63	2/3/18 23:01	67	4/3/18 0:06	65	5/3/18 1:11	56	6/3/18 2:16	51
28/2/18 4:56	62	1/3/18 6:01	62	2/3/18 23:06	67	4/3/18 0:11	65	5/3/18 1:16	51	6/3/18 2:21	53
28/2/18 5:01	63	1/3/18 6:06	63	2/3/18 23:11	67	4/3/18 0:16	66	5/3/18 1:21	50	6/3/18 2:26	56
28/2/18 5:06	63	1/3/18 6:11	63	2/3/18 23:16	66	4/3/18 0:21	65	5/3/18 1:26	58	6/3/18 2:31	59
28/2/18 5:11	63	1/3/18 6:16	64	2/3/18 23:21	67	4/3/18 0:26	64	5/3/18 1:31	52	6/3/18 2:36	54
28/2/18 5:16	54	1/3/18 6:21	65	2/3/18 23:26	67	4/3/18 0:31	64	5/3/18 1:36	52	6/3/18 2:41	54
28/2/18 5:21	62	1/3/18 6:26	65	2/3/18 23:31	67	4/3/18 0:36	64	5/3/18 1:41	52	6/3/18 2:46	63
28/2/18 5:26	55	1/3/18 6:31	66	2/3/18 23:36	67	4/3/18 0:41	63	5/3/18 1:46	62	6/3/18 2:51	57
28/2/18 5:31	65	1/3/18 6:36	66	2/3/18 23:41	66	4/3/18 0:46	64	5/3/18 1:51	50	6/3/18 2:56	64
28/2/18 5:36	52	1/3/18 6:41	67	2/3/18 23:46	66	4/3/18 0:51	64	5/3/18 1:56	63	6/3/18 3:01	59
28/2/18 5:41	57	1/3/18 6:46	69	2/3/18 23:51	67	4/3/18 0:56	63	5/3/18 2:01	63	6/3/18 3:06	62
28/2/18 5:46	60	1/3/18 6:51	69	2/3/18 23:56	66	4/3/18 1:01	63	5/3/18 2:06	52	6/3/18 3:11	57
28/2/18 5:51	58	1/3/18 6:56	68	3/3/18 0:01	66	4/3/18 1:06	63	5/3/18 2:11	63	6/3/18 3:16	51
28/2/18 5:56	59	1/3/18 23:01	68	3/3/18 0:06	66	4/3/18 1:11	64	5/3/18 2:16	63	6/3/18 3:21	55
28/2/18 6:01	62	1/3/18 23:06	67	3/3/18 0:11	66	4/3/18 1:16	57	5/3/18 2:21	62	6/3/18 3:26	46
28/2/18 6:06	64	1/3/18 23:11	66	3/3/18 0:16	66	4/3/18 1:21	63	5/3/18 2:26	63	6/3/18 3:31	51
28/2/18 6:11	65	1/3/18 23:16	67	3/3/18 0:21	66	4/3/18 1:26	63	5/3/18 2:31	62	6/3/18 3:36	63
28/2/18 6:16	65	1/3/18 23:21	66	3/3/18 0:26	66	4/3/18 1:31	54	5/3/18 2:36	62	6/3/18 3:41	52
28/2/18 6:21	66	1/3/18 23:26	66	3/3/18 0:31	65	4/3/18 1:36	63	5/3/18 2:41	62	6/3/18 3:46	63
28/2/18 6:26	66	1/3/18 23:31	67	3/3/18 0:36	66	4/3/18 1:41	50	5/3/18 2:46	62	6/3/18 3:51	63
28/2/18 6:31	66	1/3/18 23:36	66	3/3/18 0:41	65	4/3/18 1:46	62	5/3/18 2:51	62	6/3/18 3:56	63
28/2/18 6:36	67	1/3/18 23:41	66	3/3/18 0:46	66	4/3/18 1:51	63	5/3/18 2:56	62	6/3/18 4:01	61
28/2/18 6:41	67	1/3/18 23:46	66	3/3/18 0:51	65	4/3/18 1:56	62	5/3/18 3:01	62	6/3/18 4:06	62
28/2/18 6:46	68	1/3/18 23:51	65	3/3/18 0:56	64	4/3/18 2:01	52	5/3/18 3:06	62	6/3/18 4:11	63
28/2/18 6:51	68	1/3/18 23:56	66	3/3/18 1:01	64	4/3/18 2:06	62	5/3/18 3:11	62	6/3/18 4:16	63
28/2/18 6:56	68	2/3/18 0:01	65	3/3/18 1:06	66	4/3/18 2:11	61	5/3/18 3:16	61	6/3/18 4:21	62
28/2/18 23:01	66	2/3/18 0:06	66	3/3/18 1:11	64	4/3/18 2:16	62	5/3/18 3:21	62	6/3/18 4:26	63
28/2/18 23:06	68	2/3/18 0:11	65	3/3/18 1:16	64	4/3/18 2:21	62	5/3/18 3:26	61	6/3/18 4:31	63
28/2/18 23:11	66	2/3/18 0:16	66	3/3/18 1:21	64	4/3/18 2:26	62	5/3/18 3:31	60	6/3/18 4:36	62
28/2/18 23:16	66	2/3/18 0:21	66	3/3/18 1:26	64	4/3/18 2:31	61	5/3/18 3:36	62	6/3/18 4:41	63
28/2/18 23:21	67	2/3/18 0:26	65	3/3/18 1:31	64	4/3/18 2:36	61	5/3/18 3:41	62	6/3/18 4:46	61
28/2/18 23:26	66	2/3/18 0:31	66	3/3/18 1:36	64	4/3/18 2:41	61	5/3/18 3:46	61	6/3/18 4:51	63
28/2/18 23:31	66	2/3/18 0:36	64	3/3/18 1:41	70	4/3/18 2:46	61	5/3/18 3:51	61	6/3/18 4:56	62
28/2/18 23:36	66	2/3/18 0:41	65	3/3/18 1:46	64	4/3/18 2:51	62	5/3/18 3:56	62	6/3/18 5:01	57
28/2/18 23:41	66	2/3/18 0:46	65	3/3/18 1:51	64	4/3/18 2:56	61	5/3/18 4:01	62	6/3/18 5:06	54
28/2/18 23:46	65	2/3/18 0:51	64	3/3/18 1:56	64	4/3/18 3:01	61	5/3/18 4:06	61	6/3/18 5:11	57
28/2/18 23:51	66	2/3/18 0:56	64	3/3/18 2:01	66	4/3/18 3:06	62	5/3/18 4:11	62	6/3/18 5:16	47
28/2/18 23:56	65	2/3/18 1:01	64	3/3/18 2:06	65	4/3/18 3:11	62	5/3/18 4:16	61	6/3/18 5:21	57
1/3/18 0:01	66	2/3/18 1:06	63	3/3/18 2:11	62	4/3/18 3:16	61	5/3/18 4:21	62	6/3/18 5:26	59
1/3/18 0:06	65	2/3/18 1:11	63	3/3/18 2:16	62	4/3/18 3:21	63	5/3/18 4:26	61	6/3/18 5:31	42
1/3/18 0:11	64	2/3/18 1:16	63	3/3/18 2:21	68	4/3/18 3:26	62	5/3/18 4:31	62	6/3/18	

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)									
6/3/18 23:41	66	8/3/18 0:46	62	9/3/18 1:51	64	10/3/18 2:56	61	11/3/18 4:01	61	12/3/18 5:06	59
6/3/18 23:46	66	8/3/18 0:51	63	9/3/18 1:56	61	10/3/18 3:01	63	11/3/18 4:06	61	12/3/18 5:11	49
6/3/18 23:51	66	8/3/18 0:56	64	9/3/18 2:01	62	10/3/18 3:06	62	11/3/18 4:11	62	12/3/18 5:16	49
6/3/18 23:56	66	8/3/18 1:01	63	9/3/18 2:06	64	10/3/18 3:11	62	11/3/18 4:16	62	12/3/18 5:21	59
7/3/18 0:01	65	8/3/18 1:06	62	9/3/18 2:11	58	10/3/18 3:16	62	11/3/18 4:21	61	12/3/18 5:26	55
7/3/18 0:06	65	8/3/18 1:11	63	9/3/18 2:16	62	10/3/18 3:21	61	11/3/18 4:26	56	12/3/18 5:31	62
7/3/18 0:11	65	8/3/18 1:16	62	9/3/18 2:21	60	10/3/18 3:26	59	11/3/18 4:31	60	12/3/18 5:36	58
7/3/18 0:16	66	8/3/18 1:21	59	9/3/18 2:26	62	10/3/18 3:31	63	11/3/18 4:36	61	12/3/18 5:41	62
7/3/18 0:21	66	8/3/18 1:26	62	9/3/18 2:31	59	10/3/18 3:36	61	11/3/18 4:41	60	12/3/18 5:46	62
7/3/18 0:26	64	8/3/18 1:31	59	9/3/18 2:36	60	10/3/18 3:41	63	11/3/18 4:46	61	12/3/18 5:51	63
7/3/18 0:31	65	8/3/18 1:36	60	9/3/18 2:41	58	10/3/18 3:46	59	11/3/18 4:51	61	12/3/18 5:56	64
7/3/18 0:36	65	8/3/18 1:41	60	9/3/18 2:46	59	10/3/18 3:51	59	11/3/18 4:56	61	12/3/18 6:01	63
7/3/18 0:41	65	8/3/18 1:46	59	9/3/18 2:51	60	10/3/18 3:56	61	11/3/18 5:01	62	12/3/18 6:06	63
7/3/18 0:46	64	8/3/18 1:51	62	9/3/18 2:56	59	10/3/18 4:01	59	11/3/18 5:06	62	12/3/18 6:11	63
7/3/18 0:51	64	8/3/18 1:56	58	9/3/18 3:01	57	10/3/18 4:06	55	11/3/18 5:11	61	12/3/18 6:16	66
7/3/18 0:56	64	8/3/18 2:01	50	9/3/18 3:06	63	10/3/18 4:11	56	11/3/18 5:16	61	12/3/18 6:21	66
7/3/18 1:01	63	8/3/18 2:06	58	9/3/18 3:11	52	10/3/18 4:16	61	11/3/18 5:21	60	12/3/18 6:26	65
7/3/18 1:06	64	8/3/18 2:11	56	9/3/18 3:16	57	10/3/18 4:21	62	11/3/18 5:26	62	12/3/18 6:31	67
7/3/18 1:11	63	8/3/18 2:16	58	9/3/18 3:21	59	10/3/18 4:26	62	11/3/18 5:31	63	12/3/18 6:36	67
7/3/18 1:16	67	8/3/18 2:21	58	9/3/18 3:26	57	10/3/18 4:31	60	11/3/18 5:36	65	12/3/18 6:41	68
7/3/18 1:21	63	8/3/18 2:26	59	9/3/18 3:31	62	10/3/18 4:36	61	11/3/18 5:41	62	12/3/18 6:46	68
7/3/18 1:26	62	8/3/18 2:31	58	9/3/18 3:36	57	10/3/18 4:41	59	11/3/18 5:46	64	12/3/18 6:51	68
7/3/18 1:31	61	8/3/18 2:36	43	9/3/18 3:41	50	10/3/18 4:46	59	11/3/18 5:51	64	12/3/18 6:56	70
7/3/18 1:36	62	8/3/18 2:41	59	9/3/18 3:46	56	10/3/18 4:51	61	11/3/18 5:56	67	12/3/18 7:01	68
7/3/18 1:41	61	8/3/18 2:46	57	9/3/18 3:51	57	10/3/18 4:56	61	11/3/18 6:01	63	12/3/18 7:06	67
7/3/18 1:46	63	8/3/18 2:51	56	9/3/18 3:56	50	10/3/18 5:01	62	11/3/18 6:06	64	12/3/18 7:11	67
7/3/18 1:51	60	8/3/18 2:56	58	9/3/18 4:01	58	10/3/18 5:06	62	11/3/18 6:11	64	12/3/18 7:16	67
7/3/18 1:56	60	8/3/18 3:01	54	9/3/18 4:06	56	10/3/18 5:11	60	11/3/18 6:16	65	12/3/18 7:21	67
7/3/18 2:01	59	8/3/18 3:06	57	9/3/18 4:11	50	10/3/18 5:16	58	11/3/18 6:21	69	12/3/18 7:26	65
7/3/18 2:06	61	8/3/18 3:11	58	9/3/18 4:16	58	10/3/18 5:21	60	11/3/18 6:26	65	12/3/18 7:31	67
7/3/18 2:11	57	8/3/18 3:16	55	9/3/18 4:21	52	10/3/18 5:26	59	11/3/18 6:31	65	12/3/18 7:36	65
7/3/18 2:16	60	8/3/18 3:21	55	9/3/18 4:26	58	10/3/18 5:31	61	11/3/18 6:36	68	12/3/18 7:41	67
7/3/18 2:21	59	8/3/18 3:26	59	9/3/18 4:31	55	10/3/18 5:36	58	11/3/18 6:41	68	12/3/18 7:46	65
7/3/18 2:26	61	8/3/18 3:31	58	9/3/18 4:36	60	10/3/18 5:41	62	11/3/18 6:46	66	12/3/18 7:51	65
7/3/18 2:31	56	8/3/18 3:36	59	9/3/18 4:41	58	10/3/18 5:46	61	11/3/18 6:51	68	12/3/18 7:56	65
7/3/18 2:36	55	8/3/18 3:41	58	9/3/18 4:46	58	10/3/18 5:51	65	11/3/18 6:56	71	13/3/18 0:01	64
7/3/18 2:41	59	8/3/18 3:46	60	9/3/18 4:51	59	10/3/18 5:56	63	11/3/18 7:01	66	13/3/18 0:06	65
7/3/18 2:46	63	8/3/18 3:51	58	9/3/18 4:56	43	10/3/18 6:01	64	11/3/18 7:06	67	13/3/18 0:11	65
7/3/18 2:51	53	8/3/18 3:56	57	9/3/18 5:01	57	10/3/18 6:06	62	11/3/18 7:11	66	13/3/18 0:16	66
7/3/18 2:56	37	8/3/18 4:01	63	9/3/18 5:06	60	10/3/18 6:11	64	11/3/18 7:16	67	13/3/18 0:21	66
7/3/18 3:01	63	8/3/18 4:06	63	9/3/18 5:11	60	10/3/18 6:16	66	11/3/18 7:21	66	13/3/18 0:26	63
7/3/18 3:06	51	8/3/18 4:11	59	9/3/18 5:16	60	10/3/18 6:21	64	11/3/18 7:26	65	13/3/18 0:31	65
7/3/18 3:11	54	8/3/18 4:16	58	9/3/18 5:21	59	10/3/18 6:26	67	11/3/18 7:31	65	13/3/18 0:36	65
7/3/18 3:16	44	8/3/18 4:21	55	9/3/18 5:26	62	10/3/18 6:31	67	11/3/18 7:36	65	13/3/18 0:41	64
7/3/18 3:21	63	8/3/18 4:26	58	9/3/18 5:31	61	10/3/18 6:36	67	11/3/18 7:41	65	13/3/18 0:46	62
7/3/18 3:26	42	8/3/18 4:31	52	9/3/18 5:36	60	10/3/18 6:41	68	11/3/18 7:46	65	13/3/18 0:51	64
7/3/18 3:31	56	8/3/18 4:36	59	9/3/18 5:41	62	10/3/18 6:46	67	11/3/18 7:51	65	13/3/18 0:56	63
7/3/18 3:36	58	8/3/18 4:41	60	9/3/18 5:46	62	10/3/18 6:51	68	11/3/18 7:56	64	13/3/18 1:01	62
7/3/18 3:41	63	8/3/18 4:46	46	9/3/18 5:51	63	10/3/18 6:56	68	12/3/18 0:01	64	13/3/18 1:06	62
7/3/18 3:46	63	8/3/18 4:51	59	9/3/18 5:56	63	10/3/18 7:01	68	12/3/18 0:06	64	13/3/18 1:11	63
7/3/18 3:51	54	8/3/18 4:56	50	9/3/18 6:01	62	10/3/18 7:06	68	12/3/18 0:11	63	13/3/18 1:16	65
7/3/18 3:56	63	8/3/18 5:01	57	9/3/18 6:06	64	10/3/18 7:11	68	12/3/18 0:16	64	13/3/18 1:21	60
7/3/18 4:01	52	8/3/18 5:06	58	9/3/18 6:11	64	10/3/18 7:16	68	12/3/18 0:21	63	13/3/18 1:26	57
7/3/18 4:06	55	8/3/18 5:11	58	9/3/18 6:16	66	10/3/18 7:21	68	12/3/18 0:26	64	13/3/18 1:31	60
7/3/18 4:11	47	8/3/18 5:16	59	9/3/18 6:21	66	10/3/18 7:26	67	12/3/18 0:31	62	13/3/18 1:36	57
7/3/18 4:16	55	8/3/18 5:21	54	9/3/18 6:26	67	10/3/18 7:31	67	12/3/18 0:36	63	13/3/18 1:41	56
7/3/18 4:21	57	8/3/18 5:26	62	9/3/18 6:31	66	10/3/18 7:36	68	12/3/18 0:41	63	13/3/18 1:46	63
7/3/18 4:26	53	8/3/18 5:31	58	9/3/18 6:36	68	10/3/18 7:41	67	12/3/18 0:46	63	13/3/18 1:51	49
7/3/18 4:31	57	8/3/18 5:36	60	9/3/18 6:41	68	10/3/18 7:46	68	12/3/18 0:51	62	13/3/18 1:56	50
7/3/18 4:36	61	8/3/18 5:41	62	9/3/18 6:46	68	10/3/18 7:51	67	12/3/18 0:56	63	13/3/18 2:01	56
7/3/18 4:41	54	8/3/18 5:46	63	9/3/18 6:51	69	10/3/18 7:56	67	12/3/18 1:01	62	13/3/18 2:06	63
7/3/18 4:46	50	8/3/18 5:51	65	9/3/18 6:56	69	11/3/18 0:01	66	12/3/18 1:06	61	13/3/18 2:11	50
7/3/18 4:51	55	8/3/18 5:56	64	9/3/18 7:01	68	11/3/18 0:06	68	12/3/18 1:11	59	13/3/18 2:16	47
7/3/18 4:56	50	8/3/18 6:01	64	9/3/18 7:06	68	11/3/18 0:11	67	12/3/18 1:16	60	13/3/18 2:21	63
7/3/18 5:01	53	8/3/18 6:06	66	9/3/18 7:11	68	11/3/18 0:16	66	12/3/18 1:21	58	13/3/18 2:26	63
7/3/18 5:06	54	8/3/18 6:11	65	9/3/18 7:16	68	11/3/18 0:21	67	12/3/18 1:26	51	13/3/18 2:31	56
7/3/18 5:11	59	8/3/18 6:16	67	9/3/18 7:21	68	11/3/18 0:26	67	12/3/18 1:31	46	13/3/18 2:36	62
7/3/18 5:16	58	8/3/18 6:21	68	9/3/18 7:26	67	11/3/18 0:31	67	12/3/18 1:36	51	13/3/18 2:41	62
7/3/18 5:21	60	8/3/18 6:26	68	9/3/18 7:31	69	11/3/18 0:36	67	12/3/18 1:41	54	13/3/18 2:46	62
7/3/18 5:26	57	8/3/18 6:31	67	9/3/18 7:36	68	11/3/18 0:41	65	12/3/18 1:46	62	13/3/18 2:51	63
7/3/18 5:31	58	8/3/18 6:36	67	9/3/18 7:41	68	11/3/18 0:46	67	12/3/18 1:51	63	13/3/18 2:56	63
7/3/18 5:36	61	8/3/18 6:41	67	9/3/18 7:46	68	11/3/18 0:51	66	12/3/18 1:56	62	13/3/18 3:01	63
7/3/18 5:41	61	8/3/18 6:46	70	9/3/18 7:51	68	11/3/18 0:56	67	12/3/18 2:01	63	13/3/18 3:06	63
7/3/18 5:46	59	8/3/18 6:51	71	9/3/18 7:56	66	11/3/18 1:01	65	12/3/18 2:06	62	13/3/18 3:11	62
7/3/18 5:51	60	8/3/18 6:56	71	10/3/18 0:01	67	11/3/18 1:06	65	12/3/18 2:11	61	13/3/18 3:16	61
7/3/18 5:56	63	8/3/18 7:01	69	10/3/18 0:06	67	11/3/18 1:11	66	12/3/18 2:16	62	13/3/18 3:21	61
7/3/18 6:01	61	8/3/18 7:06	70	10/3/18 0:11	68	11/3/18 1:16	65	12/3/18 2:21	61	13/3/18 3:26	63
7/3/18 6:06	64	8/3/18 7:11	69	10/3/18 0:16	68	11/3/18 1:21	65	12/3/18 2:26	62	13/3/18 3:31	62
7/3/18 6:11	64	8/3/18 7:16	70	10/3/18 0:21	66	11/3/18 1:26	66	12/3/18 2:31	61	13/3/18 3:36	61
7/3/18 6:16	65	8/3/18 7:21	69	10/3/18 0:26	68	11/3/18 1:31	66	12/3/18 2:36	61	13/3/18 3:41	62
7/3/18 6:21	65	8/3/18 7:26	68	10/3/18 0:31	66	11/3/18 1:36	63	12/3/18 2:41	62	13/3/18 3:46	62
7/3/18 6:26	65	8/3/18 7:31	68	10/3/18 0:36	65	11/3/18 1:41	65	12/3/18 2:46	62	13/3/18 3:51	62
7/3/18 6:31	66	8/3/18 7:36	68	10/3/18 0:41	66	11/3/18 1:46	64	12/3/18 2:51	61	13/3/18 3:56	62
7/3/18 6:36	66	8/3/18 7:41	68	10/3/18 0:46	65	11/3/18 1:51	63	12/3/18 2:56	61	13/3/18 4:01	61
7/3/18 6:41											

Real-time Noise Data RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)

13/3/18 6:11	65	14/3/18 23:16	69	16/3/18 0:21	65	17/3/18 1:26	59	18/3/18 2:31	43	19/3/18 3:36	61
13/3/18 6:16	66	14/3/18 23:21	68	16/3/18 0:26	66	17/3/18 1:31	60	18/3/18 2:36	56	19/3/18 3:41	60
13/3/18 6:21	66	14/3/18 23:26	68	16/3/18 0:31	64	17/3/18 1:36	61	18/3/18 2:41	57	19/3/18 3:46	61
13/3/18 6:26	67	14/3/18 23:31	68	16/3/18 0:36	65	17/3/18 1:41	62	18/3/18 2:46	53	19/3/18 3:51	61
13/3/18 6:31	67	14/3/18 23:36	67	16/3/18 0:41	64	17/3/18 1:46	64	18/3/18 2:51	55	19/3/18 3:56	60
13/3/18 6:36	68	14/3/18 23:41	67	16/3/18 0:46	64	17/3/18 1:51	59	18/3/18 2:56	50	19/3/18 4:01	60
13/3/18 6:41	67	14/3/18 23:46	66	16/3/18 0:51	60	17/3/18 1:56	60	18/3/18 3:01	58	19/3/18 4:06	61
13/3/18 6:46	69	14/3/18 23:51	67	16/3/18 0:56	61	17/3/18 2:01	55	18/3/18 3:06	69	19/3/18 4:11	60
13/3/18 6:51	69	14/3/18 23:56	65	16/3/18 1:01	60	17/3/18 2:06	63	18/3/18 3:11	54	19/3/18 4:16	62
13/3/18 6:56	69	15/3/18 0:01	66	16/3/18 1:06	59	17/3/18 2:11	55	18/3/18 3:16	63	19/3/18 4:21	61
13/3/18 23:01	68	15/3/18 0:06	67	16/3/18 1:11	57	17/3/18 2:16	66	18/3/18 3:21	53	19/3/18 4:26	61
13/3/18 23:06	67	15/3/18 0:11	66	16/3/18 1:16	60	17/3/18 2:21	61	18/3/18 3:26	54	19/3/18 4:31	61
13/3/18 23:11	66	15/3/18 0:16	67	16/3/18 1:21	59	17/3/18 2:26	58	18/3/18 3:31	57	19/3/18 4:36	59
13/3/18 23:16	66	15/3/18 0:21	66	16/3/18 1:26	58	17/3/18 2:31	56	18/3/18 3:36	55	19/3/18 4:41	62
13/3/18 23:21	67	15/3/18 0:26	65	16/3/18 1:31	52	17/3/18 2:36	60	18/3/18 3:41	50	19/3/18 4:46	60
13/3/18 23:26	67	15/3/18 0:31	65	16/3/18 1:36	59	17/3/18 2:41	60	18/3/18 3:46	63	19/3/18 4:51	61
13/3/18 23:31	68	15/3/18 0:36	65	16/3/18 1:41	63	17/3/18 2:46	51	18/3/18 3:51	63	19/3/18 4:56	53
13/3/18 23:36	67	15/3/18 0:41	62	16/3/18 1:46	42	17/3/18 2:51	56	18/3/18 3:56	62	19/3/18 5:01	63
13/3/18 23:41	66	15/3/18 0:46	63	16/3/18 1:51	63	17/3/18 2:56	57	18/3/18 4:01	51	19/3/18 5:06	61
13/3/18 23:46	66	15/3/18 0:51	66	16/3/18 1:56	62	17/3/18 3:01	57	18/3/18 4:06	62	19/3/18 5:11	57
13/3/18 23:51	65	15/3/18 0:56	62	16/3/18 2:01	54	17/3/18 3:06	57	18/3/18 4:11	62	19/3/18 5:16	56
13/3/18 23:56	65	15/3/18 1:01	63	16/3/18 2:06	58	17/3/18 3:11	51	18/3/18 4:16	37	19/3/18 5:21	58
14/3/18 0:01	65	15/3/18 1:06	61	16/3/18 2:11	63	17/3/18 3:16	56	18/3/18 4:21	56	19/3/18 5:26	59
14/3/18 0:06	65	15/3/18 1:11	58	16/3/18 2:16	52	17/3/18 3:21	44	18/3/18 4:26	62	19/3/18 5:31	59
14/3/18 0:11	66	15/3/18 1:16	58	16/3/18 2:21	56	17/3/18 3:26	57	18/3/18 4:31	63	19/3/18 5:36	60
14/3/18 0:16	65	15/3/18 1:21	61	16/3/18 2:26	58	17/3/18 3:31	58	18/3/18 4:36	51	19/3/18 5:41	63
14/3/18 0:21	65	15/3/18 1:26	57	16/3/18 2:31	58	17/3/18 3:36	56	18/3/18 4:41	56	19/3/18 5:46	62
14/3/18 0:26	64	15/3/18 1:31	50	16/3/18 2:36	63	17/3/18 3:41	63	18/3/18 4:46	63	19/3/18 5:51	63
14/3/18 0:31	63	15/3/18 1:36	58	16/3/18 2:41	53	17/3/18 3:46	45	18/3/18 4:51	58	19/3/18 5:56	63
14/3/18 0:36	62	15/3/18 1:41	56	16/3/18 2:46	55	17/3/18 3:51	40	18/3/18 4:56	59	19/3/18 6:01	64
14/3/18 0:41	60	15/3/18 1:46	59	16/3/18 2:51	45	17/3/18 3:56	63	18/3/18 5:01	56	19/3/18 6:06	64
14/3/18 0:46	61	15/3/18 1:51	50	16/3/18 2:56	63	17/3/18 4:01	51	18/3/18 5:06	60	19/3/18 6:11	65
14/3/18 0:51	59	15/3/18 1:56	54	16/3/18 3:01	53	17/3/18 4:06	52	18/3/18 5:11	58	19/3/18 6:16	65
14/3/18 0:56	59	15/3/18 2:01	54	16/3/18 3:06	62	17/3/18 4:11	63	18/3/18 5:16	53	19/3/18 6:21	65
14/3/18 1:01	59	15/3/18 2:06	62	16/3/18 3:11	62	17/3/18 4:16	48	18/3/18 5:21	61	19/3/18 6:26	68
14/3/18 1:06	59	15/3/18 2:11	63	16/3/18 3:16	62	17/3/18 4:21	47	18/3/18 5:26	61	19/3/18 6:31	68
14/3/18 1:11	58	15/3/18 2:16	63	16/3/18 3:21	62	17/3/18 4:26	57	18/3/18 5:31	62	19/3/18 6:36	68
14/3/18 1:16	53	15/3/18 2:21	63	16/3/18 3:26	62	17/3/18 4:31	54	18/3/18 5:36	61	19/3/18 6:41	68
14/3/18 1:21	59	15/3/18 2:26	45	16/3/18 3:31	62	17/3/18 4:36	63	18/3/18 5:41	63	19/3/18 6:46	68
14/3/18 1:26	59	15/3/18 2:31	63	16/3/18 3:36	63	17/3/18 4:41	63	18/3/18 5:46	64	19/3/18 6:51	68
14/3/18 1:31	60	15/3/18 2:36	62	16/3/18 3:41	63	17/3/18 4:46	62	18/3/18 5:51	62	19/3/18 6:56	68
14/3/18 1:36	53	15/3/18 2:41	62	16/3/18 3:46	62	17/3/18 4:51	62	18/3/18 5:56	61	19/3/18 23:01	66
14/3/18 1:41	57	15/3/18 2:46	62	16/3/18 3:51	61	17/3/18 4:56	57	18/3/18 6:01	64	19/3/18 23:06	66
14/3/18 1:46	49	15/3/18 2:51	62	16/3/18 3:56	62	17/3/18 5:01	60	18/3/18 6:06	63	19/3/18 23:11	65
14/3/18 1:51	48	15/3/18 2:56	63	16/3/18 4:01	61	17/3/18 5:06	61	18/3/18 6:11	66	19/3/18 23:16	65
14/3/18 1:56	63	15/3/18 3:01	62	16/3/18 4:06	62	17/3/18 5:11	62	18/3/18 6:16	64	19/3/18 23:21	67
14/3/18 2:01	59	15/3/18 3:06	61	16/3/18 4:11	62	17/3/18 5:16	59	18/3/18 6:21	69	19/3/18 23:26	65
14/3/18 2:06	49	15/3/18 3:11	62	16/3/18 4:16	61	17/3/18 5:21	61	18/3/18 6:26	66	19/3/18 23:31	65
14/3/18 2:11	62	15/3/18 3:16	62	16/3/18 4:21	62	17/3/18 5:26	62	18/3/18 6:31	67	19/3/18 23:36	65
14/3/18 2:16	47	15/3/18 3:21	63	16/3/18 4:26	61	17/3/18 5:31	62	18/3/18 6:36	65	19/3/18 23:41	65
14/3/18 2:21	63	15/3/18 3:26	61	16/3/18 4:31	62	17/3/18 5:36	61	18/3/18 6:41	66	19/3/18 23:46	64
14/3/18 2:26	62	15/3/18 3:31	62	16/3/18 4:36	62	17/3/18 5:41	63	18/3/18 6:46	66	19/3/18 23:51	65
14/3/18 2:31	62	15/3/18 3:36	62	16/3/18 4:41	62	17/3/18 5:46	64	18/3/18 6:51	66	19/3/18 23:56	65
14/3/18 2:36	62	15/3/18 3:41	61	16/3/18 4:46	61	17/3/18 5:51	67	18/3/18 6:56	70	20/3/18 0:01	64
14/3/18 2:41	62	15/3/18 3:46	62	16/3/18 4:51	62	17/3/18 5:56	64	18/3/18 23:01	66	20/3/18 0:06	64
14/3/18 2:46	62	15/3/18 3:51	62	16/3/18 4:56	57	17/3/18 6:01	65	18/3/18 23:06	67	20/3/18 0:11	64
14/3/18 2:51	62	15/3/18 3:56	62	16/3/18 5:01	62	17/3/18 6:06	64	18/3/18 23:11	66	20/3/18 0:16	65
14/3/18 2:56	62	15/3/18 4:01	62	16/3/18 5:06	63	17/3/18 6:11	65	18/3/18 23:16	66	20/3/18 0:21	62
14/3/18 3:01	61	15/3/18 4:06	61	16/3/18 5:11	62	17/3/18 6:16	66	18/3/18 23:21	66	20/3/18 0:26	61
14/3/18 3:06	61	15/3/18 4:11	61	16/3/18 5:16	63	17/3/18 6:21	66	18/3/18 23:26	65	20/3/18 0:31	62
14/3/18 3:11	62	15/3/18 4:16	61	16/3/18 5:21	62	17/3/18 6:26	67	18/3/18 23:31	65	20/3/18 0:36	59
14/3/18 3:16	62	15/3/18 4:21	62	16/3/18 5:26	61	17/3/18 6:31	67	18/3/18 23:36	67	20/3/18 0:41	58
14/3/18 3:21	61	15/3/18 4:26	61	16/3/18 5:31	56	17/3/18 6:36	66	18/3/18 23:41	66	20/3/18 0:46	57
14/3/18 3:26	62	15/3/18 4:31	62	16/3/18 5:36	57	17/3/18 6:41	67	18/3/18 23:46	64	20/3/18 0:51	61
14/3/18 3:31	62	15/3/18 4:36	62	16/3/18 5:41	61	17/3/18 6:46	67	18/3/18 23:51	64	20/3/18 0:56	58
14/3/18 3:36	61	15/3/18 4:41	61	16/3/18 5:46	62	17/3/18 6:51	67	18/3/18 23:56	66	20/3/18 1:01	44
14/3/18 3:41	61	15/3/18 4:46	51	16/3/18 5:51	61	17/3/18 6:56	67	19/3/18 0:01	65	20/3/18 1:06	55
14/3/18 3:46	61	15/3/18 4:51	53	16/3/18 5:56	63	17/3/18 23:01	67	19/3/18 0:06	64	20/3/18 1:11	49
14/3/18 3:51	62	15/3/18 4:56	54	16/3/18 6:01	62	17/3/18 23:06	68	19/3/18 0:11	63	20/3/18 1:16	61
14/3/18 3:56	62	15/3/18 5:01	53	16/3/18 6:06	63	17/3/18 23:11	67	19/3/18 0:16	63	20/3/18 1:21	63
14/3/18 4:01	61	15/3/18 5:06	61	16/3/18 6:11	63	17/3/18 23:16	67	19/3/18 0:21	65	20/3/18 1:26	56
14/3/18 4:06	60	15/3/18 5:11	57	16/3/18 6:16	66	17/3/18 23:21	67	19/3/18 0:26	63	20/3/18 1:31	40
14/3/18 4:11	61	15/3/18 5:16	58	16/3/18 6:21	67	17/3/18 23:26	66	19/3/18 0:31	62	20/3/18 1:36	63
14/3/18 4:16	62	15/3/18 5:21	55	16/3/18 6:26	69	17/3/18 23:31	67	19/3/18 0:36	61	20/3/18 1:41	58
14/3/18 4:21	62	15/3/18 5:26	56	16/3/18 6:31	68	17/3/18 23:36	67	19/3/18 0:41	56	20/3/18 1:46	63
14/3/18 4:26	61	15/3/18 5:31	61	16/3/18 6:36	68	17/3/18 23:41	67	19/3/18 0:46	57	20/3/18 1:51	63
14/3/18 4:31	62	15/3/18 5:36	59	16/3/18 6:41	69	17/3/18 23:46	66	19/3/18 0:51	60	20/3/18 1:56	62
14/3/18 4:36	62	15/3/18 5:41	60	16/3/18 6:46	69	17/3/18 23:51	66	19/3/18 0:56	55	20/3/18 2:01	62
14/3/18 4:41	62	15/3/18 5:46	62	16/3/18 6:51	69	17/3/18 23:56	66	19/3/18 1:01	53	20/3/18 2:06	63
14/3/18 4:46	62	15/3/18 5:51	63	16/3/18 6:56	70	18/3/18 0:01	66	19/3/18 1:06	63	20/3/18 2:11	62
14/3/18 4:51	62	15/3/18 5:56	61	16/3/18 23:01	67	18/3/18 0:06	67	19/3/18 1:11	56	20/3/18 2:16	62
14/3/18 4:56	55	15/3/18 6:01	63	16/3/18 23:06	67	18/3/18 0:11	67	19/3/18 1:16	42	20/3/18 2:21	62
14/3/18 5:0											

Real-time Noise Data		RTN3 (Po Leung Kuk Yu Lee Mo Fan Memorial School)									
20/3/18 4:41	61	21/3/18 5:46	62	22/3/18 6:51	70	23/3/18 23:56	67	25/3/18 1:01	61	26/3/18 2:06	62
20/3/18 4:46	53	21/3/18 5:51	62	22/3/18 6:56	68	24/3/18 0:01	67	25/3/18 1:06	59	26/3/18 2:11	62
20/3/18 4:51	62	21/3/18 5:56	64	22/3/18 23:01	67	24/3/18 0:06	67	25/3/18 1:11	61	26/3/18 2:16	62
20/3/18 4:56	63	21/3/18 6:01	65	22/3/18 23:06	67	24/3/18 0:11	67	25/3/18 1:16	60	26/3/18 2:21	61
20/3/18 5:01	52	21/3/18 6:06	64	22/3/18 23:11	68	24/3/18 0:16	67	25/3/18 1:21	61	26/3/18 2:26	62
20/3/18 5:06	47	21/3/18 6:11	65	22/3/18 23:16	67	24/3/18 0:21	66	25/3/18 1:26	62	26/3/18 2:31	61
20/3/18 5:11	48	21/3/18 6:16	66	22/3/18 23:21	67	24/3/18 0:26	66	25/3/18 1:31	62	26/3/18 2:36	61
20/3/18 5:16	63	21/3/18 6:21	67	22/3/18 23:26	67	24/3/18 0:31	66	25/3/18 1:36	61	26/3/18 2:41	60
20/3/18 5:21	58	21/3/18 6:26	66	22/3/18 23:31	68	24/3/18 0:36	66	25/3/18 1:41	59	26/3/18 2:46	60
20/3/18 5:26	59	21/3/18 6:31	68	22/3/18 23:36	67	24/3/18 0:41	65	25/3/18 1:46	55	26/3/18 2:51	62
20/3/18 5:31	55	21/3/18 6:36	68	22/3/18 23:41	67	24/3/18 0:46	65	25/3/18 1:51	56	26/3/18 2:56	62
20/3/18 5:36	56	21/3/18 6:41	69	22/3/18 23:46	67	24/3/18 0:51	66	25/3/18 1:56	46	26/3/18 3:01	61
20/3/18 5:41	58	21/3/18 6:46	69	22/3/18 23:51	66	24/3/18 0:56	66	25/3/18 2:01	58	26/3/18 3:06	63
20/3/18 5:46	61	21/3/18 6:51	70	22/3/18 23:56	66	24/3/18 1:01	63	25/3/18 2:06	58	26/3/18 3:11	62
20/3/18 5:51	62	21/3/18 6:56	69	23/3/18 0:01	66	24/3/18 1:06	58	25/3/18 2:11	58	26/3/18 3:16	61
20/3/18 5:56	61	21/3/18 23:01	67	23/3/18 0:06	66	24/3/18 1:11	63	25/3/18 2:16	60	26/3/18 3:21	60
20/3/18 6:01	62	21/3/18 23:06	67	23/3/18 0:11	66	24/3/18 1:16	55	25/3/18 2:21	58	26/3/18 3:26	61
20/3/18 6:06	62	21/3/18 23:11	67	23/3/18 0:16	66	24/3/18 1:21	59	25/3/18 2:26	59	26/3/18 3:31	61
20/3/18 6:11	64	21/3/18 23:16	67	23/3/18 0:21	66	24/3/18 1:26	60	25/3/18 2:31	58	26/3/18 3:36	60
20/3/18 6:16	65	21/3/18 23:21	67	23/3/18 0:26	65	24/3/18 1:31	58	25/3/18 2:36	57	26/3/18 3:41	61
20/3/18 6:21	66	21/3/18 23:26	67	23/3/18 0:31	66	24/3/18 1:36	60	25/3/18 2:41	54	26/3/18 3:46	61
20/3/18 6:26	65	21/3/18 23:31	67	23/3/18 0:36	64	24/3/18 1:41	61	25/3/18 2:46	53	26/3/18 3:51	62
20/3/18 6:31	67	21/3/18 23:36	67	23/3/18 0:41	63	24/3/18 1:46	61	25/3/18 2:51	63	26/3/18 3:56	61
20/3/18 6:36	66	21/3/18 23:41	66	23/3/18 0:46	61	24/3/18 1:51	63	25/3/18 2:56	54	26/3/18 4:01	60
20/3/18 6:41	70	21/3/18 23:46	69	23/3/18 0:51	60	24/3/18 1:56	58	25/3/18 3:01	65	26/3/18 4:06	60
20/3/18 6:46	68	21/3/18 23:51	69	23/3/18 0:56	63	24/3/18 2:01	60	25/3/18 3:06	60	26/3/18 4:11	59
20/3/18 6:51	68	21/3/18 23:56	66	23/3/18 1:01	63	24/3/18 2:06	60	25/3/18 3:11	63	26/3/18 4:16	60
20/3/18 6:56	69	22/3/18 0:01	69	23/3/18 1:06	60	24/3/18 2:11	57	25/3/18 3:16	50	26/3/18 4:21	61
20/3/18 23:01	66	22/3/18 0:06	65	23/3/18 1:11	56	24/3/18 2:16	59	25/3/18 3:21	63	26/3/18 4:26	60
20/3/18 23:06	66	22/3/18 0:11	65	23/3/18 1:16	57	24/3/18 2:21	57	25/3/18 3:26	63	26/3/18 4:31	61
20/3/18 23:11	66	22/3/18 0:16	66	23/3/18 1:21	60	24/3/18 2:26	58	25/3/18 3:31	57	26/3/18 4:36	60
20/3/18 23:16	66	22/3/18 0:21	65	23/3/18 1:26	59	24/3/18 2:31	57	25/3/18 3:36	51	26/3/18 4:41	63
20/3/18 23:21	66	22/3/18 0:26	65	23/3/18 1:31	55	24/3/18 2:36	60	25/3/18 3:41	59	26/3/18 4:46	62
20/3/18 23:26	65	22/3/18 0:31	64	23/3/18 1:36	58	24/3/18 2:41	60	25/3/18 3:46	63	26/3/18 4:51	60
20/3/18 23:31	66	22/3/18 0:36	60	23/3/18 1:41	58	24/3/18 2:46	56	25/3/18 3:51	62	26/3/18 4:56	61
20/3/18 23:36	66	22/3/18 0:41	62	23/3/18 1:46	57	24/3/18 2:51	58	25/3/18 3:56	63	26/3/18 5:01	62
20/3/18 23:41	65	22/3/18 0:46	61	23/3/18 1:51	51	24/3/18 2:56	59	25/3/18 4:01	62	26/3/18 5:06	63
20/3/18 23:46	65	22/3/18 0:51	59	23/3/18 1:56	51	24/3/18 3:01	56	25/3/18 4:06	62	26/3/18 5:11	61
20/3/18 23:51	66	22/3/18 0:56	63	23/3/18 2:01	63	24/3/18 3:06	63	25/3/18 4:11	62	26/3/18 5:16	63
20/3/18 23:56	65	22/3/18 1:01	61	23/3/18 2:06	55	24/3/18 3:11	58	25/3/18 4:16	51	26/3/18 5:21	63
21/3/18 0:01	66	22/3/18 1:06	59	23/3/18 2:11	53	24/3/18 3:16	57	25/3/18 4:21	62	26/3/18 5:26	63
21/3/18 0:06	65	22/3/18 1:11	60	23/3/18 2:16	49	24/3/18 3:21	60	25/3/18 4:26	63	26/3/18 5:31	62
21/3/18 0:11	65	22/3/18 1:16	57	23/3/18 2:21	63	24/3/18 3:26	52	25/3/18 4:31	63	26/3/18 5:36	63
21/3/18 0:16	65	22/3/18 1:21	61	23/3/18 2:26	52	24/3/18 3:31	56	25/3/18 4:36	63	26/3/18 5:41	57
21/3/18 0:21	64	22/3/18 1:26	58	23/3/18 2:31	63	24/3/18 3:36	56	25/3/18 4:41	63	26/3/18 5:46	61
21/3/18 0:26	65	22/3/18 1:31	58	23/3/18 2:36	63	24/3/18 3:41	52	25/3/18 4:46	51	26/3/18 5:51	63
21/3/18 0:31	65	22/3/18 1:36	59	23/3/18 2:41	47	24/3/18 3:46	53	25/3/18 4:51	62	26/3/18 5:56	62
21/3/18 0:36	63	22/3/18 1:41	59	23/3/18 2:46	63	24/3/18 3:51	63	25/3/18 4:56	62	26/3/18 6:01	61
21/3/18 0:41	61	22/3/18 1:46	58	23/3/18 2:51	62	24/3/18 3:56	63	25/3/18 5:01	63	26/3/18 6:06	64
21/3/18 0:46	62	22/3/18 1:51	55	23/3/18 2:56	62	24/3/18 4:01	54	25/3/18 5:06	56	26/3/18 6:11	64
21/3/18 0:51	59	22/3/18 1:56	46	23/3/18 3:01	62	24/3/18 4:06	63	25/3/18 5:11	58	26/3/18 6:16	66
21/3/18 0:56	59	22/3/18 2:01	56	23/3/18 3:06	56	24/3/18 4:11	62	25/3/18 5:16	57	26/3/18 6:21	67
21/3/18 1:01	60	22/3/18 2:06	58	23/3/18 3:11	62	24/3/18 4:16	50	25/3/18 5:21	60	26/3/18 6:26	67
21/3/18 1:06	59	22/3/18 2:11	59	23/3/18 3:16	62	24/3/18 4:21	51	25/3/18 5:26	61	26/3/18 6:31	67
21/3/18 1:11	60	22/3/18 2:16	62	23/3/18 3:21	62	24/3/18 4:26	53	25/3/18 5:31	62	26/3/18 6:36	67
21/3/18 1:16	56	22/3/18 2:21	63	23/3/18 3:26	61	24/3/18 4:31	62	25/3/18 5:36	60	26/3/18 6:41	69
21/3/18 1:21	58	22/3/18 2:26	63	23/3/18 3:31	63	24/3/18 4:36	59	25/3/18 5:41	60	26/3/18 6:46	69
21/3/18 1:26	65	22/3/18 2:31	62	23/3/18 3:36	61	24/3/18 4:41	63	25/3/18 5:46	59	26/3/18 6:51	69
21/3/18 1:31	54	22/3/18 2:36	61	23/3/18 3:41	63	24/3/18 4:46	62	25/3/18 5:51	61	26/3/18 6:56	68
21/3/18 1:36	63	22/3/18 2:41	61	23/3/18 3:46	62	24/3/18 4:51	63	25/3/18 5:56	61	26/3/18 23:01	67
21/3/18 1:41	51	22/3/18 2:46	62	23/3/18 3:51	61	24/3/18 4:56	60	25/3/18 6:01	62	26/3/18 23:06	68
21/3/18 1:46	57	22/3/18 2:51	61	23/3/18 3:56	62	24/3/18 5:01	61	25/3/18 6:06	67	26/3/18 23:11	66
21/3/18 1:51	63	22/3/18 2:56	61	23/3/18 4:01	62	24/3/18 5:06	60	25/3/18 6:11	62	26/3/18 23:16	67
21/3/18 1:56	56	22/3/18 3:01	61	23/3/18 4:06	61	24/3/18 5:11	58	25/3/18 6:16	64	26/3/18 23:21	68
21/3/18 2:01	62	22/3/18 3:06	61	23/3/18 4:11	62	24/3/18 5:16	59	25/3/18 6:21	67	26/3/18 23:26	67
21/3/18 2:06	52	22/3/18 3:11	61	23/3/18 4:16	62	24/3/18 5:21	61	25/3/18 6:26	65	26/3/18 23:31	67
21/3/18 2:11	37	22/3/18 3:16	61	23/3/18 4:21	62	24/3/18 5:26	62	25/3/18 6:31	64	26/3/18 23:36	67
21/3/18 2:16	57	22/3/18 3:21	61	23/3/18 4:26	61	24/3/18 5:31	58	25/3/18 6:36	66	26/3/18 23:41	65
21/3/18 2:21	63	22/3/18 3:26	62	23/3/18 4:31	61	24/3/18 5:36	62	25/3/18 6:41	67	26/3/18 23:46	66
21/3/18 2:26	62	22/3/18 3:31	61	23/3/18 4:36	63	24/3/18 5:41	61	25/3/18 6:46	67	26/3/18 23:51	66
21/3/18 2:31	63	22/3/18 3:36	61	23/3/18 4:41	61	24/3/18 5:46	61	25/3/18 6:51	67	26/3/18 23:56	67
21/3/18 2:36	63	22/3/18 3:41	61	23/3/18 4:46	62	24/3/18 5:51	64	25/3/18 6:56	65		
21/3/18 2:41	62	22/3/18 3:46	61	23/3/18 4:51	62	24/3/18 5:56	66	25/3/18 23:01	67		
21/3/18 2:46	62	22/3/18 3:51	61	23/3/18 4:56	62	24/3/18 6:01	64	25/3/18 23:06	66		
21/3/18 2:51	62	22/3/18 3:56	61	23/3/18 5:01	62	24/3/18 6:06	63	25/3/18 23:11	66		
21/3/18 2:56	62	22/3/18 4:01	63	23/3/18 5:06	57	24/3/18 6:11	63	25/3/18 23:16	65		
21/3/18 3:01	61	22/3/18 4:06	61	23/3/18 5:11	60	24/3/18 6:16	65	25/3/18 23:21	66		
21/3/18 3:06	62	22/3/18 4:11	61	23/3/18 5:16	57	24/3/18 6:21	64	25/3/18 23:26	66		
21/3/18 3:11	61	22/3/18 4:16	62	23/3/18 5:21	62	24/3/18 6:26	66	25/3/18 23:31	64		
21/3/18 3:16	62	22/3/18 4:21	62	23/3/18 5:26	60	24/3/18 6:31	67	25/3/18 23:36	65		
21/3/18 3:21	61	22/3/18 4:26	62	23/3/18 5:31	56	24/3/18 6:36	67	25/3/18 23:41	66		
21/3/18 3:26	62	22/3/18 4:31	61	23/3/18 5:36	60	24/3/18 6:41	68	25/3/18 23:46	65		
21/3/18 3:31	62	22/3/18 4:36	61	23/3/18 5:41	63	24/3/18 6:46	69	25/3/18 23:51	65		
21/3/18 3:36	63	22/3/18 4:41	62	23/3/18 5							

Real-time Noise Data		RTN4 (Causeway Bay Community Centre)									
28/2/18 20:56	61	2/3/18 22:01	62	4/3/18 11:06	60	4/3/18 20:11	60	6/3/18 21:16	60	8/3/18 22:21	62
28/2/18 21:01	60	2/3/18 22:06	62	4/3/18 11:11	60	4/3/18 20:16	63	6/3/18 21:21	60	8/3/18 22:26	61
28/2/18 21:06	61	2/3/18 22:11	62	4/3/18 11:16	62	4/3/18 20:21	60	6/3/18 21:26	61	8/3/18 22:31	61
28/2/18 21:11	60	2/3/18 22:16	62	4/3/18 11:21	60	4/3/18 20:26	60	6/3/18 21:31	60	8/3/18 22:36	61
28/2/18 21:16	60	2/3/18 22:21	62	4/3/18 11:26	59	4/3/18 20:31	61	6/3/18 21:36	61	8/3/18 22:41	59
28/2/18 21:21	61	2/3/18 22:26	63	4/3/18 11:31	58	4/3/18 20:36	61	6/3/18 21:41	60	8/3/18 22:46	61
28/2/18 21:26	60	2/3/18 22:31	62	4/3/18 11:36	59	4/3/18 20:41	60	6/3/18 21:46	61	8/3/18 22:51	44
28/2/18 21:31	60	2/3/18 22:36	62	4/3/18 11:41	58	4/3/18 20:46	60	6/3/18 21:51	60	8/3/18 22:56	60
28/2/18 21:36	62	2/3/18 22:41	62	4/3/18 11:46	56	4/3/18 20:51	61	6/3/18 21:56	60	9/3/18 19:01	61
28/2/18 21:41	59	2/3/18 22:46	61	4/3/18 11:51	56	4/3/18 20:56	60	6/3/18 22:01	59	9/3/18 19:06	60
28/2/18 21:46	61	2/3/18 22:51	61	4/3/18 11:56	57	4/3/18 21:01	60	6/3/18 22:06	59	9/3/18 19:11	61
28/2/18 21:51	61	2/3/18 22:56	62	4/3/18 12:01	60	4/3/18 21:06	60	6/3/18 22:11	60	9/3/18 19:16	62
28/2/18 21:56	60	3/3/18 19:01	57	4/3/18 12:06	58	4/3/18 21:11	60	6/3/18 22:16	60	9/3/18 19:21	62
28/2/18 22:01	60	3/3/18 19:06	60	4/3/18 12:11	61	4/3/18 21:16	59	6/3/18 22:21	60	9/3/18 19:26	56
28/2/18 22:06	61	3/3/18 19:11	57	4/3/18 12:16	61	4/3/18 21:21	59	6/3/18 22:26	61	9/3/18 19:31	61
28/2/18 22:11	61	3/3/18 19:16	62	4/3/18 12:21	61	4/3/18 21:26	59	6/3/18 22:31	59	9/3/18 19:36	62
28/2/18 22:16	61	3/3/18 19:21	62	4/3/18 12:26	61	4/3/18 21:31	60	6/3/18 22:36	61	9/3/18 19:41	61
28/2/18 22:21	61	3/3/18 19:26	61	4/3/18 12:31	60	4/3/18 21:36	59	6/3/18 22:41	60	9/3/18 19:46	61
28/2/18 22:26	61	3/3/18 19:31	61	4/3/18 12:36	62	4/3/18 21:41	60	6/3/18 22:46	62	9/3/18 19:51	61
28/2/18 22:31	60	3/3/18 19:36	62	4/3/18 12:41	63	4/3/18 21:46	59	6/3/18 22:51	59	9/3/18 19:56	61
28/2/18 22:36	60	3/3/18 19:41	62	4/3/18 12:46	61	4/3/18 21:51	60	6/3/18 22:56	60	9/3/18 20:01	57
28/2/18 22:41	61	3/3/18 19:46	54	4/3/18 12:51	62	4/3/18 21:56	59	7/3/18 19:01	63	9/3/18 20:06	58
28/2/18 22:46	61	3/3/18 19:51	60	4/3/18 12:56	61	4/3/18 22:01	60	7/3/18 19:06	62	9/3/18 20:11	61
28/2/18 22:51	59	3/3/18 19:56	61	4/3/18 13:01	61	4/3/18 22:06	60	7/3/18 19:11	62	9/3/18 20:16	62
28/2/18 22:56	59	3/3/18 20:01	62	4/3/18 13:06	62	4/3/18 22:11	60	7/3/18 19:16	63	9/3/18 20:21	61
1/3/18 19:01	62	3/3/18 20:06	61	4/3/18 13:11	62	4/3/18 22:16	59	7/3/18 19:21	61	9/3/18 20:26	60
1/3/18 19:06	63	3/3/18 20:11	61	4/3/18 13:16	62	4/3/18 22:21	60	7/3/18 19:26	61	9/3/18 20:31	63
1/3/18 19:11	62	3/3/18 20:16	61	4/3/18 13:21	62	4/3/18 22:26	59	7/3/18 19:31	62	9/3/18 20:36	61
1/3/18 19:16	62	3/3/18 20:21	60	4/3/18 13:26	62	4/3/18 22:31	60	7/3/18 19:36	63	9/3/18 20:41	60
1/3/18 19:21	62	3/3/18 20:26	62	4/3/18 13:31	61	4/3/18 22:36	60	7/3/18 19:41	63	9/3/18 20:46	63
1/3/18 19:26	61	3/3/18 20:31	64	4/3/18 13:36	61	4/3/18 22:41	60	7/3/18 19:46	62	9/3/18 20:51	61
1/3/18 19:31	62	3/3/18 20:36	61	4/3/18 13:41	62	4/3/18 22:46	59	7/3/18 19:51	62	9/3/18 20:56	61
1/3/18 19:36	61	3/3/18 20:41	59	4/3/18 13:46	61	4/3/18 22:51	59	7/3/18 19:56	63	9/3/18 21:01	61
1/3/18 19:41	62	3/3/18 20:46	61	4/3/18 13:51	62	4/3/18 22:56	59	7/3/18 20:01	63	9/3/18 21:06	61
1/3/18 19:46	62	3/3/18 20:51	60	4/3/18 13:56	61	5/3/18 19:01	62	7/3/18 20:06	62	9/3/18 21:11	61
1/3/18 19:51	62	3/3/18 20:56	61	4/3/18 14:01	61	5/3/18 19:06	62	7/3/18 20:11	62	9/3/18 21:16	62
1/3/18 19:56	62	3/3/18 21:01	61	4/3/18 14:06	62	5/3/18 19:11	62	7/3/18 20:16	62	9/3/18 21:21	60
1/3/18 20:01	61	3/3/18 21:06	60	4/3/18 14:11	61	5/3/18 19:16	62	7/3/18 20:21	62	9/3/18 21:26	60
1/3/18 20:06	62	3/3/18 21:11	61	4/3/18 14:16	61	5/3/18 19:21	63	7/3/18 20:26	62	9/3/18 21:31	61
1/3/18 20:11	61	3/3/18 21:16	64	4/3/18 14:21	62	5/3/18 19:26	62	7/3/18 20:31	62	9/3/18 21:36	62
1/3/18 20:16	61	3/3/18 21:21	59	4/3/18 14:26	61	5/3/18 19:31	62	7/3/18 20:36	62	9/3/18 21:41	60
1/3/18 20:21	61	3/3/18 21:26	54	4/3/18 14:31	61	5/3/18 19:36	62	7/3/18 20:41	62	9/3/18 21:46	61
1/3/18 20:26	61	3/3/18 21:31	59	4/3/18 14:36	61	5/3/18 19:41	62	7/3/18 20:46	63	9/3/18 21:51	61
1/3/18 20:31	62	3/3/18 21:36	60	4/3/18 14:41	62	5/3/18 19:46	62	7/3/18 20:51	63	9/3/18 21:56	61
1/3/18 20:36	61	3/3/18 21:41	61	4/3/18 14:46	61	5/3/18 19:51	62	7/3/18 20:56	62	9/3/18 22:01	60
1/3/18 20:41	61	3/3/18 21:46	61	4/3/18 14:51	61	5/3/18 19:56	61	7/3/18 21:01	62	9/3/18 22:06	61
1/3/18 20:46	62	3/3/18 21:51	60	4/3/18 14:56	61	5/3/18 20:01	61	7/3/18 21:06	62	9/3/18 22:11	62
1/3/18 20:51	60	3/3/18 21:56	60	4/3/18 15:01	61	5/3/18 20:06	61	7/3/18 21:11	62	9/3/18 22:16	62
1/3/18 20:56	61	3/3/18 22:01	61	4/3/18 15:06	61	5/3/18 20:11	61	7/3/18 21:16	62	9/3/18 22:21	60
1/3/18 21:01	60	3/3/18 22:06	59	4/3/18 15:11	61	5/3/18 20:16	61	7/3/18 21:21	62	9/3/18 22:26	60
1/3/18 21:06	61	3/3/18 22:11	60	4/3/18 15:16	62	5/3/18 20:21	61	7/3/18 21:26	62	9/3/18 22:31	61
1/3/18 21:11	61	3/3/18 22:16	60	4/3/18 15:21	61	5/3/18 20:26	61	7/3/18 21:31	62	9/3/18 22:36	61
1/3/18 21:16	62	3/3/18 22:21	60	4/3/18 15:26	61	5/3/18 20:31	61	7/3/18 21:36	62	9/3/18 22:41	60
1/3/18 21:21	60	3/3/18 22:26	60	4/3/18 15:31	63	5/3/18 20:36	62	7/3/18 21:41	62	9/3/18 22:46	61
1/3/18 21:26	61	3/3/18 22:31	60	4/3/18 15:36	62	5/3/18 20:41	61	7/3/18 21:46	63	9/3/18 22:51	61
1/3/18 21:31	60	3/3/18 22:36	60	4/3/18 15:41	61	5/3/18 20:46	60	7/3/18 21:51	62	9/3/18 22:56	60
1/3/18 21:36	60	3/3/18 22:41	60	4/3/18 15:46	61	5/3/18 20:51	61	7/3/18 21:56	62	10/3/18 19:01	61
1/3/18 21:41	61	3/3/18 22:46	60	4/3/18 15:51	61	5/3/18 20:56	61	7/3/18 22:01	62	10/3/18 19:06	61
1/3/18 21:46	61	3/3/18 22:51	60	4/3/18 15:56	62	5/3/18 21:01	61	7/3/18 22:06	62	10/3/18 19:11	61
1/3/18 21:51	61	3/3/18 22:56	60	4/3/18 16:01	62	5/3/18 21:06	61	7/3/18 22:11	61	10/3/18 19:16	61
1/3/18 21:56	60	4/3/18 7:01	60	4/3/18 16:06	61	5/3/18 21:11	60	7/3/18 22:16	62	10/3/18 19:21	61
1/3/18 22:01	60	4/3/18 7:06	59	4/3/18 16:11	62	5/3/18 21:16	62	7/3/18 22:21	62	10/3/18 19:26	61
1/3/18 22:06	60	4/3/18 7:11	58	4/3/18 16:16	62	5/3/18 21:21	60	7/3/18 22:26	62	10/3/18 19:31	61
1/3/18 22:11	60	4/3/18 7:16	60	4/3/18 16:21	61	5/3/18 21:26	62	7/3/18 22:31	62	10/3/18 19:36	61
1/3/18 22:16	61	4/3/18 7:21	59	4/3/18 16:26	61	5/3/18 21:31	61	7/3/18 22:36	61	10/3/18 19:41	61
1/3/18 22:21	60	4/3/18 7:26	60	4/3/18 16:31	61	5/3/18 21:36	60	7/3/18 22:41	62	10/3/18 19:46	60
1/3/18 22:26	60	4/3/18 7:31	60	4/3/18 16:36	62	5/3/18 21:41	60	7/3/18 22:46	61	10/3/18 19:51	61
1/3/18 22:31	60	4/3/18 7:36	60	4/3/18 16:41	61	5/3/18 21:46	61	7/3/18 22:51	61	10/3/18 19:56	61
1/3/18 22:36	61	4/3/18 7:41	61	4/3/18 16:46	62	5/3/18 21:51	60	7/3/18 22:56	62	10/3/18 20:01	60
1/3/18 22:41	61	4/3/18 7:46	60	4/3/18 16:51	61	5/3/18 21:56	60	8/3/18 19:01	60	10/3/18 20:06	60
1/3/18 22:46	59	4/3/18 7:51	61	4/3/18 16:56	61	5/3/18 22:01	60	8/3/18 19:06	59	10/3/18 20:11	60
1/3/18 22:51	61	4/3/18 7:56	60	4/3/18 17:01	62	5/3/18 22:06	60	8/3/18 19:11	59	10/3/18 20:16	61
1/3/18 22:56	60	4/3/18 8:01	60	4/3/18 17:06	62	5/3/18 22:11	60	8/3/18 19:16	59	10/3/18 20:21	60
2/3/18 19:01	63	4/3/18 8:06	62	4/3/18 17:11	62	5/3/18 22:16	61	8/3/18 19:21	59	10/3/18 20:26	61
2/3/18 19:06	62	4/3/18 8:11	61	4/3/18 17:16	61	5/3/18 22:21	60	8/3/18 19:26	58	10/3/18 20:31	61
2/3/18 19:11	62	4/3/18 8:16	62	4/3/18 17:21	61	5/3/18 22:26	61	8/3/18 19:31	60	10/3/18 20:36	60
2/3/18 19:16	63	4/3/18 8:21	61	4/3/18 17:26	60	5/3/18 22:31	61	8/3/18 19:36	61	10/3/18 20:41	60
2/3/18 19:21	63	4/3/18 8:26	62	4/3/18 17:31	61	5/3/18 22:36	61	8/3/18 19:41	61	10/3/18 20:46	61
2/3/18 19:26	63	4/3/18 8:31	62	4/3/18 17:36	60	5/3/18 22:41	60	8/3/18 19:46	61	10/3/18 20:51	60
2/3/18 19:31	63	4/3/18 8:36	61	4/3/18 17:41	61	5/3/18 22:46	59	8/3/18 19:51	62	10/3/18 20:56	60
2/3/18 19:36	63	4/3/18 8:41	61	4/3/18 17:46	60	5/3/18 22:51	59	8/3/18 19:56	61	10/3/18 21:01	61
2/3/18 19:41	40	4/3/18 8:46	62	4/3/18 17:51	60	5/3/18 22:56	59	8/3/18 20:01	61	10/3/18 21:06	60
2/3/18 19:46	62	4/3/18 8:51	62	4/							

Real-time Noise Data		RTN4 (Causeway Bay Community Centre)									
11/3/18 7:26	59	11/3/18 16:31	61	12/3/18 21:36	60	14/3/18 22:41	60	17/3/18 19:46	60	18/3/18 12:51	62
11/3/18 7:31	60	11/3/18 16:36	61	12/3/18 21:41	60	14/3/18 22:46	60	17/3/18 19:51	61	18/3/18 12:56	62
11/3/18 7:36	60	11/3/18 16:41	61	12/3/18 21:46	60	14/3/18 22:51	60	17/3/18 19:56	61	18/3/18 13:01	62
11/3/18 7:41	61	11/3/18 16:46	62	12/3/18 21:51	60	14/3/18 22:56	60	17/3/18 20:01	60	18/3/18 13:06	62
11/3/18 7:46	61	11/3/18 16:51	62	12/3/18 21:56	61	15/3/18 19:01	62	17/3/18 20:06	59	18/3/18 13:11	62
11/3/18 7:51	61	11/3/18 16:56	61	12/3/18 22:01	59	15/3/18 19:06	63	17/3/18 20:11	60	18/3/18 13:16	62
11/3/18 7:56	61	11/3/18 17:01	61	12/3/18 22:06	59	15/3/18 19:11	63	17/3/18 20:16	60	18/3/18 13:21	63
11/3/18 8:01	60	11/3/18 17:06	61	12/3/18 22:11	60	15/3/18 19:16	63	17/3/18 20:21	62	18/3/18 13:26	61
11/3/18 8:06	63	11/3/18 17:11	61	12/3/18 22:16	59	15/3/18 19:21	64	17/3/18 20:26	60	18/3/18 13:31	60
11/3/18 8:11	61	11/3/18 17:16	62	12/3/18 22:21	60	15/3/18 19:26	63	17/3/18 20:31	59	18/3/18 13:36	61
11/3/18 8:16	61	11/3/18 17:21	62	12/3/18 22:26	60	15/3/18 19:31	62	17/3/18 20:36	59	18/3/18 13:41	61
11/3/18 8:21	60	11/3/18 17:26	62	12/3/18 22:31	60	15/3/18 19:36	62	17/3/18 20:41	60	18/3/18 13:46	60
11/3/18 8:26	61	11/3/18 17:31	61	12/3/18 22:36	61	15/3/18 19:41	62	17/3/18 20:46	60	18/3/18 13:51	61
11/3/18 8:31	62	11/3/18 17:36	61	12/3/18 22:41	60	15/3/18 19:46	62	17/3/18 20:51	60	18/3/18 13:56	63
11/3/18 8:36	61	11/3/18 17:41	61	12/3/18 22:46	59	15/3/18 19:51	62	17/3/18 20:56	60	18/3/18 14:01	62
11/3/18 8:41	61	11/3/18 17:46	62	12/3/18 22:51	59	15/3/18 19:56	61	17/3/18 21:01	59	18/3/18 14:06	61
11/3/18 8:46	62	11/3/18 17:51	62	12/3/18 22:56	60	15/3/18 20:01	62	17/3/18 21:06	59	18/3/18 14:11	61
11/3/18 8:51	61	11/3/18 17:56	62	13/3/18 19:01	62	15/3/18 20:06	62	17/3/18 21:11	60	18/3/18 14:16	62
11/3/18 8:56	62	11/3/18 18:01	61	13/3/18 19:06	62	15/3/18 20:11	62	17/3/18 21:16	61	18/3/18 14:21	61
11/3/18 9:01	62	11/3/18 18:06	62	13/3/18 19:11	63	15/3/18 20:16	62	17/3/18 21:21	59	18/3/18 14:26	61
11/3/18 9:06	61	11/3/18 18:11	61	13/3/18 19:16	61	15/3/18 20:21	61	17/3/18 21:26	60	18/3/18 14:31	62
11/3/18 9:11	62	11/3/18 18:16	62	13/3/18 19:21	63	15/3/18 20:26	62	17/3/18 21:31	60	18/3/18 14:36	61
11/3/18 9:16	62	11/3/18 18:21	61	13/3/18 19:26	63	15/3/18 20:31	62	17/3/18 21:36	60	18/3/18 14:41	62
11/3/18 9:21	61	11/3/18 18:26	61	13/3/18 19:31	63	15/3/18 20:36	61	17/3/18 21:41	60	18/3/18 14:46	62
11/3/18 9:26	61	11/3/18 18:31	62	13/3/18 19:36	63	15/3/18 20:41	61	17/3/18 21:46	60	18/3/18 14:51	63
11/3/18 9:31	62	11/3/18 18:36	62	13/3/18 19:41	63	15/3/18 20:46	61	17/3/18 21:51	60	18/3/18 14:56	61
11/3/18 9:36	61	11/3/18 18:41	62	13/3/18 19:46	63	15/3/18 20:51	62	17/3/18 21:56	60	18/3/18 15:01	61
11/3/18 9:41	62	11/3/18 18:46	61	13/3/18 19:51	63	15/3/18 20:56	61	17/3/18 22:01	60	18/3/18 15:06	63
11/3/18 9:46	60	11/3/18 18:51	61	13/3/18 19:56	62	15/3/18 21:01	61	17/3/18 22:06	60	18/3/18 15:11	62
11/3/18 9:51	62	11/3/18 18:56	62	13/3/18 20:01	62	15/3/18 21:06	60	17/3/18 22:11	60	18/3/18 15:16	61
11/3/18 9:56	61	11/3/18 19:01	61	13/3/18 20:06	62	15/3/18 21:11	61	17/3/18 22:16	61	18/3/18 15:21	62
11/3/18 10:01	61	11/3/18 19:06	61	13/3/18 20:11	63	15/3/18 21:16	62	17/3/18 22:21	59	18/3/18 15:26	61
11/3/18 10:06	62	11/3/18 19:11	61	13/3/18 20:16	62	15/3/18 21:21	60	17/3/18 22:26	61	18/3/18 15:31	61
11/3/18 10:11	61	11/3/18 19:16	61	13/3/18 20:21	63	15/3/18 21:26	62	17/3/18 22:31	60	18/3/18 15:36	61
11/3/18 10:16	61	11/3/18 19:21	61	13/3/18 20:26	63	15/3/18 21:31	60	17/3/18 22:36	60	18/3/18 15:41	62
11/3/18 10:21	61	11/3/18 19:26	61	13/3/18 20:31	62	15/3/18 21:36	51	17/3/18 22:41	60	18/3/18 15:46	61
11/3/18 10:26	61	11/3/18 19:31	61	13/3/18 20:36	62	15/3/18 21:41	60	17/3/18 22:46	60	18/3/18 15:51	62
11/3/18 10:31	64	11/3/18 19:36	61	13/3/18 20:41	62	15/3/18 21:46	62	17/3/18 22:51	59	18/3/18 15:56	61
11/3/18 10:36	61	11/3/18 19:41	61	13/3/18 20:46	62	15/3/18 21:51	60	17/3/18 22:56	60	18/3/18 16:01	62
11/3/18 10:41	61	11/3/18 19:46	61	13/3/18 20:51	63	15/3/18 21:56	61	18/3/18 7:01	61	18/3/18 16:06	62
11/3/18 10:46	60	11/3/18 19:51	61	13/3/18 20:56	62	15/3/18 22:01	60	18/3/18 7:06	59	18/3/18 16:11	63
11/3/18 10:51	60	11/3/18 19:56	60	13/3/18 21:01	62	15/3/18 22:06	60	18/3/18 7:11	60	18/3/18 16:16	62
11/3/18 10:56	61	11/3/18 20:01	61	13/3/18 21:06	62	15/3/18 22:11	62	18/3/18 7:16	59	18/3/18 16:21	61
11/3/18 11:01	61	11/3/18 20:06	60	13/3/18 21:11	62	15/3/18 22:16	61	18/3/18 7:21	61	18/3/18 16:26	61
11/3/18 11:06	61	11/3/18 20:11	60	13/3/18 21:16	62	15/3/18 22:21	61	18/3/18 7:26	59	18/3/18 16:31	62
11/3/18 11:11	59	11/3/18 20:16	60	13/3/18 21:21	63	15/3/18 22:26	61	18/3/18 7:31	61	18/3/18 16:36	62
11/3/18 11:16	60	11/3/18 20:21	61	13/3/18 21:26	62	15/3/18 22:31	60	18/3/18 7:36	59	18/3/18 16:41	62
11/3/18 11:21	60	11/3/18 20:26	59	13/3/18 21:31	63	15/3/18 22:36	62	18/3/18 7:41	60	18/3/18 16:46	61
11/3/18 11:26	60	11/3/18 20:31	60	13/3/18 21:36	63	15/3/18 22:41	61	18/3/18 7:46	61	18/3/18 16:51	61
11/3/18 11:31	60	11/3/18 20:36	60	13/3/18 21:41	62	15/3/18 22:46	55	18/3/18 7:51	61	18/3/18 16:56	62
11/3/18 11:36	60	11/3/18 20:41	60	13/3/18 21:46	63	15/3/18 22:51	60	18/3/18 7:56	63	18/3/18 17:01	61
11/3/18 11:41	60	11/3/18 20:46	60	13/3/18 21:51	62	15/3/18 22:56	60	18/3/18 8:01	62	18/3/18 17:06	61
11/3/18 11:46	60	11/3/18 20:51	60	13/3/18 21:56	62	16/3/18 19:01	60	18/3/18 8:06	60	18/3/18 17:11	61
11/3/18 11:51	61	11/3/18 20:56	62	13/3/18 22:01	62	16/3/18 19:06	62	18/3/18 8:11	61	18/3/18 17:16	61
11/3/18 11:56	61	11/3/18 21:01	60	13/3/18 22:06	62	16/3/18 19:11	61	18/3/18 8:16	60	18/3/18 17:21	62
11/3/18 12:01	62	11/3/18 21:06	60	13/3/18 22:11	62	16/3/18 19:16	62	18/3/18 8:21	60	18/3/18 17:26	61
11/3/18 12:06	62	11/3/18 21:11	60	13/3/18 22:16	63	16/3/18 19:21	58	18/3/18 8:26	47	18/3/18 17:31	62
11/3/18 12:11	62	11/3/18 21:16	60	13/3/18 22:21	63	16/3/18 19:26	37	18/3/18 8:31	62	18/3/18 17:36	61
11/3/18 12:16	61	11/3/18 21:21	61	13/3/18 22:26	63	16/3/18 19:31	61	18/3/18 8:36	62	18/3/18 17:41	63
11/3/18 12:21	61	11/3/18 21:26	61	13/3/18 22:31	63	16/3/18 19:36	61	18/3/18 8:41	61	18/3/18 17:46	61
11/3/18 12:26	61	11/3/18 21:31	60	13/3/18 22:36	63	16/3/18 19:41	60	18/3/18 8:46	61	18/3/18 17:51	61
11/3/18 12:31	61	11/3/18 21:36	60	13/3/18 22:41	61	16/3/18 19:46	62	18/3/18 8:51	60	18/3/18 17:56	63
11/3/18 12:36	61	11/3/18 21:41	60	13/3/18 22:46	61	16/3/18 19:51	55	18/3/18 8:56	61	18/3/18 18:01	60
11/3/18 12:41	62	11/3/18 21:46	60	13/3/18 22:51	62	16/3/18 19:56	62	18/3/18 9:01	60	18/3/18 18:06	63
11/3/18 12:46	61	11/3/18 21:51	62	13/3/18 22:56	62	16/3/18 20:01	63	18/3/18 9:06	62	18/3/18 18:11	61
11/3/18 12:51	62	11/3/18 21:56	61	14/3/18 19:01	62	16/3/18 20:06	61	18/3/18 9:11	61	18/3/18 18:16	61
11/3/18 12:56	61	11/3/18 22:01	61	14/3/18 19:06	62	16/3/18 20:11	62	18/3/18 9:16	63	18/3/18 18:21	62
11/3/18 13:01	61	11/3/18 22:06	60	14/3/18 19:11	62	16/3/18 20:16	59	18/3/18 9:21	61	18/3/18 18:26	61
11/3/18 13:06	61	11/3/18 22:11	60	14/3/18 19:16	62	16/3/18 20:21	60	18/3/18 9:26	62	18/3/18 18:31	61
11/3/18 13:11	61	11/3/18 22:16	60	14/3/18 19:21	63	16/3/18 20:26	62	18/3/18 9:31	62	18/3/18 18:36	63
11/3/18 13:16	61	11/3/18 22:21	60	14/3/18 19:26	62	16/3/18 20:31	61	18/3/18 9:36	61	18/3/18 18:41	62
11/3/18 13:21	61	11/3/18 22:26	60	14/3/18 19:31	62	16/3/18 20:36	60	18/3/18 9:41	63	18/3/18 18:46	61
11/3/18 13:26	61	11/3/18 22:31	60	14/3/18 19:36	62	16/3/18 20:41	62	18/3/18 9:46	60	18/3/18 18:51	60
11/3/18 13:31	62	11/3/18 22:36	60	14/3/18 19:41	61	16/3/18 20:46	60	18/3/18 9:51	62	18/3/18 18:56	61
11/3/18 13:36	62	11/3/18 22:41	60	14/3/18 19:46	62	16/3/18 20:51	61	18/3/18 9:56	63	18/3/18 19:01	62
11/3/18 13:41	58	11/3/18 22:46	60	14/3/18 19:51	62	16/3/18 20:56	61	18/3/18 10:01	62	18/3/18 19:06	61
11/3/18 13:46	61	11/3/18 22:51	60	14/3/18 19:56	61	16/3/18 21:01	61	18/3/18 10:06	61	18/3/18 19:11	61
11/3/18 13:51	61	11/3/18 22:56	59	14/3/18 20:01	61	16/3/18 21:06	60	18/3/18 10:11	62	18/3/18 19:16	61
11/3/18 13:56	61	12/3/18 19:01	61	14/3/18 20:06	62	16/3/18 21:11	61	18/3/18 10:16	63	18/3/18 19:21	61
11/3/18 14:01	61	12/3/18 19:06	61	14/3/18 20:11	62	16/3/18 21:1					

Real-time Noise Data		RTN4 (Causeway Bay Community Centre)									
18/3/18 21:56	59	21/3/18 19:01	59	23/3/18 20:06	62	25/3/18 9:11	61	25/3/18 18:16	62	27/2/18 0:06	60
18/3/18 22:01	60	21/3/18 19:06	62	23/3/18 20:11	63	25/3/18 9:16	62	25/3/18 18:21	61	27/2/18 0:11	60
18/3/18 22:06	60	21/3/18 19:11	59	23/3/18 20:16	62	25/3/18 9:21	62	25/3/18 18:26	62	27/2/18 0:16	61
18/3/18 22:11	59	21/3/18 19:16	59	23/3/18 20:21	62	25/3/18 9:26	62	25/3/18 18:31	61	27/2/18 0:21	60
18/3/18 22:16	60	21/3/18 19:21	59	23/3/18 20:26	62	25/3/18 9:31	62	25/3/18 18:36	62	27/2/18 0:26	60
18/3/18 22:21	60	21/3/18 19:26	60	23/3/18 20:31	62	25/3/18 9:36	61	25/3/18 18:41	61	27/2/18 0:31	60
18/3/18 22:26	59	21/3/18 19:31	60	23/3/18 20:36	62	25/3/18 9:41	61	25/3/18 18:46	61	27/2/18 0:36	60
18/3/18 22:31	60	21/3/18 19:36	61	23/3/18 20:41	62	25/3/18 9:46	61	25/3/18 18:51	62	27/2/18 0:41	59
18/3/18 22:36	59	21/3/18 19:41	61	23/3/18 20:46	62	25/3/18 9:51	61	25/3/18 18:56	61	27/2/18 0:46	60
18/3/18 22:41	59	21/3/18 19:46	61	23/3/18 20:51	62	25/3/18 9:56	61	25/3/18 19:01	61	27/2/18 0:51	60
18/3/18 22:46	59	21/3/18 19:51	61	23/3/18 20:56	62	25/3/18 10:01	61	25/3/18 19:06	61	27/2/18 0:56	60
18/3/18 22:51	60	21/3/18 19:56	61	23/3/18 21:01	62	25/3/18 10:06	62	25/3/18 19:11	60	27/2/18 1:01	59
18/3/18 22:56	59	21/3/18 20:01	61	23/3/18 21:06	50	25/3/18 10:11	61	25/3/18 19:16	60	27/2/18 1:06	59
19/3/18 19:01	61	21/3/18 20:06	60	23/3/18 21:11	62	25/3/18 10:16	62	25/3/18 19:21	60	27/2/18 1:11	59
19/3/18 19:06	62	21/3/18 20:11	61	23/3/18 21:16	62	25/3/18 10:21	62	25/3/18 19:26	61	27/2/18 1:16	60
19/3/18 19:11	61	21/3/18 20:16	61	23/3/18 21:21	62	25/3/18 10:26	62	25/3/18 19:31	61	27/2/18 1:21	59
19/3/18 19:16	61	21/3/18 20:21	61	23/3/18 21:26	62	25/3/18 10:31	61	25/3/18 19:36	62	27/2/18 1:26	60
19/3/18 19:21	61	21/3/18 20:26	61	23/3/18 21:31	62	25/3/18 10:36	61	25/3/18 19:41	60	27/2/18 1:31	59
19/3/18 19:26	63	21/3/18 20:31	61	23/3/18 21:36	62	25/3/18 10:41	61	25/3/18 19:46	55	27/2/18 1:36	59
19/3/18 19:31	61	21/3/18 20:36	61	23/3/18 21:41	63	25/3/18 10:46	62	25/3/18 19:51	59	27/2/18 1:41	59
19/3/18 19:36	62	21/3/18 20:41	60	23/3/18 21:46	62	25/3/18 10:51	63	25/3/18 19:56	58	27/2/18 1:46	59
19/3/18 19:41	62	21/3/18 20:46	61	23/3/18 21:51	51	25/3/18 10:56	64	25/3/18 20:01	62	27/2/18 1:51	59
19/3/18 19:46	62	21/3/18 20:51	60	23/3/18 21:56	62	25/3/18 11:01	59	25/3/18 20:06	61	27/2/18 1:56	59
19/3/18 19:51	62	21/3/18 20:56	60	23/3/18 22:01	62	25/3/18 11:06	63	25/3/18 20:11	60	27/2/18 2:01	59
19/3/18 19:56	62	21/3/18 21:01	59	23/3/18 22:06	63	25/3/18 11:11	61	25/3/18 20:16	63	27/2/18 2:06	58
19/3/18 20:01	62	21/3/18 21:06	60	23/3/18 22:11	62	25/3/18 11:16	61	25/3/18 20:21	61	27/2/18 2:11	59
19/3/18 20:06	61	21/3/18 21:11	61	23/3/18 22:16	62	25/3/18 11:21	61	25/3/18 20:26	60	27/2/18 2:16	58
19/3/18 20:11	62	21/3/18 21:16	60	23/3/18 22:21	62	25/3/18 11:26	53	25/3/18 20:31	63	27/2/18 2:21	59
19/3/18 20:16	62	21/3/18 21:21	60	23/3/18 22:26	63	25/3/18 11:31	61	25/3/18 20:36	61	27/2/18 2:26	59
19/3/18 20:21	62	21/3/18 21:26	60	23/3/18 22:31	62	25/3/18 11:36	63	25/3/18 20:41	59	27/2/18 2:31	59
19/3/18 20:26	62	21/3/18 21:31	60	23/3/18 22:36	62	25/3/18 11:41	61	25/3/18 20:46	62	27/2/18 2:36	59
19/3/18 20:31	61	21/3/18 21:36	60	23/3/18 22:41	62	25/3/18 11:46	60	25/3/18 20:51	55	27/2/18 2:41	59
19/3/18 20:36	62	21/3/18 21:41	60	23/3/18 22:46	62	25/3/18 11:51	62	25/3/18 20:56	60	27/2/18 2:46	58
19/3/18 20:41	61	21/3/18 21:46	60	23/3/18 22:51	62	25/3/18 11:56	61	25/3/18 21:01	60	27/2/18 2:51	58
19/3/18 20:46	61	21/3/18 21:51	61	23/3/18 22:56	62	25/3/18 12:01	61	25/3/18 21:06	59	27/2/18 2:56	59
19/3/18 20:51	62	21/3/18 21:56	60	24/3/18 19:01	61	25/3/18 12:06	62	25/3/18 21:11	61	27/2/18 3:01	59
19/3/18 20:56	61	21/3/18 22:01	60	24/3/18 19:06	61	25/3/18 12:11	62	25/3/18 21:16	59	27/2/18 3:06	59
19/3/18 21:01	61	21/3/18 22:06	59	24/3/18 19:11	61	25/3/18 12:16	59	25/3/18 21:21	60	27/2/18 3:11	58
19/3/18 21:06	61	21/3/18 22:11	60	24/3/18 19:16	61	25/3/18 12:21	59	25/3/18 21:26	59	27/2/18 3:16	58
19/3/18 21:11	61	21/3/18 22:16	60	24/3/18 19:21	49	25/3/18 12:26	37	25/3/18 21:31	60	27/2/18 3:21	59
19/3/18 21:16	61	21/3/18 22:21	61	24/3/18 19:26	61	25/3/18 12:31	63	25/3/18 21:36	60	27/2/18 3:26	59
19/3/18 21:21	61	21/3/18 22:26	60	24/3/18 19:31	61	25/3/18 12:36	62	25/3/18 21:41	61	27/2/18 3:31	59
19/3/18 21:26	61	21/3/18 22:31	59	24/3/18 19:36	60	25/3/18 12:41	62	25/3/18 21:46	59	27/2/18 3:36	59
19/3/18 21:31	61	21/3/18 22:36	60	24/3/18 19:41	62	25/3/18 12:46	55	25/3/18 21:51	61	27/2/18 3:41	58
19/3/18 21:36	63	21/3/18 22:41	60	24/3/18 19:46	61	25/3/18 12:51	58	25/3/18 21:56	61	27/2/18 3:46	59
19/3/18 21:41	61	21/3/18 22:46	59	24/3/18 19:51	61	25/3/18 12:56	59	25/3/18 22:01	59	27/2/18 3:51	60
19/3/18 21:46	61	21/3/18 22:51	60	24/3/18 19:56	61	25/3/18 13:01	62	25/3/18 22:06	59	27/2/18 3:56	58
19/3/18 21:51	61	21/3/18 22:56	60	24/3/18 20:01	61	25/3/18 13:06	61	25/3/18 22:11	60	27/2/18 4:01	58
19/3/18 21:56	61	22/3/18 19:01	59	24/3/18 20:06	60	25/3/18 13:11	61	25/3/18 22:16	60	27/2/18 4:06	58
19/3/18 22:01	61	22/3/18 19:06	59	24/3/18 20:11	62	25/3/18 13:16	62	25/3/18 22:21	60	27/2/18 4:11	58
19/3/18 22:06	61	22/3/18 19:11	59	24/3/18 20:16	62	25/3/18 13:21	62	25/3/18 22:26	61	27/2/18 4:16	61
19/3/18 22:11	62	22/3/18 19:16	60	24/3/18 20:21	61	25/3/18 13:26	58	25/3/18 22:31	59	27/2/18 4:21	59
19/3/18 22:16	61	22/3/18 19:21	59	24/3/18 20:26	60	25/3/18 13:31	57	25/3/18 22:36	59	27/2/18 4:26	59
19/3/18 22:21	61	22/3/18 19:26	59	24/3/18 20:31	60	25/3/18 13:36	57	25/3/18 22:41	59	27/2/18 4:31	59
19/3/18 22:26	61	22/3/18 19:31	60	24/3/18 20:36	60	25/3/18 13:41	60	25/3/18 22:46	59	27/2/18 4:36	59
19/3/18 22:31	61	22/3/18 19:36	60	24/3/18 20:41	60	25/3/18 13:46	62	25/3/18 22:51	59	27/2/18 4:41	59
19/3/18 22:36	62	22/3/18 19:41	61	24/3/18 20:46	61	25/3/18 13:51	62	25/3/18 22:56	58	27/2/18 4:46	58
19/3/18 22:41	61	22/3/18 19:46	61	24/3/18 20:51	60	25/3/18 13:56	56	26/3/18 19:01	58	27/2/18 4:51	59
19/3/18 22:46	61	22/3/18 19:51	60	24/3/18 20:56	61	25/3/18 14:01	60	26/3/18 19:06	59	27/2/18 4:56	59
19/3/18 22:51	61	22/3/18 19:56	61	24/3/18 21:01	60	25/3/18 14:06	57	26/3/18 19:11	60	27/2/18 5:01	58
19/3/18 22:56	61	22/3/18 20:01	61	24/3/18 21:06	60	25/3/18 14:11	59	26/3/18 19:16	61	27/2/18 5:06	59
20/3/18 19:01	61	22/3/18 20:06	63	24/3/18 21:11	60	25/3/18 14:16	60	26/3/18 19:21	61	27/2/18 5:11	59
20/3/18 19:06	61	22/3/18 20:11	62	24/3/18 21:16	60	25/3/18 14:21	59	26/3/18 19:26	61	27/2/18 5:16	59
20/3/18 19:11	61	22/3/18 20:16	61	24/3/18 21:21	61	25/3/18 14:26	59	26/3/18 19:31	61	27/2/18 5:21	59
20/3/18 19:16	60	22/3/18 20:21	61	24/3/18 21:26	61	25/3/18 14:31	59	26/3/18 19:36	61	27/2/18 5:26	60
20/3/18 19:21	61	22/3/18 20:26	61	24/3/18 21:31	61	25/3/18 14:36	60	26/3/18 19:41	61	27/2/18 5:31	59
20/3/18 19:26	60	22/3/18 20:31	61	24/3/18 21:36	60	25/3/18 14:41	60	26/3/18 19:46	62	27/2/18 5:36	59
20/3/18 19:31	60	22/3/18 20:36	61	24/3/18 21:41	61	25/3/18 14:46	59	26/3/18 19:51	62	27/2/18 5:41	59
20/3/18 19:36	61	22/3/18 20:41	61	24/3/18 21:46	60	25/3/18 14:51	60	26/3/18 19:56	63	27/2/18 5:46	60
20/3/18 19:41	61	22/3/18 20:46	61	24/3/18 21:51	64	25/3/18 14:56	59	26/3/18 20:01	62	27/2/18 5:51	60
20/3/18 19:46	60	22/3/18 20:51	61	24/3/18 21:56	61	25/3/18 15:01	59	26/3/18 20:06	62	27/2/18 5:56	59
20/3/18 19:51	62	22/3/18 20:56	60	24/3/18 22:01	61	25/3/18 15:06	60	26/3/18 20:11	62	27/2/18 6:01	60
20/3/18 19:56	58	22/3/18 21:01	61	24/3/18 22:06	60	25/3/18 15:11	60	26/3/18 20:16	61	27/2/18 6:06	60
20/3/18 20:01	61	22/3/18 21:06	60	24/3/18 22:11	60	25/3/18 15:16	58	26/3/18 20:21	62	27/2/18 6:11	60
20/3/18 20:06	60	22/3/18 21:11	61	24/3/18 22:16	60	25/3/18 15:21	61	26/3/18 20:26	61	27/2/18 6:16	61
20/3/18 20:11	60	22/3/18 21:16	60	24/3/18 22:21	60	25/3/18 15:26	59	26/3/18 20:31	61	27/2/18 6:21	61
20/3/18 20:16	63	22/3/18 21:21	60	24/3/18 22:26	60	25/3/18 15:31	58	26/3/18 20:36	62	27/2/18 6:26	48
20/3/18 20:21	61	22/3/18 21:26	61	24/3/18 22:31	60	25/3/18 15:36	59	26/3/18 20:41	61	27/2/18 6:31	50
20/3/18 20:26	60	22/3/18 21:31	61	24/3/18 22:36	60	25/3/18 15:41	59	26/3/18 20:46	61	27/2/18 6:36	50
20/3/18 20:31	61	22/3/18 21:36	60	24/3/18 22:41	59	25/3/18 15:46	58	26/3/18 20:51			

Real-time Noise Data		RTN4 (Causeway Bay Community Centre)									
28/2/18 1:11	56	1/3/18 2:16	56	2/3/18 3:21	55	3/3/18 4:26	60	4/3/18 5:31	56	5/3/18 6:36	60
28/2/18 1:16	57	1/3/18 2:21	55	2/3/18 3:26	55	3/3/18 4:31	60	4/3/18 5:36	56	5/3/18 6:41	60
28/2/18 1:21	56	1/3/18 2:26	55	2/3/18 3:31	55	3/3/18 4:36	59	4/3/18 5:41	56	5/3/18 6:46	60
28/2/18 1:26	57	1/3/18 2:31	56	2/3/18 3:36	54	3/3/18 4:41	59	4/3/18 5:46	57	5/3/18 6:51	60
28/2/18 1:31	56	1/3/18 2:36	56	2/3/18 3:41	55	3/3/18 4:46	60	4/3/18 5:51	57	5/3/18 6:56	60
28/2/18 1:36	56	1/3/18 2:41	55	2/3/18 3:46	55	3/3/18 4:51	59	4/3/18 5:56	58	5/3/18 23:01	59
28/2/18 1:41	55	1/3/18 2:46	55	2/3/18 3:51	54	3/3/18 4:56	59	4/3/18 6:01	56	5/3/18 23:06	59
28/2/18 1:46	58	1/3/18 2:51	54	2/3/18 3:56	53	3/3/18 5:01	60	4/3/18 6:06	57	5/3/18 23:11	59
28/2/18 1:51	56	1/3/18 2:56	56	2/3/18 4:01	54	3/3/18 5:06	60	4/3/18 6:11	58	5/3/18 23:16	59
28/2/18 1:56	55	1/3/18 3:01	55	2/3/18 4:06	55	3/3/18 5:11	59	4/3/18 6:16	57	5/3/18 23:21	59
28/2/18 2:01	56	1/3/18 3:06	56	2/3/18 4:11	58	3/3/18 5:16	59	4/3/18 6:21	58	5/3/18 23:26	59
28/2/18 2:06	56	1/3/18 3:11	55	2/3/18 4:16	53	3/3/18 5:21	60	4/3/18 6:26	59	5/3/18 23:31	59
28/2/18 2:11	56	1/3/18 3:16	55	2/3/18 4:21	56	3/3/18 5:26	60	4/3/18 6:31	59	5/3/18 23:36	58
28/2/18 2:16	55	1/3/18 3:21	54	2/3/18 4:26	54	3/3/18 5:31	60	4/3/18 6:36	59	5/3/18 23:41	58
28/2/18 2:21	55	1/3/18 3:26	55	2/3/18 4:31	53	3/3/18 5:36	60	4/3/18 6:41	58	5/3/18 23:46	58
28/2/18 2:26	54	1/3/18 3:31	56	2/3/18 4:36	56	3/3/18 5:41	60	4/3/18 6:46	58	5/3/18 23:51	58
28/2/18 2:31	54	1/3/18 3:36	56	2/3/18 4:41	55	3/3/18 5:46	60	4/3/18 6:51	59	5/3/18 23:56	58
28/2/18 2:36	55	1/3/18 3:41	55	2/3/18 4:46	56	3/3/18 5:51	60	4/3/18 6:56	58	6/3/18 0:01	57
28/2/18 2:41	55	1/3/18 3:46	55	2/3/18 4:51	54	3/3/18 5:56	60	4/3/18 23:01	59	6/3/18 0:06	58
28/2/18 2:46	55	1/3/18 3:51	55	2/3/18 4:56	55	3/3/18 6:01	61	4/3/18 23:06	59	6/3/18 0:11	57
28/2/18 2:51	54	1/3/18 3:56	55	2/3/18 5:01	55	3/3/18 6:06	60	4/3/18 23:11	59	6/3/18 0:16	57
28/2/18 2:56	55	1/3/18 4:01	54	2/3/18 5:06	54	3/3/18 6:11	60	4/3/18 23:16	59	6/3/18 0:21	57
28/2/18 3:01	54	1/3/18 4:06	54	2/3/18 5:11	54	3/3/18 6:16	61	4/3/18 23:21	58	6/3/18 0:26	58
28/2/18 3:06	54	1/3/18 4:11	54	2/3/18 5:16	54	3/3/18 6:21	61	4/3/18 23:26	58	6/3/18 0:31	57
28/2/18 3:11	54	1/3/18 4:16	55	2/3/18 5:21	55	3/3/18 6:26	61	4/3/18 23:31	58	6/3/18 0:36	56
28/2/18 3:16	54	1/3/18 4:21	56	2/3/18 5:26	56	3/3/18 6:31	46	4/3/18 23:36	58	6/3/18 0:41	58
28/2/18 3:21	55	1/3/18 4:26	55	2/3/18 5:31	56	3/3/18 6:36	61	4/3/18 23:41	58	6/3/18 0:46	57
28/2/18 3:26	55	1/3/18 4:31	56	2/3/18 5:36	55	3/3/18 6:41	52	4/3/18 23:46	58	6/3/18 0:51	57
28/2/18 3:31	54	1/3/18 4:36	55	2/3/18 5:41	56	3/3/18 6:46	52	4/3/18 23:51	57	6/3/18 0:56	57
28/2/18 3:36	54	1/3/18 4:41	55	2/3/18 5:46	56	3/3/18 6:51	53	4/3/18 23:56	58	6/3/18 1:01	57
28/2/18 3:41	55	1/3/18 4:46	54	2/3/18 5:51	56	3/3/18 6:56	55	5/3/18 0:01	57	6/3/18 1:06	57
28/2/18 3:46	55	1/3/18 4:51	54	2/3/18 5:56	57	3/3/18 23:01	59	5/3/18 0:06	58	6/3/18 1:11	57
28/2/18 3:51	53	1/3/18 4:56	56	2/3/18 6:01	57	3/3/18 23:06	60	5/3/18 0:11	57	6/3/18 1:16	57
28/2/18 3:56	54	1/3/18 5:01	55	2/3/18 6:06	58	3/3/18 23:11	60	5/3/18 0:16	57	6/3/18 1:21	57
28/2/18 4:01	54	1/3/18 5:06	55	2/3/18 6:11	58	3/3/18 23:16	59	5/3/18 0:21	57	6/3/18 1:26	56
28/2/18 4:06	54	1/3/18 5:11	55	2/3/18 6:16	58	3/3/18 23:21	59	5/3/18 0:26	57	6/3/18 1:31	56
28/2/18 4:11	54	1/3/18 5:16	56	2/3/18 6:21	59	3/3/18 23:26	59	5/3/18 0:31	57	6/3/18 1:36	55
28/2/18 4:16	55	1/3/18 5:21	57	2/3/18 6:26	59	3/3/18 23:31	60	5/3/18 0:36	59	6/3/18 1:41	56
28/2/18 4:21	54	1/3/18 5:26	56	2/3/18 6:31	59	3/3/18 23:36	59	5/3/18 0:41	57	6/3/18 1:46	56
28/2/18 4:26	54	1/3/18 5:31	56	2/3/18 6:36	60	3/3/18 23:41	60	5/3/18 0:46	57	6/3/18 1:51	56
28/2/18 4:31	54	1/3/18 5:36	56	2/3/18 6:41	60	3/3/18 23:46	59	5/3/18 0:51	57	6/3/18 1:56	55
28/2/18 4:36	54	1/3/18 5:41	56	2/3/18 6:46	61	3/3/18 23:51	59	5/3/18 0:56	56	6/3/18 2:01	56
28/2/18 4:41	53	1/3/18 5:46	57	2/3/18 6:51	61	3/3/18 23:56	59	5/3/18 1:01	55	6/3/18 2:06	56
28/2/18 4:46	54	1/3/18 5:51	57	2/3/18 6:56	47	4/3/18 0:01	59	5/3/18 1:06	56	6/3/18 2:11	55
28/2/18 4:51	55	1/3/18 5:56	57	2/3/18 23:01	52	4/3/18 0:06	59	5/3/18 1:11	55	6/3/18 2:16	54
28/2/18 4:56	56	1/3/18 6:01	58	2/3/18 23:06	50	4/3/18 0:11	59	5/3/18 1:16	55	6/3/18 2:21	56
28/2/18 5:01	54	1/3/18 6:06	59	2/3/18 23:11	47	4/3/18 0:16	58	5/3/18 1:21	56	6/3/18 2:26	54
28/2/18 5:06	56	1/3/18 6:11	58	2/3/18 23:16	50	4/3/18 0:21	58	5/3/18 1:26	55	6/3/18 2:31	56
28/2/18 5:11	55	1/3/18 6:16	59	2/3/18 23:21	48	4/3/18 0:26	58	5/3/18 1:31	56	6/3/18 2:36	56
28/2/18 5:16	55	1/3/18 6:21	58	2/3/18 23:26	55	4/3/18 0:31	58	5/3/18 1:36	56	6/3/18 2:41	54
28/2/18 5:21	56	1/3/18 6:26	59	2/3/18 23:31	51	4/3/18 0:36	57	5/3/18 1:41	55	6/3/18 2:46	55
28/2/18 5:26	45	1/3/18 6:31	60	2/3/18 23:36	47	4/3/18 0:41	57	5/3/18 1:46	55	6/3/18 2:51	56
28/2/18 5:31	56	1/3/18 6:36	60	2/3/18 23:41	52	4/3/18 0:46	58	5/3/18 1:51	54	6/3/18 2:56	55
28/2/18 5:36	56	1/3/18 6:41	60	2/3/18 23:46	50	4/3/18 0:51	57	5/3/18 1:56	55	6/3/18 3:01	55
28/2/18 5:41	56	1/3/18 6:46	61	2/3/18 23:51	44	4/3/18 0:56	57	5/3/18 2:01	56	6/3/18 3:06	54
28/2/18 5:46	56	1/3/18 6:51	61	2/3/18 23:56	35	4/3/18 1:01	58	5/3/18 2:06	54	6/3/18 3:11	56
28/2/18 5:51	56	1/3/18 6:56	60	3/3/18 0:01	47	4/3/18 1:06	57	5/3/18 2:11	55	6/3/18 3:16	55
28/2/18 5:56	57	1/3/18 23:01	60	3/3/18 0:06	45	4/3/18 1:11	58	5/3/18 2:16	53	6/3/18 3:21	55
28/2/18 6:01	57	1/3/18 23:06	59	3/3/18 0:11	51	4/3/18 1:16	54	5/3/18 2:21	55	6/3/18 3:26	55
28/2/18 6:06	59	1/3/18 23:11	60	3/3/18 0:16	61	4/3/18 1:21	54	5/3/18 2:26	53	6/3/18 3:31	55
28/2/18 6:11	58	1/3/18 23:16	59	3/3/18 0:21	61	4/3/18 1:26	55	5/3/18 2:31	55	6/3/18 3:36	55
28/2/18 6:16	58	1/3/18 23:21	59	3/3/18 0:26	61	4/3/18 1:31	54	5/3/18 2:36	54	6/3/18 3:41	54
28/2/18 6:21	58	1/3/18 23:26	59	3/3/18 0:31	61	4/3/18 1:36	54	5/3/18 2:41	55	6/3/18 3:46	54
28/2/18 6:26	59	1/3/18 23:31	59	3/3/18 0:36	61	4/3/18 1:41	55	5/3/18 2:46	54	6/3/18 3:51	55
28/2/18 6:31	60	1/3/18 23:36	59	3/3/18 0:41	60	4/3/18 1:46	56	5/3/18 2:51	55	6/3/18 3:56	54
28/2/18 6:36	60	1/3/18 23:41	59	3/3/18 0:46	60	4/3/18 1:51	55	5/3/18 2:56	53	6/3/18 4:01	53
28/2/18 6:41	60	1/3/18 23:46	58	3/3/18 0:51	60	4/3/18 1:56	56	5/3/18 3:01	55	6/3/18 4:06	55
28/2/18 6:46	60	1/3/18 23:51	58	3/3/18 0:56	60	4/3/18 2:01	56	5/3/18 3:06	54	6/3/18 4:11	54
28/2/18 6:51	61	1/3/18 23:56	58	3/3/18 1:01	60	4/3/18 2:06	54	5/3/18 3:11	53	6/3/18 4:16	55
28/2/18 6:56	61	2/3/18 0:01	58	3/3/18 1:06	60	4/3/18 2:11	54	5/3/18 3:16	54	6/3/18 4:21	55
28/2/18 23:01	61	2/3/18 0:06	58	3/3/18 1:11	60	4/3/18 2:16	54	5/3/18 3:21	53	6/3/18 4:26	57
28/2/18 23:06	59	2/3/18 0:11	58	3/3/18 1:16	60	4/3/18 2:21	53	5/3/18 3:26	54	6/3/18 4:31	55
28/2/18 23:11	59	2/3/18 0:16	58	3/3/18 1:21	60	4/3/18 2:26	54	5/3/18 3:31	55	6/3/18 4:36	55
28/2/18 23:16	59	2/3/18 0:21	58	3/3/18 1:26	60	4/3/18 2:31	53	5/3/18 3:36	54	6/3/18 4:41	53
28/2/18 23:21	59	2/3/18 0:26	58	3/3/18 1:31	60	4/3/18 2:36	54	5/3/18 3:41	53	6/3/18 4:46	54
28/2/18 23:26	60	2/3/18 0:31	58	3/3/18 1:36	57	4/3/18 2:41	53	5/3/18 3:46	53	6/3/18 4:51	55
28/2/18 23:31	59	2/3/18 0:36	57	3/3/18 1:41	61	4/3/18 2:46	54	5/3/18 3:51	55	6/3/18 4:56	55
28/2/18 23:36	59	2/3/18 0:41	58	3/3/18 1:46	60	4/3/18 2:51	54	5/3/18 3:56	55	6/3/18 5:01	56
28/2/18 23:41	59	2/3/18 0:46	58	3/3/18 1:51	61	4/3/18 2:56	53	5/3/18 4:01	54	6/3/18 5:06	56
28/2/18 23:46	59	2/3/18 0:51	57	3/3/18 1:56	60	4/3/18 3:01	54	5/3/18 4:06	54	6/3/18 5:11	56
28/2/18 23:51	59	2/3/18 0:56	57	3/3/18 2:01	61	4/3/18 3:06	56	5/3/18 4:11	54	6/3/18 5:16	55
28/2/18 23:56	60	2/3/18 1:01	57	3/3/18 2:06	60	4/3/18 3:11	54	5/3/18 4:16	55	6/3/18 5:21	55
1/3/18 0:01	59	2/3/18 1:06	56	3/3/18 2:11	60	4/3/18 3:16	54	5/3/18 4:21	53	6/3/18 5:26	55
1/3/18 0:06	58	2/3/18 1:11	57	3/3/18 2:16	60	4/3/18 3:21	53	5/3/18 4:26	54	6/3/18 5:31	57
1/3/18 0:11	59	2/3/18 1:16	57	3/3/18 2:21	54	4/3/18 3:26	53	5/3/18 4:31	54	6/3/18 5:36	


Real-time Noise Data		RTN4 (Causeway Bay Community Centre)									
6/3/18 23:41	59	8/3/18 0:46	60	9/3/18 1:51	57	10/3/18 2:56	57	11/3/18 4:01	56	12/3/18 5:06	56
6/3/18 23:46	58	8/3/18 0:51	60	9/3/18 1:56	56	10/3/18 3:01	58	11/3/18 4:06	55	12/3/18 5:11	55
6/3/18 23:51	59	8/3/18 0:56	60	9/3/18 2:01	56	10/3/18 3:06	57	11/3/18 4:11	57	12/3/18 5:16	55
6/3/18 23:56	58	8/3/18 1:01	46	9/3/18 2:06	56	10/3/18 3:11	57	11/3/18 4:16	55	12/3/18 5:21	55
7/3/18 0:01	58	8/3/18 1:06	60	9/3/18 2:11	56	10/3/18 3:16	57	11/3/18 4:21	55	12/3/18 5:26	57
7/3/18 0:06	58	8/3/18 1:11	60	9/3/18 2:16	56	10/3/18 3:21	56	11/3/18 4:26	56	12/3/18 5:31	56
7/3/18 0:11	58	8/3/18 1:16	60	9/3/18 2:21	55	10/3/18 3:26	57	11/3/18 4:31	56	12/3/18 5:36	56
7/3/18 0:16	59	8/3/18 1:21	59	9/3/18 2:26	56	10/3/18 3:31	57	11/3/18 4:36	56	12/3/18 5:41	57
7/3/18 0:21	57	8/3/18 1:26	59	9/3/18 2:31	55	10/3/18 3:36	57	11/3/18 4:41	55	12/3/18 5:46	58
7/3/18 0:26	58	8/3/18 1:31	59	9/3/18 2:36	55	10/3/18 3:41	56	11/3/18 4:46	56	12/3/18 5:51	57
7/3/18 0:31	57	8/3/18 1:36	60	9/3/18 2:41	55	10/3/18 3:46	56	11/3/18 4:51	56	12/3/18 5:56	57
7/3/18 0:36	57	8/3/18 1:41	60	9/3/18 2:46	56	10/3/18 3:51	56	11/3/18 4:56	56	12/3/18 6:01	58
7/3/18 0:41	58	8/3/18 1:46	60	9/3/18 2:51	55	10/3/18 3:56	56	11/3/18 5:01	56	12/3/18 6:06	57
7/3/18 0:46	58	8/3/18 1:51	59	9/3/18 2:56	55	10/3/18 4:01	54	11/3/18 5:06	56	12/3/18 6:11	59
7/3/18 0:51	58	8/3/18 1:56	59	9/3/18 3:01	54	10/3/18 4:06	54	11/3/18 5:11	55	12/3/18 6:16	59
7/3/18 0:56	57	8/3/18 2:01	60	9/3/18 3:06	55	10/3/18 4:11	56	11/3/18 5:16	56	12/3/18 6:21	59
7/3/18 1:01	57	8/3/18 2:06	59	9/3/18 3:11	55	10/3/18 4:16	56	11/3/18 5:21	56	12/3/18 6:26	59
7/3/18 1:06	57	8/3/18 2:11	59	9/3/18 3:16	55	10/3/18 4:21	57	11/3/18 5:26	57	12/3/18 6:31	60
7/3/18 1:11	57	8/3/18 2:16	59	9/3/18 3:21	55	10/3/18 4:26	56	11/3/18 5:31	57	12/3/18 6:36	60
7/3/18 1:16	59	8/3/18 2:21	59	9/3/18 3:26	56	10/3/18 4:31	55	11/3/18 5:36	57	12/3/18 6:41	61
7/3/18 1:21	56	8/3/18 2:26	60	9/3/18 3:31	56	10/3/18 4:36	56	11/3/18 5:41	57	12/3/18 6:46	51
7/3/18 1:26	56	8/3/18 2:31	60	9/3/18 3:36	55	10/3/18 4:41	56	11/3/18 5:46	58	12/3/18 6:51	38
7/3/18 1:31	56	8/3/18 2:36	61	9/3/18 3:41	54	10/3/18 4:46	55	11/3/18 5:51	60	12/3/18 6:56	49
7/3/18 1:36	56	8/3/18 2:41	60	9/3/18 3:46	55	10/3/18 4:51	56	11/3/18 5:56	57	12/3/18 7:01	59
7/3/18 1:41	57	8/3/18 2:46	63	9/3/18 3:51	54	10/3/18 4:56	56	11/3/18 6:01	58	12/3/18 7:06	59
7/3/18 1:46	56	8/3/18 2:51	64	9/3/18 3:56	56	10/3/18 5:01	55	11/3/18 6:06	57	12/3/18 7:11	59
7/3/18 1:51	56	8/3/18 2:56	63	9/3/18 4:01	56	10/3/18 5:06	56	11/3/18 6:11	57	12/3/18 7:16	60
7/3/18 1:56	56	8/3/18 3:01	61	9/3/18 4:06	55	10/3/18 5:11	56	11/3/18 6:16	59	12/3/18 7:21	58
7/3/18 2:01	57	8/3/18 3:06	61	9/3/18 4:11	54	10/3/18 5:16	56	11/3/18 6:21	58	12/3/18 7:26	60
7/3/18 2:06	56	8/3/18 3:11	61	9/3/18 4:16	56	10/3/18 5:21	55	11/3/18 6:26	59	12/3/18 7:31	59
7/3/18 2:11	56	8/3/18 3:16	46	9/3/18 4:21	55	10/3/18 5:26	57	11/3/18 6:31	58	12/3/18 7:36	59
7/3/18 2:16	55	8/3/18 3:21	52	9/3/18 4:26	55	10/3/18 5:31	55	11/3/18 6:36	59	12/3/18 7:41	59
7/3/18 2:21	56	8/3/18 3:26	51	9/3/18 4:31	55	10/3/18 5:36	56	11/3/18 6:41	59	12/3/18 7:46	58
7/3/18 2:26	55	8/3/18 3:31	52	9/3/18 4:36	56	10/3/18 5:41	56	11/3/18 6:46	60	12/3/18 7:51	58
7/3/18 2:31	55	8/3/18 3:36	61	9/3/18 4:41	55	10/3/18 5:46	57	11/3/18 6:51	60	12/3/18 7:56	58
7/3/18 2:36	56	8/3/18 3:41	61	9/3/18 4:46	54	10/3/18 5:51	57	11/3/18 6:56	60	13/3/18 0:01	58
7/3/18 2:41	55	8/3/18 3:46	60	9/3/18 4:51	55	10/3/18 5:56	57	11/3/18 7:01	60	13/3/18 0:06	58
7/3/18 2:46	56	8/3/18 3:51	60	9/3/18 4:56	56	10/3/18 6:01	56	11/3/18 7:06	59	13/3/18 0:11	59
7/3/18 2:51	54	8/3/18 3:56	59	9/3/18 5:01	54	10/3/18 6:06	57	11/3/18 7:11	60	13/3/18 0:16	58
7/3/18 2:56	54	8/3/18 4:01	61	9/3/18 5:06	56	10/3/18 6:11	58	11/3/18 7:16	59	13/3/18 0:21	57
7/3/18 3:01	54	8/3/18 4:06	61	9/3/18 5:11	55	10/3/18 6:16	58	11/3/18 7:21	59	13/3/18 0:26	58
7/3/18 3:06	54	8/3/18 4:11	61	9/3/18 5:16	56	10/3/18 6:21	58	11/3/18 7:26	60	13/3/18 0:31	58
7/3/18 3:11	54	8/3/18 4:16	60	9/3/18 5:21	56	10/3/18 6:26	59	11/3/18 7:31	58	13/3/18 0:36	58
7/3/18 3:16	54	8/3/18 4:21	60	9/3/18 5:26	56	10/3/18 6:31	59	11/3/18 7:36	58	13/3/18 0:41	57
7/3/18 3:21	54	8/3/18 4:26	60	9/3/18 5:31	56	10/3/18 6:36	59	11/3/18 7:41	59	13/3/18 0:46	57
7/3/18 3:26	54	8/3/18 4:31	60	9/3/18 5:36	56	10/3/18 6:41	60	11/3/18 7:46	59	13/3/18 0:51	57
7/3/18 3:31	56	8/3/18 4:36	60	9/3/18 5:41	57	10/3/18 6:46	60	11/3/18 7:51	58	13/3/18 0:56	57
7/3/18 3:36	54	8/3/18 4:41	59	9/3/18 5:46	56	10/3/18 6:51	60	11/3/18 7:56	58	13/3/18 1:01	57
7/3/18 3:41	55	8/3/18 4:46	59	9/3/18 5:51	58	10/3/18 6:56	61	12/3/18 0:01	59	13/3/18 1:06	58
7/3/18 3:46	54	8/3/18 4:51	59	9/3/18 5:56	57	10/3/18 7:01	50	12/3/18 0:06	59	13/3/18 1:11	57
7/3/18 3:51	56	8/3/18 4:56	59	9/3/18 6:01	58	10/3/18 7:06	60	12/3/18 0:11	59	13/3/18 1:16	58
7/3/18 3:56	54	8/3/18 5:01	59	9/3/18 6:06	57	10/3/18 7:11	60	12/3/18 0:16	58	13/3/18 1:21	56
7/3/18 4:01	55	8/3/18 5:06	59	9/3/18 6:11	58	10/3/18 7:16	60	12/3/18 0:21	59	13/3/18 1:26	56
7/3/18 4:06	54	8/3/18 5:11	59	9/3/18 6:16	59	10/3/18 7:21	60	12/3/18 0:26	58	13/3/18 1:31	56
7/3/18 4:11	55	8/3/18 5:16	59	9/3/18 6:21	59	10/3/18 7:26	60	12/3/18 0:31	57	13/3/18 1:36	56
7/3/18 4:16	56	8/3/18 5:21	59	9/3/18 6:26	59	10/3/18 7:31	59	12/3/18 0:36	57	13/3/18 1:41	57
7/3/18 4:21	55	8/3/18 5:26	59	9/3/18 6:31	60	10/3/18 7:36	59	12/3/18 0:41	58	13/3/18 1:46	57
7/3/18 4:26	55	8/3/18 5:31	59	9/3/18 6:36	60	10/3/18 7:41	59	12/3/18 0:46	57	13/3/18 1:51	56
7/3/18 4:31	56	8/3/18 5:36	60	9/3/18 6:41	60	10/3/18 7:46	59	12/3/18 0:51	57	13/3/18 1:56	55
7/3/18 4:36	54	8/3/18 5:41	59	9/3/18 6:46	61	10/3/18 7:51	59	12/3/18 0:56	58	13/3/18 2:01	55
7/3/18 4:41	57	8/3/18 5:46	61	9/3/18 6:51	61	10/3/18 7:56	59	12/3/18 1:01	57	13/3/18 2:06	55
7/3/18 4:46	55	8/3/18 5:51	60	9/3/18 6:56	61	11/3/18 0:01	59	12/3/18 1:06	56	13/3/18 2:11	56
7/3/18 4:51	55	8/3/18 5:56	60	9/3/18 7:01	52	11/3/18 0:06	59	12/3/18 1:11	56	13/3/18 2:16	56
7/3/18 4:56	55	8/3/18 6:01	53	9/3/18 7:06	60	11/3/18 0:11	58	12/3/18 1:16	58	13/3/18 2:21	55
7/3/18 5:01	55	8/3/18 6:06	44	9/3/18 7:11	60	11/3/18 0:16	59	12/3/18 1:21	56	13/3/18 2:26	56
7/3/18 5:06	57	8/3/18 6:11	52	9/3/18 7:16	60	11/3/18 0:21	59	12/3/18 1:26	56	13/3/18 2:31	55
7/3/18 5:11	55	8/3/18 6:16	58	9/3/18 7:21	60	11/3/18 0:26	58	12/3/18 1:31	57	13/3/18 2:36	55
7/3/18 5:16	56	8/3/18 6:21	54	9/3/18 7:26	60	11/3/18 0:31	60	12/3/18 1:36	56	13/3/18 2:41	55
7/3/18 5:21	55	8/3/18 6:26	56	9/3/18 7:31	60	11/3/18 0:36	59	12/3/18 1:41	56	13/3/18 2:46	55
7/3/18 5:26	56	8/3/18 6:31	56	9/3/18 7:36	61	11/3/18 0:41	60	12/3/18 1:46	57	13/3/18 2:51	56
7/3/18 5:31	56	8/3/18 6:36	57	9/3/18 7:41	60	11/3/18 0:46	59	12/3/18 1:51	57	13/3/18 2:56	56
7/3/18 5:36	56	8/3/18 6:41	60	9/3/18 7:46	60	11/3/18 0:51	58	12/3/18 1:56	56	13/3/18 3:01	55
7/3/18 5:41	56	8/3/18 6:46	63	9/3/18 7:51	61	11/3/18 0:56	58	12/3/18 2:01	57	13/3/18 3:06	55
7/3/18 5:46	56	8/3/18 6:51	62	9/3/18 7:56	60	11/3/18 1:01	58	12/3/18 2:06	55	13/3/18 3:11	54
7/3/18 5:51	58	8/3/18 6:56	61	10/3/18 0:01	60	11/3/18 1:06	60	12/3/18 2:11	55	13/3/18 3:16	54
7/3/18 5:56	56	8/3/18 7:01	60	10/3/18 0:06	47	11/3/18 1:11	58	12/3/18 2:16	55	13/3/18 3:21	54
7/3/18 6:01	58	8/3/18 7:06	60	10/3/18 0:11	59	11/3/18 1:16	58	12/3/18 2:21	55	13/3/18 3:26	55
7/3/18 6:06	57	8/3/18 7:11	60	10/3/18 0:16	60	11/3/18 1:21	59	12/3/18 2:26	56	13/3/18 3:31	55
7/3/18 6:11	58	8/3/18 7:16	60	10/3/18 0:21	60	11/3/18 1:26	58	12/3/18 2:31	55	13/3/18 3:36	55
7/3/18 6:16	58	8/3/18 7:21	60	10/3/18 0:26	59	11/3/18 1:31	58	12/3/18 2:36	56	13/3/18 3:41	55
7/3/18 6:21	59	8/3/18 7:26	59	10/3/18 0:31	58	11/3/18 1:36	57	12/3/18 2:41	55	13/3/18 3:46	55
7/3/18 6:26	59	8/3/18 7:31	59	10/3/18 0:36	60	11/3/18 1:41	57	12/3/18 2:46	55	13/3/18 3:51	56
7/3/18 6:31	59	8/3/18 7:36	59	10/3/18 0:41	59	11/3/18 1:46	58	12/3/18 2:51	55	13/3/18 3:56	54
7/3/18 6:36	60	8/3/18 7:41	59	10/3/18 0:46	59	11/3/18 1:51	57	12/3/18 2:56	55	13/3/18 4:01	53
7/3/18 6:41	60</										

Real-time Noise Data		RTN4 (Causeway Bay Community Centre)									
13/3/18 6:11	59	14/3/18 23:16	59	16/3/18 0:21	59	17/3/18 1:26	58	18/3/18 2:31	56	19/3/18 3:36	54
13/3/18 6:16	59	14/3/18 23:21	60	16/3/18 0:26	59	17/3/18 1:31	57	18/3/18 2:36	56	19/3/18 3:41	54
13/3/18 6:21	58	14/3/18 23:26	60	16/3/18 0:31	58	17/3/18 1:36	58	18/3/18 2:41	55	19/3/18 3:46	53
13/3/18 6:26	60	14/3/18 23:31	59	16/3/18 0:36	59	17/3/18 1:41	58	18/3/18 2:46	56	19/3/18 3:51	53
13/3/18 6:31	60	14/3/18 23:36	60	16/3/18 0:41	59	17/3/18 1:46	57	18/3/18 2:51	56	19/3/18 3:56	52
13/3/18 6:36	60	14/3/18 23:41	59	16/3/18 0:46	58	17/3/18 1:51	57	18/3/18 2:56	56	19/3/18 4:01	53
13/3/18 6:41	60	14/3/18 23:46	60	16/3/18 0:51	58	17/3/18 1:56	56	18/3/18 3:01	56	19/3/18 4:06	54
13/3/18 6:46	47	14/3/18 23:51	58	16/3/18 0:56	58	17/3/18 2:01	57	18/3/18 3:06	56	19/3/18 4:11	53
13/3/18 6:51	61	14/3/18 23:56	58	16/3/18 1:01	58	17/3/18 2:06	57	18/3/18 3:11	56	19/3/18 4:16	54
13/3/18 6:56	50	15/3/18 0:01	59	16/3/18 1:06	58	17/3/18 2:11	58	18/3/18 3:16	56	19/3/18 4:21	53
13/3/18 23:01	38	15/3/18 0:06	58	16/3/18 1:11	58	17/3/18 2:16	57	18/3/18 3:21	55	19/3/18 4:26	54
13/3/18 23:06	46	15/3/18 0:11	58	16/3/18 1:16	58	17/3/18 2:21	57	18/3/18 3:26	55	19/3/18 4:31	54
13/3/18 23:11	48	15/3/18 0:16	59	16/3/18 1:21	57	17/3/18 2:26	56	18/3/18 3:31	56	19/3/18 4:36	52
13/3/18 23:16	49	15/3/18 0:21	59	16/3/18 1:26	56	17/3/18 2:31	56	18/3/18 3:36	56	19/3/18 4:41	54
13/3/18 23:21	49	15/3/18 0:26	59	16/3/18 1:31	58	17/3/18 2:36	57	18/3/18 3:41	57	19/3/18 4:46	53
13/3/18 23:26	53	15/3/18 0:31	58	16/3/18 1:36	56	17/3/18 2:41	58	18/3/18 3:46	56	19/3/18 4:51	52
13/3/18 23:31	48	15/3/18 0:36	57	16/3/18 1:41	56	17/3/18 2:46	56	18/3/18 3:51	56	19/3/18 4:56	54
13/3/18 23:36	61	15/3/18 0:41	57	16/3/18 1:46	56	17/3/18 2:51	57	18/3/18 3:56	55	19/3/18 5:01	54
13/3/18 23:41	45	15/3/18 0:46	58	16/3/18 1:51	56	17/3/18 2:56	56	18/3/18 4:01	56	19/3/18 5:06	56
13/3/18 23:46	61	15/3/18 0:51	59	16/3/18 1:56	57	17/3/18 3:01	56	18/3/18 4:06	54	19/3/18 5:11	56
13/3/18 23:51	61	15/3/18 0:56	58	16/3/18 2:01	57	17/3/18 3:06	56	18/3/18 4:11	55	19/3/18 5:16	56
13/3/18 23:56	60	15/3/18 1:01	59	16/3/18 2:06	56	17/3/18 3:11	56	18/3/18 4:16	55	19/3/18 5:21	56
14/3/18 0:01	61	15/3/18 1:06	59	16/3/18 2:11	55	17/3/18 3:16	55	18/3/18 4:21	56	19/3/18 5:26	55
14/3/18 0:06	61	15/3/18 1:11	58	16/3/18 2:16	55	17/3/18 3:21	56	18/3/18 4:26	55	19/3/18 5:31	56
14/3/18 0:11	60	15/3/18 1:16	58	16/3/18 2:21	56	17/3/18 3:26	56	18/3/18 4:31	56	19/3/18 5:36	56
14/3/18 0:16	61	15/3/18 1:21	56	16/3/18 2:26	56	17/3/18 3:31	57	18/3/18 4:36	55	19/3/18 5:41	56
14/3/18 0:21	60	15/3/18 1:26	57	16/3/18 2:31	55	17/3/18 3:36	56	18/3/18 4:41	54	19/3/18 5:46	57
14/3/18 0:26	60	15/3/18 1:31	57	16/3/18 2:36	55	17/3/18 3:41	55	18/3/18 4:46	55	19/3/18 5:51	58
14/3/18 0:31	60	15/3/18 1:36	57	16/3/18 2:41	55	17/3/18 3:46	56	18/3/18 4:51	55	19/3/18 5:56	58
14/3/18 0:36	60	15/3/18 1:41	58	16/3/18 2:46	55	17/3/18 3:51	56	18/3/18 4:56	56	19/3/18 6:01	56
14/3/18 0:41	61	15/3/18 1:46	61	16/3/18 2:51	55	17/3/18 3:56	55	18/3/18 5:01	55	19/3/18 6:06	59
14/3/18 0:46	61	15/3/18 1:51	57	16/3/18 2:56	56	17/3/18 4:01	56	18/3/18 5:06	55	19/3/18 6:11	58
14/3/18 0:51	60	15/3/18 1:56	56	16/3/18 3:01	54	17/3/18 4:06	55	18/3/18 5:11	55	19/3/18 6:16	59
14/3/18 0:56	60	15/3/18 2:01	55	16/3/18 3:06	54	17/3/18 4:11	55	18/3/18 5:16	55	19/3/18 6:21	59
14/3/18 1:01	60	15/3/18 2:06	56	16/3/18 3:11	55	17/3/18 4:16	56	18/3/18 5:21	56	19/3/18 6:26	61
14/3/18 1:06	60	15/3/18 2:11	56	16/3/18 3:16	55	17/3/18 4:21	55	18/3/18 5:26	56	19/3/18 6:31	60
14/3/18 1:11	60	15/3/18 2:16	55	16/3/18 3:21	55	17/3/18 4:26	56	18/3/18 5:31	56	19/3/18 6:36	61
14/3/18 1:16	60	15/3/18 2:21	57	16/3/18 3:26	55	17/3/18 4:31	55	18/3/18 5:36	55	19/3/18 6:41	60
14/3/18 1:21	60	15/3/18 2:26	56	16/3/18 3:31	56	17/3/18 4:36	55	18/3/18 5:41	57	19/3/18 6:46	44
14/3/18 1:26	59	15/3/18 2:31	55	16/3/18 3:36	55	17/3/18 4:41	55	18/3/18 5:46	57	19/3/18 6:51	50
14/3/18 1:31	59	15/3/18 2:36	55	16/3/18 3:41	54	17/3/18 4:46	55	18/3/18 5:51	56	19/3/18 6:56	61
14/3/18 1:36	60	15/3/18 2:41	56	16/3/18 3:46	53	17/3/18 4:51	57	18/3/18 5:56	57	19/3/18 23:01	51
14/3/18 1:41	60	15/3/18 2:46	54	16/3/18 3:51	55	17/3/18 4:56	56	18/3/18 6:01	57	19/3/18 23:06	54
14/3/18 1:46	59	15/3/18 2:51	56	16/3/18 3:56	54	17/3/18 5:01	56	18/3/18 6:06	58	19/3/18 23:11	61
14/3/18 1:51	59	15/3/18 2:56	56	16/3/18 4:01	53	17/3/18 5:06	56	18/3/18 6:11	57	19/3/18 23:16	61
14/3/18 1:56	60	15/3/18 3:01	56	16/3/18 4:06	56	17/3/18 5:11	55	18/3/18 6:16	57	19/3/18 23:21	50
14/3/18 2:01	60	15/3/18 3:06	57	16/3/18 4:11	54	17/3/18 5:16	56	18/3/18 6:21	59	19/3/18 23:26	38
14/3/18 2:06	59	15/3/18 3:11	56	16/3/18 4:16	55	17/3/18 5:21	55	18/3/18 6:26	60	19/3/18 23:31	60
14/3/18 2:11	59	15/3/18 3:16	55	16/3/18 4:21	55	17/3/18 5:26	56	18/3/18 6:31	59	19/3/18 23:36	61
14/3/18 2:16	59	15/3/18 3:21	55	16/3/18 4:26	55	17/3/18 5:31	55	18/3/18 6:36	59	19/3/18 23:41	61
14/3/18 2:21	59	15/3/18 3:26	55	16/3/18 4:31	54	17/3/18 5:36	57	18/3/18 6:41	60	19/3/18 23:46	60
14/3/18 2:26	59	15/3/18 3:31	55	16/3/18 4:36	56	17/3/18 5:41	56	18/3/18 6:46	58	19/3/18 23:51	60
14/3/18 2:31	59	15/3/18 3:36	55	16/3/18 4:41	54	17/3/18 5:46	58	18/3/18 6:51	59	19/3/18 23:56	60
14/3/18 2:36	59	15/3/18 3:41	57	16/3/18 4:46	55	17/3/18 5:51	58	18/3/18 6:56	59	20/3/18 0:01	60
14/3/18 2:41	59	15/3/18 3:46	57	16/3/18 4:51	55	17/3/18 5:56	56	18/3/18 23:01	59	20/3/18 0:06	60
14/3/18 2:46	59	15/3/18 3:51	56	16/3/18 4:56	55	17/3/18 6:01	57	18/3/18 23:06	60	20/3/18 0:11	60
14/3/18 2:51	59	15/3/18 3:56	55	16/3/18 5:01	54	17/3/18 6:06	57	18/3/18 23:11	59	20/3/18 0:16	60
14/3/18 2:56	59	15/3/18 4:01	54	16/3/18 5:06	55	17/3/18 6:11	58	18/3/18 23:16	58	20/3/18 0:21	60
14/3/18 3:01	59	15/3/18 4:06	55	16/3/18 5:11	55	17/3/18 6:16	57	18/3/18 23:21	59	20/3/18 0:26	59
14/3/18 3:06	59	15/3/18 4:11	56	16/3/18 5:16	54	17/3/18 6:21	58	18/3/18 23:26	58	20/3/18 0:31	60
14/3/18 3:11	59	15/3/18 4:16	54	16/3/18 5:21	56	17/3/18 6:26	59	18/3/18 23:31	58	20/3/18 0:36	60
14/3/18 3:16	58	15/3/18 4:21	56	16/3/18 5:26	56	17/3/18 6:31	59	18/3/18 23:36	61	20/3/18 0:41	60
14/3/18 3:21	59	15/3/18 4:26	56	16/3/18 5:31	56	17/3/18 6:36	59	18/3/18 23:41	58	20/3/18 0:46	60
14/3/18 3:26	59	15/3/18 4:31	56	16/3/18 5:36	56	17/3/18 6:41	60	18/3/18 23:46	58	20/3/18 0:51	60
14/3/18 3:31	59	15/3/18 4:36	56	16/3/18 5:41	56	17/3/18 6:46	60	18/3/18 23:51	57	20/3/18 0:56	60
14/3/18 3:36	58	15/3/18 4:41	55	16/3/18 5:46	57	17/3/18 6:51	59	18/3/18 23:56	57	20/3/18 1:01	60
14/3/18 3:41	59	15/3/18 4:46	55	16/3/18 5:51	57	17/3/18 6:56	60	19/3/18 0:01	58	20/3/18 1:06	60
14/3/18 3:46	59	15/3/18 4:51	56	16/3/18 5:56	57	17/3/18 23:01	60	19/3/18 0:06	58	20/3/18 1:11	60
14/3/18 3:51	59	15/3/18 4:56	55	16/3/18 6:01	57	17/3/18 23:06	60	19/3/18 0:11	57	20/3/18 1:16	60
14/3/18 3:56	59	15/3/18 5:01	56	16/3/18 6:06	58	17/3/18 23:11	59	19/3/18 0:16	56	20/3/18 1:21	59
14/3/18 4:01	59	15/3/18 5:06	57	16/3/18 6:11	57	17/3/18 23:16	59	19/3/18 0:21	57	20/3/18 1:26	60
14/3/18 4:06	59	15/3/18 5:11	57	16/3/18 6:16	60	17/3/18 23:21	59	19/3/18 0:26	58	20/3/18 1:31	59
14/3/18 4:11	59	15/3/18 5:16	56	16/3/18 6:21	59	17/3/18 23:26	58	19/3/18 0:31	57	20/3/18 1:36	59
14/3/18 4:16	58	15/3/18 5:21	55	16/3/18 6:26	60	17/3/18 23:31	59	19/3/18 0:36	56	20/3/18 1:41	59
14/3/18 4:21	59	15/3/18 5:26	56	16/3/18 6:31	60	17/3/18 23:36	60	19/3/18 0:41	56	20/3/18 1:46	58
14/3/18 4:26	59	15/3/18 5:31	57	16/3/18 6:36	60	17/3/18 23:41	59	19/3/18 0:46	55	20/3/18 1:51	59
14/3/18 4:31	59	15/3/18 5:36	56	16/3/18 6:41	61	17/3/18 23:46	59	19/3/18 0:51	55	20/3/18 1:56	58
14/3/18 4:36	58	15/3/18 5:41	57	16/3/18 6:46	53	17/3/18 23:51	58	19/3/18 0:56	56	20/3/18 2:01	58
14/3/18 4:41	58	15/3/18 5:46	59	16/3/18 6:51	52	17/3/18 23:56	58	19/3/18 1:01	55	20/3/18 2:06	60
14/3/18 4:46	59	15/3/18 5:51	58	16/3/18 6:56	46	18/3/18 0:01	59	19/3/18 1:06	56	20/3/18 2:11	59
14/3/18 4:51	59	15/3/18 5:56	59	16/3/18 23:01	60	18/3/18 0:06	59	19/3/18 1:11	56	20/3/18 2:16	59
14/3/18 4:56	59	15/3/18 6:01	58	16/3/18 23:06	59	18/3/18 0:11	59	19/3/18 1:16	55	20/3/18 2:21	

Real-time Noise Data		RTN4 (Causeway Bay Community Centre)									
20/3/18 4:41	59	21/3/18 5:46	56	22/3/18 6:51	61	23/3/18 23:56	50	25/3/18 1:01	56	26/3/18 2:06	54
20/3/18 4:46	60	21/3/18 5:51	57	22/3/18 6:56	60	24/3/18 0:01	48	25/3/18 1:06	57	26/3/18 2:11	54
20/3/18 4:51	60	21/3/18 5:56	57	22/3/18 23:01	59	24/3/18 0:06	49	25/3/18 1:11	57	26/3/18 2:16	54
20/3/18 4:56	60	21/3/18 6:01	57	22/3/18 23:06	59	24/3/18 0:11	46	25/3/18 1:16	57	26/3/18 2:21	54
20/3/18 5:01	60	21/3/18 6:06	58	22/3/18 23:11	60	24/3/18 0:16	52	25/3/18 1:21	57	26/3/18 2:26	53
20/3/18 5:06	60	21/3/18 6:11	58	22/3/18 23:16	59	24/3/18 0:21	42	25/3/18 1:26	57	26/3/18 2:31	53
20/3/18 5:11	60	21/3/18 6:16	59	22/3/18 23:21	60	24/3/18 0:26	45	25/3/18 1:31	56	26/3/18 2:36	53
20/3/18 5:16	60	21/3/18 6:21	59	22/3/18 23:26	60	24/3/18 0:31	61	25/3/18 1:36	56	26/3/18 2:41	53
20/3/18 5:21	60	21/3/18 6:26	60	22/3/18 23:31	59	24/3/18 0:36	61	25/3/18 1:41	56	26/3/18 2:46	53
20/3/18 5:26	60	21/3/18 6:31	60	22/3/18 23:36	59	24/3/18 0:41	61	25/3/18 1:46	56	26/3/18 2:51	54
20/3/18 5:31	60	21/3/18 6:36	60	22/3/18 23:41	60	24/3/18 0:46	61	25/3/18 1:51	55	26/3/18 2:56	54
20/3/18 5:36	60	21/3/18 6:41	61	22/3/18 23:46	59	24/3/18 0:51	61	25/3/18 1:56	56	26/3/18 3:01	53
20/3/18 5:41	60	21/3/18 6:46	49	22/3/18 23:51	58	24/3/18 0:56	61	25/3/18 2:01	57	26/3/18 3:06	54
20/3/18 5:46	47	21/3/18 6:51	50	22/3/18 23:56	59	24/3/18 1:01	45	25/3/18 2:06	59	26/3/18 3:11	54
20/3/18 5:51	49	21/3/18 6:56	60	23/3/18 0:01	59	24/3/18 1:06	60	25/3/18 2:11	56	26/3/18 3:16	53
20/3/18 5:56	47	21/3/18 23:01	59	23/3/18 0:06	59	24/3/18 1:11	41	25/3/18 2:16	56	26/3/18 3:21	54
20/3/18 6:01	61	21/3/18 23:06	59	23/3/18 0:11	59	24/3/18 1:16	61	25/3/18 2:21	57	26/3/18 3:26	54
20/3/18 6:06	61	21/3/18 23:11	59	23/3/18 0:16	58	24/3/18 1:21	61	25/3/18 2:26	56	26/3/18 3:31	54
20/3/18 6:11	51	21/3/18 23:16	59	23/3/18 0:21	58	24/3/18 1:26	60	25/3/18 2:31	58	26/3/18 3:36	54
20/3/18 6:16	54	21/3/18 23:21	59	23/3/18 0:26	58	24/3/18 1:31	60	25/3/18 2:36	56	26/3/18 3:41	54
20/3/18 6:21	54	21/3/18 23:26	59	23/3/18 0:31	58	24/3/18 1:36	61	25/3/18 2:41	56	26/3/18 3:46	53
20/3/18 6:26	56	21/3/18 23:31	59	23/3/18 0:36	58	24/3/18 1:41	61	25/3/18 2:46	56	26/3/18 3:51	54
20/3/18 6:31	58	21/3/18 23:36	58	23/3/18 0:41	57	24/3/18 1:46	60	25/3/18 2:51	55	26/3/18 3:56	55
20/3/18 6:36	56	21/3/18 23:41	58	23/3/18 0:46	58	24/3/18 1:51	60	25/3/18 2:56	56	26/3/18 4:01	52
20/3/18 6:41	59	21/3/18 23:46	60	23/3/18 0:51	57	24/3/18 1:56	60	25/3/18 3:01	58	26/3/18 4:06	53
20/3/18 6:46	59	21/3/18 23:51	61	23/3/18 0:56	58	24/3/18 2:01	60	25/3/18 3:06	56	26/3/18 4:11	53
20/3/18 6:51	58	21/3/18 23:56	58	23/3/18 1:01	58	24/3/18 2:06	60	25/3/18 3:11	56	26/3/18 4:16	52
20/3/18 6:56	57	22/3/18 0:01	49	23/3/18 1:06	57	24/3/18 2:11	60	25/3/18 3:16	56	26/3/18 4:21	53
20/3/18 23:01	59	22/3/18 0:06	58	23/3/18 1:11	56	24/3/18 2:16	60	25/3/18 3:21	55	26/3/18 4:26	54
20/3/18 23:06	59	22/3/18 0:11	58	23/3/18 1:16	57	24/3/18 2:21	60	25/3/18 3:26	56	26/3/18 4:31	54
20/3/18 23:11	59	22/3/18 0:16	57	23/3/18 1:21	57	24/3/18 2:26	60	25/3/18 3:31	57	26/3/18 4:36	54
20/3/18 23:16	59	22/3/18 0:21	58	23/3/18 1:26	58	24/3/18 2:31	60	25/3/18 3:36	56	26/3/18 4:41	54
20/3/18 23:21	59	22/3/18 0:26	59	23/3/18 1:31	56	24/3/18 2:36	60	25/3/18 3:41	58	26/3/18 4:46	55
20/3/18 23:26	59	22/3/18 0:31	57	23/3/18 1:36	56	24/3/18 2:41	60	25/3/18 3:46	56	26/3/18 4:51	53
20/3/18 23:31	59	22/3/18 0:36	56	23/3/18 1:41	57	24/3/18 2:46	60	25/3/18 3:51	55	26/3/18 4:56	54
20/3/18 23:36	59	22/3/18 0:41	58	23/3/18 1:46	56	24/3/18 2:51	60	25/3/18 3:56	55	26/3/18 5:01	54
20/3/18 23:41	58	22/3/18 0:46	57	23/3/18 1:51	56	24/3/18 2:56	60	25/3/18 4:01	54	26/3/18 5:06	55
20/3/18 23:46	58	22/3/18 0:51	57	23/3/18 1:56	55	24/3/18 3:01	60	25/3/18 4:06	55	26/3/18 5:11	55
20/3/18 23:51	59	22/3/18 0:56	56	23/3/18 2:01	56	24/3/18 3:06	60	25/3/18 4:11	55	26/3/18 5:16	55
20/3/18 23:56	58	22/3/18 1:01	57	23/3/18 2:06	56	24/3/18 3:11	60	25/3/18 4:16	55	26/3/18 5:21	55
21/3/18 0:01	59	22/3/18 1:06	56	23/3/18 2:11	55	24/3/18 3:16	60	25/3/18 4:21	55	26/3/18 5:26	56
21/3/18 0:06	58	22/3/18 1:11	57	23/3/18 2:16	55	24/3/18 3:21	60	25/3/18 4:26	55	26/3/18 5:31	55
21/3/18 0:11	59	22/3/18 1:16	56	23/3/18 2:21	55	24/3/18 3:26	60	25/3/18 4:31	55	26/3/18 5:36	56
21/3/18 0:16	58	22/3/18 1:21	57	23/3/18 2:26	54	24/3/18 3:31	60	25/3/18 4:36	55	26/3/18 5:41	57
21/3/18 0:21	57	22/3/18 1:26	56	23/3/18 2:31	55	24/3/18 3:36	60	25/3/18 4:41	55	26/3/18 5:46	56
21/3/18 0:26	58	22/3/18 1:31	58	23/3/18 2:36	55	24/3/18 3:41	60	25/3/18 4:46	56	26/3/18 5:51	58
21/3/18 0:31	58	22/3/18 1:36	57	23/3/18 2:41	55	24/3/18 3:46	59	25/3/18 4:51	55	26/3/18 5:56	57
21/3/18 0:36	58	22/3/18 1:41	55	23/3/18 2:46	55	24/3/18 3:51	59	25/3/18 4:56	54	26/3/18 6:01	57
21/3/18 0:41	56	22/3/18 1:46	56	23/3/18 2:51	55	24/3/18 3:56	59	25/3/18 5:01	55	26/3/18 6:06	58
21/3/18 0:46	57	22/3/18 1:51	57	23/3/18 2:56	55	24/3/18 4:01	59	25/3/18 5:06	56	26/3/18 6:11	58
21/3/18 0:51	57	22/3/18 1:56	55	23/3/18 3:01	55	24/3/18 4:06	59	25/3/18 5:11	56	26/3/18 6:16	59
21/3/18 0:56	57	22/3/18 2:01	56	23/3/18 3:06	55	24/3/18 4:11	59	25/3/18 5:16	55	26/3/18 6:21	61
21/3/18 1:01	57	22/3/18 2:06	55	23/3/18 3:11	55	24/3/18 4:16	59	25/3/18 5:21	57	26/3/18 6:26	60
21/3/18 1:06	56	22/3/18 2:11	57	23/3/18 3:16	54	24/3/18 4:21	59	25/3/18 5:26	56	26/3/18 6:31	60
21/3/18 1:11	56	22/3/18 2:16	55	23/3/18 3:21	54	24/3/18 4:26	59	25/3/18 5:31	57	26/3/18 6:36	60
21/3/18 1:16	57	22/3/18 2:21	54	23/3/18 3:26	54	24/3/18 4:31	59	25/3/18 5:36	56	26/3/18 6:41	60
21/3/18 1:21	56	22/3/18 2:26	55	23/3/18 3:31	55	24/3/18 4:36	60	25/3/18 5:41	56	26/3/18 6:46	60
21/3/18 1:26	57	22/3/18 2:31	56	23/3/18 3:36	54	24/3/18 4:41	59	25/3/18 5:46	55	26/3/18 6:51	60
21/3/18 1:31	55	22/3/18 2:36	55	23/3/18 3:41	56	24/3/18 4:46	59	25/3/18 5:51	56	26/3/18 6:56	53
21/3/18 1:36	55	22/3/18 2:41	55	23/3/18 3:46	55	24/3/18 4:51	59	25/3/18 5:56	56	26/3/18 23:01	60
21/3/18 1:41	56	22/3/18 2:46	55	23/3/18 3:51	54	24/3/18 4:56	60	25/3/18 6:01	57	26/3/18 23:06	60
21/3/18 1:46	56	22/3/18 2:51	54	23/3/18 3:56	55	24/3/18 5:01	59	25/3/18 6:06	57	26/3/18 23:11	59
21/3/18 1:51	55	22/3/18 2:56	55	23/3/18 4:01	54	24/3/18 5:06	60	25/3/18 6:11	57	26/3/18 23:16	59
21/3/18 1:56	55	22/3/18 3:01	54	23/3/18 4:06	55	24/3/18 5:11	60	25/3/18 6:16	58	26/3/18 23:21	60
21/3/18 2:01	55	22/3/18 3:06	55	23/3/18 4:11	54	24/3/18 5:16	59	25/3/18 6:21	59	26/3/18 23:26	60
21/3/18 2:06	55	22/3/18 3:11	54	23/3/18 4:16	54	24/3/18 5:21	60	25/3/18 6:26	59	26/3/18 23:31	59
21/3/18 2:11	55	22/3/18 3:16	55	23/3/18 4:21	55	24/3/18 5:26	60	25/3/18 6:31	58	26/3/18 23:36	60
21/3/18 2:16	55	22/3/18 3:21	55	23/3/18 4:26	54	24/3/18 5:31	60	25/3/18 6:36	59	26/3/18 23:41	59
21/3/18 2:21	55	22/3/18 3:26	54	23/3/18 4:31	54	24/3/18 5:36	60	25/3/18 6:41	59	26/3/18 23:46	59
21/3/18 2:26	56	22/3/18 3:31	55	23/3/18 4:36	56	24/3/18 5:41	60	25/3/18 6:46	60	26/3/18 23:51	58
21/3/18 2:31	55	22/3/18 3:36	54	23/3/18 4:41	54	24/3/18 5:46	60	25/3/18 6:51	58	26/3/18 23:56	59
21/3/18 2:36	55	22/3/18 3:41	55	23/3/18 4:46	54	24/3/18 5:51	60	25/3/18 6:56	58		
21/3/18 2:41	54	22/3/18 3:46	54	23/3/18 4:51	55	24/3/18 5:56	61	25/3/18 23:01	59		
21/3/18 2:46	53	22/3/18 3:51	55	23/3/18 4:56	55	24/3/18 6:01	60	25/3/18 23:06	59		
21/3/18 2:51	55	22/3/18 3:56	54	23/3/18 5:01	55	24/3/18 6:06	60	25/3/18 23:11	58		
21/3/18 2:56	54	22/3/18 4:01	54	23/3/18 5:06	60	24/3/18 6:11	60	25/3/18 23:16	58		
21/3/18 3:01	53	22/3/18 4:06	56	23/3/18 5:11	56	24/3/18 6:16	61	25/3/18 23:21	58		
21/3/18 3:06	55	22/3/18 4:11	53	23/3/18 5:16	56	24/3/18 6:21	61	25/3/18 23:26	58		
21/3/18 3:11	53	22/3/18 4:16	55	23/3/18 5:21	57	24/3/18 6:26	52	25/3/18 23:31	58		
21/3/18 3:16	54	22/3/18 4:21	55	23/3/18 5:26	56	24/3/18 6:31	39	25/3/18 23:36	58		
21/3/18 3:21	56	22/3/18 4:26	54	23/3/18 5:31	56	24/3/18 6:36	53	25/3/18 23:41	58		
21/3/18 3:26	55	22/3/18 4:31	54	23/3/18 5:36	56	24/3/18 6:41	54	25/3/18 23:46	59		
21/3/18 3:31	54	22/3/18 4:36	54	23/3/18 5:41	57	24/3/18 6:46	54	25/3/18 23:51	58		
21/3/18 3:36	54	22/3/1									




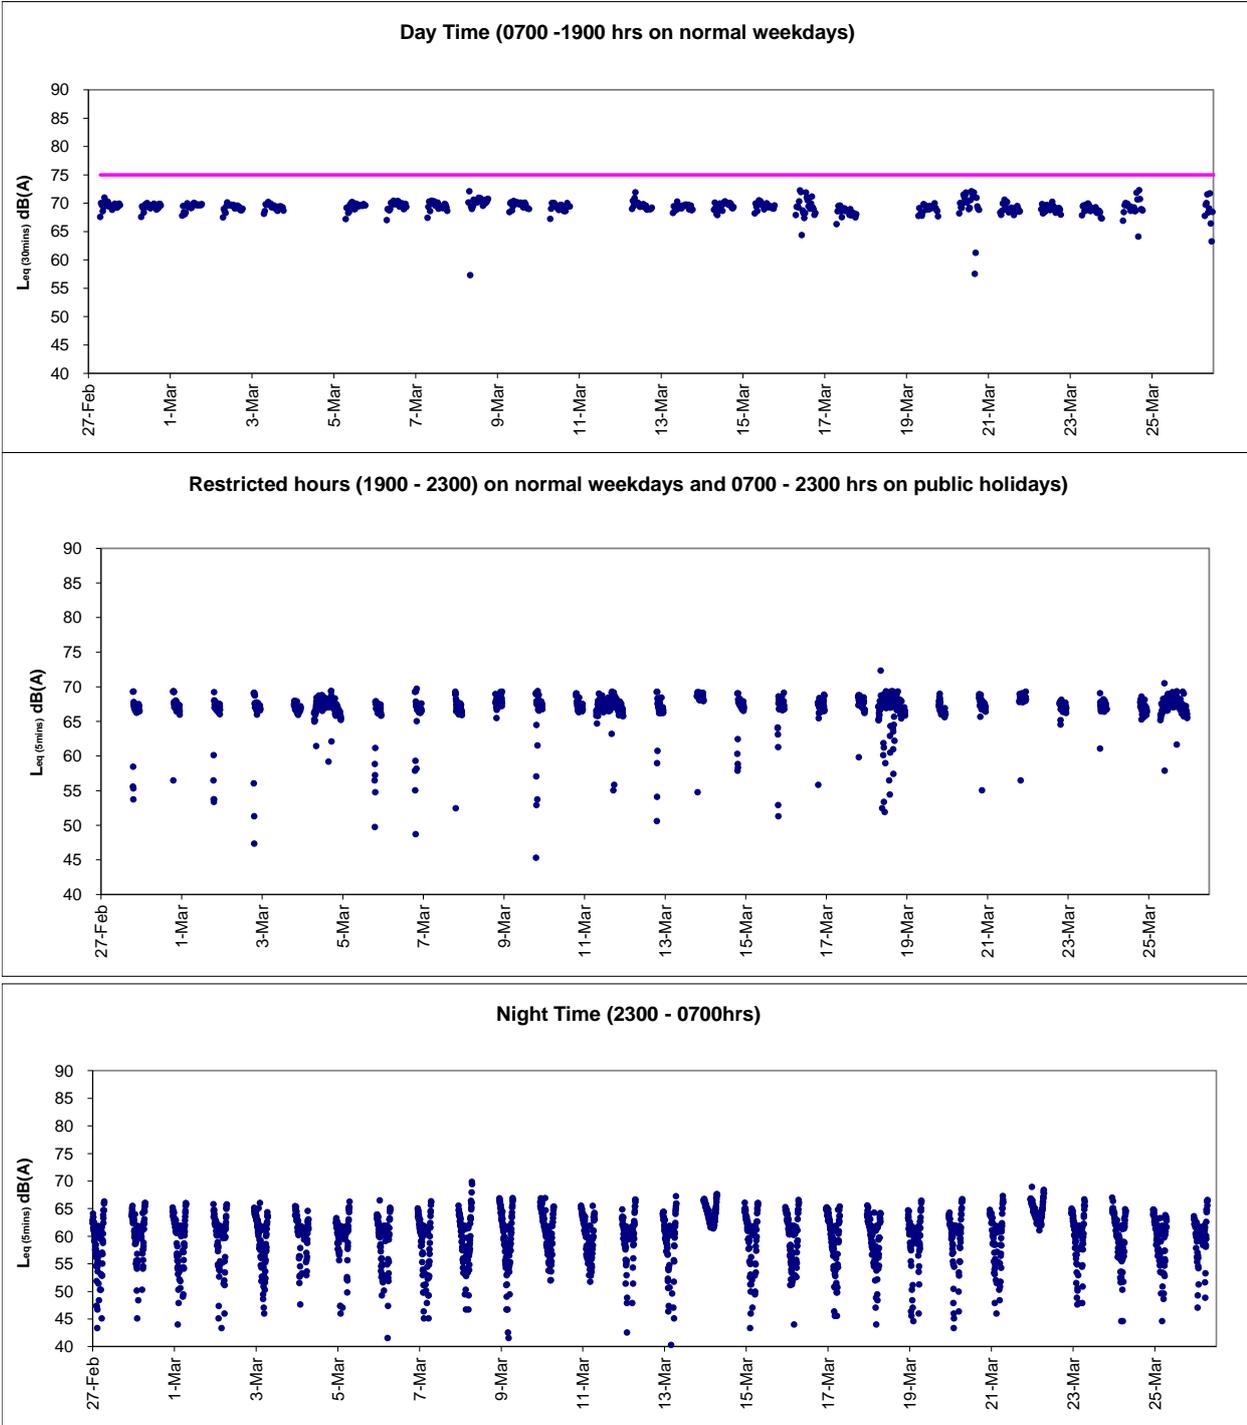Graphic Presentation of Real Time Noise Monitoring Result (RTN1-Food and Environmental Hygiene Department Depot)





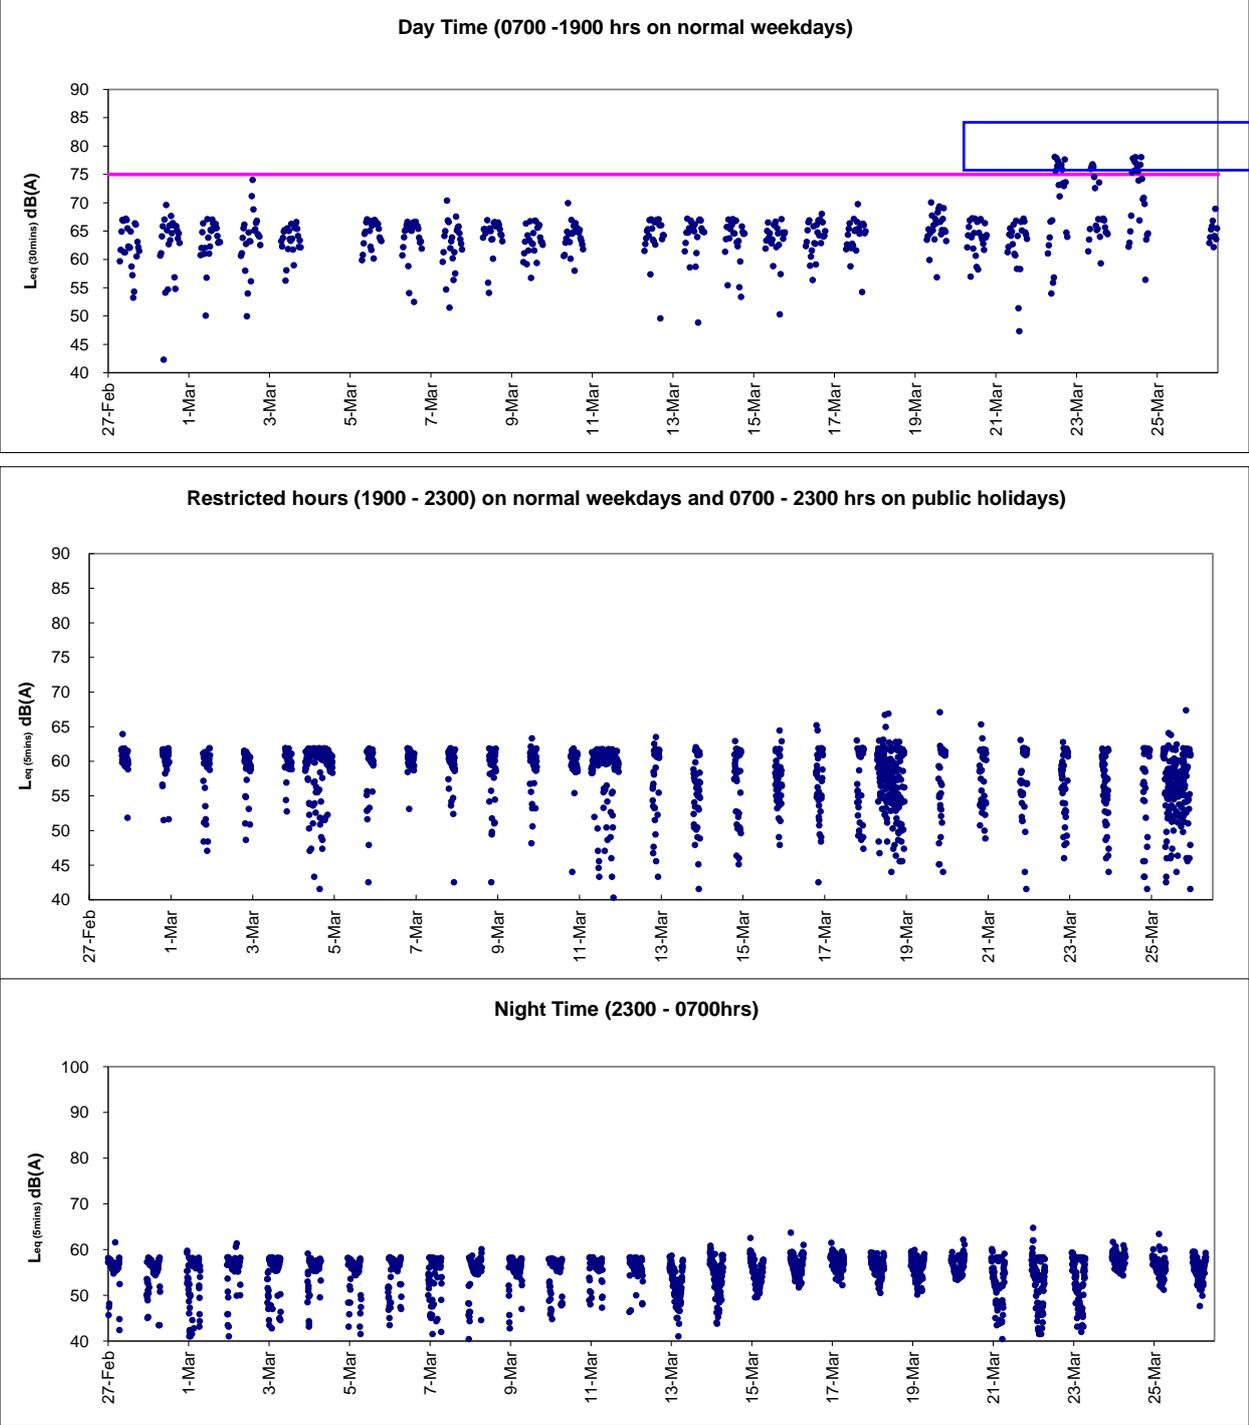
Graphic Presentation of Real Time Noise Monitoring Result (RTN2a- Hong Kong Electric Centre)



After checking with the Contractor of HY/2009/19, rebar fixing, concrete chipping and removal of scaffolding was conducted on 22 March 2018 while concreting and removal of scaffolding were conducted on 23 March 2018 and soil compaction and rebar fixing were conducted on 24 March 2018 and no major noise emanation were considered for the above construction works. After checking with the Contractor of HY/2011/08, architectural builders work and finishes, drainage and external works were conducted on 22, 23 and 24 March 2018 and no major noise emanation were considered for the above construction works. In addition, chiller plant maintenance and repair work was observed conducted at HKE roof top near the monitoring station was observed across the above exceedances period and considered as the major noise contribution. As such, the exceedances were considered as non-Project related.



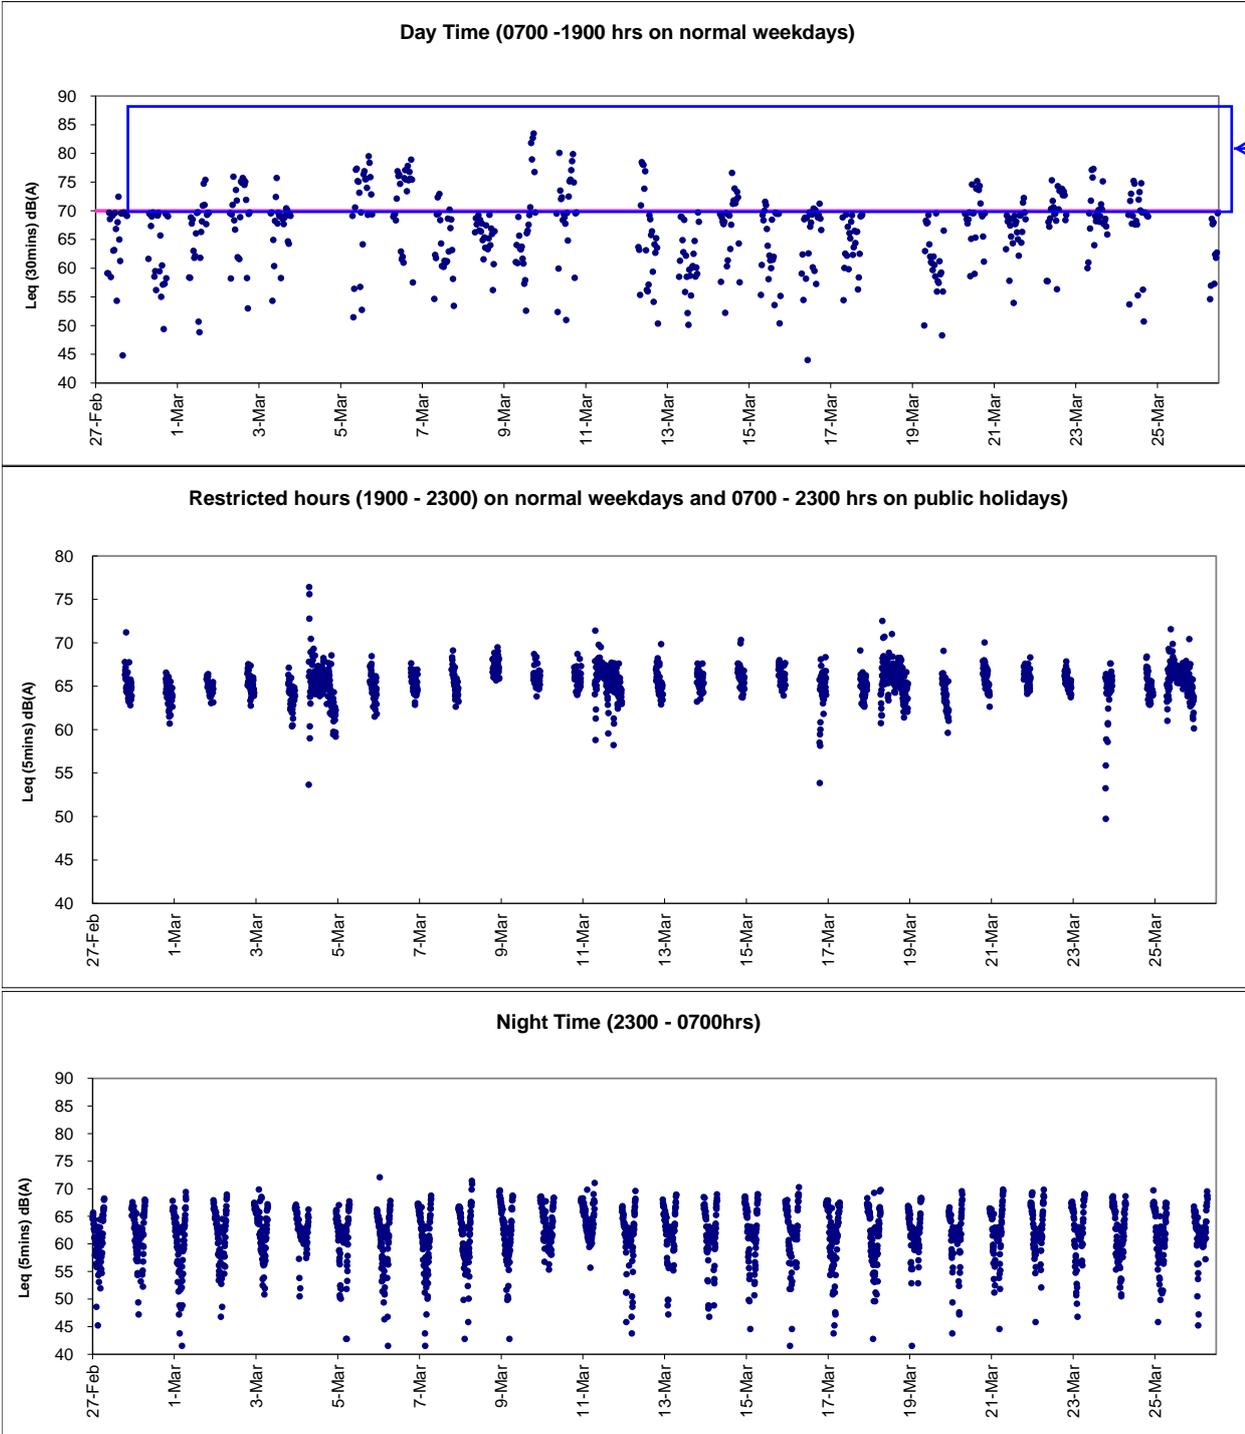
Graphic Presentation of Real Time Noise Monitoring Result (RTN3-Yu Lee Mo Fan Memorial School)



After checking with Contractor of HY/2009/19, breaking and/or saw cutting works were conducted on 01, 02, 05, 06, 07, 09, 10, 12, 14, 15, 16, 20, 21, 22, 23 and 24 March 2018 and environmental deficiencies including i) inadequate extend of temporary noise barrier for shielding the line of sight to nearby sensitive receiver and ii) insufficient noise screening for breaking or saw cutting and iii) continuous breaking works without intermittence were found to be the major contribution to the measured noise level and hence the exceedances were considered as Project related. Actions including i) provision of additional temporary noise barrier, ii) repairment of damaged or incomplete temporary noise barrier installed for the breaking works, iii) provision of additional acoustics screen to the breaking tip in addition to temporary noise barrier installed, iv) covering of breaker tip with acoustic material for noise reduction and conduct breaking works intermittently were advised for Contractors implementation to mitigate the noise impact recorded at the concerned monitoring station upon identification of exceedance and the Contractor was advised to refrain from the impact associated construction works prior to the implementation of the remedial/ enhancement and confirmation of the implementation of the mitigation measure. On the other hand, only hand held breaking works behind temporary noise enclosure was conducted and the exceedance recorded on 27 Feb 2018 was found to be non Project related



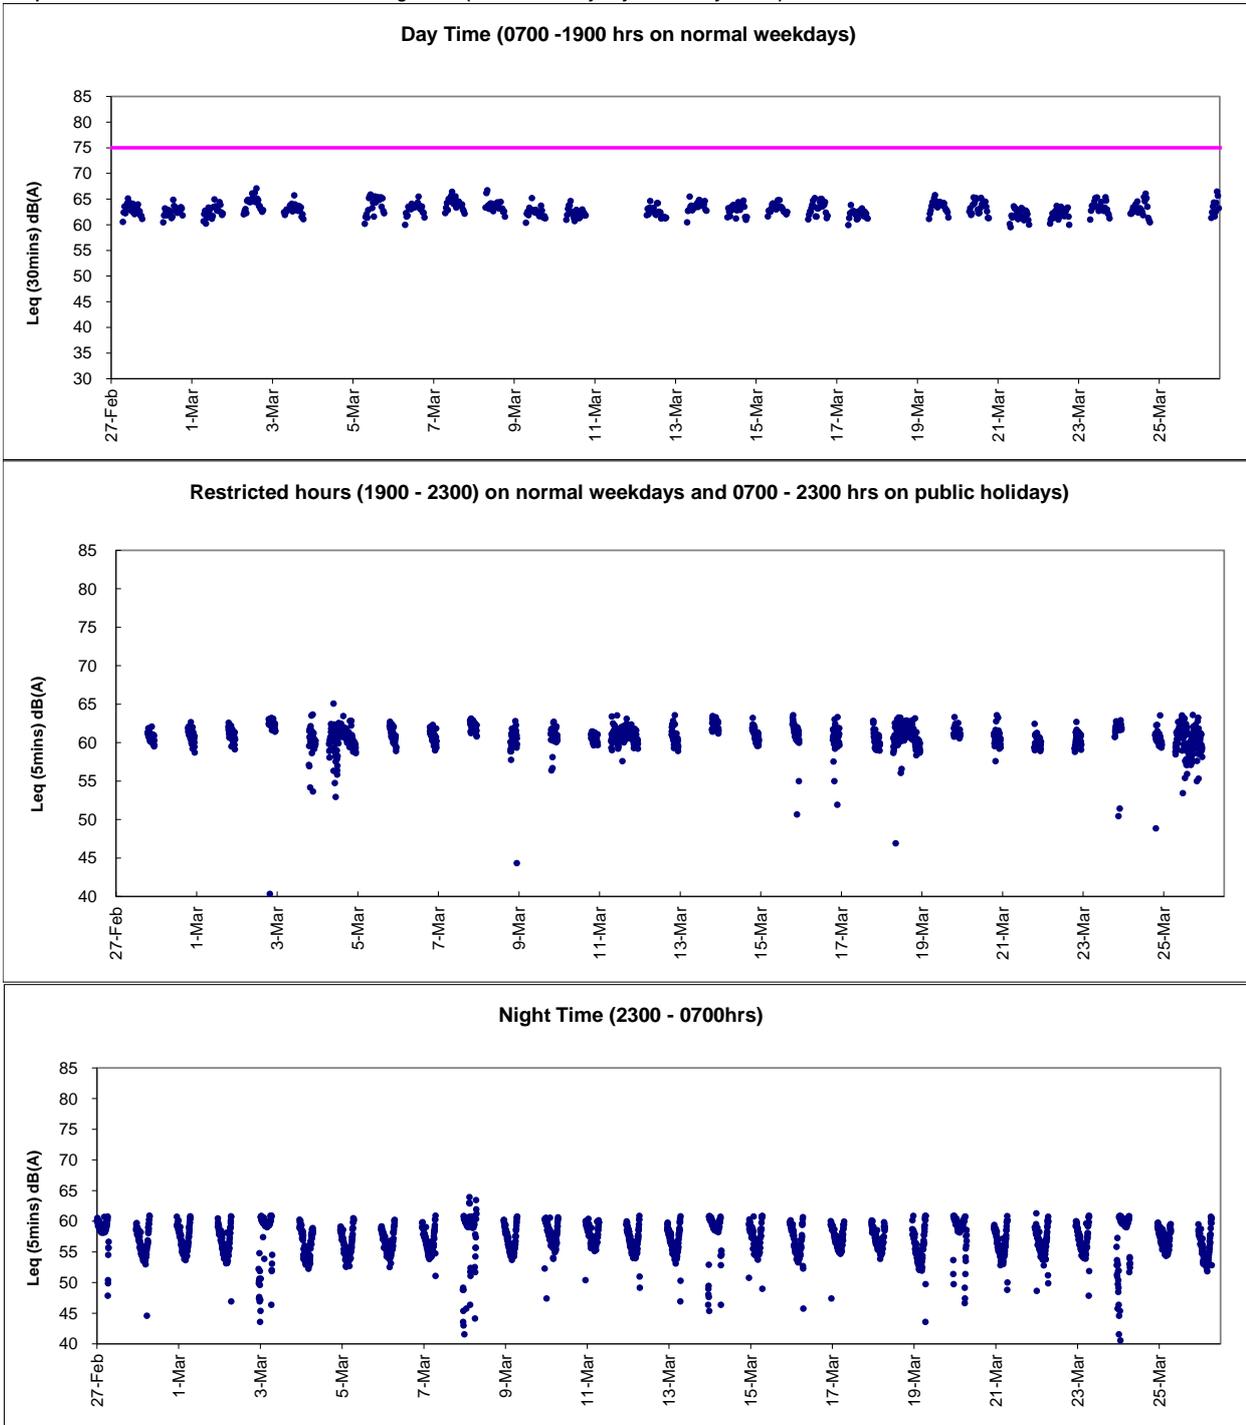Graphic Presentation of Real Time Noise Monitoring Result (RTN4-Causeway Bay Community Centre)





Appendix 6.1

Event Action Plans



Event/Action Plan for Construction Noise

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Action Level being exceeded	<ol style="list-style-type: none">1. Notify ER, IEC and Contractor;2. Carry out investigation;3. Report the results of investigation to the IEC, ER and Contractor;4. Discuss with the IEC and Contractor on remedial measures required;5. Increase monitoring frequency to check mitigation effectiveness. <p>(The above actions should be taken within 2 working days after the exceedance is identified)</p>	<ol style="list-style-type: none">1. Review the investigation results submitted by the ET;2. Review the proposed remedial measures by the Contractor and advise the ER accordingly;3. Advise the ER on the effectiveness of the proposed remedial measures. <p>(The above actions should be taken within 2 working days after the exceedance is identified)</p>	<ol style="list-style-type: none">1. Confirm receipt of notification of failure in writing;2. Notify Contractor;3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented;4. Supervise the implementation of remedial measures. <p>(The above actions should be taken within 2 working days after the exceedance is identified)</p>	<ol style="list-style-type: none">1. Submit noise mitigation proposals to IEC and ER;2. Implement noise mitigation proposals. <p>(The above actions should be taken within 2 working days after the exceedance is identified)</p>



EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Limit Level being exceeded	1. Inform IEC, ER, Contractor and EPD; 2. Repeat measurements to confirm findings; 3. Increase monitoring frequency; 4. Identify source and investigate the cause of exceedance; 5. Carry out analysis of Contractor's working procedures; 6. Discuss with the IEC, Contractor and ER on remedial measures required; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Discuss amongst ER, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Supervise the implementation of remedial measures; 5. If exceedance continues, consider stopping the Contractor to continue working on that portion of work which causes the exceedance until the exceedance is abated. (The above actions should be taken within 2 working days after the exceedance is identified)	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC and ER within 3 working days of notification; 3. Implement the agreed proposals; 4. Submit further proposal if problem still not under control; 5. Stop the relevant portion of works as instructed by the ER until the exceedance is abated. (The above actions should be taken within 2 working days after the exceedance is identified)



Event / Action Plan for Construction Air Quality

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
ACTION LEVEL				
1. Exceedance for one sample	<ol style="list-style-type: none"> Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to daily. (The above actions should be taken within 2 working days after the exceedance is identified)	<ol style="list-style-type: none"> Check monitoring data submitted by ET; Check Contractor's working method. (The above actions should be taken within 2 working days after the exceedance is identified)	<ol style="list-style-type: none"> Notify Contractor. (The above actions should be taken within 2 working days after the exceedance is identified)	<ol style="list-style-type: none"> Rectify any unacceptable practice; Amend working methods if appropriate. (The above actions should be taken within 2 working days after the exceedance is identified)
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> Identify source; Inform IEC and ER; Advise the ER on the effectiveness of the proposed remedial measures; Repeat measurements to confirm findings; Increase monitoring frequency to daily; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and ER; If exceedance stops, cease additional monitoring. (The above actions should be taken within 2 working days after the exceedance is identified)	<ol style="list-style-type: none"> Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ET on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures. (The above actions should be taken within 2 working days after the exceedance is identified)	<ol style="list-style-type: none"> Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented. (The above actions should be taken within 2 working days after the exceedance is identified)	<ol style="list-style-type: none"> Submit proposals for remedial to ER within 3 working days of notification; Implement the agreed proposals; Amend proposal if appropriate. (The above actions should be taken within 2 working days after the exceedance is identified)
LIMIT LEVEL				
1. Exceedance for one sample	<ol style="list-style-type: none"> Identify source, investigate the causes of exceedance and propose remedial measures; Inform ER, Contractor and EPD; Repeat measurement to confirm finding; Increase monitoring frequency to daily; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results. (The above actions should be taken within 2 working days after the exceedance is identified)	<ol style="list-style-type: none"> Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ER on the effectiveness of the proposed remedial measures; Supervise implementation of remedial measures. (The above actions should be taken within 2 working days after the exceedance is identified)	<ol style="list-style-type: none"> Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented. (The above actions should be taken within 2 working days after the exceedance is identified)	<ol style="list-style-type: none"> Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Amend proposal if appropriate. (The above actions should be taken within 2 working days after the exceedance is identified)
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> Notify IEC, ER, Contractor and EPD; Identify source; Repeat measurement to confirm findings; Increase monitoring frequency to daily; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Arrange meeting with IEC and ER to discuss the remedial actions to be taken; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; If exceedance stops, cease additional monitoring. (The above actions should be taken within 2 working days after the exceedance is identified)	<ol style="list-style-type: none"> Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> Confirm receipt of notification of failure in writing; Notify Contractor; In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. (The above actions should be taken within 2 working days after the exceedance is identified)	<ol style="list-style-type: none"> Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated. (The above actions should be taken within 2 working days after the exceedance is identified)



Appendix 6.2

Summary for Notification of Exceedance



Ref. No.	Date	Time	Location	Construction Noise Level, dB(A)	Parameter	Action Level	Limit Level dB(A)	Follow-up action
X_18N013	6-Mar-18	15:35	M6-HK Baptist Church Henrietta Secondary School	77	Leq(30min)	when one documented complaint was received.	70	<p>Possible reason: Concurrent breaking and saw cutting works on IECL opposite to Henrietta Secondary School was considered as the major noise contribution.</p> <p>Action taken / to be taken: Immediate repeat measurement was conducted to confirm the result at the same location. The construction noise level of repeated measurement at the same location on the same date was: 06 March 2018 at 16:05 77dB(A). Contractor was advised to prepare and submit the remediation plan for the concerned construction works according to the Event and Action Plan.</p> <p>Remarks / Other Obs: Additional monitoring was conducted on 08 March 2018 at 10:50 during non-examination period and the construction noise level was found to be at 69 dB(A) and no further exceedance was recorded.</p> <p>Concurrent breaking and saw cutting works on IECL opposite to Henrietta Secondary School under Contract HY/2009/19 was conducted during the measurement on 06 March 2018 and the noise contribution from the concurrent operation was observed as the major noise contribution. Hence, the exceedance was considered as Project related. Remedial actions including saw cutting works alone without concurrent operation of breaker and provision of additional temporary noise barrier for cutting works were implemented by the Contractor and no further exceedances was recorded during the additional monitoring on 08 March 2018. The Contractor of HY/2009/19 was advised to avoid future concurrent operation of major noise emanating works such as breaking and saw cutting works to avoid potential cumulative impact.</p>



Appendix 9.1

Complaint Log

**Environmental Complaints Log**

Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
110723a	23/07/2011	Ms. Law at Victoria Centre by ICC no. 1-303887687	North Point	She concerned that Highways Department published a notice in their Management Office about construction works will be conducted from 0700 hours to 2300 hours during July to December 2011 including Saturday, Sunday and public holiday.	1) It was referred by AECOM to ET on 28 July 2011 2) RSS confirmed that the notice was prepared by Victoria Centre 'a Management office to their resident and the advice was only given on the extension construction works (for Contract HY/2009/15) to 7am-9pm Monday to Saturday except Public Holidays and Sundays. 3) As a mitigation measure to minimize the noise nuisance in the vicinity of the residents, rock breaking activities will be started at 8am and is expected to be completed by mid-August 2011. 4) No noise exceedance was recorded at construction noise monitoring station at Victoria Centre on 19 and 25 July 2011 during daytime and evening time period while breaking and excavation works were observed during monitoring. 5) In conclusion, it was related to the construction works under Contract HY/2009/15 and mitigation measure was provided. The complainant was satisfied with the arrangement and no further complaint was received after proposed measures.	Closed
110723b	23/07/2011	Ms. Yau at Block 2, Victoria Centre by ICC no. 1-304013959	North Point	Reclamation work was conducted at Causeway Bay Typhoon Shelter at 7am on 23 July 2011. She complained that the works shall be started later to minimize the noise nuisance to the vicinity of the residents in early morning	1) It was referred by AECOM to ET on 8 August 2011 2) RSS confirmed to start the rock breaking activities for Contract HY/2009/15 at 8am as a mitigation measure to minimize the noise nuisance in the vicinity of the residents. 3) With reference to the construction noise monitoring at Victoria Centre, no exceedance was recorded on 19 and 25 July 2011 during daytime while breaking and excavation works were undertaken during monitoring 4) In conclusion, it was related to the construction works under Contract HY/2009/15 and mitigation measure was provided. The complainant was satisfied with the arrangement and no further complaint was received after proposed measures.	Closed
110727a	27/07/2011	Mr. Law from Victoria Centre Management Office by ICC no. 1-304616162	North Point	It was complained by Mr. Law from Victoria Centre Management Office on 27 July 2011 regarding construction noise generated by the construction operations of	1) It was referred by AECOM to ET on 28 July 2011 2) RSS confirmed to start the rock breaking activities for Contract HY/2009/15 at 8am as a mitigation measure to minimize the noise nuisance in the vicinity of the residents. 3) No noise exceedance was recorded at construction noise monitoring station at Victoria Centre on 25 July and	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
				Central-Wanchai Bypass at noon rather than in morning at 7am.	4 August 2011 during daytime and evening time period while breaking and excavation works were observed during monitoring. 5) In conclusion, it was related to the construction works under Contract HY/2009/15 and mitigation measure was provided. No further complaint from complainant was received after proposed the mitigation measure.	
110727b	27/07/2011	Ms. Chiu by ICC no.1-304615409	North Point	Noise nuisance from the excavation works for the Highways Department adjacent to the Victoria Centre was conducted from 7am	1) It was referred by AECOM to ET on 28 July 2011 2) With reference to the construction noise monitoring at Vitoria Centre, no exceedance was recorded on 25 July and 4 and 10 August 2011 during daytime while breaking and excavation works were undertaken during monitoring. 3) As a mitigation measure to minimize the noise nuisance in the vicinity of the residents, rock breaking activities will be started at 8am.	Closed
	07/08/2011				4) However, complainant did not satisfy with the response on the noise nuisance from the rock-breaking during morning in front of Victoria Centre and then further complaint via 1823 on 7 August 2011. 5) Highways contacted the complainant on 15 August 2011 that the noisy rock breaking operation had been completed. <i>Remarks: There will be counted as two complaints in this complaint log.</i>	
110730	30/07/2011	Mr. Tsui by ICC no. 1-305074350	Central	Construction noise generated by operations of Central-Interchange which is near the spa room at Four-Season Hotel. Also, the complaint enquired the commencement time of the construction on Saturday.	1) It was referred by AECOM to ET on 1 August 2011. 2) RSS confirmed that noisy plants from 2 vibratory hammers have been conducted in alternating manner for piling and drilling works for diaphragm wall construction. 3) With reference to the construction noise monitoring at IFC Western End of Podium, no exceedance was recorded on 4 August 2011 during monitoring while sheet piling works were undertaken during monitoring. 4) In order to reduce the noise impact to nearby noise sensitive receivers, Contractor has been implemented the following noise mitigation measures: - Erection of acoustic lining at the hoarding next to Four Seasons Hotel; - Temporary noise barrier with extended acoustic lining; - Reduced in plant such that only have one vibration hammer operating at the west side near Four	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					Seasons Hotel instead of 2 5) In conclusion, it was related to the construction works under Contract HY/2009/18 and mitigation measure was provided. The complainant was satisfied with the arrangement and no further complaint was received after proposed measures.	
110810	10/08/2011	Mr. Yip by ICC no. 1 – 306740207	North Point	Muddy water was discharged from work site to the seafront near Oil Street during heavy rain. The environmental protection measures were not good enough and are needed to rectify.	1) It was referred by AECOM to ET on 17 August 2011. 2) Confirmed with RE, Muddy water was caused by a heap of earth being washed to the sea by heavy rain. The heap of earth was referred as a small stockpile placed close to the seafront in front of Oil Street within the site area under handover transition period from contract HY/2009/11 to contract HY/2009/19. The necessary mitigation measures to protect the small stockpile against rainfall were missing at the time of complaint. 3) Due to the missing of mitigation measures to protect the small stockpile during handover transition period, loose material was washed into the harbour when heavy rain came. Muddy water was formed and dispersed in the sea that caused the water quality and visual concern to the public. The complaint was considered as valid. 4) Contractors were advised to relocate the loose materials away from the coastline as far as practicable. Any loose material placed which needed to be placed near the coastline shall be properly compacted or covered as appropriate. To avoid any further environmental deficiency, Contractors shall ensure all necessary environmental mitigation measures will not be missing during site area handover.	Closed
110817	17/08/2011	ICC no. 1-307657681	North Point	Visual impact generated by light from a large amount of spot-lights on the barge during mid-night nearby City Garden.	1) It was referred by AECOM to ET on 23 August 2011 2) RSS confirmed that some non-essential lights were turned on during night-time period which caused the nuisance to the nearby residents. In addition, absence of lighting shields at flood lights results in visual glare to the complaint at night-time. 3) Follow-up action had been taken by contractor that switches off all non-essential lights to minimized nuisance to the nearby residents. The complainant satisfied to the practice and no further complaint was received after that.	Closed
110826	26/08/2011	Grand Hyatt and a complainant by ICC	Wan Chai	Construction noise and vibration nuisance generated from the works at Convention Avenue and inside the HKCEC1	1) Confirmed with the Resident Site Staff that the construction works were referred to the Contractor HK/2009/01. 2) The Excavator mounted breaker at Convention Avenue	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
				reclamation area.	and Drilling rig at HKCEC1 reclamation area were the dominant construction noise source during this period. 3) The drilling rig at HKCEC1 reclamation area and excavator mounted breaker at Convention Avenue were then temporary suspended after received the complaint. 4) Investigation revealed that the erected noise barrier (4m cantilevered movable noise barrier for the drilling rig and 1m movable noise barrier for the excavator mounted breaker) were not located close to the plants to provide adequate noise screening. 5) Contractor was advised to avoid concurrent operation of construction plants at site. Further enhancement of movable noise barriers at HKCEC1 and providing noise enclosure for the excavator mounted breaker at Convention Avenue are needed. 6) Further site investigation and checking on 31 August and 7 September 2011 revealed that the implemented noise mitigation measures were in proper and minimize the noise impact.	
110826A	26/08/2011	A complaint letter from Mr. Au of Cayley Property of City Garden	North Point	Harbor front adjacent to their water intake suction which caused 3 times of system breakdown of the sea water pump on 9, 22 and 25 August 2011.	1) It was referred by AECOM to ET on 29 August 2011 2) Confirmed with the Resident Site Staff that the construction works were referred to the Contractors HY/2009/11 and HY/2009/19. 3) The pump is located on the site area of HY/2009/19 4) A temporary garbage defender was installed on 23 July 2011 by HY/2009/11 and the shape of the defender was adjusted on 8 August 2011 in order to exclude the outfall. 5) An ad hoc inspection of the effectiveness of garbage defender was conducted with RSS (CWB project team), contractor of HY/200911 and HY/2009/19 and IECon 29 August 2011. Inspection report of it was submitted to RSS on 19 September 2011. 5) Daily cleaning near the water intake was conducted twice a day by contractor HY/2009/19. 6) In response to City Garden request, the contractors have set up the temporary garbage defender in function and collect the floating refuses, but cannot eliminate all refuses, in particular the refuse come from sea bed from entering the intake. 6) According to the complaint letter from Cayley Property, the outcomes of the preventive measures were not complying with their expectation. 7) During on-site inspection, floating refuses observed	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>occasionally outside the garbage defender. No conclusion could be made for the source of these floating refuses. On the other hand, some of the floating refuses were observed immigrating in the protective zone during investigation</p> <p>8) All daily cleaning actions had been taken by contractor to minimize floating refuse inside the construction site. It was noted that the intake (land side) is open access to public, so that many activities such as fishing, feeding fish were conducted there even though a notice has already hoisted. Also, tripping of rubbish by the passers-by could result in a lot of rubbish accumulated around the intake point.</p> <p>9) Referring to the record provided by CPML, there were a lot of nylon/ plastic bags and nylon wire mesh that matched those rubbishes generated from the public activities.</p> <p>10) Contractors have fulfilled the requirement of site cleanness and no exceedance was recorded during Water Quality Monitoring. It is consider the cause of this complaint is not related to project and environmental issue in this project as well. No more complaint received after ad-hoc inspection</p>	
111014	14/10/2011	The complainant, Ms. Tam complained via hotline 1823	Wan Chai	The polluted fumes and exhaust from the excavation by sub-contractor of CEDD on pedestrian way outside no.25 Harbour Road (in front of the Harbour Centre)	<p>1) RSS notified ET to carry out investigation on 17 October 2011.</p> <p>2) ET confirmed with the Resident Site Staff that the location of the excavator was within site area of Contract no. HK/2009/02 undertaking the water cooling main reprovision works along the Harbour Road. The plants including the excavator have been checked before using at the site. However, the polluted fumes and exhausted from the excavator was caused due to insufficient maintenance of the plant after using at site.</p> <p>3) After receiving the complaint, the excavator was then removal off-site for checking and maintenance works on 17 October 2011.</p> <p>4) Contractor was reminded to enhance regular checking and maintenance to all plants at site.</p> <p>5) RSS has replied to the complainant on the arrangement of the measures taken on 17 October 2011. Complainant was satisfied with the response and follow-up action taken by the Contractor.</p>	Closed
111104	04/11/2011	Mr. Liu from	Wan Chai	Complain about a tree near the	1) ET confirmed with the Resident Site Staff that	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
		LCSD complained via Contractor Complaint Hotline		site of pipe installation works outside Wan Chai Swimming Pool at Harbour Road, the status is not healthy and roof ball of two trees inside the site near Renaissance Hong Kong Harbour View Hotel at Convention Avenue were half cut.	<ul style="list-style-type: none">· A tree near the site of pipe installation works outside Wan Chai Swimming Pool at Harbour Road is the Tree no. TA1122 under Contract no. HK/2009/02. Leaves of a branch of this tree were shrivelled.· Two trees inside the site near Renaissance Hong Kong Harbour View Hotel at Convention Avenue are the tree nos. A160 and A161 under Contract no. HK/2009/01. Part of roof ball of these two trees was covered by the metal plate. 2) Independent Tree Specialists for these two inspected the trees. Contractor HK/2009/01 has taken the measure as recommend downgrading the soil level around the trunk base. Reinstating of the ground works will be conducted in mid-December 2011. For the tree no. TA1122 under Contract no. HK/2009/02, the brown leaves were removed and fenced the tree with orange net is provided to prevent damage of tree trunk by construction works. The distance between the tree and the edge of the trench is kept approximate 2m. Two Contractors were reminded to carry out regular watering to the trees within their site area.	
111106	06/11/2011	Police officer	Wan Chai	Construction noise generated from the site at about 6:30 a.m on 6 November 2011 and require to stop the machine operation	<ol style="list-style-type: none">1) According to the information reported by Contractor, one BC cutter and hoist were operated for Diaphragm Wall construction of Shatin-Central Link to inspect bentonite pipes and ensure no damages and all the joints are tightened in good position. Then, the subcontractor for Diaphragm wall, SAMBO Korean foreman stopped the engine of the BC cutter immediately. The police officer recorded the details and HKID number of the foreman and then left. Due to the different language communication between the police officer and the Korean foreman, no CNP was checked by the police officer.2) ET confirmed with the Resident Site Staff that same issue was also raised out by RSS at about 7:00a.m on the same day. Besides, it was confirmed that there is no valid Construction Noise Permit for the conducted construction works in the period between 2300 and 0700.3) Due to insufficient communication between Contractor HK/2009/01 and their Korean Sub-contractor, Korean Sub-contractor had not notified to Contractor before carrying out the inspection of the BC cutter, hoists and	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>bentonite pipes at about 6:00a.m to ensure no damages and all the pipe joints should be tightened and in good position.</p> <p>4) Contractor was advised to enhance the communication between Contractor and sub-contractor and provide sufficient environmental training to all foreman and operators on restricted hour operation. Furthermore, Construction Noise Permit should be checked and in place for the construction works during restricted hour</p> <p>5) This complaint was considered in relation to the conducted construction works during restricted hours without valid Construction Noise Permit. No more construction works were conducted during night time period. The construction works will be conducted in accordance with the time period stated in valid CNP. This complaint will be kept in view of any follow-up action from the relevant government activities.</p>	
111212	12/12/2011	The complainant, Mr Tsui from IFCII's management office complained via hotline 1823	Central	A visual impact complaint from hotline 1823 was received by ET on 9 January 2011 (ICC Ref. No.: ICC#1-333037096 dated on 12 December 2011). The complaint, Mr Tsui was reported that visual nuisance caused by lighting in the construction site during night time.	<p>1) RSS notified ET on 9 Jan 2012.</p> <p>2) ET confirmed with the Resident Site Staff that A joint inspection was conducted by Mr Tsui and contractor on that night to see whether there is any improvement.</p> <p>3) Due to safety reason, igniting enough lights should not be avoided in construction site. However, the light sources were not directed away from pointing to the sensitive receiver and results in visual glare to the complainant.</p> <p>4) Confirmed with the Resident Site Staff the complainant was satisfied the new arrangement of the lights with contractor after the joint inspection. No further complaint received after that.</p>	Closed
111220	20/12/2011	The complainant, Ms. Poon complained via hotline 1823 (ICC Ref. No.: ICC#1-334683841)	North Point	Construction air and noise nuisance generated that many trucks carrying construction materials driving along Watson Road and Oil Street and possibly entering/leaving the construction site near the IEC during 0800 to 1900 hours.	<p>1) RSS notified ET on 22 Dec 2011.</p> <p>2) ET confirmed with the Resident Site Staff that the complainant cannot identify whether the trucks were working under the CWB project or not.</p> <p>3) The dominant construction air and noise nuisances were emitted by the trucks along Oil Street and Waston Road, however, this is the public road for all vehicles. Reviewing the air quality monitoring and noise monitoring results. No exceedance was recorded during this period.</p> <p>4) Confirmed with the Resident Site Staff that they provided a contact no. for any future enquiries regarding</p>	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					CWB project to the complainant and she was satisfied on the arrangement and no further complaint was received after that.	
111230	30/12/2011	Residents of Harbour Heights	North Point	Construction air and noise nuisance generated by construction vehicles were found parked illegally at King Wah Road and lining up at Oil Street without the engine turning off.	<p>1) RSS notified ET on 6 January 2011.</p> <p>2) ET confirmed with the Resident Site Staff that a number of construction activities are concurrently proceeding in the vicinity of Oil Street, King Wah Street and a private development project in King Wah Street</p> <p>3) The dominant construction air and noise nuisances were emitted by the trucks along Oil Street and King Wah Road, however, this is the public road for all vehicles. Reviewing the results of air quality monitoring station (CMA1b) and noise monitoring (M4b). No exceedance was recorded during this period. Site inspections for HY/2009/19 were conducted on 4 January 2012. The condition of the site access at Oil Street and the public road nearby were found satisfactory. It is noted that HyD also allow and encourage their contractors to maximize the use of marine access, where available, to work sites, so as to minimize burdening nearby public roads. When land trips are unavoidable, they require contractors to tidy up their construction vehicles before leaving works sites. No contractor under CWB project parked their vehicles illegally at King Wah Street, and HyD still reminded them not to commit such offence.</p> <p>4) According to HyD's staff replied the complaint letter on 10 January 2012, there is a private development project under construction at King Wah Road. To access these works sites, construction vehicles have to use public roads nearby. No further complaint received after HyD's reply.</p>	Closed
120118	18/01/2012	N/A	North Point	A complaint regarding a tree located in front of Victoria Centre under IECL was covered by one meter mud without any protection. The complainant concerns the health of the tree in such condition.	<p>1) RSS notified ET on 20 January 2012.</p> <p>2) ET confirmed with the Resident Site Staff that The tree is inside the site area of HY/2009/19 and The Botanical name of the tree is Ficus superba var. japonica and the I.D. of the tree is UT48</p> <p>3) According to the information provided by RSS on 20 Jan 2012, the tree shall be felled that has been approved by DLO on 29 August 2011. Moreover, the tree was felled</p>	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					by contractor on 19 January 2012. 4) No further complaint received after HyD's reply.	
120305	03/03/2012	Resident of Harbour Heights complained via hotline 1823 (ICC Ref. No.: ICC#1-344632511)	North Point	A complaint regarding excessive noise from construction sites of CWB was observed outside Harbour Heights from Monday to Saturday before 8am. The plants were frequently turned on before 7:30am creating nuisance. The complainant requested a speedy follow-up and reply from relevant department.	1) RSS notified ET on 5 March 2012. 2) ET confirmed with the Resident Site Staff that PME for diaphragm wall construction started to operate at about 7:30am whilst the other PME, including those for land bored piling work, started to operate after 8am. 3) After reviewing the results of noise monitoring (M4b), no exceedance was recorded during daytime period and the noise level were below 75dB(A). Site inspection for HY/2009/19 was conducted on 7 March 2012. The condition of noise mitigation measures near Harbour Heights was found satisfactory. RSS confirmed that no operation was active before 7:00am everyday. The suspected nuisance was to be considered caused by the PME for diaphragm wall construction. A surprise check was performed on 13 March 2012 by RSS. It was found that no noisy PME was in operation by Contractor of HY/2009/19 before 8am, and the construction noise level was minimal and not disturbing. The noise level and operation time both complied with statutory requirements set up in NCO. 4) Complainant called ICC on 8 March 2012 to confirm HyD has provided a response. No further complaint was received after the response.	Closed
120405	05/04/2012	N/A	North Point	A complaint regarding excessive noise from construction sites of CBTS was observed daily before 7:30am except on public holidays, and the noise source was mainly from piling works. The complainant requested that construction works should start after 8:30am to avoid nuisance to nearby residents and a speedy follow-up and reply.	1) RSS notified ET on 5 April 2012. 2) ET confirmed with the Resident Site Staff that no piling works were performed during the concerned period. 3) After reviewing the results of noise monitoring (M2b and M3a), no exceedance was recorded during daytime period and the noise level was below 75dB(A). Site inspection for HY/2009/15 was conducted on 10 April 2012. The condition of noise mitigation measures around CBTS was found satisfactory. RSS confirmed that no pilings were performed during the concerned period. The major works included drilling, diaphragm wall construction and excavations. 4) HyD made a reply to the complainant on 16 April	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					2012 via 1823. HyD replied that the current works at CBTS were drilling, diaphragm wall construction and deep excavations. In order to minimize the noise generated from the above works, the Contractor had erected temporary noise barriers and provided noise blankets on plants. RSS would continue to work with the Contractor on the effectiveness of the environmental mitigation measures implemented on site. No further complaint was received after the response.	
120415	15/04/2012	The complainant Ms. Law, resident of Fu Lee Loy Mansion, complained via hotline 1823 (ICC Ref. No.: 1-351021108)	North Point	A complaint regarding excessive noise generated from a HyD project that is located at the connection point of CWB and IEC affecting nearby residents. Lately during the middle of the night (around 00:00 to 05:00), low frequency noise, which possibly came from the operating power generator and the barges which were parked along the Oil Street work site, were making a nuisance to the complainant and residents nearby. The complainant requested that relevant department should follow-up.	<ol style="list-style-type: none"> 1) RSS notified ET on 17 April 2012. 2) ET confirmed with the Resident Site Staff that there was no operation of power generators for HY/2009/19 and HY/2009/17 (HY/2009/11 had no physical work on site) during the concerned period. Although there were a few barges mooring at the seafront of HY/2009/19, they were not in operation and hence no operational noise would be emitted. 3) After reviewing the results of noise monitoring (M4b and M5b), no exceedance was recorded during day time period and the noise level was below 75dB(A). Site inspection for HY/2009/19 was conducted on 18 April 2012. The condition of noise mitigation measures near Harbour Heights were found satisfactory. RSS confirmed that no operation of power generators for HY/2009/19 and HY/2009/17 (HY/2009/11 had no physical work on site) during the concerned period. Although there were a few barges mooring at the seafront of HY/2009/19, they were not in operation and hence no operational noise would be emitted. 4) HyD made a reply to the complainant on 30 April 2012 via email. HyD replied that the current works near Oil Street, North Point, included CWB tunnel works, IEC connections and associated foundation works. According to RSS records, no operations were performed during the early hours of March and April at Oil Street and the waterbody nearby, and so it was believed that the noise nuisance was not generated from the CWB project. Despite that, RSS would continue to monitor the Contractor on the operations and effectiveness of the environmental mitigation measures implemented on site, as not to affect daily life of local residents nearby. No further complaint was received after the response. 	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
130308	06/03/2013	ICC Case#1-407181502	Tin Hau	A complaint regarding the dropping of fine rock material into surrounding waterbody was observed during rock breaking operation with two excavators in active operation at the Eastern Breakwater of Causeway Bay Typhoon Shelter near the North Point lighthouse.	<p>1) RSS notified ET on 8 Marc 2013</p> <p>2) ET confirmed with RSS that excavation works, installation of buoy, flashing light and silt curtain and dredging works were undertaken at Eastern Breakwater during the concerned period on 6 March 2013. One backhoe equipped with breaker and one derrick barge were confirmed in operation while another backhoe was at idle during the concerned period on 6 March 2013.</p> <p>3) Reviewing the photo record provided by RSS, the condition of the silt curtain deployed around the Eastern Breakwater on 6 March 2013 was found to be in good condition. It is considered that the silt curtain was properly in place during the concerned period and the concerned act of dropping of fine rock material was confined within the silt curtain boundary without adverse impact to the nearby water quality.</p> <p>Further follow up was conducted on 12 March 2013 during weekly environmental audit inspection, the silt curtain deployed around the concerned area was found to be maintained in good condition and the water quality at the concerned work area was generally satisfactory. No violation of the Environmental Permit condition was found.</p> <p>The contracotr was advised and committed to implement preventive meaures to mimize the potential impact of work including conducting regular diver check to ensure the integrity and the extend of silt curtain deployment and to provide adequtae back up stock of silt curtain for emergency use.</p>	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
130606	30/5/2013	ICC Ref. No.: #1-430164728	Central – Man Kat Street	1. A number of trees (approximately more than ten) along Man Kat Street were found to be in poor health condition with withered and yellow leaves. The complainant has requested a follow-up by relevant department.	<p>1) RSS notify ET on 6 June 2013</p> <p>2) ET confirmed with the Resident Site Staff that</p> <p>According to the information provided by RSS, 13 no. of the trees - Roystonea regia (T1674, T1675, T1676, T1677, T1678, T1679, T1680, T1681, T1683, T1644, T1643, T1641, T1639) at the concerned location raised by the complainant was found to be with withered and yellow leaves and 1 no. of tree- Khaya senegalensis (T1712) raised by the complainant was found to be in poor health condition.</p> <p>No construction works was undertaken by Contract HY/2009/18 at the concerned planter area where the affected trees are located.</p> <p>It was also observed that an active CEDD construction works area under a separate contractor not related to Central Wan Chai Bypass Project was found to be located within the concerned planter area.</p> <p>3) A follow-up joint inspection with RSS and Landscape specialist was conducted on 10 June 2013, it was considered that the witered and yellow leaves of the affected trees (T1674,T1675,T1676,T1677,T1678,T1679,T1680,T1681, T1683,T1644,T1643,T1641,T1639) at the concerned planter area were contributed by natrual life cycle of the affected trees and the health condition of the affected trees were considered to be fair. It was also noted that an active CEDD works area was located within the concerned planter area in close proximity to few of the concerned trees (T1644,T1643,T1641,T1639)</p> <p>According to tree inspection records from Jan 2013 to May 2013 confirmed by RSS (Document Ref: CI-F1-043b, CI-F1-044b, CI-F1-045b, CI-F1-046b, CI-F1-047b), the affected tree (T1712) at the concerned planter area was considered to show sign of withering and considered to be in poor health condition in latest tree survey report confirmed by RSS.</p>	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>During the follow-up inspection on 10 June 2013, It was observed that construction material and oil drum were placed near the the roots area of other trees within the CEDD works. Despite the above observation, no direct evidence was found on site which indicates the work front have contributed to the poor health condition of the affected tree (T1712) at the time of investigation.</p> <p>4) The relevant contractor have removed the construction material near the root area of the trees retained on site and conduct pruning to remove the withered and yellow leaves retained on tree trunk to minimize impact on the trees appearance.In addition, safety supporting wire was provided for concerned tree (T1712)</p> <p>5) ET recommended the contractor to keep in view the health condition of the concerned tree (T1712) and apply permission for tree felling together with tree compensation plan if considered necessary. Furthermore, the contractor was reminded to implement regular checking of tree health condition and regular removal of withered leaves to maintain the overall tree appearance.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
130611	30 May 2013 and 1 June 2013	EPD Ref.:H04/RS/0001 1587-13	Area near Central Pier	1. Noise was emanated from the construction site near the Central Piers at around 0900 hrs on 30 May 2013 and other days and requested follow up action by relevant department.	<p>1) RSS notify ET on 11 June 2013</p> <p>2) ET confirmed with the Resident Site Staff that According the information confirmed by RSS, major noise generating construction activities undertaken at works area near Central Pier during the concerned time include</p> <ul style="list-style-type: none">- Breaking up existing D-wall concrete and excavation at portion 4B and 4C- Sheet piling works at Portion VI (Man Kat Street) <p>3) Total 1 no. of Backhoe with breaker, 1 no. of Backhoe with vibratory hammer and 4 no.s of pneumatic breakers were deployed for the above construction activities.</p> <p>Reviewing the noise monitoring data at monitoring stations (M7e- International Finance Centre Eastern End of Podium and M7w- International Finance Centre Western End of Podium), no limit level exceedances were recorded during routine noise monitoring event on 28 May 2013 and 03 June 2013. As similar construction works activities conducted on 30 May 2013 was continued across the above monitoring period, the noise emanated from the construction activities under Contract HY/2009/18 was considered to complied with the statutory requirement.</p> <p>In addition, weekly environmental site inspection was conducted on 30 May 2013 at around 10:00. According to the inspection record, no particular observation regarding noise impact was recorded and the mitigation measures including erection of of temporary noise barrier was observed in place.</p> <p>As such, no direct information associated with the noise concerned raised was considered available and no non-conformity was identified.</p> <p>4) ET recommend the contractor to review the need of additional noise mitigation measures to further reduce the noise enmated during construction works for pier side public area.</p>	Interim report submitted to EPD on 19 June 2013, EPD advised no further comment on 5 Aug 2013and final report for case closing submitted on 6 Aug 2013.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
131010	03 Oct 2013	ICC Ref: No.1-467000768	Area between Central Pier and International Finance Centre	Noise and air quality impact was experienced at the area located between IFC and Central Pier during peak hours.	<p>ET confirmed with the Resident Site Staff that</p> <p>1) The major construction activities at the concerned location conducted over the past three months include;</p> <ul style="list-style-type: none">- Formwork, rebar and concreting- Backfilling- Water-proofing- Scaffolding erection <p>2) Mitigation measures implemented by the Contractor for the above construction works include</p> <ul style="list-style-type: none">- Select quiet plant and work methods;- Check plant and equipment for condition;- For use of powered mechanical equipment during restricted hours: Obtain necessary Construction Noise Permit and strictly comply with their conditions;- Frequently spray water to major haul road and stockpiles to suppress dust generation; and- Cover stockpiles with impervious sheets <p>The construction activities including backfilling, concreting and other associated tunnel works were undertaken in the past three months. Having reviewing the monitoring data of the monitoring stations in the vicinity of the concerned location raised by the complainant, namely monitoring station M7e and M7w (Noise Monitoring Station) and MA1e and MA1w (Air Monitoring Station), no action or limit level exceedance was recorded.</p> <p>In addition, mitigations measures including water spraying and erection of noise barrier were observed during weekly site inspection in August and September 2013 and reminders on dust mitigations measures given during weekly site inspection to the contractor were rectified. As such, the construction activities under Contract HY/2009/18 were considered in compliance with the statutory requirement and no cumulative air/ noise quality impact was observed in the past three months.</p>	Closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					Elevated noise level at monitoring station M7e (International Finance Centre East Podium) was noted on 24 September 2013. The Contractor is recommended to review the current measures and to implement additional noise mitigation measures to further avoid potential impact to nearby public area during construction works.	
131217	16 Dec 2013	ICC Case Ref.: 1-484998552	Victoria Park near Hing Fat Street Exit	Sweeping of muddy water into public drains.	<p>ET confirmed with the Resident Site Staff that</p> <p>1)The major construction activities around the concerned location conducted on 16 Dec 2013 a.m.includes: -Preparation work of rootball for tree transplanting</p> <p>According to the information provided by RSS, the construction activities around the concerned location on 16 Dec 2013 include preparation work of rootball for tree transplanting at Zone 17/18.</p> <p>A further investigation on the complaint was conducted on 19 Dec 2013 during weekly environmental inspection. It was observed that a tree worksarea comprised of mainly loosen soil was located near the concerned location. It was considered that the inclined surface and loosen soil nature of the concerned worksarea could have led to the muddy surface runoff in rain. Deposition of muddy runoff onto nearby public pavement outside worksarea was hence resulted and was subsequently cleaned into nearby public stormwater drain by the Contractor's workers on the complaint date. As such, the case was considered as works related.</p> <p>Sandbags, geotextile and gravels were immediately placed by the Contractor around the gullies at the concerned location to prevent leftover muddy runoff to the public stormwater drain as observed during the weekly inspection on 19 Dec 2013.</p> <p>With respect to the follow-up raised by the complainant on 19 Dec 2013, sandbags, geotextile and gravels placed at gullies located at public area were removed by the Contractor on the same day for maintaining passible public pavement. Follow up measures including sandbag bundle and covering of worksarea with impervious sheeting was immediately placed at the source of impact at the concerned worksarea boundary by the Contractor.</p>	Final investigation report issued on 20 Dec 2013. Case closed on 3 Jan 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
131224	24 Dec 2013	(ICC Case Ref.: 1-486434321	Victoria Park Children Playground	Odour and large amount of dust particles affecting the public user of the Victoria Park near Children playground	<p>ET confirmed with the Resident Site Staff that</p> <p>1) The major construction activities around the concerned location conducted on 24 Dec 2013 include:</p> <ul style="list-style-type: none">- Breaking up existing pillar box for new children playground Portion II- Pressing of sheet pile at bowling green for ELS works Portion XII- Welding work for preparation of sheetpiling work at bowling green Portion VI- Demolition of existing pavilion for bowling green Portion VI-Felling of tree TA50 at Victoria Park Zone <p>2) Mitigation measures implemented by the Contractor for the above construction works include</p> <ul style="list-style-type: none">-Water spraying for demolition and other dust generating works. <p>According to the relevant site records, breaking up of existing pillar box, pressing of sheet pile, welding work for preparation of sheetpiling demolition of existing pavilion and felling of tree TA50 at Victoria Park Zone 13 were conducted at the concerned location during the time of complaint.</p> <p>Based on information and photo record provided by the RSS, dust mitigation measures including water spraying during dust generating works were implemented by the Contractor at the concerned location on 24 Dec 2013.</p> <p>Follow-up investigation was conducted on 27 Dec 2013 during weekly environmental inspection, dust mitigation measures including water spraying to dusty area and major dust generation works were confirmed in place despite a general reminder was given to the contractor to enhance the water spraying to dusty haul road during dry season. Based on on-going site inspection and the follow-up investigation, the site condition was considered generally satisfactory and no non-conformance was identified.</p> <p>Upon further review on the supplementary information provided by the complainant on 31 Dec 2013 and investigation conducted on 2 Jan 2014, the tree felling work of tree TA50 was located nearest to the location of the complainant. According to the location plan provided by the RSS and on site investigation, the tree felling work</p>	Case closed and full investigation report issued on 3 Jan 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>for TA50 was immediately in front of the location of the complainant. Based on site observation, scrap material of bark and leaves inevitably generated from cutting of branches during tree felling work was considered to be the most probable cause for the observation raised by the complainant at the concerned location on 24 Dec 2013.</p> <p>Furthermore, welding work was observed near the concerned location and was considered to be the potential source for the smell and exhaust fumes as described by the complainant. Notwithstanding the above, welding work was not identified as a work activity with air quality impact under Project EIA report but it would be desirable to implement preventive measures to minimize potential nuisance to nearby public.</p>	
140123	22 Jan 2014	ICC Case Ref.:1-494077682	Causeway Bay Typhoon Shelter	Construction works have been undertaken during restricted hours until 2300 hrs and occasionally the working hours were extended to around 0100 hrs at nighttime period over the last two to three months at a construction site located within Causeway Bay Typhoon Shelter. For instance, concreting and excavation works were conducted at the concerned location on 22 Jan 2014 during nighttime hours and generated noise impact to the complainant.	<p>ET confirmed with the Resident Site Staff that No construction activity was undertaken at workzone TS1 under HY/2009/15 within Causeway Bay Typhoon Shelter after 1900 hrs on 21 Jan 2014.</p> <p>No construction activity was undertaken at workzone TS3 under HY/2010/08 within Causeway Bay Typhoon Shelter after 1900 hrs on 21 Jan 2014.</p> <p>Concreting for base slab and hanger wall was conducted at workzone TS2 under HY/2009/15 within Causeway Bay Typhoon Shelter from 1900 to 0000 hrs on 21 Jan 2014; Total 8 no.s of concrete lorry mixers, 1 no. of water pump, 2 no.s of concrete pumps (lorry mounted), 1 no. of mobile crane QPME (diesel) and 3 no.s of vibratory pokers were operating from 1900 to 0000hrs on 21 Jan 2014.</p> <p>Concreting for base slab and hanger wall was conducted at workzone TS2 under HY/2009/15 within Causeway Bay Typhoon Shelter from 0000 to 0700 hrs on 22 Jan 2014;</p> <p>Total 1. no of concrete lorry mixer, 1 no. of water pump, 1 no. of concrete pump (lorry mounted), 1 no. of vibratory poker were operating from 1900 to 0000hrs on 22 Jan 2014</p>	Case closed and full investigation report issued on 4 Feb 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>According to the relevant site records, from 1900-0000hrs on 21 Jan 2014, concreting for base slab and hanger wall was conducted at workzone TS2 under HY/2009/15 within Causeway Bay Typhoon Shelter. Total 8 no.s of concrete lorry mixers, 1 no. of water pump, 2 no.s of concrete pumps (lorry mounted), 1 no. of mobile crane QPME (diesel) and 3 no.s of vibratory pokers were operating at the above period.</p> <p>From 0000 to 0700 hrs on 22 Jan 2014, concreting for base slab and hanger wall was conducted at workzone TS2 under HY/2009/15 within Causeway Bay Typhoon Shelter. Total 1. no of concrete lorry mixer, 1 no. of water pump, 1 no. of concrete pump (lorry mounted), 1 no. of vibratory poker were found operating at the above period.</p> <p>After reviewing relevant photo records and information verified by RSS and the Construction Noise Permit (CNP) no.GW-RS1384-13, it was considered that several conditions of CNP GW-RS1384-13 were not fulfilled by the Contractor in particular for the item(s) below,</p> <p>No acoustic installation was provided for the relevant PME(s) used as stated in CNP condition 3.d.during the concerned concreting works.</p> <p>From 1900 to 2300 hours on 21 Jan 2014, the PME(s) used on-site did not comply with any given PME grouping requirement(s) as stated in condition 3.a. and condition 3.d. in CNP no.GW-RS1384-13.</p> <p>From 0000 to 0700 hours on 22 Jan 2014, the PME(s) used by the Contractor on-site did not comply with any given PME grouping requirement(s) as stated in condition 3.a. and condition 3.d. in CNP no.GW-RS1384-13.</p> <p>From 1900 to 2300 hours on 21 Jan 2014 and from 0000 to 0700 hours on 22 Jan 2014, PME (Concrete Lorry Mixer) was deployed by the Contractor without barge enclosure and was unable to comply with condition 3.a. in CNP no.GW-RS1384-13.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
140127	24 Jan 2014	ICC Case Ref.: 1-494612639	Works area adjacent to the Victoria Park Bowling Green	Noise generated from piling works conducted at the works area adjacent to the Victoria Park Bowling Green have created nuisance to the Bowling Green users.	<p>ET confirmed with the Resident Site Staff that The major construction activities around the concerned location conducted on 23 Jan 2014 include:</p> <p>Pressing of sheetpile Ch.279-285 (RHS) and Ch.317 for ELS works on 23 Jan 2014. Splicing of sheetpile Ch.275-285 (LHS) for ELS works on 23 Jan 2014.</p> <p>Mitigation measures implemented by the Contractor for the above construction works include:</p> <p>Installation of acoustic panels along hoarding line at East Bowling Green; Installation of addition noise barriers on top of hoarding at East Bowling Green; Display of publicity notices along hoarding line; and No noisy work shall be carried out at the areas adjoining East Bowling Green as if there is any Bowling Green competition event to be held (i.e. Saturday afternoon).</p> <p>According to relevant site records, pressing of sheetpile Ch.279-285 (RHS) and Ch.317 for ELS works and splicing of sheetpile Ch.275-285 (LHS) for ELS works were conducted at the concerned location during the time of complaint.</p> <p>Based on the photo records and information verified by RSS, noise mitigation measures including installation of acoustic panels along hoarding line at East Bowling Green and installation of addition noise barriers on top of hoarding at East Bowling Green were implemented by the Contractor at the concerned location. Furthermore, no noisy work was conducted by contractor at the areas adjoining</p>	Case closed and full investigation report issued on 6 Feb 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>East Bowling Green when there is any Bowling Green competition event to be held.</p> <p>Follow-up investigation was conducted on 29 Jan 2014 during weekly environmental inspection, noise mitigation measures including noise barriers and acoustic panels were confirmed in place and maintained in good condition. According to previous environmental inspections recorded in Jan 2014, no particular observation regarding the noise impact was recorded. As such, no non-conformity was identified.</p>	
140311	27 Feb 2014	EPD Complaint Case (Ref:H04/RS/00 04232-14) received by ET on 11 March 2014	Central IFC Area	Excessive noise (from the operation of compressors, other heavy machinery and concrete breaking) was emanated from the construction site near IFC in daytime on 27 Feb 2014.	<p>ET confirmed with the Resident Site Staff that the major construction activities at the concerned location conducted on 27 Feb 2014 (Daytime) include:</p> <ul style="list-style-type: none"> Backfilling works between north wall and sheetpiles and for roof slab; Site hoarding removal; Formwork erection and removal works, falsework erection; Concrete breaking works at roof slab and base slab and breaking up of existing tunnel corner; Concreting works for profile barrier inside cut and cover tunnel; and Rebar fixing works and WVB basement remediation works. <p>Mitigation measures implemented by the Contractor for the above construction works include:</p> <p>Use of quiet plants (air compressor with a Noise Emission Label of 99 dB(A)).</p>	<p>Interim report submitted to EPD on 18 March 2014,</p> <p>EPD advised no further comment on 26 March 2014 and final report for case closing issued on 26 March 2014</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>According to relevant site records, major noise emanating construction activities conducted around the concerned location on 27 Feb 2014 include concrete breaking works at roof slab and base slab and breaking up of existing tunnel corner and concreting works.</p> <p>Based on information verified by the RSS, noise mitigation measure including utilization of quiet air compressor with noise emission label of 99 dB(A) was implemented by the Contractor on the 27 February 2014 to minimize the potential noise impact.</p> <p>Having reviewed the monitoring data of the monitoring stations in the vicinity of the construction site near IFC, namely noise monitoring stations M7e and M7w, no limit level exceedances were recorded on 24 Feb 2014 and 4 March 2014 and the major concrete breaking works at the concerned location conducted on 27 February 2014 was continued across the above monitoring period. In addition, no particular observations regarding noise impact were recorded during weekly site inspection conducted on 27 Feb 2014. No non-conformity was identified. As such, the construction activities under Contract HY/2009/18 were considered generally in compliance with the statutory requirement.</p> <p>Nevertheless, in view of the concern regarding noise nuisance raised by public, it is considered desirable for the Contractor to review and strengthen the noise mitigation measures around the concerned location.</p> <p>Follow-up inspection was conducted during weekly environmental inspection on 13 March 2014, additional noise mitigation measure including erection of noise blanket for concrete breaking works were implemented by the Contractor to further minimize the noise nuisance to nearby public</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
140623	11 June 2014	EPD Complaint Case (Ref:H04/RS/00 013590-14) received by ET on 23 June 2014	Foot Bridge to Central Pier 7	Excessive Paint Spray Odour	<p>A public complaint regarding odour concern referred by EPD was received by ET on 23 June 2014.</p> <p>The complainant reported that excessive paint spray odour was detected at the foot-bridge to the Central Pier 7.</p> <p>ET confirmed with the Resident Site Staff that spraying of waterproofing membrane (integritank) from Ch1700 to Ch1705 was conducted at roof slab Bay12 on 11 June 2014 and</p> <p>Screeding concrete placing from Ch1700 to Ch1683 was conducted at roof slab Bay12 on 11 June 2014 and</p> <p>Backfilling and removal of concrete blocks was conducted at roof slab Bay 11 and Bay 10-north on 11 June 2014</p> <p>According to relevant site records, major construction activities conducted around the concerned location on 11 June 2014 include spraying of waterproofing membrane (integritank) from Ch1700 to Ch1705; screeding concrete placing from Ch1700 to Ch1683 and backfilling and removal of concrete blocks. Having reviewed the relevant information verified by RSS, the chemicals applied at the concerned area on 11 June 2014 are waterproof paint and paint adhesives.</p> <p>In view of the concern regarding odour nuisance raised by the public, it is considered desirable for the Contractor to review the application method for waterproof layer nearby public area to minimize the nuisance caused to the surroundings.</p>	<p>Preliminary report issued on 25 June 2014.</p> <p>Interim report submitted to EPD on 30 June 2014.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					Follow-up inspection was conducted during weekly environmental inspection on 26 June 2014, no further spraying works was conducted by the Contractor at the concerned area and no particular odour was observed at the concerned location.	
20140723	21 July 2014	ICC complaint (ICC Case Ref.: 2-341537112) received by ET on 23 July 2014	Area opposite to Ngan Tao Building	Noise nuisance due to works and machine at opposite project site during nighttime	<p>A public complaint regarding construction noise impact referred by RSS was received by ET on 25 July 2014 (ICC Case Ref.: 2-341537112 dated 21 July 2014). The complainant reported that :</p> <p>At 00:57hrs on 21 July 2014, he could not sleep due to work and machine at the project site opposite to the building (Ngan Tao Building), where he was living, were still going on and in operation. Noise traveled to his flat despite it was some distance away.</p> <p>ET confirmed with the Resident Site Staff that dewatering works was conducted under HY/2009/19 at the works area at Watson Road from around 23:00hrs on 20 July 2014 to 01:00hrs on 21 July 2014. Total 1 no. of generator and 23 nos. of dewatering pumps were in operation. Mobilization of telescopic arm excavator to trailer truck was performed under HY/2009/19 at the works area at Watson Road from around 00:15hrs to 01:00hrs on 21 July 2014. Total 1 no. of telescopic arm excavator and 1 no. of trailer truck were in operation.</p> <p>According to the relevant site records under Contract HY/2009/19, from around 23:00hrs on 20 July 2014 to 01:00hrs on 21 July 2014, dewatering works was conducted under HY/2009/19 at the works area at Watson Road. Total 1 no. of generator and 23 nos. of dewatering pump were in</p>	<p>Final Investigation report (Issue1) issued on 31 July 2014.</p> <p>Final investigation report (Issue 2) based on further follow-up issued on 12 Aug 2014.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>operation at the above period.</p> <p>In addition, mobilization of telescopic arm excavator to trailer truck was performed under HY/2009/19 at the works area at Watson Road from around 00:15hrs to 01:00hrs on 21 July 2014. Total 1 no. of telescopic arm excavator and 1 no. of trailer truck were in operation.</p> <p>After reviewing relevant records and information verified by RSS and the Construction Noise Permit (CNP) no. GW-RS0152-14, it was considered that the below condition of CNP no.GW-RS0152-14 was not fulfilled by the Contractor of HY/2009/19.</p> <p>From 00:15hrs to 01:00hrs on 21 July 2014, the PME(s) (1 no. of telescopic arm excavator and 1 no. of trailer truck) operated under the Contractor of HY/2009/19 on-site could not follow any given PME grouping requirement(s) as stated in condition 3.a. and condition 3.d. in no.GW-RS0152-14.</p> <p>Notwithstanding the above, according to the information provided by the RSS, the telescopic arm excavator was mobilized at night time hours with consideration that passage of vehicle with large plant & machinery through cross harbour tunnel shall be conducted after mid-night.</p> <p>the Contractor of HY/2009/19 was advised to review the need to renew relevant CNP for PME grouping with respect to specific site operation requirements such that the Construction Noise Permit would be followed. Furthermore, the Contractor of HY/2009/19 was suggested to review the arrangement for PME mobilization with maintenance need to be conducted within specific period allowed under the relevant CNP(s).</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
20140801	30 July 2014	ICC complaint (ICC Case Ref.: 2-360638977) received by ET on 01 August 2014	Area opposite to Harbour Heights	Noise of sand and gravel movements at area opposite to the Harbour Heights	<p>A public complaint regarding construction noise impact referred by RSS was received by ET on 01 Aug 2014 (ICC Case Ref.: 2-360638977 dated 31 July 2014). The complainant reported that at 01:20hrs on 30 July 2014, the complainant was woken up by the noise of sand and gravel movements at area opposite to the Harbour Heights.</p> <p>ET confirmed with the Resident Site Staff that EVB excavation was undertaken at the works area around Watson Road under HY/2009/19 before 23:00hrs on 29 July 2014. (Total 1 no. of excavator, 1 no. of dump truck, 23 nos. of underground dewatering pump and 3 nos. of generator were in operation).</p> <p>Dewatering works was undertaken at works area around Watson Road under HY/2009/19 from 23:00hrs on 29 July 2104 to 01:00 hrs on 30 July 2014. (Total 23 nos. of underground dewatering pumps and 1 no. of generator were in operation).</p> <p>Mobilization of PMEs was performed at works area around Watson Road under HY/2009/19 from 00:45hrs to 01:30hrs on 30 July 2014. (1 no. of excavation machine and 1 no. of dump truck were in operation). No other construction activity or operation was performed at the area opposite to Harbour Heights from 23:00hrs on 29 July 2014 to 01:00hrs on 30 July 2014 under HY/2009/19.</p> <p>According to the relevant site records, before 2300hrs on 29 July 2014, EVB excavation at the works area around Watson Road was conducted under HY/2009/19. (Total 1 no. of dump truck , 1 no. of excavator, 3 nos. of generators and 23 nos. of dewatering pumps were in operation at the</p>	Final investigation report issued on 12 Aug 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>above period).</p> <p>From around 23:00hrs on 29 July 2014 to 01:00hrs on 30 July 2014, dewatering works at works area around Watson Road was conducted under HY/2009/19. Total 23 nos. of dewatering pumps were operating at the above period.</p> <p>In addition, mobilization of PME(s) was performed at works area around Watson Road under HY/2009/19 from 00:45hrs to 01:30hrs on 30 July 2014. Total 1 no. of excavation machine and 1 no. of dump truck were in operation. After reviewing relevant records and information verified by RSS and the Construction Noise Permit (CNP) no. GW-RS0152-14, it was considered the below condition of CNP GW-RS0152-14 was not fulfilled by the Contractor of HY/2009/19. From around 00:45hrs to 01:30hrs on 30 July 2014, the operation of PME(s) (1 no. of excavator and 1 no. of dump truck) under the Contractor of HY/2009/19 on-site could not follow any given PME grouping requirement(s) as stated in condition 3.a. and condition 3.d. in no. GW-RS0152-14.</p> <p>Notwithstanding the above, according to the information provided by the RSS, the excavator and dump truck were mobilized away from the edge of the temporary ELS structure towards the area opposite to the Harbour Heights after 23:00hrs under safety consideration.</p> <p>The Contractor of HY/2009/19 was advised to review the arrangement and location for retaining and securing PME(s)/ plants to minimize the movements of PME or plants after completion of works such that the Construction Noise Permit would be followed.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
20140929	26 Sep 2014	ICC complaint (ICC Case Ref.: 2-466911619) received by ET on 29 September 2014	IEC flyover opposite to City Garden	Light originating from the flyover under Central-WanChai Bypass Project was emitted towards City Garden direction and caused light nuisance	<p>A public complaint regarding visual impact referred by RSS was received by ET on 29 September 2014 (ICC Case Ref.: 2-466911619 dated 26 September 2014)</p> <p>The complainant reported that on 26 September 2014 at around 00:50hrs, light originating from the flyover under Central-WanChai Bypass Project was emitted towards City Garden direction and caused light nuisance.</p> <p>ET confirmed with the Resident Site Staff that the light emission on 25 and 26 September 2014 at the concerned area was originated from the temporary lighting provided at the soffit of the permanent noise enclosure at the new Island Eastern Corridor (IEC) Eastbound which was necessary to provide sufficient illumination for the traffic operation on the new IEC Eastbound after the traffic diversion on 28 September 2014.</p> <p>According to the relevant information provided by RSS, the light emission on 25 and 26 September 2014 at the concerned location was originated from the temporary lighting provided at the soffit of the permanent noise enclosure at the new Island Eastern Corridor Eastbound.</p> <p>The lighting was necessary to provide sufficient illumination for the traffic operation on the new IEC Eastbound after traffic diversion on 28 September 2014. Nevertheless, in view of the public concern regarding light nuisance raised by the public, it is considered desirable for the Contractor to review the lighting arrangement and implement additional measures to minimize the nuisance caused to the surrounding receivers as far as practicable.</p>	Final Investigation report submitted on 9 October 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Follow-up inspection was conducted during weekly environmental inspection on 8 October 2014, additional measures including erection of green net and tarpaulin sheet were provided by the Contractor of HY/2009/19 at the concerned area as interim measure to minimize the nuisance caused to the surroundings. Further to the interim measure implemented by the Contractor of HY/2009/19, the Contractor of HY/2009/19 will replace the concerned temporary lighting with temporary lighting facing Victoria Harbour at the other side of the road to minimize the light nuisance to the surroundings.</p> <p>The Contractor of HY/2009/19 was suggested to review the lighting arrangement and implement additional measures to minimize the nuisance caused to the surroundings receivers as far as practicable.</p> <p>Additional measures including erection of green net and tarpaulin sheet were provided by the Contractor of HY/2009/19 at the concerned area as interim measure to minimize the nuisance caused to the surroundings and the Contractor of HY/2009/19 will replace the concerned temporary lighting with temporary lighting facing Victoria Harbour at the other side of the road to minimize the light nuisance to the surroundings.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
20141006	25,26 Sep 2014	ICC complaint (ICC Case Ref.: 2-469099657) received by ET on 06 October 2014	IEC flyover opposite to City Garden	Light originating from the flyover under Central-WanChai Bypass Project was emitted towards City Garden direction and caused light nuisance	<p>A public complaint regarding visual impact referred by RSS was received by ET on 6 October 2014 (ICC Case Ref.: 2-469099657 dated 26 September 2014). The complainant reported that on 25 September 2014 night and on 26 September 2014 at around 23:23 hrs, light originating from the flyover under Central-Wan Chai Bypass Project was emitted towards City Garden direction and caused light nuisance.</p> <p>ET confirmed with the Resident Site Staff that the light emission on 25 and 26 September 2014 at the concerned area was originated from the temporary lighting provided at the soffit of the permanent noise enclosure at the new Island Eastern Corridor (IEC) Eastbound which was necessary to provide sufficient illumination for the traffic operation on the new IEC Eastbound after the traffic diversion on 28 September 2014.</p> <p>According to the relevant information provided by RSS, the light emission on 25 and 26 September 2014 at the concerned location was originated from the temporary lighting provided at the soffit of the permanent noise enclosure at the new Island Eastern Corridor Eastbound.</p> <p>The lighting was necessary to provide sufficient illumination for the traffic operation on the new IEC Eastbound after traffic diversion on 28 September 2014. Nevertheless, in view of the public concern regarding light nuisance raised by the public, it is considered desirable for the Contractor to review the lighting arrangement and implement additional measures to minimize the nuisance caused to the surrounding receivers as far as practicable.</p>	Final Investigation report submitted on 9 October 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Follow-up inspection was conducted during weekly environmental inspection on 8 October 2014, additional measures including erection of green net and tarpaulin sheet were provided by the Contractor of HY/2009/19 at the concerned area as interim measure to minimize the nuisance caused to the surroundings. Further to the interim measure implemented by the Contractor of HY/2009/19, the Contractor of HY/2009/19 will replace the concerned temporary lighting with temporary lighting facing Victoria Harbour at the other side of the road to minimize the light nuisance to the surroundings.</p> <p>The Contractor of HY/2009/19 was suggested to review the lighting arrangement and implement additional measures to minimize the nuisance caused to the surroundings receivers as far as practicable.</p> <p>Additional measures including erection of green net and tarpaulin sheet were provided by the Contractor of HY/2009/19 at the concerned area as interim measure to minimize the nuisance caused to the surroundings and the Contractor of HY/2009/19 will replace the concerned temporary lighting with temporary lighting facing Victoria Harbour at the other side of the road to minimize the light nuisance to the surroundings.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
20141010	07 Oct 2014	ICC complaint (ICC Case Ref.: 2-487376144) received by ET on 10 October 2014	IEC flyover opposite to City Garden	Light originating from the flyover under Central-WanChai Bypass Project was emitted towards City Garden direction and caused light nuisance	<p>ET confirmed with the Resident Site Staff that temporary lighting was provided at the concerned area at the soffit of the permanent noise enclosure at the new Island Eastern Corridor (IEC) Eastbound which was necessary to provide sufficient illumination for the traffic operation on the new IEC Eastbound after the traffic diversion on 28 September 2014.</p> <p>Temporary lighting was provided at the concerned area at the soffit of the permanent noise enclosure at the new Island Eastern Corridor (IEC) Eastbound which was necessary to provide sufficient illumination for the traffic operation on the new IEC Eastbound after the traffic diversion on 28 September 2014. In view of the public concern regarding light nuisance raised by the public, it is considered desirable for the Contractor to review the lighting arrangement and implement additional measures to minimize the nuisance caused to the surrounding receivers as far as practicable.</p> <p>During weekly environmental inspection on 8 October 2014, additional measures including erection of green net and tarpaulin sheet were provided by the Contractor of HY/2009/19 at the concerned area as interim measure to minimize the nuisance caused to the surroundings. Further to the interim measure implemented, on 13 October 2014 the Contractor of HY/2009/19 have replaced the concerned temporary lighting with temporary lighting facing Victoria Harbour at the other side of the road to minimize the light nuisance to the surroundings.</p>	Final investigation report submitted on 14 Oct 2014.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>The Contractor of HY/2009/19 was suggested to review the lighting arrangement and implement additional measures to minimize the nuisance caused to the surroundings receivers as far as practicable.</p> <p>Additional measures including erection of green net and tarpaulin sheet were provided by the Contractor of HY/2009/19 at the concerned area as interim measure and on 13 October 2014 the Contractor of HY/2009/19 have replaced the concerned temporary lighting with temporary lighting facing Victoria Harbour at the other side of the road to minimize the light nuisance to the surroundings.</p>	
141016	14 Oct 2014	EPD complaint EPD Ref.:H05/RS/00 025795-14) received by ET on 16 October 2014	work site next to new Wan Chai Ferry Pier and opposite to Wan Chai Sports Ground.	Construction noise like piling works was heard on 14 October 2014 night until 23:45 hrs. It was suspected that the noise was emanated from the work site next to new Wan Chai Ferry Pier and opposite to Wan Chai Sports Ground.	<p>A public complaint regarding construction noise impact referred by EPD was received by ET on 16 October 2014 (EPD Ref.: EP860/E2/24 Annex IV dated 16 October 2014).</p> <p>The complainant reported that construction noise like piling works was heard on 14 October 2014 night until 23:45 hrs. It was suspected that the noise was emanated from the work site next to new Wan Chai Ferry Pier and opposite to Wan Chai Sports Ground.</p> <p>ET confirmed with the Resident Site Staff that From 19:00hrs to 23:00hrs on 14 October 2014, dredging works was conducted under Contractor of HK/2009/02 at WCR3 Area.</p> <p>Total one grab dredger was in operation. Mitigation measures including provision of steel sheeting screening to the power generation part of the grab dredger was implemented by the Contractor of HK/2009/02.</p>	<p>Updated interim investigation with supplementary information submitted to EPD on 17 November 2014.</p> <p>EPD advised no further comment on the updated interim report and case closed on 27 Nov 2014.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>From 23:00 hrs to 05:00 hrs, dredging works was conducted under Contractor of HK/2009/02 at WCR3 Area.</p> <p>Total one grab dredger was in operation. Mitigation measures including provision of steel sheeting screening to the power generation part of the grab dredger was implemented by the Contractor of HK/2009/02.</p> <p>From 23:00 hrs to 06:00hrs, panel replacement works was conducted under Contractor of HK/2009/02 at the Temporary Covered Walkway. Total one scissor platform and two hand held drills (battery) were in operation.</p> <p>From 23:00 hrs to 06:00hrs, trial pit works was conducted under Contractor of HK/2009/02 at Hung Hing Road. Total one crane lorry was in operation.</p> <p>According to the relevant site records under Contract HK/2009/02, from 19:00hrs to 23:00hrs on 14 October 2014, dredging works was conducted under Contractor of HK/2009/02 at WCR3 Area. Total one grab dredger was in operation. Mitigation measures including provision of steel sheeting screening to the power generation part of the grab dredger was implemented by the Contractor of HK/2009/02.</p> <p>From 23:00 hrs to 05:00 hrs, dredging works was conducted under Contractor of HK/2009/02 at WCR3 Area. Total one grab dredger was in operation. Mitigation measures including provision of steel sheeting screening to the power generation part of the grab dredger was implemented by the Contractor of HK/2009/02.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>From 23:00 hrs to 06:00hrs, panel replacement works was conducted under Contractor of HK/2009/02 at the Temporary Covered Walkway. Total one scissor platform and two hand held drills (battery) were in operation.</p> <p>From 23:00 hrs to 06:00hrs, trial pit works was conducted under Contractor of HK/2009/02 at Hung Hing Road. Total one crane lorry was in operation.</p> <p>In view of the above findings, no direct information associated with the noise concern was considered available.</p>	
20141108	07 Nov 2014	EPD complaint (EPD Ref.: H05/RS/00027 815-14) received by ET on 10 November 2014	Construction site at old Wan Chai Ferry Pier	Malodour of construction plant exhaust from the construction site at old Wan Chai Ferry Pier was scented that affecting the swimmers at Wan Chai Swimming Pool.	<p>A public complaint regarding odour concern referred by EPD was received by ET on 07 November 2014 (EPD Ref.: H05/RS/00027815-14 dated 10 November 2014).</p> <p>The complainant reported that Malodour of construction plant exhaust from the construction site at old Wan Chai Ferry Pier was scented that affecting the swimmers at Wan Chai Swimming Pool.</p> <p>ET confirmed with the Resident Site Staff that ELS works was conducted on 7 November 2014 during daytime at Portion 2 (Area oppsite to WanChai Swimming Pool).</p> <p>Total 3 nos. of excavators, 2 nos. of crawler cranes, 2 nos. of generator, 1 no. of crane lorry and 2 no. of dump trucks were operated.</p> <p>Demolition works was conducted on 7 November 2014 during daytime at West of old Wan Chai Ferry Pier.</p> <p>Total 2 nos. of excavators, 1 no. of derrick barge and 1 no. of tug boat were operated.</p>	<p>Interim investigation report submitted to EPD on 17 November 2014.</p> <p>EPD advised no comment on the interim report and case closed on 1 Dec 2014.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Dredging works was conducted on 7 November 2014 during daytime at WCR3 (East of old Wan Chai Ferry Pier)</p> <p>Total 1 no .of dredger, 1 no. of hopper and 1 no. of tug boat were operated.</p> <p>According to the relevant site records under Contract HK/2009/02, ELS works was conducted on 7 November 2014 during daytime at Portion 2 (Area oppsite to WanChai Swimming Pool). Total 3 nos. of excavators, 2 nos. of crawler cranes, 2 nos. of generator, 1 no. of crane lorry and 2 no. of dump trucks were operated. Demolition works was conducted on 7 November 2014 during daytime at West of old Wan Chai Ferry Pier. Total 2 nos. of excavators, 1 no. of derrick barge and 1 no. of tug boat were operated.</p> <p>Follow-up inspection was conducted during weekly environmental inspection on 13 November 2014, no dark smoke emission was observed from the PMEs operating on-site. The condition of chemical waste storage was considered satisfactory and no malodour was identified. Despite no information related to malodour was identified, the Contractor was reminded to conduct regular checking on the condition of PMEs to ensure only well maintained PMEs are used on site.</p> <p>Based on the relevant information provided by RSS, despite no information associated with the malodour concern was identified after investigation, the Contractor was reminded to conduct regular checking on the condition of PME used on site to ensure only well maintained PME are used on site</p> <p>The interim report would be submitted to EPD on 17 November 2014.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
20141113	12 Nov 2014	EPD complaint (EPD Ref.: H05/RS/00028 253-14) received by ET on 13 November 2014	Construction site at old Wan Chai Ferry Pier	Malodour and dark smoke emission from an excavator located at the construction site at old Wan Chai Ferry Pier was observed that affecting the pedestrians.	<p>A public complaint regarding odour concern referred by EPD was received by ET on 13 November 2014 (EPD Ref.: H05/RS/00028253-14 dated 13 November 2014). The complainant reported that Malodour and dark smoke emission from an excavator located at the construction site at old Wan Chai Ferry Pier was observed that affecting the pedestrians. (Contract HK/2009/02)</p> <p>ET confirmed with the Resident Site Staff that demolition works was conducted under Contract HK/2009/02 on 12 November 2014 during daytime at old Wan Chai Ferry Pier. Total 2 nos. of excavators, 1 no. of derrick barge and 1 no. tug boat were operated.</p> <p>According to the relevant site records under Contract HK/2009/02, demolition works was conducted on 12 November 2014 during daytime at old Wan Chai Ferry Pier. Total 2 nos. of excavators, 1 no. of derrick barge and 1 no. tug boat were operated.</p> <p>In addition, investigation found that due to malfunctioning of one of the excavators deployed at old Wan Chai Ferry Pier, dark smoke was emitted from the defective excavator for a short period of approximately 30 seconds at around 15:00 hrs on 12 November 2014. The operation of excavator was immediately suspended and followed by repair works. The normal operation of the excavator was resumed after repair.</p> <p>Follow-up inspection was conducted during weekly environmental inspection on 13 November 2014, no dark smoke emission was observed from the PMEs operating on-site and the Contractor of HK/2009/02 was reminded to conduct regular checking on the condition of PMEs to ensure only well maintained PMEs are used on site.</p>	<p>Interim investigation report submitted to EPD on 19 November 2014.</p> <p>EPD advised no comment on the interim report and case closed on 8 Dec 2014.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
20150127	21 Jan 2015	EPD complaint (EPD Ref.: H05/RS/00001725-15) received by ET on 27 January 2015 and further information from EPD regarding the updated location under complaint was received by ET on 30 January 2015	A portion of Hung Hing Road immediately to the east of Marsh Road near SPCA	Construction dust and grit was emitted from the construction site to the carriageway causing nuisance to the public.	<p>A public complaint regarding air quality impact referred by EPD was received by ET on 27 January 2015 (EPD Case Ref.: H05/RS/00001725-15 dated 27 January 2015) and further information from EPD regarding the updated location under complaint was received by ET on 30 January 2015. The complainant reported that construction dust and grit was emitted from the construction site to the carriageway causing nuisance to the public.</p> <p>ET confirmed with the Resident Site Staff that the major construction activities around the concerned location conducted on 21 January 2015 include breaking of seawall blocks and D-wall at TPCWAW; concreting, grouting and drilling works at TPCWAW;reclamation/ backfilling works at TPCWAW</p> <p>Mitigation measures implemented by the Contractor for the above construction works include spraying haul road with water; covering bagged cement with tarpaulin; providing three sided and top covering for grouting stations; providing water spraying to dusty activities such as breaking works</p> <p>According to the relevant site records, breaking of seawall blocks and D-wall, concreting, grouting and drilling works and reclamation/ backfilling works were conducted at TPCWAW. Dust mitigation measures including spraying haul road with water, covering bagged cement with tarpaulin, providing three sided and top covering for grouting stations and water spraying to dusty activities such as breaking works were implemented by the Contractor of HY/2009/15 near the concerned location on 21 January 2015.</p>	Interim report submitted to EPD on 9 February 2015, EPD advised no comment on 27 February 2015 on the interim report submitted and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Follow-up investigation was conducted on 27 January 2015 during weekly environmental inspection, dust mitigation measures including water spraying for dusty haul road and major dust generation works; and provision of three sides and top covering for grouting station were confirmed in place.</p> <p>In addition, based on the review of the monitoring data of the monitoring station located at the concerned location raised by the complainant, namely monitoring station CMA3a , no action or limit level exceedance was recorded during air quality monitoring conducted on 20 and 21 January 2015. Nevertheless, the Air Quality Health Index (AQHI) recorded by EPD across Western District and Eastern District on the complaint date was ranged from 4 to 10+ indicating a severely high concentration of ambient air pollutants.</p> <p>As such, the site condition under Contract HY/2009/15 at the concerned location was considered to be generally satisfactory and no non-conformity related to cumulative air quality impact was observed. Nevertheless, in view of the public concern, the contractor was reminded to enhance the dust mitigation measures implemented to minimize potential nuisance to nearby public.</p> <p>ET confirmed with the Resident Site Staff that the major construction activities under Contract HK/2009/02 around the concerned location conducted on 21 January 2015 include trenching grabbing for D-wall construction at temporary road eastward, shear pin installation at temporary road westward and ground Investigation drilling at temporary road westward</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Mitigation measures implemented by the Contractor of HK/2009/02 for the above construction works include regular water spraying at haul road, vehicle wheel-washing at the ingress/egress (Gate No. 4) to the temporary road, hard paving at the works area at temporary road northward and frequent water spraying at the ingress/egress (Gate No. 4) to the temporary road. According to the relevant site records, trenching grabbing for D-wall construction, shear pin installation and ground investigation drilling works were conducted at the concerned location. Dust mitigation measures including water spraying for haul road, vehicle wheel washing and hard paving for a section of works area nearby public road were implemented by the Contractor of HK/2009/02 near the concerned location on 21 January 2015.</p> <p>Follow-up investigation was conducted on 5 February 2015 during weekly environmental inspection, dust mitigation measures including water spraying for dusty haul road and major dust generation works and provision of wheel washing combine with cleaning of public road were confirmed in place and no dust related impact from the construction works was observed. The Air Quality Health Index (AQHI) recorded by EPD across Western District and Eastern District on 21 January 2015 was ranged from 4 to 10+ indicating a severely high concentration of ambient air pollutants. Based on reviewing relevant impact monitoring data, elevated TSP were recorded at monitoring stations across Wan Chai West area to North Point area and a non-Project related exceedance was recorded at nearby monitoring station CMA4a (at SPCA) on 21 January 2015 due to ambient air pollutant.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>In addition, it was noted that a section of the works area at the concerned location was not provided with site hoarding. Based on further review on relevant records it was noted that the works area at concerned section was either hard paved or have to maintain adequate line of sight due to traffic safety consideration. The Contractor of HK/2009/02 was advised to inform EPD with respect to the site constraint and provide relevant updated meeting records on the arrangement for review.</p> <p>In view of the public concern, the contractor has committed to conduct additional cleaning of the concerned public road section once a week to minimize potential nuisance caused to nearby road users. The contractor was also reminded to enhance the dust mitigation measures implemented to minimize potential nuisance to nearby public.</p>	
20150409	07 April 2015 09 April 2015	EPD complaint (Ref.:H05/RS/00008074-15 dated 9 April 2015) received by ET on 09 April 2015	Construction site exit near Expo Drive Central; Construction site gate V2 & gate V8	Construction dust was generated from lorries transporting out of the construction via site exit without wheel washing	<p>A public complaint regarding construction dust impact referred by EPD was received by ET on 09 April 2015 (EPD Ref.:H05/RS/00008074-15 dated 9 April 2015). The complainant reported that: Construction dust was generated from lorries transporting out of the construction via site exit near Expo Drive Central without wheel washing at the morning of 7 April 2015. Lorries were also found transporting out of the construction site via gates V2 and V8 without wheel washing and causing dust nuisance at about 10:30 hours on 9 April 2015.</p> <p>ET confirmed with the Resident Site Staff that on 7 April 2015, major vehicle movements included oil tanker passing at Gate V2 at Expo Drive East and dump truck passing at Gate V8 at Expo Drive Central under Contract HK/2009/01.</p>	Interim report submitted to EPD on 17 April 2015, EPD advised no comment on 30 April 2015 on the interim report submitted and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>2. On 9 April 2015, major vehicle movements include oil tanker, crane lorry and dump truck passing at at Gate V2 at Expo Drive East and dump truck at Gate V8 at Expo Drive Central under Contract HK/2009/01.</p> <p>Mitigation measures adopted by the Contractor of HK/2009/01 at the above locations include water hose was provided for wheel washing at Gate V2 and Gate V8, concrete paving at site exit, dump truck fitted with mechanic cover and cleaned before leaving construction site, regular street washing at Expo Drive Central.</p> <p>According to the relevant site records under Contract HK/2009/01, on 7 April 2015, major vehicle movements included oil tanker passing at Gate V2 at Expo Drive East and dump truck passing at Gate V8 at Expo Drive Central under Contract HK/2009/01 while on 9 April 2015 major vehicle movements include oil tanker, crane lorry and dump truck passing at at Gate V2 at Expo Drive East and dump truck at Gate V8 at Expo Drive Central under Contract HK/2009/01.</p> <p>At the above locations, mitigation measures including water hose for wheel washing at Gate V2 and Gate V8; concrete paving at site exit; dump truck fitted with mechanic cover and cleaned before leaving construction site and regular street washing at Expo Drive Central were generally adopted by the Contractor of HK/2009/01.</p> <p>In view of the public concern on the complaint date, the Contractor of HK/2009/01 was advised to conduct cleaning at the concerned site exit point and the section of public road adjoining the site exit to clear any residue grit and silt desposit to avoid further dust impact.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Follow up inspection was conducted on 16 April 2015 during weekly environmental inspection and mitigation measures including water spraying for dusty haul road and provision of wheel washing were in place. The construction site exit was observed clear from residue silt / grit at the concerned location.</p> <p>In view of the public concern, the contractor was advised to conduct training to the construction site workers to enhance the effectiveness of wheel washing and to ensure proper wheel washing is provided for dump truck and other vehicle prior to leaving the construction site to avoid generating any dust nuisance.</p>	
20150409A	03 April 2015 to 07 April 2015	EPD complaint (Ref.:H05/RS/00007861-15 dated 9 April 2015) received by ET on 09 April 2015	Construction site at Convention Avenue near Renaissance Harbour View Hotel	Construction noise was emanated from the construction site at Convention Avenue near Renaissance Harbour View Hotel during the period of Easter Holiday	<p>A public complaint regarding construction noise impact referred by EPD was received by ET on 09 April 2015 (EPD Ref.:H05/RS/00007861-15 dated 9 April 2015). The complainant reported that construction noise was emanated from the construction site at Convention Avenue near Renaissance Harbour View Hotel during the period of Easter Holiday, including April 3 at about 13:00 hours.</p> <p>ET confirmed with the Resident Site Staff that from 3 April 2015 to 7 April 2015, from 08:00 hours to 18:00 hours, and at about 13:00 hours on 3 April 2015 at area CWB Tunnel Stage 3, backfilling works was conducted under HK/2009/01. Either 1 no. of dump truck and 1. no. of excavator was operated on site at each given time during the concerned period.</p> <p>According to the relevant site records under Contract HK/2009/01, from across 08:00hrs to 18:00hrs during the period from 3 April 2015 to 7 April 2015, backfilling works was conducted under Contract HK/2009/01 at CWB Tunnel Stage 3. Either 1 no. of dump truck and 1 no. of excavator was operated on site at each given time during the</p>	Interim report submitted to EPD on 17 April 2015, EPD advised no comment on 30 April 2015 on the interim report submitted and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>concerned period and the relevant Construction Noise Permit GW-RS0104-15 for the works was in place and the same construction activity was undertaken at around 13:00hrs on 3 April 2015. No other concurrent construction activity was undertaken at the concerned location during the concerned period under Contract HK/2009/01. The construction activity conducted under Contract HK/2009/01 during the concerned period was in compliance with the statutory requirement.</p> <p>Nevertheless, in view of the concern regarding the noise nuisance raised by the public at the concerned location, it is considered desirable for the Contractor of HK/2009/01 to review the truck unloading procedures of the specific construction task to minimize potential noise emanated during the course for work.</p>	
20150415	13 April 2015	ICC complaint case (ICC Case Ref.: 2-885677297 dated 13 April 2015) received by ET on 15 April 2015	Construction Site at Causeway Bay Typhoon Bay Shelter	Unnecessary light nuisance from the construction site	<p>A public complaint regarding visual impact received by the RSS was referred to the ET on 15 April 2015 (ICC Case Ref.: 2-885677297 dated 13 April 2015). The complainant reported that " I live in a building next to Gloucester Road in Causeway Bay. Recently, I am suffering from unnecessary light source from the construction site. The banners of the construction companies are always illuminated with very bright lights."</p> <p>ET confirmed with the Resident Site Staff that the concerned lighting for the banners was maintained under Contract HY/2010/08.</p> <p>The concerned lighting for the banners was maintained under Contract HY/2010/08 and the concerned lighting was subsequently switched off at all times since 13 April 2015 to alleviate the lighting nuisance caused to the surroundings.</p>	Final Investigation report issued on 20 April 2015 and case closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
20150423	21 April 2015	EPD complaint case (EPD Case Ref: :H05/RS/00009456-15 dated 23 April 2015) received by ET on 23 April 2015	Road work at Fleming Road and Convention Avenue near Renaissance Harbour View Hotel	Construction noise emanated from the road work at Fleming Road and Convention Avenue near Renaissance Harbour View Hotel causing nuisance	<p>A public complaint regarding construction noise impact referred by EPD was received by ET on 23 April 2015 (EPD Ref.:H05/RS/00009456-15 dated 23 April 2015). The complainant reported that construction noise emanated from the road work at Fleming Road and Convention Avenue near Renaissance Harbour View Hotel almost every night recently causing nuisance.</p> <p>ET confirmed with the Resident Site Staff that from 21:00hrs on 20 April 2015 to 06:00hrs on 21 April 2015 and from 21:00hrs on 21 April 2015 to 06:00hrs on 22 April 2015, cooling main connection works was undertaken by the Contractor of Contract HK/2009/01 at the concerned location. Total 1 no. of crane lorry and 1 no. of excavator were in operation.</p> <p>According to the relevant site records under Contract HK/2009/01, from 21:00hrs on 20 April 2015 to 06:00hrs on 21 April 2015 and from 21:00hrs on 21 April 2015 to 06:00hrs on 22 April 2015, cooling main connection works was undertaken by the Contractor of Contract HK/2009/01 at the concerned location. Total 1 no. of crane lorry and 1 no. of excavator were in operation during the concerned period and the relevant Construction Noise Permit GW-RS0269-15 was confirmed in place. The construction activity conducted under Contract HK/2009/01 during the concerned period was in compliance with the statutory requirement. In view of the potential noise nuisance, a notice to affected parties was issued by the Contractor of Contract HK/2009/01 to the nearby residents including Renaissance Harbour View Hotel on 17 April 2015. Besides, construction works undertaken by other parties at the concerned location was observed at the concerned period.</p>	Final Investigation report issued on 18 May 2015 and case closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
20150601	29 May 2015	EPD complaint case (EPD Case Ref: :H05/RS/00013254-15 dated 1 June 2015) received by ET on 23 April 2015	Construction site gates V2 and V3 near Expo Drive Central	Vehicle with plate no. TG2426 was found leaving the construction site at gate V2 near Expo Drive Central without wheel-washed	<p>A public complaint regarding construction dust impact referred by EPD was received by ET on 01 June 2015 (EPD Ref.:H05/RS/00013254-15 dated 1 June 2015). The complainant reported that vehicle with plate no. TG2426 was found leaving the construction site at gate V2 near Expo Drive Central without wheel-washed at about 10:33hrs on 29 May 2015. The complainant also alleged that water spraying at the gates V2 and V3 near Expo Drive Central was insufficient causing dust nuisance to the public.</p> <p>ET confirmed with the Resident Site Staff that on 29 May 2015, vehicle record indicated that concerned vehicle TG 2426 has entered and exited the construction site via gate V3.</p> <p>Mitigation measures adopted by the Contractor of HK/2009/01 at the above locations include, water hose was provided for wheel washing at Gate V2 and Gate V3.</p> <p>According to the relevant site records under Contract HK/2009/01, vehicle record indicated that concerned vehicle TG 2426 has entered and exited the construction site via gate V3 on 29 May 2015 under Contract HK/2009/01. As confirmed by WDII RSS, the concerned construction site Gate V2 and Gate V3 have been closed from 31 May 2015 and formed part of the construction site area.</p> <p>Follow up inspection was conducted on 3 June 2015 during weekly environmental inspection and mitigation measures including wheel washing were implemented at construction exit gates around the concerned location despite a vehicle was observed leaving the construction site via Gate V8 without wheel washing. The Contractor was immediately advised to review and strengthen the control measures for vehicle exits to ensure wheel washing are provided for exiting vehicles.</p>	Interim report submitted to EPD on 08 June 2015, EPD advised no comment on 22 June 2015 on the interim report submitted and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					In view of the public concern and the site observation, the Contractor of HK/2009/01 has implemented enhanced site exit control measures using red string to alert drivers to stop their vehicles for cleaning before leaving the construction site and wheel washing facilities including water hose were implemented at Gate V1 and Gate V10 around the concerned location and the vehicle gate V8 was subsequently closed. In addition, removal of spoil arising from wheel washing around site exit location would be conducted by the Contractor of HK/2009/01 as appropriate to alleviate for potential dust impact at construction site exits.	
20150608	04 June 2015	EPD Ref.:H05/RS/00013843-15 dated 8 June 2015	A portion of construction site of Contract HK/2012/08 outside Fleet Arcade	Construction noise was generated from the construction site of Contract HK/2012/08 at location outside Fleet Arcade during restricted hours including Sundays and General Holidays.	<p>A public complaint regarding construction noise impact referred by EPD was received by ET on 8 June 2015 (EPD Ref.:H05/RS/00013843-15 dated 8 June 2015). The complainant reported that construction noise was generated from the construction site of Contract HK/2012/08 at location outside Fleet Arcade during restricted hours including Sundays and General Holidays.</p> <p>ET confirmed with the Resident Site Staff that from 08:00hrs to 18:00hrs on 31 May 2015 (Sunday), construction work including steel welding was conducted under Contract HK/2012/08 at site portion zone A1 opposite to Fleet Arcade. Total one welding machine was in operation.</p> <p>According to the relevant site records under Contract HK/2012/08, from 08:00hrs to 18:00hrs on 31 May 2015 (Sunday), construction work including steel welding was conducted under Contract HK/2012/08 site portion zone A1 opposite to Fleet Arcade. Total one welding machine was in operation and the relevant Construction Noise Permit GW-RS0296-15 was confirmed in place. The construction activity conducted under Contract</p>	Interim report submitted to EPD on 16 June 2015 and EPD advised no comment on 20 July 2015 on the interim report submitted and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>HK/2012/08 during the concerned period was in compliance with the statutory requirement. Ad-hoc inspection was conducted during weekly environmental inspection on 9 June 2015 and it was noted that Construction Noise Permits under Contract HK/2012/08 were posted at site entrance locations for public inspection.</p> <p>In view of the potential noise nuisance, the Contractor was reminded to upkeep the site control system for construction works carrying out at restricted hours and night time for Construction Noise Permit compliance. Besides, other construction sites at the concerned location were observed.</p> <p>Furthermore, a meeting was held on 15 June 2015 between the EPD, Contractor of HK/2012/08, WDII RSS team and the Environmental Team on the public concern and the Contractor of HK/2012/08 has committed to review the re-application for the Construction Noise Permits GW-RS0223-15 and GW-RS0296-15 on usage of PMEs at a portion of site area outside the Fleet Arcade during public holiday including Sundays to minimize for the potential noise nuisance to nearby public.</p>	
150622	18 June 2015	EPD Ref.:H05/RS/00015054-15 dated 22 June 2015	A mooring location near shore and at location outside Wan Chai Sports Ground	Dark smoke and malodour emission was observed from a hopper barge moored near shore and other construction plants under operation from the reclamation construction site	A public complaint regarding dark smoke and malodour concern referred by EPD was received by ET on 22 June 2015 (EPD Ref.: H05/RS/00015054-15 dated 22 June 2015). The complainant reported that dark smoke and malodour emission was observed from a hopper barge moored near shore and other construction plants under operation from the reclamation construction site with Contract no. HK/2009/02 at location outside Wan Chai Sports Ground caused air pollution. The complainant alleged that the said situation had been observed for a prolonged period.	Interim report submitted to EPD on 29 June 2015 and EPD advised no comment on 20 July 2015 on the interim report submitted and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>ET confirmed with the Resident Site Staff that reinforced bar fixing and concreting work (on 17 June 2015 only) were conducted at Portion 2 from 15 June 2015 to 19 June 2015. Total 3 nos. of mobile crane were in operation. On 17 June 2015, one no. of concrete pump truck and two nos. of concrete mixer were in operation. Excavation and Lateral Support was conducted at Portions 3 & 4 from 15 June 2015 to 19 June 2015. Total 4 nos. of excavator, 2 nos. of truck and 2 nos. of crawler crane were in operation. In addition, on 15 June 2015, 17 June 2015 and 19 June 2015, 1 no. of derrick barge was moored near Portions 3 & 4 for transportation of the excavated material away from site.</p> <p>According to the relevant site records under Contract HK/2009/02, from 15 June 2015 to 19 June 2015, reinforced bar fixing and concreting work (on 17 June 2015 only) were conducted at Portion 2 and total 3 nos. of mobile crane, one no. of concrete pump truck (on 17 June 2015 only) and two nos. of concrete mixer (on 17 June 2015 only) were in operation; excavation and lateral support was conducted at Portions 3 & 4 and total 4 nos. of excavator, 2 nos. of truck and 2 nos. of crawler crane were in operation. Based on relevant site record, no hopper barge was moored under Contract HK/2009/02 around the concerned location while 1 no. of derrick barge was moored under Contract HK/2009/02 near Portions 3 & 4 for transportation of the excavated material from Portions 3 & 4 away from site on 15 June 2015, 17 June 2015 and 19 June 2015 respectively.</p> <p>Follow-up inspection was conducted during weekly environmental inspection on 25 June 2015, no dark smoke and malodour emission was observed from the PMEs operating on-site. A derrick barge was</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					observed moored near Portions 3 & 4 and excavated material was transferred to the derrick barge by the excavators on land without barge operation and no particular dark smoke and malodour emission was observed. Nevertheless, the Contractor was reminded to conduct regular checking on the condition of the derrick barge and other PMEs deployed on site to ensure only well maintained PMEs are used to avoid potential dark smoke and maldour emission affecting nearby public.	
150714	11 July 2015	ICC Complaint (Ref:#2-1149562777) referred by RSS was received by ET on 14 July 2015	A portion of site area adjacent to Hing Fat Street Site entrance	Direct discharge of muddy effluent into marine waters	<p>A public complaint regarding direct discharge of muddy effluent referred by RSS was received by ET on 14 July 2015 (ICC Ref.: #2-1149562777). The complainant reported that:</p> <p>Muddy effluent was directly discharged into nearby marine waters by Chun Wo worker. Further information was received by ET from RSS on 23 July 2015 and the complaint date was clarified to be 11 July 2015 and the concerned vehicle registration number shall be JV 7319.</p> <p>ET confirmed with the Resident Site Staff that no construction works was undertaken by the Contractors HY/2009/19 and adjacent Central WanChai Bypass Project construction site at the concerned location on 11 July 2015.</p> <p>No construction works was undertaken by the Contractor of HY/2009/19 and adjacent Central WanChai Bypass Project construction site at the concerned location on 11 July 2015 and the concerned vehicle (License Plate JV 7319 labelled as Chun Wo) was confirmed not belonging to the Contractor of HY/2009/19.</p> <p>Follow-up inspection was conducted during weekly environmental inspection on 14 July 2015, no direct discharge connection was further observed on site.</p>	Updated Final investigation report submitted on 27 July 2015.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>No construction works was undertaken by Central WanChai Bypass Project at the concerned location and no sump pit or works area under Central WanChai Bypass Project associated with potential muddy effluent discharge was identified. In addition, a construction area with excavated pit under WSD Contract 12/WSD/10 was noted at the concerned location behind the alleged vehicle responsible for direct discharge of muddy effluent.</p> <p>Based on the further review on the information received on 23 July 2015, the alleged direct discharge was observed originating from the works area under WSD Contract 12/WSD/10 and not related to the Central Wan Chai Bypass Project construction works.</p>	
150723	20 July 2015	EPD Ref.:H05/RS/0018040-15 dated 23 July 2015	Ex-Wanchai Ferry Pier near 720 & 722 Bus stop	Malodour from marine sediment	<p>A public complaint regarding malodour referred by EPD was received by ET on 23 July 2015 (EPD Ref.: H05/RS/00018040-15 dated 23 July 2015).</p> <p>The complainant reported that malodour from marine sediment was scented at ex-Wanchai ferry pier near route 720 & 722 bus stop. (Contract HK/2009/02).</p> <p>ET confirmed with the Resident Site Staff that Rockfill placing works was conducted by one derrick barge at the concerned location (WCR3) under Contract HK/2009/02 on 20 July 2015. No marine sediment was stored or placed on site at the concerned location under Contract HK/2009/02 on 20 July 2015.</p> <p>According to the relevant site records under Contract HK/2009/02, rockfill placing works was conducted by one derrick barge at WCR3 area on 20 July 2015 and no marine sediment was stored or placed on site at the concerned location on the concerned date.</p>	Interim report submitted to EPD on 30 July 2015. EPD advised no comment on 17 August 2015 on the interim report submitted and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Follow-up inspection was conducted during weekly environmental inspection on 29 July 2015. No marine sediment was observed stored or placed at the concerned location while it was noted that a culvert outfall with potential odour concern is located adjacent to the concerned location.</p> <p>Nevertheless, the Contractor was reminded to review the handling procedures in case of any future marine sediment handling at the concerned location and to consider the implementation of mitigation measures as appropriate to minimize potential malodour impact to nearby public.</p>	
150904	01 Sept 2015	EPD Ref.: H05/RS/0002 2241-15 dated 04 September 2015 received by ET on 4 September 2015	East of New WanChai Ferry Pier	Dropping of excavated material from land to sea during loading of material	<p>A public complaint regarding dropping of excavated material from land to sea referred by EPD was received by ET on 04 September 2015 (EPD Ref.: H05/RS/00022241-15 dated 04 September 2015). The complainant reported that dropping of excavated materials from land to sea during loading of materials by excavator at the construction site to work boat. (Contract HK/2009/02)</p> <p>ET confirmed with the Resident Site Staff that transferring of C&D materials from land to hopper barge by excavator at seaside along CWB Tunnel Portions 3 and 4 was undertaken by Contract HK/2009/02 on 01 September 2015.</p> <p>Mitigation measure including providing tarpaulin sheet to cover the gap between seawall and the hopper barge to prevent dropping of material to the sea was implemented by the Contractor.</p> <p>According to the relevant site records under Contract HK/2009/02, transferring of C&D materials from land to hopper barge by excavator at seaside along CWB Tunnel Portions 3 and 4 was carried out on 01 September 2015 and mitigation measures including provision of tarpaulin sheet between</p>	Interim report submitted to EPD on 14 September 2015. EPD advised no comment on 5 October 2015 on the interim report submitted and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>seawall and the hopper barge was implemented by the Contractor of HK/2009/02 on the concerned date. Follow-up inspection was conducted during weekly environmental inspection on 10 September 2015. Transferring of C&D materials from land to barge by excavator was observed at the concerned location and mitigation measures including provision of tarpaulin sheet between seawall and hopper barge and the material transfer works was generally in order. Nevertheless, the Contractor of HK/2009/02 was reminded to maintain the handling procedure for C&D materials transfer from land to hopper barge and regularly inspect the condition of the tarpaulin sheet provided to ensure the nearby water quality are not affected by the loading and unloading of material from land side to hopper barge.</p> <p>The Contractor was reminded to maintain the handling procedure for C&D materials transfer from land to hopper barge and regularly inspect the condition of the tarpaulin sheet provided to ensure the nearby water quality are not affected by the loading and unloading of material from land side to hopper barge.</p>	
150904	02 Sept 2015	EPD Ref.: H04/RS/0002 2385-15 dated 04 September 2015 received by ET on 04 September 2015	Location outside Fleet Arcade	Construction noise was generated from the construction site of HK/2012/08 at location outside Fleet Arcade during night time on weekdays and daytime during General Holidays. The complainant also concerned construction dust and exhaust emission from derrick barges during	A public complaint regarding construction noise and dust and exhaust emission referred by EPD was received by ET on 04 September 2015 (EPD Ref.: H04/RS/00022385-15 dated 04 September 2015). The complainant reported that construction noise was generated from the construction site of HK/2012/08 at location outside Fleet Arcade during night time on weekdays and daytime during General Holidays. The complainant also concerned construction dust and exhaust emission from derrick barges during transporting C&D material at the site. (Contract HK/2012/08)	Interim report submitted to EPD on 14 September 2015. 2 nd interim report submitted to EPD on 17 Dec 2015



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
				transporting C&D material at the site.	<p>ET confirmed with the Resident Site Staff that from 0800 hrs to 1800 hrs on 30 August 2015, removal of scaffold and timber and installation of bulkhead was undertaken by the Contractor of HK/2012/08 at the concerned location. Total one generator and one circular saw were in operation.</p> <p>From 1900hrs on 30 August 2015 to 0700 on 31 August 2015, no construction works was undertaken by the Contractor of HK/2012/08 at the concerned location.</p> <p>From 1900hrs on 31 August 2015 to 0700hrs on 01 September 2015, no construction works was undertaken by the Contractor of HK/2012/08 at the concerned location.</p> <p>From 1900hrs to 2115 hrs on 01 September 2015, unloading of soil was undertaken by the Contractor of HK/2012/08 at the concerned location.</p> <p>Total one derrick barge was in operation.</p> <p>From 2300hrs on 01 September 2015 to 0700hrs on 02 September 2015, no construction works was undertaken by the Contractor of HK/2012/08 at the concerned location.</p> <p>One derrick barge was deployed for unloading of soil on 02 September 2015 during daytime under Contract HK/2012/08 at the concerned location.</p> <p>Based on the relevant site records, from 0800 hrs to 1800 hrs on 30 August 2015, removal of scaffold</p>	3 rd interim report submitted to EPD on 31 Dec 2015



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>and timber and installation of bulkhead was undertaken by the Contractor of HK/2012/08 at the concerned location. Total one generator and one circular saw were in operation and the relevant Construction Noise Permit GW-RS0296-15 for the concerned operation was confirmed in place.</p> <p>From 1900hrs on 30 August 2015 to 0700 on 31 August 2015, no construction works was undertaken by the Contractor of HK/2012/08 at the concerned location and from 1900hrs on 31 August 2015 to 0700hrs on 01 September 2015, no construction works was undertaken by the Contractor of HK/2012/08 at the concerned location.</p> <p>From 1900hrs to 2115 hrs on 01 September 2015, unloading of soil was undertaken by the Contractor of HK/2012/08 at the concerned location. Total one derrick barge was in operation and the Construction Noise Permit GW-RS0296-15 for the concerned operation was confirmed in place.</p> <p>From 2300hrs on 01 September 2015 to 0700hrs on 02 September 2015, no construction works was undertaken by the Contractor of HK/2012/08 at the concerned location. In view of the above, the construction activities conducted under Contract HK/2012/08 during the concerned period was in compliance with the statutory requirement.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>In addition, one derrick barge was deployed for unloading of soil on 02 September 2015 during daytime under Contract HK/2012/08 at the concerned location. Follow-up inspection was conducted during weekly environmental inspection on 08 September 2015 and no dark smoke emission was observed from the derrick barge moored outside the concerned location. Nevertheless, the Contractor of HK/2012/08 was reminded to conduct regular checking on the condition of the all derrick barges deployed on site to ensure only well maintained equipment are used to avoid potential dark smoke emission affecting nearby public and the Contractor of HK/2012/08 was reminded to upkeep the site control system for construction works carrying out at restricted hours and night time for Construction Noise Permit compliance.</p> <p>The Contractor was reminded to conduct regular checking on the condition of derrick barges deployed on site to ensure only well maintained equipments are used on site to avoid potential dark smoke emission affecting nearby public.</p> <p>The Contractor of HK/2012/08 was reminded to upkeep the site control system for construction works carrying out at restricted hours and night time for Construction Noise Permit compliance.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
151117	Not specified	EPD complaint received by ET on 17 Novmeber 2015	Causeway Bay Typhoon Shelter	Improper handling or bentonite and marine sediment generated from construction works and contaminated discharge from water treatment plant into Victoria Harbour	<p>A public complaint regarding illegal disposal of construction waste referred by EPD was received by ET on 17 November 2015. The complainant reported that over 10,000 m3 of bentonite after usage for construction of diaphragm wall was disposed of at Victoria Harbour.</p> <p>The Contractor recently deployed mobile crane to transfer the bentonite from mud pit on to works barge. The bentonite was then mixed with soil and transported to the Public Fill. During the course, seepage of slurry through grab generated drop off to marine waters and the soil mixing generated dust impact to nearby yacht club, typhoon shelter and affect nearby public and boats.</p> <p>Disposal of dredged marine sediment was not carried out in accordance with the Management of Dredged/Excavated Sediment. Instead the marine sediment was covered by sand and soil and transported to the Public Fill.</p> <p>White or greyish effluent was discharged directly into Victoria Harbour marine waters from wastewater treatment plant on construction site.</p> <p>In response to the complaint concern, additional water quality monitoring from end November 2015 to mid January 2016 until the post-diaphragm wall construction activities and all bentonite silos and residue bentonite slurry at TS3 were completely removed had been undertaken by the Environmental Team and additional site inspections</p>	<p>Interim investigation report submitted to EPD on 24 November 2015.</p> <p>2nd interim investigation report submitted to EPD on 17 December 2015.</p> <p>3rd interim investigation report submitted to EPD on 31 December 2015.</p> <p>Final investigation report submitted on 5 February 2016.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>have been conducted by the ET and the investigation findings were included in the interim investigation reports separately submitted to the EPD. In addition, the ET and IEC have conducted checking on the waste disposal records and site construction records with the CWB RSS team to confirm the key construction activities during the concerned period and the quantities of inert C&D material disposed.</p> <p>Specific enhancement on site supervision was undertake by the CWB RSS team to ensure the properly handling of the remaining bentonite slurry in terms of the following: Depth of the bentonite slurry at the primary mixing pit (at south of TS3) was recorded by RSS team daily at regular intervals starting from 22nd December 2015 to record the changes in the level of slurry, particularly before end of works and at the start of works on the next day to confirm no significant change in bentonite slurry level during non-working hours until the complete removal of the mud pit. During the silo dismantling stage, the amount of residue bentonite cleared from the remaining silo were monitored on daily basis to record of the residue bentonite transferred for mixing and final disposal.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					The Environmental Team will continue to keep in view on the contractor environmental mitigation measures during the routine inspections, with specific attention at TS3 area on the effectiveness of Contractor's remediation measures and check the implementation of site measures in accordance with the EIA and EM&A Manual recommendations.	
ICC complaint case (ICC Ref: 2-1593165694) dated 26 November 2015	26 No 2015	ICC complaint received by ET on 27 November 2015	Construction area outside City Garden Block 11	Noise nuisance due to windblown slapping of a metal onto adjacent barrier at night time	<p>A public complaint regarding noise impact referred by RSS was received by ET on 27 November 2015 (ICC Case Ref.: 2-1593165694 dated 26 November 2015). The complainant reported that noise was emanated from the IECL construction site outside City Garden Block 11 due to the windblown slapping of a metal sheet onto adjacent barrier causing nuisance to nearby residents at night time.</p> <p>ET confirmed with the Resident Site Staff that the noise nuisance was caused by the windblown action of the corrugated metal sheet loosely affixed onto the temporary noise barrier panel above a concrete block footing fronting City Garden.</p> <p>The noise nuisance was caused by the windblown action of the corrugated metal sheet loosely affixed onto the temporary noise barrier panel above a concrete blocking footing fronting City Garden. The concerned corrugated metal sheet was removed by the Contractor of HY/2009/19 on 27 November 2015 to avoid further generation of noise nuisance.</p>	Final investigation report to be issued on 01 December 2015.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					The Contractor was reminded to check and ensure metal sheetings and other material stored within the construction site are properly affixed to avoid potential noise nuisance due to windblown action.	
EPD complaint case (EPD Ref: H04/RS/00 028924-15 dated 04 December 2015	12 November 2015	EPD complaint received by ET on 04 December 2015	Two International Finance Centre at Finance Street, Central	Construction dust generated from construction site near Two International Finance Centre	<p>A public complaint regarding construction dust impact referred by EPD was received by ET on 04 December 2015 (EPD Ref: H04/RS/00028924-15). The complainant reported that excessive construction dust was generated from the construction site near Two International Finance Centre at Finance Street, Central</p> <p>ET confirmed with the Resident Site Staff that bridge works and drains/ sewers construction at the concerned location was undertaken by Contract HY/2009/18 on 12 November 2015. A stockpile which would be reused for backfilling was stored at the concerned location by Contract HY/2009/18 on 12 November 2015.</p> <p>Mitigation measures implemented by the Contractor for the above construction works including covering of idled portion of stockpile and dampening of the exposed stockpile was implemented for the stockpile at the concerned location.</p>	<p>1st interim report submitted to EPD on 14 December 2015</p> <p>2nd interim report submitted to EPD on 4 January 2016</p> <p>EPD advised no comment on 07 January 2015 on the report submitted and case closed.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>According to relevant site records confirmed by RSS, bridge works and drains/ sewers construction at the concerned location was undertaken by Contractor of HY/2009/18 on 12 November 2015 and a stockpile which would be reused for backfilling was stored at the concerned location. Mitigation measures including covering of idled portion of stockpile and dampening of the exposed stockpile was implemented for the stockpile at the concerned location.</p> <p>In view of the public concern on potential dust impact at the concerned location, the Contractor of HY/2009/18 rearranged the works sequence and placed concrete blocks at the bridge retaining wall to allow for early commencement of backfilling on 19 November 2015 to minimize the size of the stockpile at an earlier stage. Additional water sprinklers were installed on 27 November 2015 to further enhance the dampening of the stockpile surface during excavation.</p> <p>Follow-up inspection was conducted during weekly environmental inspection on 10 December 2015 and mitigation measures including covering of stockpile stored at the concerned location was implemented while it was observed that stockpiles stored near Man Chiu Street was not properly covered. The Contractor of HY/2009/18 was advised to promptly provide covering to all idled stockpile stored on site and the Contractor was reminded to enhance the</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					watering during excavated material handling near the concerned location. Further follow up inspection was conducted on 17 December 2015 and mitigation measures including covering and watering for idle stockpile and material handling were implemented.	
ICC complaint case (ICC Case Ref: 2-1656689815 dated 14 December 2015	14 Decemb er 2015	EPD complaint received by ET on 04 December 2015	Construction area outside City Garden Block 10 and Block 11	Incessant noise emanating from the construction site of the Island East Corridor link that forms part of the Central Wanchai Bypass Project	<p>A public complaint regarding noise impact referred by RSS was received by ET on 16 December 2015 (ICC Case Ref.: 2-1656689815 dated 14 December 2015). The complainant reported that:</p> <p>Incessant noise emanating from the construction site of the Island Eastern Corridor Link that forms part of the Central-Wanchai Bypass Project.</p> <p>Over the past couple of weeks, there have been loud mechanical pounding at the construction site over the reclaimed area between Blocks 10 and 11 of City Garden. As can be seen, machines have been breaking open the concrete paved on top of the reclaimed area. Work often starts well before 9am on weekdays and, barring a brief period of lull during lunch hours, would often continue unabated untill after 5pm. Although I note that certain noise reduction measures have been put into place (e.g. the erection of flimsy noise barriers around the work area), the noise created is still enormous, and this has become a significant nuisance for residents</p>	Final report was issued on 23 December 2015 and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>living in nearby blocks of our estate, especially children and the elderly who have to stay at home for longer hours.</p> <p>ET confirmed with the Resident Site Staff that concreting breaking works was carried out with one breaker on 7, 9, 11, 12 and 14 December 2015 and the breaking works at the concerned location were completed on 14 December 2015 morning. Noise mitigation measures including temporary noise barriers near the point of breaking and covering the breaker with acoustic mat were provided during the concerned concrete breaking works.</p> <p>According to information confirmed by RSS, concreting breaking works was carried out by one excavator mounted breaker on 7, 9, 11, 12 and 14 December 2015 and the concerned breaking works outside City Garden Block 10 and Block 11 was completed on 14 December 2015 morning. Noise mitigation measures including temporary noise barriers near the point of breaking and covering the breaker with acoustic mat were provided during the concerned concrete breaking works. Based on the further review on the record of the environmental inspection conducted on 09 December 2015, the Contractor of HY/2009/19 was reminded to temporary noise barrier provided for the pile cap demolition shall follow the the Environmental Permit EP-364/2009/D requirement.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					Follow up inspection was conducted during weekly environmental inspection on 17 December 2015, the concerned breaking works opposite to City Garden Block 10 and Block 11 was observed completed while the Contractor was reminded that the remaining section of temporary noise barrier in accordance with the latest Environmental Permit EP-364/2009/D shall be completed on site as soon as possible. According to the information provided by RSS, the temporary noise barrier in accordance with the Environmental Permit requirement opposite to City Garden was substantially completed on 21 December 2015. In view of the public concern, the Contractor was suggested to consider to review the works duration at daytime and conduct other future breaking works around the concerned location intermittently to minimize the potential noise nuisance caused to the surroundings.	
EPD Ref.: H05/RS/00 000570-16 dated 14 January 2016	07 January 2016	EPD complaint received by ET on 14 January 2016	Lung King Street	Operation of powered mechanical equipment at the construction site near Lung King Street after 1900hrs.	<p>A public complaint regarding construction noise referred by EPD was received by ET on 14 January 2016 (EPD Ref.: H05/RS/00000570-16 dated 14 January 2016). The complainant reported that there was operation of powered mechanical equipment at the construction site near Lung King Street after 1900hrs. (Contract HK/2012/08)</p> <p>ET confirmed with the Resident Site Staff that from 1900hrs to 2115hrs on 06 January 2016, shifting of equipment and socket H-pile casing was undertaken by the Contractor of HK/2012/08 at the concerned location. Total one crawler crane was in operation.</p>	Interim investigation report submitted to EPD on 22 January 2016. EPD advised on 17 February no comment on the interim report submitted and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>According to the relevant site records provided by RSS, shifting of equipment and socket H-pile casing was undertaken by the Contractor of HK/2012/08 at the concerned location from 1900hrs to 2115hrs on 06 January 2016. Total one crawler crane was in operation and the relevant Construction Noise Permit GW-RS0976-15 for the concerned operation was confirmed in place.</p> <p>Based on the above, the construction activities conducted under Contract HK/2012/08 on 06 January 2016 after 1900hrs was in compliance with the statutory requirement. Nevertheless, the Contractor was reminded to upkeep the site control system for construction works carried out during restricted hours and night time for Construction Noise Permit compliance in view of the nearby public concern.</p>	
ICC complaint case (ICC Ref.: #2-1754682833 and ICC Ref: #2-1759629742	19 January 2016	EPD complaint received by ET on 19 January 2016	Hung Hing Road	Drainage at Hung Hing Road, Causeway Bay near the entrance of Cross Harbour Tunnel was blocked and sewage was overflowing from the sewer.	<p>Two public complaints regarding the subject matter on blocked drainage were referred by RSS was received by ET on 19 January 2016 (ICC Ref.: #2-1754682833 and ICC Ref: #2-1759629742).</p> <p>The first complainant (ICC Ref.: #2-1754682833) on 11 January 2016 reported that the drainage at Hung Hing Road, Causeway Bay near the entrance of Cross Harbour Tunnel was blocked and sewage was overflowing from the sewer.</p> <p>The first complainant on 13 January 2016 enquired the status of follow-up, the complainant reported that the sewage overflow was severe and pose environmental hygiene concern to the</p>	Final investigation report issued on 27 January 2016



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>surroundings.</p> <p>The first complainant on 14 January 2016 reported that the situation was not improved and would escalate the case if not addressed.</p> <p>The second complainant on 12 January 2016 (ICC Ref: #2-1759629742) reported that a foul sewer was found choking and foul water flows onto the carriageways.</p> <p>ET confirmed with the Resident Site Staff that no discharge point from the Contractor of HY/2009/15 is located within the concern portion of public drain (roadside gully) along Hung Hing Road.</p> <p>The observed yellow pipe extending from the roadside gully at Hung Hing Road into the site area under Contract HY/2009/15 was installed by the Contractor of HY/2009/15 to pump excessive sewage from the roadside gully on 11 January 2016.</p> <p>According to relevant site records and information provided by RSS, a steady flow of wastewater, noticeably sewer-like odour, was seeping through an existing sewage manhole at Hung Hing Road on 11 January 2016 and resulting in the formation of local ponding formed around the low point gully nearby.</p> <p>Based on relevant site information, no discharge point from the Contractor of HY/2009/15 was located at the concerned public drain (roadside gully) along Hung Hing Road while the observed yellow pipe extending from the roadside gully at Hung Hing Road into Contract HY/2009/15 site area was installed by the Contractor of HY/2009/15 to pump excessive sewage from the roadside gully on 11 January 2016. In view of no discharge point established under Contractor HY/2009/15 was observed at the concerned portion of Hung Hing Road, no direct information</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>indicating the association with the Contractor of HY/2009/15 is considered available.</p> <p>Follow up inspection was conducted during the weekly environmental inspection on 26 January 2016, no further accumulation of wastewater and no particular blockage of the concerned roadside gully at Hung Hing Road was observed. In addition, no overflow from the roadside sewer was observed. Nevertheless, the Contractor of HY/2009/15 was reminded to upkeep the site exit condition to avoid any potential impact to the surroundings.</p>	
EPD complaint case (EPD Case Ref.:H05/RS/00001524-16)	22 January 2016	EPD complaint received by ET on 22 January 2016	Hung Hing Road	<p>Construction wastewater from the China Stat's construction site under Contract HY/2009/15 was discharged from the site exit at Hung Hing Road near the Royal Hong Kong Yacht Club to the carriage of Hung Hing Road causing accumulation of stagnant water</p>	<p>A public complaint regarding the blockage of public drainage referred by EPD was received by ET on 22 January 2016 (EPD Case Ref.: H05/RS/00001524-16).</p> <p>The complainant reported that construction wastewater from the China State's construction site under Contract HY/2009/15 was discharged from the site exit at Hung Hing Road near the Royal Hong Kong Yacht Club to the carriage of Hung Hing Road causing accumulation of stagnant water starting from 11 January 2016.</p> <p>ET confirmed with the Resident Site Staff that no construction activities with potential runoff at the main entrance of PRE Office was conducted under Contractor of HY/2009/15 on 11, 14, 15 and 17 January 2016.</p> <p>Concreting for Seawall Reinstatement at TPCWAE was conducted under Contractor of HY/2009/15 on 12 January 2016 and 18 January 2016.</p> <p>Concreting for construction works at covered Tunnel by using concrete pump at TPCWAE was conducted under Contractor of HY/2009/15 on 13 January 2016 and 16 January 2016.</p> <p>According to relevant site records and information</p>	Interim investigation report submitted to EPD on 01 February 2016. EPD advised on 17 February no comment on the interim report submitted and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>provided by RSS, a steady flow of wastewater, noticeably sewer-like odour, was seeping through an existing sewage manhole at Hung Hing Road on 11 January 2016 and resulting in the formation of local ponding formed around the low point gully nearby.</p> <p>Based on relevant site information provided by RSS, no construction activity with potential runoff at the main entrance of PRE Office were conducted under Contractor of HY/2009/15 on 11, 14, 15 and 17 January 2016 while concreting for seawall reinstatement at TPCWAE were conducted on 12 January 2016 and 18 January 2016 and concreting for construction works at covered Tunnel by using concrete pump at TPCWAE were conducted on 13 January 2016 and 16 January 2016. All construction runoff was pumped to the wastewater treatment facility. In addition, no discharge point from the Contractor of HY/2009/15 was located at the concerned public drain (roadside gully) along Hung Hing Road.</p> <p>Follow up inspection was conducted during the weekly environmental inspection on 26 January 2016. No further accumulation of wastewater and particular blockage of the concerned roadside gully at Hung Hing Road was observed and no overflow from the roadside sewer was observed. The condition of the construction site exit under HY/2009/15 was generally in order and no particular construction surface runoff was observed. Nevertheless, the Contractor of HY/2009/15 was reminded to upkeep the site exit condition to avoid any potential impact to the surroundings.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
EPD Ref.: H05/RS/000 03169-16 dated 16 February 2016	16 February 2016	EPD complaint received by ET on 16 February 2016	West of HKCEC	Construction work at construction site of CEDD Wan Chai Development Phase II reclamation project around 2200hrs	<p>A public complaint regarding construction works at restricted hours referred by EPD was received by ET on 16 February 2016 (EPD Ref.:H05/RS/00003169-16 dated 16 February 2016). The complainant reported that:</p> <p>There was construction work at construction site of CEDD Wan Chai Development Phase II reclamation project around 2200hrs on 06 February 2016 at the west of HKCEC within the work area of Contract HK/2012/08.</p> <p>ET confirmed with the Resident Site Staff that from 1900hrs to 2300hrs on 06 February 2016, no site activity was undertaken by the Contractor of HK/2012/08 at the concerned location and site activities under the Contractor of HK/2012/08 at the concerned area were stopped around 1700hrs on 06 February 2016.</p> <p>According to the relevant site records provided by RSS, from 1900hrs to 2300hrs on 06 February 2016, no site activity was undertaken by the Contractor of HK/2012/08 at the concerned location and site activities under the Contractor of HK/2012/08 at the concerned area were stopped around 1700hrs on 06 February 2016.</p> <p>Nevertheless, the Contractor was reminded to upkeep the site control system for any construction works carried out during restricted hours and night time for Construction Noise Permit compliance.</p>	Interim investigation report submitted to EPD on 23 February 2016.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
ICC Ref.: CASE#2-1938637403 dated 01 March 2016	01 March 2016	ICC complaint received by ET on 03 March 2016	Lung King Street near the parking spaces for motorcycles	Construction noise was emanated from road works	<p>A public complaint regarding construction noise referred by ICC was received by ET on 03 March 2016 (ICC Ref.: CASE#2-1938637403 dated 01 March 2016). The complainant reported that construction noise was emanated from road works located between Lung Wo Road and Lung Wui Road Interface.</p> <p>Further information was referred by RSS on 15 March 2016, the complainant clarified on 15 March 2016 that construction noise was emanated from road works located between Lung Wo Road and Lung Wui Road Interface during midnight and has lasted for one and half month resulting in nuisance to nearby residence.</p> <p>Further information was referred by RSS on 18 March 2016, the complainant further clarified on 18 March 2016 that the concerned location shall be Lung King Street near the parking spaces for motorcycles and the Contract no. as stated on the publicity board is HK/2012/08. Furthermore, the complainant identified the noise was from power generators.</p> <p>ET confirmed with the Resident Site Staff that there was neither construction works nor operation of power generators under Contract HK/2012/08 at the concerned location from 1900hrs to 0700hrs during the period from 23 February 2016 to 14 March 2016.</p> <p>Based on the complaint information referred by ICC on 3 March 2016, according to the relevant site records provided by RSS, from 0800hrs to 1800hrs on both 29 February 2016 and 01 March 2016, drainage works was undertaken by Contract HK/2012/08 at Lung Wo Road and one excavator was in operation for soil excavation. Follow up inspection was conducted during the weekly environmental site inspection on 08 March 2016</p>	<p>1st investigation report issued on 11 March 2016.</p> <p>2nd investigation report issued on 23 March 2016 and case closed.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>and no particular noise emanating works was observed.</p> <p>Based on the further information provided by the complainant on 15 March 2016, the complainant clarified on 15 March 2016 that Construction noise was emanated from road works located between Lung Wo Road and Lung Wui Road Interface during midnight and has lasted for one and half month resulting in nuisance to nearby residence. On 18 March 2016, the complainant further clarified on 18 March 2016 that the concerned location shall be Lung King Street near the parking spaces for motorcycles and the Contract no. as stated on the publicity board is HK/2012/08. Furthermore, the complainant identified the noise was from power generators. According to the relevant site records provided by RSS, there was neither construction works nor operation of power generators under Contract HK/2012/08 at the concerned location from 1900hrs to 0700hrs during the period from 23 February 2016 to 14 March 2016.</p> <p>Nevertheless, in view of the public concern, the Contractor is recommended to maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
EPD Ref.: H05/RS/000 05206-16 dated 10 March 2016	07 March 2016	EPD complaint received by ET on 10 March 2016	Waterfront at Lung King Street	Construction dust, plant exhaust and construction noise generated from the construction work of Contract HK/2012/08 at waterfront of Lung King Street caused nuisance, and the water quality at the waterfront of Lung King Street was becoming worse that accumulation of the floating refuse and foam was found	<p>A public complaint regarding construction dust, plant exhaust, construction noise and water quality referred by EPD was received by ET on 10 March 2016 (EPD Ref.: H05/RS/00005206-16 dated 10 March 2016). The complainant reported that construction dust, plant exhaust and construction noise generated from the construction work of Contract HK/2012/08 at waterfront of Lung King Street caused nuisance, and the water quality at the waterfront of Lung King Street was becoming worse that accumulation of the floating refuse and foam was found.</p> <p>ET confirmed with the Resident Site Staff that soil excavation at ELS area, Zone A2(2), was carried out, where at approx. 100m from the waterfront of Lung King Street from 08:00 hrs to 18:00 hrs on 07 March 2016 under Contract HK/2012/08. Two excavators were involved at that location. Erection of falsework for culvert L was carried out near the waterfront of Lung King Street from 08:00 hrs to 18:00 hrs on 07 March 2016 under Contract HK/2012/08. One lorry crane was involved for lifting falsework elements. Dust suppression measures including the water sprinklers were installed along site haul road.</p> <p>Regularly removed the floating refuse at the waterfront of Lung King Street was conducted by the Contractor of HK/2012/08. The concerned observed floating foam at the waterfront of Lung King Street was found originating from the diverted cooling mains discharge.</p> <p>According to the relevant site records provided by RSS, soil excavation at ELS area, Zone A2(2) was carried out, where at approx. 100m from the waterfront of Lung King Street under Contract</p>	<p>Interim investigation report submitted to EPD on 18 March 2016.</p> <p>EPD advised no comment on 29 April 2016 on the interim report submitted and case closed.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>HK/2012/08 from 08:00hrs to 18:00hrs on 07 March 2016 and two excavators were in operation at that location while erection of falsework for culvert L was carried out near the waterfront of Lung King Street from 08:00hrs and 18:00hrs on 07 March 2016 under Contract HK/2012/08 and one lorry crane was involved for lifting falsework elements. Dust suppression measures including the use of water sprinklers along the site haul road was implemented by the Contractor of HK/2012/08 and removal of floating refuse was regularly conducted at the waterfront of Lung King Street by the Contractor of HK/2012/08. Upon investigation, the concerned observed floating foam at the waterfront of Lung King Street was found originating from the diverted cooling mains discharge.</p> <p>Follow up inspection was conducted during the weekly environmental site inspection on 15 March 2016 and dust suppression measures including watering for haul road, tarpaulin sheet covering for cement bags stored on site and three side and top covering for grouting station were implemented while and no dark smoke emission from the plant and machinery deployed on site was observed. Noise mitigation measures including acoustic covering was implementing for excavator mounted breaker. In addition, removal of floating refuse on site was observed implemented by the Contractor of HK/2012/08 and no accumulation of floating refuse was found. The concerned foam originating from diverted cooling mains discharge was observed during inspection and the dispersion of the concerned foam of unknown chemical nature was observed isolated from the nearby public area.</p> <p>Nevertheless, in view of the public concern, the</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					Contractor was recommended to maintain regular checking of the plants and equipment deployed on site to avoid potential air quality impact to the nearby public and to maintain adequate dust suppression measures on site to avoid potential dust impact to the surroundings. The Contractor was reminded to maintain regular cleaning of floating refuse within the construction site area to avoid potential nuisance to the surroundings. The Contractor was also reminded to maintain the noise mitigation measure if breaking works would be required. The Contractor was also suggested to reflect the observed foam to relevant Cooling Mains owners.	
EPD Ref.: H05/RS/000 06732-16 dated 10 March 2016	23 March 2016	EPD complaint received by ET on 31 March 2016	Seafront opposite to City Garden	Muddy water discharge from construction site outside City Garden	<p>A public complaint regarding direct discharge of muddy effluent referred by EPD was received by ET on 31 March 2016 (Case Ref.: H08/RS/00006732-16). The complainant reported that:</p> <p>Muddy water was observed discharged from the construction site of Central – Wan Chai Bypass – Tunnel (North Point Section) and Island Eastern Corridor Link (Contract No. HY/2009/19) into Victoria Harbour via a drain hole.</p> <p>ET confirmed with the Resident Site Staff that pipe Laying works between Pier 32 and Pier 33 and excavation and blinding works for Manhole at Pier 34 were in progress on 22 March 2016.</p> <p>The observed drain hole was identified to be the outlet point of a manhole and a section of an abandoned U-channel (extending from the concerned manhole to the Hong Kong Electric Substation in length along the site boundary) was adjoining the concerned manhole and sandbag was previously placed at the U-channel at the location near the inlet point to the concerned manhole.</p>	<p>The interim investigation report was submitted to EPD on 11 April 2016.</p> <p>EPD advised no comment on 02 September 2016 on the interim report submitted and case closed.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Based on the site records confirmed by RSS, pipe laying works between Pier 32 and Pier 33 and excavation and blinding works for Manhole at Pier 34 were in progress on 22 March 2016. The observed drain hole was identified to be the outlet point of a manhole and a section of an abandoned U-channel (extending from the concerned manhole to the Hong Kong Electric Substation in length along the site boundary) was adjoining the concerned manhole and sandbag was previously placed at the U-channel at the location near the inlet point to the concerned manhole. In addition, no site discharge point was connected to the aforesaid U-channel and the concerned manhole. In view of the environmental concern, the following remedial and precautionary actions were taken by the Contractor of HY/2009/19 on 29 March 2016.</p> <ul style="list-style-type: none">i) Plugging the inlet point of the concerned manhole (connecting to the abandoned U-channel) with concrete;ii) Plugging the outlet of the concerned manhole (connecting to the observed drain hole) with concrete;iii) Filling the concerned manhole with rubbles;iv) Shifting the unused wastewater treatment plant around the concerned location to other site location for use. <p>Follow-up inspection was conducted by the Environmental Team on 06 April 2016. No further contaminated runoff discharge was observed from the concerned drain hole and precautionary measures including provision of concrete bunding was implemented along the site boundary at the concerned location to avoid potential surface overflow. The pipe laying works and the excavation works was found at distant location</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>away from the concerned drain hole with no surface drain connection and no particular effluent was generated from the work. As such, no information indicate the discharge was related to the above construction activities.</p> <p>However, it was noted that another section of surface drainage channel within the construction site (perpendicular in direction to the initial identified abandoned U-channel) was also in connection to concerned manhole and minor residue mud deposition was observed within the surface drainage channel. Despite the above additional surface drainage channel identified, the outlet point of concerned final manhole (in connection with the observed drain hole) was observed plugged with concrete and filled with rubbles as rectification measure to avoid any further contaminated runoff discharge via the observed drain hole.</p> <p>Nevertheless, the Contractor of HY/2009/19 was reminded to conduct regular cleaning works for site surface drainage channel to avoid accumulation of silt and soil and avoid potential overflow by directing the surface runoff within the surface drainage channel to proper collection point for necessary treatment prior to discharge. The Contractor of HY/2009/19 was also reminded to check and review other surface drainage channel within the construction site to avoid potential runoff related impact via surface drainage channel to the nearby waters.</p> <p>In addition, it was noticed that water was discharged from a piping extending from City Garden and the discharged water would result in seepage across the site hoarding into the abandoned U-channel. The Contractor of HY/2009/19 was suggested to liaise with the City Garden Management Office for proper connection</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					of the observed pipping with discharge to prevent further seepage water into the construction site.	
H08/RS/000 07662-16	05 April 2016	EPD complaint received by ET on 05 April 2016	Construction area opposite to Harbour Heights	Construction dust emission arising from drilling activity	<p>A public complaint regarding construction dust emission was referred by EPD was received by ET on 05 April 2016 (Case Ref.: H08/RS/00007662-16). The complainant reported that construction dust emission arising from drilling activity from the construction site of Central – Wan Chai Bypass – Tunnel (North Point Section) and Island Eastern Corridor Link (Contract No. HY/2009/19).</p> <p>ET confirmed with the Resident Site Staff that drilling holes for installation of starter bars was carried out under Contract HY/2009/19 at the vertical cut face of the existing IEC road slab on 05 April 2016</p> <p>Based on the site records confirmed by RSS, drilling holes for installation of starter bars was carried out under Contract HY/2009/19 at the vertical cut face of the existing IEC road slab on 05 April 2016 and according to the photo information provided by the EPD, no dust suppression measures was implemented during the observed drilling works on 05 April 2016.</p> <p>According to Air Pollution Control Ordinance, for pneumatic or power-driven drilling, cutting and polishing, water or a dust suppression chemical shall be continuously sprayed on the surface where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation that causes dust emission is carried out, unless the process is accompanied by the operation of an effective dust extraction and filtering device.</p>	<p>The interim report was submitted to the EPD on 14 April 2016.</p> <p>EPD conducted follow up site visit on rectification measures on 21 April 2016. A inspection record form (Pink Form) was issued to the Contractor regarding the observed incident.</p> <p>EPD advised no comment on 02 September 2016 on the interim report submitted and case closed.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					Follow-up inspection was conducted on 06 April 2016, rectification actions including the use of vacuum suction to extract dust generated during the concerned drilling works was observed implemented by the Contractor of HY/2009/19 for starter bars drilling works.	
ICC Case Ref.:2-2036525055 dated 27 March 2016	27 March 2016	ICC complaint case received by ET on 11 April 2016	Victoria Park Road Pedestrian Pathway	Toppling of tree	<p>An ICC public complaint regarding landscape aspect was referred by RSS was received by ET on 11 April 2016 (Case Ref.:2-2036525055). The complainant reported that a tree (6 meters in height and 1.5 meters in diameter) was found toppled at 111 Victoria Park Road, near Lamp post 38632 and blocking the Pedestrian pathway on 27 March 2016.</p> <p>ET confirmed with the Resident Site Staff that the concerned tree was identified as T710 and no construction activity in the vicinity of tree T710 on 27 March 2016 and no construction works are required in or near its vicinity.</p> <p>Based on the site records confirmed by RSS, the concerned tree was identified as the retained tree T710 maintained under the Contract of HY/2010/08 and the concerned tree T710 was located outside the assessment area in the relevant Project EIA Report. No construction works are required in the vicinity of concerned tree T710 and no construction activity was conducted in the vicinity of tree T710 on 27 March 2016. Nevertheless, based on RSS information, recent tree monitoring report indicates an existing cavity at trunk and the concerned tree T710 has been recommended to be felled in the tree risk assessment Form 2.</p> <p>With respect to the observed incident of the toppling of the concerned tree T710, the</p>	Investigation Report issued on 15 April 2016 and case closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					Contractor of HY/2010/08 was instructed by RSS to remove the broken trunk/ remains to avoid impact to the surroundings. The concerned tree T710 shall be compensated by the Contractor of HY/2010/08 in accordance with the Development Bureau Technical Circular (Works) No. 7/2015 and the detail on compensation would be further agreed with Victoria Park Management Office. Follow-up inspection was conducted on 13 April 2016, and the remaining parts of the concerned tree T710 was observed felled to avoid further impact to nearby public road.	
Not available	12 April 2016	A CEDD public complaint referred by RSS was received by ET on 13 April 2016	East of Star Ferry Piers	Muddy water was observed to disperse from Contract HK/2009/02 site area to Victoria Harbour occasionally as there was no silt curtain installed under the buoyancy floats. The location concerned was the East of Star Ferry Piers (Contract No. HK/2009/02).	<p>A CEDD public complaint regarding muddy dispersion referred by RSS was received by ET on 13 April 2016. The complainant reported that muddy water was observed to disperse from Contract HK/2009/02 site area to Victoria Harbour occasionally as there was no silt curtain installed under the buoyancy floats. The location concerned was the East of Star Ferry Piers (Contract No. HK/2009/02).</p> <p>ET confirmed with the Resident Site Staff that no marine construction activities or land construction activities under Contract HK/2009/02 at the concerned location on 12 April 2016. Surface runoff control measures including provision of concrete bund at the concerned location was implemented by Contract HK/2009/02. No soil & silt deposition along the seawall at the concerned location on 12 April 2016. No discharge point located in the vicinity of the concerned location under Contract HK/2009/02. Silt curtain with buoyancy floats acting as anchor points was installed at Monitoring Station RW21-P789 for Water intakes.</p>	Investigation report issued on 19 April 2016 and case closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Based on the site records confirmed by RSS, no marine construction activities or land construction activities was carried out under Contract HK/2009/02 at the concerned location on 12 April 2016 and no soil and silt deposition was found along the seawall at the concerned location and precautionary measures for site runoff control including provision of concrete bund along boundary of site area near the waterfront around the concerned location was implemented by the Contractor HK/2009/02. In addition, no discharge point under Contract HK/2009/02 was located in the vicinity of the concerned location. Based on information confirmed by RSS, the buoyancy floats deployed at the concerned location are acting as the anchor points for the silt curtain deployed around the WQM Station RW21-P789 for the WSD and Cooling Water Intakes group.</p> <p>Follow-up inspection was conducted on 14 April 2016, no surface runoff from the construction site nor discharge of contaminated effluent was observed around the concerned location and precautionary measures including the provision of concrete bund at the concerned location was observed maintained by the Contractor of HK/2009/02 and the silt curtain deployed around the WQM station RW21-P789 was generally in order.</p> <p>In view of the public concern on the water quality, the Contractor of HK/2009/02 was reminded to maintain effective surface runoff protection and provide proper collection point of construction effluent around the concerned location to avoid potential surface runoff related impact.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
EPD Ref.: H05/RS/000 08367-16 dated 13 April 2016	13 April 2016	A public complaint referred by EPD was received by ET on 13 April 2016	Outside the Hong Kong Academy for Performing Arts	Muddy water discharge from construction site	<p>A public complaint regarding muddy water discharge referred by EPD was received by ET on 13 April 2016 (EPD Ref.: H05/RS/00008367-16 dated 13 April 2016). The complainant reported that muddy water was discharged from the construction work of Contract HK/2012/08 to the sea outside the Hong Kong Academy for Performing Arts on 13 April 2016 morning.</p> <p>ET confirmed with the Resident Site Staff that internal transport of soil to the hopper barge for storage via landing barge was conducted by Contractor of HK/2012/08 during 0800 hours to 1000 hours on 13 April 2016 at the sea outside the concerned location and 3 nos. of dump trucks were deployed for the operation.</p> <p>Protection measure including provision of sandbag bunding along the side of the landing barge was implemented by the Contractor of HK/2012/08.</p> <p>According to the relevant site records provided by RSS, internal transport of soil to the hopper barge for storage via landing barge was conducted by Contractor of HK/2012/08 during 0800 hours to 1000 hours on 13 April 2016 at the sea outside the concerned location and 3 nos. of dump trucks were deployed for the operation. Protection measure including provision of sandbag bunding along the side of the landing barge was implemented by the Contractor of HK/2012/08. In addition, amber rainstorm warning signal was hoisted from 0630 hours to 1200 hours on 13 April 2016 and during the above time period, muddy water was observed from the upstream of culvert L outside the HK/2012/08 site.</p> <p>Follow up inspection was conducted on 19 April 2016, protection measures including provision of</p>	<p>Interim investigation report was submitted to the EPD on 21 April 2016.</p> <p>EPD advised no further comment on 06 June 2016 on the interim report submitted and case closed.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>sandbag bunding along the side of the landing barge was implemented and no mud or soil deposition was observed along the seawall and no discharge point was located within the temporary water channel connecting the Culvert L outfall location to the Victoria Harbour. In addition, piling works was observed at the north side of Zone A1 on 19 April 2016 and construction effluent collection from piling work via sedimentation tank to wastewater treatment facility was implemented and steel barrier was installed around the piling works area to mitigate against potential surface runoff related impact.</p> <p>Nevertheless, in view of the public concern, the Contractor was reminded to maintain adequate perimeter embankment protection along the seawall boundary and maintain proper construction effluent collection system to avoid potential runoff related impact to nearby waters.</p>	
EPD Ref: H05/RS/000 12646-16 dated 27 May 2016	26 May 2016	A public complaint referred by EPD was received by ET on 27 May 2016	Construction Site near Wanchai Ferry Pier	Operation of generator around the clock	<p>A EPD complaint regarding noise nuisance referred by RSS was received by ET on 27 May 2016 (EPD Ref: H05/RS/00012646-16 dated 27 May 2016). The complainant reported that a generator was operated round-the-clock in the Chun Wo- CRGL JV construction site near Wanchai Ferry Pier that cause noise nuisance. (Contract No. HK/2009/02).</p> <p>ET confirmed with the Resident Site Staff that a generator deployed under Contract HK/2009/02 near the covered walkway for Wanchai Ferry Pier at Portion 2 area and was operated from 1900hrs on 24 May 2016 to 0700hrs on 25 May 2016 and from 1900hrs on 25 May 2016 to 0700hrs on 26 May 2016. The generator was used for the power supply of lighting inside Tunnel Portions 1 and 2.</p> <p>According to the relevant site records provided by</p>	<p>Interim investigation report submitted to EPD on 7 June 2016.</p> <p>EPD advised no further comment on 05 August 2016 on the report submitted and case closed.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>RSS, a generator deployed under Contract HK/2009/02 near the covered walkway for Wanchai Ferry Pier at Portion 2 area and was operated from 1900hrs on 24 May 2016 to 0700hrs on 25 May 2016 and from 1900hrs on 25 May 2016 to 0700hrs on 26 May 2016. The generator was used for the power supply of lighting inside Tunnel Portions 1 and 2. Based on review on site information, relevant Construction Noise Permits GW-RS0516-16 and GW-RS0390-16 for the operation of the concerned generator were confirmed in place while no sufficient site information was considered available to demonstrate the use of acoustic enclosure for the operation of the generator following the special condition 3d item 4. Despite the above, the Contractor of HK/2009/02 has suspended the use of the generator at the concerned location after 2300hours to minimize potential noise concern to the surroundings from 28 May 2016.</p> <p>Nevertheless, the Contractor of HK/2009/02 was reminded to upkeep the site control system for construction works carried out during restricted hours and night time for Construction Noise Permit compliance and maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
EPD Ref: H08/RS/000 14627-16 dated 16 June 2016	15 June 2016	A public complaint referred by EPD was received by ET on 16 June 2016	Construction area of Island Eastern Corridor near Sea View Estate.	Splashing from the working area of Island Eastern Corridor near Sea View Estate.	<p>A public complaint was referred by EPD was received by ET on 16 June 2016 (Case Ref.: H08/RS/00014627-16). The complainant reported that his or her properties were covered by many water stains which were splashing from the working area of Island Eastern Corridor near Sea View Estate.</p> <p>ET confirmed with the Resident Site Staff that rebar fixing was carried out on 13 and 14 June 2016 under the Contractor of HY/2009/19 while formwork cleaning and laying concrete for stitching and curing work for concrete were carried out under the Contractor of HY/2009/19 on 15 June 2016 and 16 June 2016 respectively.</p> <p>Mitigation measures including provision of metal cover underneath the bridge deck in slanting position at Watson Road to prevent spilling of water onto public road and provision of tarpaulin sheet along the guard rails of the bridge deck at Pier 19-20 (opposite to Sea View Estate) to prevent splashing of water to outside area were implemented by the Contractor of HY/2009/19.</p> <p>Based on the site records confirmed by RSS, rebar fixing was carried out on 13 and 14 June 2016 under the Contractor of HY/2009/19 while formwork cleaning and laying concrete for stitching and curing work for concrete were carried out under the Contractor of HY/2009/19 on 15 June 2016 and 16 June 2016 respectively.</p> <p>Mitigation measures including provision of metal cover underneath the bridge deck in slanting position at Watson Road to prevent spilling of water onto public road and provision of tarpaulin sheet along the guard rails of the bridge deck at Pier 19-20 (opposite to Sea View Estate) to prevent splashing of water to outside area were implemented by the Contractor of HY/2009/19.</p>	The interim report submitted to the EPD on 29 June 2016. EPD advised no comment on the interim report submitted and case closed on 02 September 2016.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Follow up inspection was conducted on 22 June 2016, mitigation measures including the use of metal cover underneath the bridge deck at Watson Road and provision of tarpaulin sheet along the guard rails of the section of bridge deck opposite to Sea View Estate were implemented by the Contractor of HY/2009/19. No particular spilling or splashing of construction water was observed during inspection around the concerned location.</p> <p>Nevertheless, in view of the public concern, the Contractor of HY/2009/19 was suggested that the direction of the water hose shall be pointed away from the public area as far as practicable during water use or watering for dust suppression to avoid potential splashing nuisance caused to the surroundings. The Contractor of HY/2009/19 was also reminded to maintain proper site drainage to direct surface runoff generated from construction works or cleaning to the proper collection point within site area to avoid potential nuisance to the surroundings.</p>	
EPD Ref: H08/RS/000 16213-16 dated 14 July 2016	30 June 2016	A public complaint referred by EPD was received by ET on 14 July 2016	Construction Site of TS3 near Slip Road 8	Night time construction noise from construction works between 0200hrs to 0300hrs and construction dust emission from construction site of TS3 near Slip Road 8 section.	<p>A public complaint referred by EPD was received by ET on 14 July 2016 (Case Ref.: H08/RS/00016213-16). The complainant reported the concern about night time construction noise from construction works between 0200hrs to 0300hrs and construction dust emission from construction site of TS3 near Slip Road 8 section.</p> <p>ET confirmed with the Resident Site Staff that excavation at TS3 and loading of material onto derrick barge (Shun Tat 28) by crawler crane was undertaken by the Contractor of HY/2010/08 from 19:00hrs to around 02:00hrs on 30 June 2016. Total one crawler crane was in operation.</p> <p>Noise mitigation measures including equipping the crawler crane with noise barrier was implemented</p>	The interim report submitted to the EPD on 22 July 2016



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>by the Contractor of HY/2010/08.</p> <p>Dust mitigation measures including manual spraying of water and mist nozzles are deployed on the ground level and at the cofferdam.</p> <p>Based on the site records confirmed by RSS, excavation at TS3 and loading of material onto derrick barge (Shun Tat 28) by crawler crane was undertaken by the Contractor of HY/2010/08 from 19:00hrs on 29 June 2016 to around 02:00hrs on 30 June 2016. No construction works was conducted at the concerned location after around 02:00hrs on 30 June 2016. Total one crawler crane was in operation and noise mitigation measures including equipping the crawler crane with noise barrier was implemented by the Contractor of HY/2010/08.</p> <p>Based on review on relevant record, Construction Noise Permit GW-RS0434-16 for the operation of crawler crane at the concerned location was in place. However, based on relevant site record, it was noted that the crawler crane deployed during the concerned period could not match with the specific PME requirement under condition 3a (Crane, crawler, mounted with noise barrier (Kobelco 7250S)) of the Construction Noise Permit GW-RS0434-16 between 23:00hrs to 07:00hrs on the following day. Dust mitigation measures including manual spraying of water and mist nozzles were deployed on the ground level and at the cofferdam.</p> <p>Follow up inspection was conducted on 20 July 2016, the potential concerned excavation works at the concerned location was not observed and no particular dust impact was observed around the concerned location.</p> <p>In view of the above, the Contractor of HY/2010/08 was advised to review the site control system for</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					construction works carried out during restricted hours to check and ensure the model/ specific PMEs deployed are in compliance with relevant Construction Noise Permit. The Contractor of HY/2010/08 was also reminded to maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public. Also, the Contractor of HY/2010/08 was reminded to maintain sufficient watering for excavated material handling to avoid potential dust nuisance to the surroundings.	
EPD Ref: H08/RS/000 22448-16 dated 06 September 2016	04 Sept 2016	A public complaint referred by EPD was received by ET on 06 September 2016	Road construction works area near Causeway Bay Typhoon Shelter	Construction noise from road construction work near Causeway Bay Typhoon Shelter	<p>A public complaint referred by EPD was received by ET on 06 September 2016 (Case Ref.: H08/RS/00022448-16). The complainant reported that construction noise from the road construction work near Causeway Bay Typhoon Shelter during 0800hrs to 2100 hrs on 04 September 2016 (Sunday) caused nuisance. The complainant also indicated that the construction noise was generated up to 0100 hrs on normal weekdays.</p> <p>ET confirmed with the Resident Site Staff that underwater welding of lagging plate at Zone C was conducted from 0800hrs to 2100hrs on 04 September 2016. Total 1 no. of generator and 1 no. of welding machine were in operation. Grouting works at Victoria Park Road Eastbound slow lane was conducted from 2300hrs on 01 September 2016 to 0100hrs on 02 September 2016. Total 1 no. of grout mixer, 1 no. of agitator and 1 no. of grout pump were in operation. Grouting works at Victoria Park Road Eastbound slow lane was conducted from 2300hrs on 02 September 2016 to 0100hrs on 03 September 2016. Total 1 no. of grout mixer, 1 no. of agitator and 1 no. of grout pump were in operation. Grouting works at Victoria Park Road Eastbound</p>	<p>The interim report submitted to EPD on 20 September 2016.</p> <p>EPD advised no comment on 31 October 2016 on the interim report submitted and case closed.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>slow lane was conducted from 2300hrs to 2359hrs on 03 September 2016. Total 1 no. of grout mixer, 1 no. of agitator and 1 no. of grout pump were in operation.</p> <p>Based on the site records confirmed by RSS, underwater welding of lagging plate at Zone C was conducted from 0800hrs to 2100hrs on 04 September 2016, total 1 no. of generator and 1 no. of welding machine were in operation and relevant Construction Noise Permit GW-RS0442-16 was in place. Grouting works at Victoria Park Road Eastbound slow lane was conducted from 2300hrs on 01 September 2016 to 0100hrs on 02 September 2016. Total 1 no. of grout mixer, 1 no. of agitator and 1 no. of grout pump were in operation. Grouting works at Victoria Park Road Eastbound slow lane was conducted from 2300hrs on 02 September 2016 to 0100hrs on 03 September 2016. Total 1 no. of grout mixer, 1 no. of agitator and 1 no. of grout pump were in operation. Grouting works at Victoria Park Road Eastbound slow lane was conducted from 2300hrs to 2359hrs on 03 September 2016. Total 1 no. of grout mixer, 1 no. of agitator and 1 no. of grout pump were in operation. Relevant Construction Noise Permit GW-RS0531-16 was in place for the above construction activities.</p> <p>Nevertheless, in view of the public concern, the Contractor of HY/2010/08 was reminded to maintain the site control system for construction works carried out during restricted hours to ensure the PMEs deployed are in compliance with relevant Construction Noise Permit. The Contractor of HY/2010/08 was also reminded to maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
EPD Ref: H08/RS/000 24768-16 dated 07 October 2016	28 Sept 2016 04 Oct 2016	A public complaint referred by EPD was received by ET on 07 October 2016	Causeway Bay Typhoon Shelter	Construction work at the construction site in Causeway Bay Typhoon Shelter area was found after 1900hrs on 28 September 2016 and 04 October 2016 that caused noise nuisance.	<p>A public complaint referred by EPD was received by ET on 07 October 2016 (Case Ref.: H08/RS/00024768-16). The complainant reported that construction work at the construction site in Causeway Bay Typhoon Shelter area was found after 1900hrs on 28 September 2016 and 04 October 2016 that caused noise nuisance. The complainant also reported that there were 5 concrete lorry mixers operating at the above site after 1900hrs on 04 October 2016.</p> <p>ET confirmed with the Resident Site Staff that concreting for tunnel structure in TS3 (W) was conducted from 1900hrs to 2300hrs on 28 September 2016. One concrete pump and two concrete lorry mixers were in operation. One no. of concrete lorry mixer was located at the East of TS3 (W) and one no. of concrete lorry mixer was located at the west of TS3 (W). Concreting for tunnel structure in TS3 (W) was conducted from 1900hrs to 2300hrs on 04 October 2016. One concrete pump and two concrete lorry mixers were in operation. One no. of concrete lorry mixer was located at the East of TS3 (W) and one no. of concrete lorry mixer was located at the west of TS3 (W).</p> <p>Based on the site records confirmed by RSS, concreting for tunnel structure in TS3 (W) was conducted from 1900hrs to 2300hrs on 28 September 2016 and from 1900hrs to 2300hrs on 04 October 2016 and total one concrete pump and two concrete lorry mixers were in operation during the above concerned periods. One no. of concrete lorry mixer was located at the East of TS3 (W) and one no. of concrete lorry mixer was located at the west of TS3(W) during the above concerned periods and relevant Construction Noise Permit</p>	The interim investigation report was submitted to EPD on 18 October 2016.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>GW-RS0434-16 and GW-RS0407-16 were in place for the construction works conducted during the above concerned periods.</p> <p>Nevertheless, in view of the public concern, the Contractor of HY/2010/08 was reminded to maintain the site control system for construction works carried out during restricted hours to ensure the PMEs deployed are in compliance with relevant Construction Noise Permit. The Contractor of HY/2010/08 was also reminded to maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public.</p>	
EPD Ref: H05/RS/0002 9722-16 dated 22 November 2016	15 Nov 2016	A public complaint referred by EPD received by ET on 22 November 2016	Construction Site near Wanchai Ferry Pier	Noise was emanated in the Chun Wo – CRGLJV construction site near Wanchai Ferry Pier till late night and caused nuisance to nearby sensitive receivers.	<p>An EPD complaint regarding noise nuisance referred by EPD was received by ET on 22 November 2016 (EPD Ref: H05/RS/00029722-16 dated 22 November 2016). The complainant reported that noise was emanated in the Chun Wo – CRGLJV construction site near Wanchai Ferry Pier till late night and caused nuisance to nearby sensitive receivers.</p> <p>ET confirmed with the Resident Site Staff that Excavation works at Portion 5 was conducted under Contract HK/2009/02 at Portion 5 area (West of Wan Chai Ferry Pier) from 1900hrs to 2300hrs on 14 November 2016. Total two crawler cranes, two excavators and two generators were operated at ground level and four excavators were operated below ground level. No construction activity was conducted under Contract HK/2009/02 from 2300hrs on 14 November 2016 to 0700hrs on 15 November 2016. Total two generators were operated at ground level for lighting illumination of Portion 5.</p>	Interim investigation report submitted to EPD on 29 November 2016.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>According to information provided by RSS, excavation works at Portion 5 was conducted under Contract HK/2009/02 at Portion 5 area (West of Wan Chai Ferry Pier) from 1900hrs to 2300hrs on 14 November 2016. Total two crawler cranes and two excavators were operated at ground level and four excavators were operated below ground level. Two generators were operated at ground level. Based on review on site information, relevant Construction Noise Permits GW-RS0593-15 for the above construction activities and above operation of the generators were confirmed in place. No construction activity was conducted under Contract HK/2009/02 from 2300hrs on 14 November 2016 to 0700hrs on 15 November 2016 and two generators were operated at ground level for lighting illumination of Portion 5.</p> <p>In view of the public concern, the Contractor of HK/2009/02 confirmed that the two generators for lighting power supply at ground level after 2300hrs had been suspended and replaced by other two generators located below ground level at Portion 5 area since 23 November 2016 to minimize the noise impact to the surroundings. In addition, the Contractor of HK/2009/02 was reminded to upkeep the site control system for construction works carried out during restricted hours and night time for Construction Noise Permit compliance and maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public. Also, the Contractor of HK/2009/02 was recommended to review the enhancement noise mitigation measure to be adopted for the generators deployed at ground level before 2300hrs to alleviate potential noise concern to the surroundings.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
EPD ref: H08/RS/0003 0890-16 dated 07 December 2016	24 Nov 2016	A public complaint referred by EPD received by ET on 07 December 2016	Construction Site at Victoria Park	Noise emanated from the construction site at Victoria Park after 1900hrs.	<p>A public complaint referred by EPD was received by ET on 07 December 2016 (Case Ref.: H08/RS/00030890-16). The complainant reported that Noise was emanated in the construction site near Victoria Park after 19:00 and caused nuisance to nearby sensitive receivers on 24 November 2016. ET confirmed with the Resident Site Staff that welding works for the tie-rod for the vertical blinding concrete was undertaken by the Contractor of HY/2010/08 at the construction site in the Victoria Park from 1900hrs to 2300hrs on 24 November 2016. Total 3 nos. of welding machines (electric), 3 nos. of water pumps (electric) and 1 no. of AquaSED were in operation.</p> <p>Based on the site records confirmed by RSS, welding works for the tie-rod for the vertical blinding concrete was undertaken by the Contractor of HY/2010/08 at the construction site in the Victoria Park from 1900hrs to 2300hrs on 24 November 2016. Total 3 nos. of welding machines (electric), 3 nos. of water pumps (electric) and 1 no. of AquaSED were in operation and relevant Construction Noise Permit GW-RS0930-16 was in place for the construction works conducted during the above concerned period. In addition, according to relevant site information confirmed by RSS, the welding machines, water pumps and AquaSED were connected to and powered by Hong Kong Electric power grid. Nevertheless, in view of the public concern, the Contractor of HY/2010/08 was reminded to maintain the site control system for construction works carried out during restricted hours to ensure the PMEs deployed are in compliance with relevant Construction Noise Permit. The Contractor of HY/2010/08 was also reminded to maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public.</p>	Investigation report submitted to EPD on 16 December 2016. Under EPD review



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
EPD complaint H08/RS/000 01175-17 dated 16 January 2016	10 January 2017	A public complaint referred by EPD received by ET on 16 January 2017	Causeway Bay Typhoon Shelter	Construction work at the reclamation site in Causeway Bay Typhoon Shelter area (Under the Island Eastern Corridor) was found after 1900hrs on 10 January 2017 and the concrete lorry mixer and concrete pump may not comply with the Construction Noise Permit	<p>A public complaint referred by EPD was received by ET on 16 January 2017 (Case Ref.: H08/RS/00001175-17). The complainant reported that construction work at the reclamation site in Causeway Bay Typhoon Shelter area (Under the Island Eastern Corridor) was found after 1900hrs on 10 January 2017. The complainant reported that there were 3 concrete pumps and around 10 concrete lorry mixers operating at the above site during the said period which may not comply with the Construction Noise Permit.</p> <p>ET confirmed with the Resident Site Staff that concreting of tunnel structure was conducted under Contract HY/2010/08 at Temporary Reclamation Area TS3 between 1900hrs and 2000hrs on 10 January 2017.</p> <p>Total 3 nos. of Lorry Mounted Concrete Pumps and 6 nos. of Concrete Lorry Mixers were operated at TS3 while temporary noise barrier was provided for 2 nos. of the operating Lorry Mounted Concrete Pumps and 4 nos. of the operating Concrete Lorry Mixers. Total 1 no. of Concrete Lorry Mixer was at stand-by within TS3 Works area.</p> <p>Concreting of tunnel structure was conducted under Contract HY/2010/08 at Temporary Reclamation Area TS3 between 2000hrs and 2030hrs 10 January 2017. Total 2 nos. of Lorry Mounted Concrete Pump and 4 nos. of Concrete Lorry Mixers were operated at TS3 while temporary noise barrier was provided for 1 no. of the operating Lorry Mounted Concrete Pumps and 2 nos. of the operating Concrete Lorry Mixers. Total 1 no. of Concrete Lorry Mixer was at stand-by within TS3 Works area.</p>	Interim investigation report submitted to EPD on 03 February 2017.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Concreting of tunnel structure was conducted under Contract HY/2010/08 at Temporary Reclamation Area TS3 between 2030hrs and 2300hrs 10 January 2017. Total 1 no. of Lorry Mounted Concrete Pump and 2 nos. of Concrete Lorry Mixers were operated at TS3.</p> <p>Based on the site records confirmed by RSS, concreting of tunnel structure was conducted under Contract HY/2010/08 at Temporary Reclamation Area TS3 between 1900hrs and 2300hrs on 10 January 2017. From 1900hrs to 2000hrs, total 3 nos. of Lorry Mounted Concrete Pumps and 6 nos. of Concrete Lorry Mixers while temporary noise barrier was provided for 2 nos. of the operating Lorry Mounted Concrete Pumps and 4 nos. of the operating Concrete Lorry Mixers. Total 1 no. of Concrete Lorry Mixer was at stand-by within TS3 Works area.</p> <p>From 2000hrs to 2030hrs, total 2 nos. of Lorry Mounted Concrete Pump and 4 nos. of Concrete Lorry Mixers were operated at TS3 while temporary noise barrier was provided for 1 no. of the operating Lorry Mounted Concrete Pumps and 2 nos. of the operating Concrete Lorry Mixers. Total 1 no. of Concrete Lorry Mixer was at stand-by within TS3 Works area.</p> <p>From 2030hrs to 2300hrs, total 1 no. of Lorry Mounted Concrete Pump and 2 nos. of Concrete Lorry Mixers were operated at TS3.</p> <p>Relevant Construction Noise Permit GW-RS1232-16 (Corresponding PME Groups operated include Group M, Group K and Group H) was in place for the construction works conducted during the above concerned periods and based on RSS information, a designated personnel on-site was responsible for controlling and supervising the switching between PME Groups. Meanwhile, there</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>is no sufficient information to conclude if the concerned PME(s) (Concrete Lorry Mixer and Lorry Mounted Concrete Pump) deployed behind the temporary noise barrier provided were not visible to nearby sensitive receivers.</p> <p>As multiple PME grouping under the Construction Noise Permit are involved, the Contractor of HY/2010/08 was reminded to strictly follow the site control system for construction works carried out during restricted hours to ensure the PMEs deployed are in strict compliance with relevant Construction Noise Permit. The Contractor of HY/2010/08 was also reminded to maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public.</p>	
ICC complaint case (Ref: #2-3218844776) dated 23 December 2017	22 Dec 2016	ICC complaint case referred by RSS received by ET on 18 January 2017	Construction Site Gate Exit near Expo Drive East	No wheel washing from CEDD work site, no supervision from the Resident Site Staff, mud was dispersed on the road and flush to the communal drain by Chun Wo-China Railway JV HK/2009/02.	<p>A public complaint regarding the subject matter on wheel washing referred by RSS was received by ET on 18 January 2017 (ICC Ref: #2-3218844776). The complainant reported that no wheel washing from CEDD work site, no supervision from the Resident Site Staff, mud was dispersed on the road and flush to the communal drain by Chun Wo-China Railway JV HK/2009/02.</p> <p>ET confirmed with the Resident Site Staff that the concerned location was Site Exit Gate No. 6 at Expo Drive East operated and maintained under HK/2009/02 on 22 December 2016. Site measures including provision of wheel washing facility was implemented by the Contractor of HK/2009/02 on the concerned date.</p> <p>According to information provided by RSS, the concerned location was Site Exit Gate No. 6 at Expo Drive East operated and maintained under HK/2009/02 on 22 December 2016. In view of the environmental concern, remedial measures including i) instructing all workers to conduct wheel</p>	Final investigation report issued on 23 January 2017.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>washing within the designated location with collection pit to prevent overflow of washing effluent and ii) manual removal of dirt/silt by worker instead of water flushing in case of dirt/muddy trail found on road were implemented by the Contractor on 28 December 2016. Also, the Contractor of HK/2009/02 was further reminded by the WDII RSS to maintain proper wheel washing facilities at Gate No.6 and inspect regularly to ensure that all vehicles leaving the site to public roads are free of mud.</p> <p>Nevertheless, the Environmental Team further reminded the Contractor on 04 January 2017 that site measures including i) wheel washing operation shall be conducted at the designated location behind the backfall to avoid overflow of washing effluent onto public road ii) any silt/ soil deposited of the public road shall be cleared manually shall be strictly followed and relevant remedial actions were taken by the Contractor of HK/2009/02 on 04 January 2017.</p> <p>According to site inspection conducted on 17 January 2017, the concerned site exit Gate No.6 was maintained in proper condition, no silt/ mud deposition was observed on the public road and wheel washing was conducted by the Contractor of HK/2009/02 at the designated location within the construction site to avoid overflow of washing effluent onto nearby public road.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
ICC complaint case (Ref: #2-3512033936) dated 20 February 2017	20 February 2017	ICC complaint case referred by RSS received by ET on 24 February 2017	Victoria Park Swimming Pool	Noise was emanated from the construction site near Victoria Park Swimming Pool between 2300hrs to 2400hrs in the past months and caused nuisance.	<p>An ICC complaint referred by RSS was received by ET on 24 February 2017 (CASE#2-3512033936). The complainant reported that noise was emanated from the construction site near Victoria Park Swimming Pool between 2300hrs to 2400hrs in the past months and caused nuisance. ET confirmed with the Resident Site Staff that no works was conducted under Contract HY/2010/08 near Victoria Park Swimming Pool (Hing Fat Street) during the restricted hours (from 1900hrs to 0700hrs on the following day) from 21 December 2016 to 20 February 2017.</p> <p>No works was conducted under Contract HY/2010/08 near Victoria Park Swimming Pool (Hing Fat Street) during the restricted hours (from 1900hrs to 0700hrs on the following day) from 21 December 2016 to 20 February 2017.</p> <p>Nevertheless, in view of the public concern, the Contractor of HY/2010/08 was reminded to maintain the site control system for construction works carried out during restricted hours to ensure the PMEs deployed are in compliance with relevant Construction Noise Permit. The Contractor of HY/2010/08 was also reminded to maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public.</p>	Final Investigation Report issued on 02 March 2017 and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
ICC complaint case (Ref: #2-351547483 1) dated 21 February 2017	21 February 2017	ICC complaint case referred by RSS received by ET on 24 February 2017	Construction Site near Victoria Park Swimming Park and Causeway Bay Typhoon Shelter	Noise was emanated from the construction site near Victoria Park Swimming Pool between 2300hrs to 2400hrs in the past months and caused nuisance.	<p>An ICC complaint referred by RSS was received by ET on 24 February 2017 (CASE#2-3515474831). The complainant reported that noise was emanated from the construction site near Victoria Park Swimming Pool and Causeway Bay Typhoon Shelter between 1900hrs to 2400hrs in the past months and caused nuisance.</p> <p>ET confirmed with the Resident Site Staff that concreting of tunnel structure at Temporary Reclamation Area TS3 were conducted under Contract HY/2010/08 between 1900hrs and 2300hrs on 13, 14, 15, 16 and 18 February 2017. Total 3 nos. of concrete pump and 6 nos. of concrete lorry mixers were operated.</p> <p>Concreting of tunnel structure at Temporary Reclamation Area TS3 were conducted under Contract HY/2010/08 between 1900hrs and 2100hrs on 21 February 2017. Total 3 nos. of concrete pump and 6 nos. of concrete lorry mixers were operated. Concreting of tunnel structure at Zone C was conducted under Contract HY/2010/08 between 1900hrs to 2300hrs on 17 and 20 February 2017. Total 1 no. of concrete pump and 2 nos. of concrete mixers were operated. Bar bending at Zone C was conducted under Contract HY/2010/08 between 1900hrs to 2300hrs on 13, 14, 15, 16, 18 and 19 February 2017. Total 1 no. bar bender and cutter was operated. No works was conducted under Contract HY/2010/08 near Victoria Park Swimming Pool (Hing Fat Street) during the restricted hours (from 1900hrs to 0700hrs on the following day) across the period from 13 February 2017 to 21 February 2017.</p> <p>Based on the site records confirmed by RSS, no works was conducted under Contract HY/2010/08</p>	Final Investigation Report issued on 07 March 2017 and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>near Victoria Park Swimming Pool (Hing Fat Street) during the restricted hours (from 1900hrs to 0700hrs on the following day) from 13 February 2017 to 20 February 2017. Concreting of tunnel structure at Temporary Reclamation Area TS3 was conducted under Contract HY/2010/08 between 1900hrs and 2300hrs on 13, 14, 15, 16 and 18 February 2017 and total 3 nos. of concrete pumps and 6 nos. of concrete lorry mixers were operated. Concreting of tunnel structure at Temporary Reclamation Area TS3 were conducted under Contract HY/2010/08 between 1900hrs and 2100hrs on 21 February 2017 and total 3 nos. of concrete pump and 6 nos. of concrete lorry mixers were operated. Relevant Construction Noise Permit GW-RS0029-17 was in place while it is considered that there is no sufficient information to indicate whether the Powered Mechanical Equipment were deployed at the designed location stipulated under the relevant Construction Noise Permit with noise mitigation measures required.</p> <p>Concreting of tunnel structure at Zone C was conducted under Contract HY/2010/08 between 1900hrs to 2300hrs on 17 and 20 February 2017. Total 1 no. of concrete pump and 2 nos. concrete mixers were operated. Bar bending at Zone C was conducted under Contract HY/2010/08 between 1900hrs to 2300hrs on 13, 14, 15, 16, 18 and 19 February 2017 and total 1 no. bar bender and cutter was operated. Relevant Construction Noise Permit GW-RS1366-13 was in place while it is considered that there is no sufficient information to indicate whether the Powered Mechanical Equipment were deployed at the designed location stipulated under the relevant Construction Noise Permit with noise mitigation measures required.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Nevertheless, further to the joint ad-hoc inspection conducted by the ET/IEC on 13 February 2017 during restricted hours (between 1900hrs to 2200hrs), concurrent operations of 4 nos. of concrete lorry trucks at the Southern Side of TS3 near Construction Site Entrance and concurrent operations of 2 nos. of concrete lorry pumps and 2 nos. of concrete lorry truck at Western and Northern Side of TS3 were observed while the temporary noise barrier provided for the concrete lorry pump and concrete lorry truck at the Northern Side of TS3 could not screen entirely the concrete lorry truck and concrete lorry pump (Located at Northern Side of TS3) from nearby sensitive receivers. Therefore, it is considered that the above operations observed could not follow the PME grouping requirement and the specific condition 3.d.4 under the relevant Construction Noise Permit.</p> <p>In view of the above, the Contractor of HY/2010/08 was advised to enhance the site supervision and strictly implement the site control system for construction works carried out during restricted hours to ensure the PMEs deployed strictly comply with relevant Construction Noise Permit. The Contractor of HY/2010/08 was also reminded to maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
ICC complaint case (Ref: #2-3521097579) dated 22 February 2017	22 February 2017	ICC complaint case referred by RSS received by ET on 27 February 2017	Construction Site at Victoria Harbour near Victoria Park	Noise was emanated from the construction Site at Victoria Harbour near Victoria Park from 0000hrs to 0200hrs on Tuesday and caused nuisance and Concrete Lorry was observed on scene.	<p>An ICC complaint referred by RSS was received by ET on 27 February 2017 (CASE#2-3521097579). The complainant reported that noise was emanated from the construction Site at Victoria Harbour near Victoria Park from 0000hrs to 0200hrs on Tuesday and caused nuisance and Concrete Lorry was observed on scene.</p> <p>ET confirmed with the Resident Site Staff that no construction work was conducted under HY/2010/08 at Zone C (Victoria Park Road) and Temporary Reclamation Area Zone between 0000hrs to 0200hrs on 21 February 2017 and between 0000hrs to 0200hrs on 22 February 2017.</p> <p>No construction work was conducted under HY/2010/08 at Zone C (Victoria Park Road) and Temporary Reclamation Area Zone between 0000hrs to 0200hrs on 21 February 2017 and between 0000hrs to 0200hrs on 22 February 2017.</p> <p>Nevertheless, in view of the public concern, the Contractor of HY/2010/08 was reminded to maintain the site control system for construction works carried out during restricted hours to ensure the PMEs deployed are in compliance with relevant Construction Noise Permit. The Contractor of HY/2010/08 was also reminded to maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public.</p>	Final Investigation Report issued on 02 March 2017 and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
ICC Complaint Case (CASE #2-3576157538 dated 05 March 2017)	05 March 2017	ICC complaint referred by RSS was received by ET on 06 March 2017	Construction works area under Contract HK/2009/02 for Wanchai Development Phase II	Noise was emanated from the construction works under Contract HK/2009/02 for Wanchai Development Phase II on 05 March 2017 and potential violation of ordinance was suspected.	<p>An ICC complaint referred by RSS was received by ET on 06 March 2017 (CASE#2-3576157538). The complainant reported that noise was emanated from the construction works under Contract HK/2009/02 for Wanchai Development Phase II on 05 March 2017 and potential violation of ordinance was suspected.</p> <p>ET confirmed with the Resident Site Staff that no works was conducted under Contract HK/2009/02 from 0000hrs to 0830hrs on 05 March 2017. Removal ELS waling at Portion 5 (West of WanChai Ferry Pier) was conducted under Contract HK/2009/02 from 0830hrs to 1700hrs on 05 March 2017. Total 2 nos. of crawler cranes were in operation at ground level.</p> <p>Tunnel backfilling and construction of temporary walls at Portions 3&4 (Near Wan Shing Street) were conducted under Contract HK/2009/02 from 0830hrs to 1700hrs. Total 1 no. of excavator and 1 no. of dump truck were in operation at ground level and 2 nos. of excavator and 1 no. of loader were in operation below ground level.</p> <p>According to the information confirmed by RSS, no works was conducted under Contract HK/2009/02 from 0000hrs to 0830hrs on 05 March 2017. Removal ELS waling at Portion 5 (West of WanChai Ferry Pier) was conducted under Contract HK/2009/02 from 0830hrs to 1700hrs on 05 March 2017. Total 2 nos. of crawler cranes were in operation at ground level. Tunnel backfilling and construction of temporary walls at Portions 3&4 (Near Wan Shing Street) were conducted under Contract HK/2009/02 from 0830hrs to 1700hrs. Total 1 no. of excavator and 1 no. of dump truck were in operation at ground level and 2 nos. of excavator and 1 loader were in operation below</p>	Investigation report issued on 10 March 2017 and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>ground level. Relevant Construction Noise Permit GW-RS1305-16 was in place.</p> <p>Nevertheless, in view of the public concern, the Contractor of HK/2009/02 was reminded to maintain the site control system for construction works carried out during restricted hours to ensure the PMEs deployed are in compliance with relevant Construction Noise Permit. The Contractor of HK/2009/02 was also reminded to maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public.</p>	
EPD complaint (Case Ref: H05/RS/00 06240-17)	05 March 2017	EPD complaint referred by RSS was received by ET on 14 March 2017. EPD clarified the complaint case shall be referred by ICC Complaint Hotline (CASE #2-3576157538)	Construction works area under Contract HK/2009/02 for Wanchai Development Phase II	Noise was emanated from the construction works under Contract HK/2009/02 for Wanchai Development Phase II on 05 March 2017 and potential violation of ordinance was suspected.	<p>A EPD complaint was referred to the ET on 14 March 2017 (CASE Ref: H05/RS/0006240-17). The complainant reported that noise was emanated from the construction works under Contract HK/2009/02 for Wanchai Development Phase II on 05 March 2017 and potential violation of ordinance was suspected.</p> <p>ET confirmed with the Resident Site Staff that no works was conducted under Contract HK/2009/02 from 0000hrs to 0830hrs on 05 March 2017. Removal ELS waling at Portion 5 (West of WanChai Ferry Pier) was conducted under Contract HK/2009/02 from 0830hrs to 1700hrs on 05 March 2017. Total 2 nos. of crawler cranes were in operation at ground level.</p> <p>Tunnel backfilling and construction of temporary walls at Portions 3&4 (Near Wan Shing Street) were conducted under Contract HK/2009/02 from 0830hrs to 1700hrs. Total 1 no. of excavator and 1 no. of dump truck were in operation at ground level and 2 nos. of excavator and 1 no. of loader were in operation below ground level.</p>	<p>Interim Investigation report issued on 10 March 2017 and case closed.</p> <p>EPD advised no comment on 09 Oct 2017 on the interim report submitted and case closed</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>According to the information confirmed by RSS, no works was conducted under Contract HK/2009/02 from 0000hrs to 0830hrs on 05 March 2017. Removal ELS waling at Portion 5 (West of WanChai Ferry Pier) was conducted under Contract HK/2009/02 from 0830hrs to 1700hrs on 05 March 2017. Total 2 nos. of crawler cranes were in operation at ground level. Tunnel backfilling and construction of temporary walls at Portions 3&4 (Near Wan Shing Street) were conducted under Contract HK/2009/02 from 0830hrs to 1700hrs. Total 1 no. of excavator and 1 no. of dump truck were in operation at ground level and 2 nos. of excavator and 1 loader were in operation below ground level. Relevant Construction Noise Permit GW-RS1305-16 was in place.</p> <p>Nevertheless, in view of the public concern, the Contractor of HK/2009/02 was reminded to maintain the site control system for construction works carried out during restricted hours to ensure the PMEs deployed are in compliance with relevant Construction Noise Permit. The Contractor of HK/2009/02 was also reminded to maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public.</p>	
ICC complaint Case (CASE#2-3603182890) dated 10 March 2017	10 March 2017	An ICC complaint referred by RSS was received by ET on 13 March 2017	Construction Site at Victoria Park	Noise was emanated from the construction Site at Victoria Park from 2300hrs to 2400hrs on 10 March 2017 and caused nuisance to nearby residents.	<p>An ICC complaint referred by RSS was received by ET on 13 March 2017 (CASE#2-3603182890). The complainant reported that noise was emanated from the construction Site at Victoria Park from 2300hrs to 2400hrs on 10 March 2017 and caused nuisance to nearby residents.</p> <p>ET confirmed with the Resident Site Staff that no construction work was conducted under Contract HY/2010/08 at Victoria Park at from 2300hrs to 2400hrs on 10 March 2017.</p>	Investigation Report issued on 15 March 2017 and case closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Based on the information provided by the RSS, no construction work was conducted under Contract HY/2010/08 at Victoria Park at from 2300hrs to 2400hrs on 10 March 2017.</p> <p>Nevertheless, in view of the public concern, the Contractor of HY/2010/08 was reminded to maintain the site control system for construction works carried out during restricted hours to ensure the PMEs deployed are in compliance with relevant Construction Noise Permit. The Contractor of HY/2010/08 was also reminded to maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public.</p>	
EPD complaint Case (CASE Ref: H05/RS/00 014415-17(14448-17) dated 18 May 2017	11 May 2017	An EPD complaint referred to ET on 18 May 2017	Construction Site under Contract HK/2009/02	<p>Construction work was found on 10 May 2017 (~03:52) that caused noise nuisance.</p> <p>According to the information provided by the IEC on 11 May 2017 and 15 May 2017, it was alleged that the concreting work under Contract No. HK/2009/02 was carried out for the Central-Wan Chai Bypass Top Slab Bay 6 during night time on 09 May 2017 and early morning on 10 May 2017 (between 11:00pm on 09 May 2017 and about 04:00 a.m. on 10 May 2017) with 3 pump trucks, 10 vibrating pokers, 9 concrete trucks and 2 generators in operation.</p>	<p>An EPD complaint was referred to the ET on 18 May 2017 (CASE Ref: H05/RS/00014415-17(14448-17)). The complainant reported that:</p> <p>Construction work was found on 10 May 2017 (~03:52) that caused noise nuisance. According to the photos provided by the complainant lorry mounted concrete pump were used. According to the information provided by the IEC on 11 May 2017 and 15 May 2017, it was alleged that the concreting work under Contract No. HK/2009/02 was carried out for the Central-Wan Chai Bypass Top Slab Bay 6 during night time on 09 May 2017 and early morning on 10 May 2017 (between 11:00pm on 09 May 2017 and about 04:00 a.m. on 10 May 2017) with 3 pump trucks, 10 vibrating pokers, 9 concrete trucks and 2 generators in operation. The concreting works under Contract No. CEDD HK/2009/02 was also carried out for the Central – Wan Chai Bypass Bay 10A OHVS Slab after 23:00 on 12 May 2017 (after 23:00) with 1 Pump truck, 2 vibrating pokers, 1 concrete trucks and 3 generators in operation.</p>	<p>Interim Investigation report submitted to EPD on 26 May 2017.</p> <p>EPD advised no comment on 09 Oct 2017 on the interim report submitted and case closed</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
				<p>The concreting works under Contract No. CEDD HK/2009/02 was also carried out for the Central – Wan Chai Bypass Bay 10A OHVS Slab after 23:00 on 12 May 2017 (after 23:00) with 1 Pump truck, 2 vibrating pokers, 1 concrete trucks and 3 generators in operation.</p>	<p>ET confirmed with the Resident Site Staff that 10 nos. of vibratory pokers, 3 nos. of concrete pump trucks and 3 nos. of generators were in operation at Tunnel Portion 5, Top Slab 6 from 2300hrs on 09 May 2017 to 0408hrs on 10 May 2017 while 9 nos. of concrete trucks were in operation at around 0320hrs on 10 May 2017.</p> <p>2 nos. of vibratory pokers, 1 no. of concrete truck, 1 no. of concrete pump truck, and 3 nos. of generators were in operation at Tunnel Portion 5, Top Slab 6 from 2300hrs on 12 May 2017 to 2340hrs on 12 May 2017.</p> <p>According to the RSS site information, 10 nos. of vibratory pokers, 3 nos. of concrete pump trucks and 3 nos. of generator were in operation at Tunnel Portion 5, Top Slab 6 from 2300hrs on 09 May 2017 to 0408hrs on 10 May 2017 while 9 nos. of concrete trucks were in operation at around 0320hrs on 10 May 2017 and the above construction operations could not comply with the item 3a - PME requirement under the Construction Noise Permit GW-RS1297-16. In response to the information provided by the RSS/ IEC on 11 May 2017, ad-hoc inspection was conducted by the Environmental Team on 13 May 2017 around 00:40 hrs. No construction operation and no PME deployment was observed at the time of inspection.</p> <p>According to the RSS site information, 2 nos. of vibratory pokers, 1 no. of concrete pump truck, and 3 nos. of generators were in operation at Tunnel Portion 5, Top Slab 6 from 2300hrs on 12 May 2017 to 2340hrs on 12 May 2017 and could not comply with the item 3a - PME requirement under Construction Noise Permit GW-RS1297-16. In response to the information provided by the RSS/ IEC on 15 May 2017, ad-hoc inspection was conducted by the Environmental Team on 19 May</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>2017 around 22:20hrs. 2 nos. of concrete truck, 1 no. of concrete pump tuck were observed in operation at the time of inspection and relevant CNP GW-RS0334-17 was in place.</p> <p>Notwithstanding the above, in view of the identified non-conformance, the Contractor of HK/2009/02 was requested to implement the following rectification measures to ensure the strict construction noise permit compliance including i) fully review Construction Noise Permit in force and the tentative construction operations to ensure the strict Construction Noise Permit compliance under Noise Control Ordinance, ii) fully review the site control system for construction works carried out during restricted hours to ensure the PMEs deployed are in compliance with relevant Construction Noise Permit and iii) review the construction sequence and schedule to ensure the construction operations and PME are operated in accordance to relevant Construction Noise Period within the specified allowable period. The Contractor of HK/2009/02 is also recommended to provide briefing and training section to site staffs to enhance the site awareness and understanding on relevant construction noise permit(s) requirement during restricted hours.</p> <p>The ET/IEC/RSS will maintain ad hoc checking on the construction operations under Contract HK/2009/02 during restricted hours and report relevant findings, if any, accordingly.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
EPD complaint Case (CASE Ref: N/A) dated 23 May 2017	23 May 2017	An EPD complaint referred to ET on 25 May 2017	Construction Site under Contract HK/2009/02	Concreting works under Contract No. CEDD HK/2009/02 was carried out with crawler cranes, 10-12 vibratory pokers, and 7 concrete lorry mixers in the morning on 21 May 2017 without a valid CNP. Also, at 15:30 on 21 May 2017, 9 vibratory pokers and 7 concrete lorry mixers were observed in operation. These works were suspected to contravene the Noise Control Ordinance (NCO).	<p>An EPD complaint was referred to the ET on 25 May 2017 (CASE Ref: N/A). The complainant reported that concreting works under Contract No. CEDD HK/2009/02 was carried out with crawler cranes, 10-12 vibratory pokers, and 7 concrete lorry mixers in the morning on 21 May 2017 without a valid CNP. Also, at 15:30 on 21 May 2017, 9 vibratory pokers and 7 concrete lorry mixers were observed in operation. These works were suspected to contravene the Noise Control Ordinance (NCO).</p> <p>ET confirmed with the Resident Site Staff that 12 nos. of vibratory pokers were operated at Tunnel Portion 5 from 0730hrs to 1740hrs on 21 May 2017. 3 nos. of crawler cranes were operated at Tunnel Portion 5 from 0800hrs to 0915hrs on 21 May 2017. 3 nos. of crawler cranes were operated at Tunnel Portion 5 from 0915hrs to 1030hrs on 21 May 2017. 4 nos. of concrete pump trucks were operated at Tunnel Portion 5 from 0750hrs to 1650hrs on 21 May 2017. 4 nos. of generators were operated at Tunnel Portion 5 from 0730hrs to 1740hrs on 21 May 2017. 7 nos. of concreting trucks were operated at intervals between the time period of 0730hrs to 1740hrs on 21 May 2017.</p> <p>According to the RSS site information, the following PME were operated on 21 May 2017, i) 12 nos. of vibratory pokers were operated at Tunnel Portion 5 from 0730hrs to 1740hrs; ii) 3 nos. of crawler cranes were operated at Tunnel Portion 5 from 0800hrs to 0915hrs; iii) 3 nos. of crawler cranes were operated at Tunnel Portion 5 from 0915hrs to 1030hrs on 21 May 2017; iv) 4 nos. of concrete pump trucks were operated at Tunnel Portion 5 from 0750hrs to 1650hrs; v) 4 nos. of generators were operated at Tunnel Portion 5 from 0730hrs to 1740hrs ;) 7 nos. of concreting trucks were</p>	<p>Investigation report submitted to EPD on 02 June 2017.</p> <p>EPD advised no comment on 09 Oct 2017 on the interim report submitted and case closed</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>operated at intervals between the time period of 0730hrs to 1740hrs on 21 May 2017 and the above construction operations could not comply with the item 3a - PME requirement under the Construction Noise Permit GW-RS334-17.</p> <p>EPD notification on the cancellation of the Construction Noise Permits GW-RS0334-17 and Construction Noise Permit GW-RS1297-16 was received by the Environmental Team on 26 May 2017. Ad hoc inspection was conducted by the Environmental Team on 26 May 2017 around 2230hrs and on 28 May 2017 around 1520hrs and no construction works and no operation of PME was observed at the concerned site Portion 5 at the time of inspections. Notwithstanding the above, in view of the identified non-conformance, the Contractor of HK/2009/02 was requested to implement the following rectification measures to ensure the strict construction noise permit compliance including i) fully review Construction Noise Permit in force and the tentative construction operations to ensure the strict Construction Noise Permit compliance under Noise Control Ordinance, ii) fully review the site control system for construction works carried out during restricted hours to ensure the PMEs deployed are in compliance with relevant Construction Noise Permit and iii) review the construction sequence and schedule to ensure the construction operations and PME are operated in accordance to relevant Construction Noise Period within the specified allowable period. The Contractor of HK/2009/02 is also recommended to provide briefing and training section to site staffs to enhance the site awareness and understanding on relevant construction noise permit(s) requirement during restricted hours.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
EPD complaint Case (CASE Ref: H05/RS/00 021311-17) dated 13 July 2017	07 July 2017	EPD complaint referred to ET on 13 July 2017	Construction site near Renaissance Hong Kong Harbour View Hotel	Construction work from a construction site near Renaissance Hong Kong Harbour View Hotel was found around 2315 hrs on 26 June 2017, causing noise nuisance.	<p>An EPD complaint was referred to the ET on 13 July 2017 (CASE Ref: H05/RS/00021311-17). The complainant reported that construction work from a construction site near Renaissance Hong Kong Harbour View Hotel was found around 2315 hrs on 26 June 2017, causing noise nuisance.</p> <p>ET confirmed with the Resident Site Staff that Manual re-bar fixing works was carried out under Contract HK/2009/02 from 2300hrs to 2330hrs on 26 June 2017 at Portion 5 Bay 15 (Non - Designated Area) top slab area adjacent to the covered walkway of the Wan Chai Ferry Pier. 1 no. of generator was operated at ground level and 2 nos. of generators were operated below ground level from 2300hrs to 2400hrs on 26 June 2017. In addition 16 electric water pump were operated below ground level from 2300hrs to 2400hrs on 26 June 2017.</p> <p>Notwithstanding the information stated in above item 1), according to relevant Resident Site Staff site record, it was recorded that 1 no. of mobile crane and 1 no. of bar bender were deployed and operated at Portion 5 area (West of Wan Chai Ferry Pier) under Contract HK/2009/02 after 2300hrs on 26 July 2017. Upon warning given by WDII Resident Site staff to the Contractor of HK/2009/02, the operation of crawler crane for lifting rebar and operation of bar bender machine were suspended at around 2315hrs on 26 June 2017.</p> <p>No construction activity and site operation was carried out under Contract HK/2009/01 from 2300hrs to 2400hrs on 26 June 2017.</p> <p>According to the RSS site information, manual re-bar fixing works was carried out under Contract HK/2009/02 from 2300hrs to 2330hrs on 26 June 2017 at Portion 5 Bay 15 (Non - Designated Area)</p>	<p>Interim investigation report submitted to EPD on 21 July 2017.</p> <p>EPD advised no comment on 09 Oct 2017 on the interim report submitted and case closed</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>top slab area adjacent to the covered walkway of the Wan Chai Ferry Pier. 1 no. of generator was operated at ground level and 2 nos. of generators were operated below ground level from 2300hrs to 2400hrs on 26 June 2017 while 16 electric water pump were operated below ground level at Portion 5 Bay from 2300hrs to 2400hrs on 26 June 2017 and the relevant Construction Noise Permit GW-RS0527-17 for the above operation was in place. However, site record on the model of generators deployed on the concerned night was not available.</p> <p>Notwithstanding the above, according to relevant Resident Site Staff site record, it was recorded that 1 no. of mobile crane and 1 no. of bar bender machine were deployed and operated at Portion 5 area (West of Wan Chai Ferry Pier) under Contract HK/2009/02 after 2300hrs on 26 July 2017 without a valid Construction Noise Permit. Upon warning given by WDII Resident Site staff to the Contractor of HK/2009/02, the operation of crawler crane for lifting rebar and operation of bar bender machine were suspended at around 2315hrs on 26 June 2017. According to Contractor of HK/2009/02, the operation bar bender machine was suspended upon warning by RSS team and the operation of crawler crane was suspended upon moving to a proper location to avoid obstruction for next day work.</p> <p>Meanwhile, no construction activity and site operation was carried out under Contract HK/2009/01 from 2300hrs to 2400hrs on 26 June 2017. In view of the above operation of powered mechanical equipment under Contract HK/2009/02 beyond 2300hrs, the Contractor of HK/2009/02 was required and urged to implement the following</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>remedial measures to ensure the strict construction noise permit compliance including:-</p> <p>Fully review the site control system for construction works carried out during restricted hours, in particular to ensure the frontline supervisors responsible for restricted hours construction operations are trained with comprehensive understanding on the requirement of the Construction Noise Permit in force to ensure the PMEs deployed are in compliance with relevant Construction Noise Permit.</p> <p>To assign delegated and competent personnel on-site to conduct checking on the deployment of PMEs on-site prior and during restricted hours to ensure only PMEs allowed under relevant Construction Noise Permit would be operated.</p> <p>In addition, the following preventive measures are also recommended including the Contractor of HK/2009/02 is recommended to provide regular briefing and training session to site staffs and frontline workers to enhance the workers awareness and understanding on relevant Construction Noise Permit(s) requirement during restricted hours.</p> <p>The Contractor of HK/2009/02 is recommended to review the construction operation planning procedures to ensure relevant PME(s) required for conducting the planned operation to ensure required PME are adequate considered and covered by relevant Construction Noise Permit.</p> <p>In view of the recent concern over restricted hours construction operations, a meeting was held amongst the CEDD, the RSS team, the Contractor of HK/2009/02 and the Environmental Team on 21 July 2017 to review the site control measures and enhancement measures to be adopted for restricted hours construction operations control for</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					Construction Noise Permit Compliance. A detailed implementation plan would be prepared by the Contractor of HK/2009/02 and further supplemented.	
EPD complaint Case (CASE Ref: H05/RS/00 022136-17) dated 17 July 2017 ICC complaint case (Ref: 2-4122021589) dated 14 July 2017	14 July 2017	EPD complaint referred to ET on 17 July 2017 ICC complaint referred to ET on 25 July 2017	Island Eastern Corridor near Provident Centre	Night time construction noise emanated from construction works conducted during early hours of 14 July 2017 at Island Eastern Corridor near Provident Centre.	<p>An EPD complaint was referred to the ET on 17 July 2017 (CASE Ref: H05/RS/00022136-17). The complainant reported that night time construction noise emanated from construction works conducted during early hours of 14 July 2017 at Island Eastern Corridor near Provident Centre.</p> <p>An ICC complaint case (Ref: 2-4122021589) was Referred to the ET on 25 July 2017. The complainant reported that the workers are now doing extremely noisy works at the Island Eastern Corridor near Provident Centre affecting the nearby residents.</p> <p>As the ICC complaint case refers to the noise concern at the same location at the same hours on the same date, hence the ICC case is considered as the same complaint case under the EPD complaint for investigation purpose.</p> <p>ET confirmed with the Resident Site Staff that emergency road repairing work including the repairing of movement joint at Pier 46 and three potholes along IEC Westbound was carried out under Contract HY/2009/19 around the concerned location from 0000hrs to 0600hrs on 14 July 2017. Total 1 no. of hand held breaker and 1 no. of hand held drill for grout mixing were operated.</p> <p>According to the RSS site information, emergency road repairing work including the repairing of movement joint at Pier 46 and three potholes along IEC Westbound was carried out under Contract HY/2009/19 around the concerned location from</p>	Interim report submitted to the EPD on 25 July 2017.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>0000hrs to 0600hrs on 14 July 2017. Total 1 no. of hand held breaker and 1 no. of hand held drill for grout mixing were operated. A written advance notification was issued to the EPD on 13 July 2017 regarding the aforesaid emergency road repairing works.</p> <p>In view of the public concern, the Contractor of HY/2009/19 is recommended to adopt additional noise mitigation measure for future emergency road repairing works, if any, at night time hours around the concerned location. In response to the public concern, the Contractor of HY/2009/19 would adopt the following additional measures for future emergency road repairing works including: i) For any emergency works requiring, for example, breaking or any other noisy activities, wherever possible, temporary noise barrier or acoustic mat will be use to fence of the line of sight between the noise emanating source and the NSR, ii) Covering breaking head with acoustic mat to minimize noise if breaking would be conducted and iii) complete noisy work as soon as possible to minimize disturbance to the nearby residents.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
EPD complaint Case (CASE Ref: H05/RS/00 022835-17) dated 21 July 2017	20 July 2017	EPD complaint referred to ET on 21 July 2017	Construction site near Renaissance Hong Kong Harbour View Hotel and Wanchai Pier	Mechanical noise was emanated from a construction site near Renaissance Hong Kong Harbour View Hotel and Wanchai Pier from late night till dawn recently, causing noise nuisance.	<p>An EPD complaint was referred to the ET on 21 July 2017 (CASE Ref: H05/RS/00022835-17). The complainant reported that mechanical noise was emanated from a construction site near Renaissance Hong Kong Harbour View Hotel and Wanchai Pier from late night till dawn recently, causing noise nuisance.</p> <p>ET confirmed with the Resident Site Staff that unloading of fill material was conducted under Contract HK/2009/02 at WCR3 area (West of Wan Chai Ferry Pier) from 2300hrs on 19 July 2017 to 0540hrs on 20 July 2017. 1 no. of grab dredger was operated for the above construction works.</p> <p>No construction activities or site operation was conducted under Contract HK/2009/01 from 2300hrs on 19 July 2019 to 0700hrs on 20 July 2017.</p> <p>According to the RSS site information, unloading of fill material was conducted under Contract HK/2009/02 at WCR3 area (West of Wan Chai Ferry Pier) from 2300hrs on 19 July 2017 to 0540hrs on 20 July 2017. 1 no. of grab dredger was operated for the above construction works and relevant Construction Noise Permit GW-RS0348-17 was in place and noise barrier with surface mass density of not less than 5kg/m² was provided to the power generating part of the grab dredger operated from 2300hrs on 19 July 2017 to 0540hrs on 20 July 2017. Meanwhile, no construction activities or site operation was conducted under Contract HK/2009/01 from 2300hrs on 19 July 2019 to 0700hrs on 20 July 2017.</p> <p>In view of the public concern, the Contractor of HK/2009/02 was reminded to upkeep the site</p>	<p>Interim report submitted to EPD on 26 July 2017.</p> <p>EPD advised no comment on 09 Oct 2017 on the interim report submitted and case closed</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					control system for construction works carried out during restricted hours and night time for Construction Noise Permit compliance and maintain regular maintenance of the plant and equipment deployed to avoid potential nuisance to the nearby public.	
ICC complaint Case (CASE Ref: #2-416246715 1) dated 25 July 2017	25 July 2017	ICC complaint referred to ET on 26 July 2017	CEDD Construction Site near Wanchai Ferry Pier	No watering system was provided to the excavation works conducted at a CEDD Construction Site near Wanchai Ferry Pier resulting in dust impact to the public area beyond site hoarding.	<p>An ICC complaint was referred to the ET on 26 July 2017 (CASE Ref: #2-4162467151). The complainant reported that no watering system was provided to the excavation works conducted at a CEDD Construction Site near Wanchai Ferry Pier resulting in dust impact to the public area beyond site hoarding.</p> <p>ET confirmed with the Resident Site Staff that breaking works and backfilling works were conducted under Contract HK/2009/02 at the concerned location on 25 July 2017 afternoon.</p> <p>Dust mitigation measures including water spraying was implemented for the above construction activities on 25 July 2017 at the concerned location.</p> <p>According to the RSS site information, breaking works and backfilling works were conducted under Contract HK/2009/02 at the concerned location on 25 July 2017 afternoon while dust mitigation measures including water spraying was implemented for the above construction activities on 25 July 2017 at the concerned location. During Environmental Team ad hoc inspection conducted on 26 July 2017, water spraying was found insufficient to mitigate the extended area of breaking operation and construction dust impact to surroundings public area was observed.</p>	Investigation report issued on 04 August 2017 and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Subsequently, Contractor of HK/2009/02 was reminded to enhance the dust suppression measure for the dust generating works.</p> <p>In response to the observed environmental concern, the Contractor of HK/2009/02 has strengthened the water spraying coverage to all breaking operation area and haul road to minimize the potential dust impact. Follow up inspection was conducted by Environmental Team on 27 July 2017 and no further dust impact was observed.</p>	
EPD complaint Case (CASE Ref: N/A) dated 06 September 2017	24 August 2017	EPD complaint referred to ET on 06 September 2017	Portion 5 (West of Wanchai Ferry Pier) under Contract HK/2009/02	Site inspection record regarding improper dust suppression measure during excavation	<p>EPD complaint regarding the inspection report issued by the EPD on 24 August 2017 on improper dust suppression measure during excavation was referred to the ET on 06 September 2017. As clarified with the EPD, the concerned location of the observation refers to Portion 5 (West of Wanchai Ferry Pier).</p> <p>ET confirmed with the Resident Site Staff that backfilling and compaction works were conducted under Contract HK/2009/02 for CWB Tunnel at the concerned location at Portion 5 (West of Wanchai Ferry Pier). According to RSS information, dust suppression measures including water spraying for stockpile stored on site was generally implemented by the Contractor of HK/2009/02 while it was observed and considered that the extent of water spraying was insufficient on 24 August 2017 at the aforesaid location.</p> <p>Follow up inspection was conducted by the Environmental Team on 08 September 2017. Concerned stockpile of dusty materials at the concerned location at Portion 5 was observed removed from site and mitigation measure including compaction and water spraying for exposed soil surface at Portion 5 were implemented and no particular dust impact was</p>	<p>Investigation report issued on 15 September 2017.</p> <p>EPD advised no comment on 09 Oct 2017 on the interim report submitted and case closed</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>observed at the concerned location at Portion 5. Subsequent follow up inspection was conducted by the Environmental Team on 11 September 2017. Exposed surface at construction site area Portion 5 was observed compacted and partially maintained in dampened condition. Despite no particular dust impact was observed, the Contractor of HK/2009/02 was further advised to review the site condition and adequately implement the following construction dust mitigation measures, as appropriate, to avoid potential dust impact to the surroundings:-</p> <p>Exposed earth shall be properly treated by compaction, turfing, hydro seeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabilizer within 6 months after the last construction activity on the construction site or part of the construction site where the exposed earth lies to avoid potential dust impact;</p> <p>Stockpile of dusty materials, if any, shall be either covered entirely by impervious sheeting; or placed in an area sheltered on the top and the 3 sides; or sprayed with water or a dust suppression chemical so as to maintain the entire surface wet and;</p> <p>Construction site surface with dusty materials should be sprayed with water to maintain entire surface wet to avoid potential dust impact to the surroundings.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
ICC complaint Case (CASE Ref: #2-4242073505) dated 18 September 2017	18 September 2017	ICC complaint referred to ET on 19 September 2017	A section of Island East Corridor opposite to Victoria Park	On recent Sundays during midnight hours, noise were emanated from road construction works and excavators for consecutive hours without any noise mitigation measures.	<p>ICC complaint referred by RSS was received by ET on 19 September 2017 (CASE#2-4242073505). The complainant reported that on recent Sundays during midnight hours, noise were emanated from road construction works and excavators for consecutive hours without any noise mitigation measures.</p> <p>ET confirmed with the Resident Site Staff that Reinstatement of movement joint at Island East Corridor Westbound Carriageway was conducted under Contract HY/2010/08 between 0000hrs to 0700hrs on 10 September 2017(Sunday) and 17 September 2017(Sunday). Powered Mechanical Equipment (PME) including 2 nos. of electric breakers, 2 nos. of portable generator, 1 no. of saw cut machine, 2 nos. of grab lorry, 1 no. of mini concrete mixer, 1 no. of welding set and 1 no. of poker vibrator were deployed in separate groups between 0000hrs to 0700hrs on 10 September 2017 and 17 September 2017. Amongst the above, 2 nos. of electric breakers and 1 no. of saw cut machine were operated only between 0000hrs to 0200hrs and 1 no. of poker vibrator was only operated beyond 0600hrs.</p> <p>Noise Mitigation measure including acoustic enclosure were provided locally for the use of electric breaker, portable generator and saw cut machine between 0000hrs to 0700hrs on 10 September 2017 and 17 September 2017.</p> <p>xix. ET confirmed with the Resident Site Staff that reinstatement of movement joint at Island East Corridor Westbound Carriageway was conducted under Contract HY/2010/08 between 0000hrs to 0700hrs on 10 September 2017(Sunday) and 17</p>	Final Investigation report issued on 30 September 2017 and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>September 2017(Sunday). Powered mechanical equipment (PME) including 2 nos. of electric breakers, 2 nos. of portable generator, 1 no. of saw cut machine, 2 nos. of grab lorry, 1 no. of mini concrete mixer, 1 no. of welding set and 1 no. of poker vibrator were deployed in separate PME groups between 0000hrs to 0700hrs on 10 September 2017 and 17 September 2017. Amongst the above, 2 nos. of electric breakers and 1 no. of saw cut machine were operated only between 0000hrs to 0200hrs and 1 no. of poker vibrator was only operated beyond 0600hrs on 10 and 17 September 2017. Noise Mitigation measure including acoustic enclosure were provided locally for the use of electric breaker, portable generator and saw cut machine between 0000hrs to 0700hrs on 10 September 2017 and 17 September 2017.</p> <p>Based on the site information, the aforesaid PMEs were deployed under the Construction Noise Permit GW-RS0697-17 while it was found the PMEs were deployed beyond the specified area under the Construction Noise Permit GW-RS0697-17. It was further found that operation of grab lorry for the removal of concrete debris was conducted beyond the specified period allowed under condition 4.d.2 of Construction Noise Permit GW-RS0697-17. Additionally, based on the site layout and the operation location of 2 nos. of electric breakers, it is considered that the operation of the two electric hand held breakers could not fulfil the condition 3.d.7. under Construction Noise Permit GW-RS0697-17.</p> <p>In view of the above findings, the Contractor of HY/2010/08 was requested to immediately</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					implement the following rectification measures to ensure the strict compliance with the Noise Control Ordinance including i) Critically review the Construction Noise Permit(s) in force and renew the Construction Noise Permit(s), if necessary, for the tentative construction operations to ensure the strict compliance with the Construction Noise Permit under Noise Control Ordinance, ii) Review the site control system for construction works carried out during restricted hours to ensure the PMEs deployed are in compliance with relevant Construction Noise Permit and iii) Fully review the construction method, sequence and schedule to ensure the construction operations and associated PMEs are operated within the specified allowable period in accordance with the relevant Construction Noise Permit.	
ICC complaint (CASE Ref: #2-4320996036) dated 08 November 2017	08 November 2017	An ICC complaint was referred by RSS to the ET on 13 November 2017	Construction works area opposite to City Garden Block 9	Noise was emanated from construction works during morning hours from 0300hrs to 0500hrs and metal hammering noise was still emanated at night time	<p>An ICC complaint was referred by RSS to the ET on 13 November 2017 (CASE Ref: #2-4320996036). The complainant reported that noise was emanated from construction works conducted opposite to City Garden Block 9 during morning hours from 0300hrs to 0500hrs and metal hammering noise was still emanated at night time causing nuisance to nearby residence.</p> <p>ET confirmed with the Resident Site Staff that night work including nut fixing works for post supporting bracket of noise enclosure was conducted under Contract HY/2009/19 at IECL westbound bridge Pier 40 around the concerned location from 0300hrs to 0500 hrs on 07 November 2017. Crane lorry for panel removal and hand tools for fixing of nuts were deployed with relevant Construction Noise Permit GW-RS0837-17. No construction works was conducted under Contract HY/2009/19 from 1900hrs to 2300hrs on 07 November 2017. Night work including nut fixing works for post supporting bracket of noise enclosure was conducted under Contract HY/2009/19 at IECL westbound bridge Pier 38 around the concerned location from 0300hrs to 0500hrs on 08 November 2017. Crane lorry for panel removal and hand tools for fixing of nuts were deployed</p>	Investigation Report issued on 23 November 2017 and case closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>with relevant Construction Noise Permit GW-RS0837-17.</p> <p>Night work including nut fixing works for post supporting bracket of noise enclosure was conducted under Contract HY/2009/19 at IECL westbound bridge Pier 40 around the concerned location from 0300hrs to 0500 hrs on 07 November 2017. Crane lorry for panel removal and hand tools for fixing of nuts were deployed. Night work including nut fixing works for post supporting bracket of noise enclosure was conducted under Contract HY/2009/19 at IECL westbound bridge Pier 38 around the concerned location from 0300hrs to 0500hrs on 08 November 2017 and crane lorry for panel removal and hand tools for fixing of nuts were deployed. Relevant Construction Noise Permit GW-RS0837-17 was in placed for the above construction activities conducted under Contract HY/2009/19 outside the Designated Area zone under Noise Control Ordinance. No construction works was conducted under Contract HY/2009/19 from 1900hrs to 2300hrs on 07 November 2017. In view of the public concern, the Contractor of HY/2009/19 is recommended to adopt soft face hammer to minimize potential noise emanation during works and ii) minimize potential bumping sound with the ground by good practice of material handling to reduce the potential nuisance caused to the surrounding residents. The Contractor of HY/2009/19 was further reminded to observe and strictly follow condition 3.d.7 under relevant Construction Noise Permit GW-RS0837-17.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
EPD complaint (Case ref: H08/RS/00037826-17) dated 24 November 2017	21 November 2017	An EPD complaint (Case ref: H08/RS/00037826-17) referred to the ET on 24 November 2017	North Point New Reclamation Area, Oil Street, North Point.	Noise was emanated from construction works conducted at around 2200hrs	<p>An EPD complaint (Case ref: H08/RS/00037826-17) was referred to the ET on 24 November 2017. The complainant reported that noise was emanated from construction works conducted at around 2200hrs at North Point New Reclamation Area, Oil Street, North Point.</p> <p>ET confirmed with the Resident Site Staff that welding works to the steel strut at Approach Ramp Phase 2 (Portion X) were conducted under Contract HY/2009/19 on 20 November 2017 and total 3 nos. of welding machines were operated until 2130hrs. No works was conducted between 2130hrs to 2230hrs on 20 November 2017. No construction works was conducted under HY/2011/08 on 20 November 2017 between 2130hrs to 2230hrs.</p> <p>Welding works to the steel strut at Approach Ramp Phase 2 (Portion X) were conducted under Contract HY/2009/19 on 20 November 2017 and total 3 nos. of welding machines were operated until 2130hrs. No works was conducted between 2130hrs to 2230hrs on 20 November 2017. Meanwhile, no construction works was conducted under HY/2011/08 on 20 November 2017 between 2130hrs to 2230hrs.</p> <p>Nevertheless, the Contractor of HY/2011/08 and the Contractor of HY/2009/19 were reminded to maintain proper site control and all construction activities to be conducted during restricted hours shall follow relevant Construction Noise Permit.</p>	Interim investigation report submitted to EPD on 08 December 2017. Under EPD Review



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
EPD complaint (H05/RS/397 21-17) dated 15 December 2017	08 December 2017	An EPD complaint (Case Ref: H05/RS/39721-17) referred to ET on 15 December 2017	Construction site near the HKCEC and Wanchai Pier	Construction dust was generated from rock breaking activities of a construction site	<p>An EPD complaint was referred to the ET on 14 December 2017 (CASE Ref: H05/RS/39721-17). The complainant reported that construction dust was generated from rock breaking activities of a construction site near the HKCEC and Wanchai Pier on 08 December 2017 (0815hrs), causing nuisance.</p> <p>ET confirmed with the Resident Site Staff that breaking works and backfilling works were conducted under Contract HK/2009/02 at Portion 5 (Site Area near Wanchai Ferry Pier) on 08 December 2017 around 0815hrs and mitigation measure including water spraying was provided for the breaking works. According to the RSS site information, breaking works and backfilling works were conducted under Contract HK/2009/02 at Portion 5 (Site Area near Wanchai Ferry Pier) on 08 December 2017 around 0815hrs and mitigation measure including water spraying was provided for the breaking works. Follow up inspection was conducted on 19 December 2017, ground compaction and intermittent breaking works was observed while dust suppression was observed implemented at intervals under Contractor of HK/2009/02 while no particular dust emission was observed from the above works. Nevertheless, in view of the public concern, the Contractor of HK/2009/02 was reminded that adequate dust suppression measure shall be provided for breaking works and dusty surface to avoid dust emission and minimize any potential dust impact to the surroundings. The Contractor of HK/2009/02 is also recommended to arrange the breaking works, if any, to be conducted collectively at specified location to enhance the overall site control and effectiveness of dust suppression measure. The Contractor is also recommended to review the use of water truck or automatic water spraying system to enhance the overall dust suppression effectiveness.</p>	<p>Interim investigation report submitted to EPD on 21 December 2017.</p> <p>EPD advised on 08 Jan 2018 no comment on the interim report submitted and case closed.</p>



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
EPD complaint (H08/RS/0000972-18) dated 11 January 2018	08 January 2018	An EPD complaint (Case Ref: H08/RS/00000972-18) referred to ET on 11 January 2018	North Point new Reclamation Area. Oil Street	Night time construction noise after 7pm	<p>An EPD complaint (Case ref: H08/RS/00000972-18) was referred to the ET on 11 January 2018. The complainant reported that night time construction noise after 7 pm near North Point New Reclamation Area, Oil Street, North Point.</p> <p>ET confirmed with the Resident Site Staff that no construction works was conducted under Contract HY/2011/08 on 08 January 2018 from 1900hrs to 2300hrs at the concerned location. Concreting operation was conducted under Contract HY/2009/19 at Approach Ramp Phase 2 site area at Oil Street on 08 January 2018 from 1900hrs to 2030hrs. Total 1 no. of concrete truck, 1 no. of concrete pump and 2 nos. of vibratory pokers were in operation.</p> <p>According to RSS confirmed information, no construction works was conducted under Contract HY/2011/08 on 08 January 2018 from 1900hrs to 2300hrs at the concerned location. Meanwhile, concreting operation was conducted under Contract HY/2009/19 at Approach Ramp Phase 2 site area at Oil Street on 08 January 2018 from 1900hrs to 2300hrs. Total 1 no. of concrete truck, 1 no. of concrete pump and 2 nos. of vibratory pokers were operated without a valid Construction Noise Permit.</p> <p>In view of the above, the Contractor of HY/2009/19 was advised to i) fully review the Construction Noise Permit(s) in force and the tentative construction operations to ensure all construction operations during restricted hours strictly complies with the Construction Noise Permit and Noise Control Ordinance, ii) review the site control system for construction works during restricted hours and tighten the site supervision to ensure site compliance; iii) review the planned construction sequence and schedule to ensure all planned construction operations would be conducted within allowable period, shall any planned construction activities might extend beyond the specified allowed period, relevant necessary Construction Noise Permit(s) shall be applied for. In addition, the Contractor of HY/2009/19 is also recommended to provide briefing and training section to site staffs to enhance the site awareness and understanding on relevant construction</p>	Interim investigation report submitted to EPD on 23 January 2018.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>noise permit(s) requirement during restricted hours.</p> <p>Follow up inspection during restricted hours was conducted by the Environmental Team on 18 January 2018, no construction operations was observed around the concerned location</p>	
EPD complaint (H08/RS/0001430-18) dated 17 January 2018	15 January 2018	An EPD complaint (Case Ref: H08/RS/00001430-18) referred to ET on 17 January 2018	2-8 Watson Road	Construction Dust was emitted from vehicles entering/ leaving construction site at 2-8 Watson Road	<p>An EPD complaint (Case ref: H08/RS/00001430-18) was referred to the ET on 17 January 2018. The complainant reported that construction dust was emitted from vehicles entering/leaving construction site at 2-8 Watson Road.</p> <p>ET confirmed with the Resident Site Staff that cable laying was conducted under Contract HY/2011/08 within the site area near Watson Road on 15 January 2018.</p> <p>No construction works was conducted under Contract HY/2009/19 near Watson Road on 15 January 2018.</p> <p>According to site information confirmed by RSS, cable laying was conducted under Contract HY/2011/08 within the site area near Watson Road on 15 January 2018 and no construction works was conducted under Contract HY/2009/19 near Watson Road on 15 January 2018. Based on review on relevant information, the concerned location of 2 – 8 Watson Road refers to a section of public road fronting the construction site entrance/ exit maintained by Contract HY/2009/19 at Watson Road.</p> <p>Follow up inspection was conducted by the Environmental Team on 17 January 2018. It was observed that wheel washing facilities and wheel washing for vehicles leaving from the construction site exit adjoining Watson Road was implemented by the Contractor HY/2009/19. No silt / soil deposition and no particular dust emission from the construction area under Contract HY/2009/19 and HY/2011/08 was observed. Separately, it was observed that non-CWB project construction waste skip containing dusty demolition waste and rubbles was placed at the concerned section of public road at 2 – 8 Watson Road and it was further noticed that non-CWB project construction area demarcation material was stored at 2-8 Watson road suggesting other non-CWB Projects had been undertaken around the concerned location.</p>	Interim investigation report submitted to EPD on 29 January 2018.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					Nevertheless, in view of the public concern, the Contractor of HY/2011/08 and the Contractor of HY/2009/19 were reminded to maintain the dust mitigation measures provided for the construction site and construction operation to avoid potential dust impact to the surroundings. The Contractor of HY/2009/19 was also reminded to upkeep the construction site exit control and wheel washing practice to maintain the proper condition of site entrance to avoid potential dust impact to the nearby public area.	
ICC complaint (CASE Ref: #2-4459226093) dated 03 February 2018	3 February 2018	ICC complaint (CASE Ref: #2-4459226093) dated 03 February 2018	Planter Area at Victoria Park boundary adjacent to footbridge to Victoria Park Road	Concern on an observed severely tilted tree with potential felling hazard. No fencing, no tree pit, trench and no irrigation pipe is observed	<p>An ICC complaint referred by RSS was received by ET on 06 February 2018 (CASE#2-4459226093). The complainant reported that there is concern on an observed severely tilted tree with potential felling hazard. No fencing, no tree pit, trench and no irrigation pipe is observed.</p> <p>ET confirmed with Resident Site Staff that the concerned tree is within the works area of HY/2010/08 and one of the roots of the concerned tree (<i>Liquidambar formosana</i>) to have suffered minor damaged by the nearby excavation works.</p> <p>Remedial works including i) nylon reinforcement ropes has been added to the existing 3 nos. of tying cables and covering of the slope surface with wet hessian for protection were carried out for the damaged root of the tree. Follow up inspection was conducted by the Environmental Team on 09 February 2018. It was observed that the concerned tree has been fortified and protected for restoration and no tilting was observed.</p> <p>In view of the nearby construction works, the Contractor is suggested to demarcate the tree protection zone for the concerned tree and fence off the tree protection zone to avoid further damage and placing of construction material, if feasible. The Contractor is also suggested to provide refreshment training for frontline works for tree protection, in particular, for trees retained of site in close proximity to active works front to avoid potential damage to retained trees</p>	Investigation Report issued on 26 February 2018 and case closed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
ICC complaint (Case Ref: 2-4495970766, lodged at 0955hrs on 12 March 2018 and Case ref: 2-449606553, lodged at 1004hrs on 12 March 2018)	12 March 2018	ICC complaint case referred to ET on 27 march 2018	Island Eastern Corridor Link	Construction noise emanation from Road Construction Works	<p>An ICC complaint (Case Ref: 2-4495970766, lodged at 0955hrs on 12 March 2018) was referred to the ET on 27 March 2018. The ICC hotline operator reported that a public complaint was referred by the Police Force regarding noise emanation from road construction works at North Point section Island East Corridor (IEC) near 19 Wharf Road at around 0920hrs on 12 March 2018. Further information regarding the same event was received via ICC hotline (Case ref: 2-449606553, lodged at 1004hrs on 12 March 2018) was referred to the ET on 27 March 2018. The complainant further reported that noise was emanated from road construction works on Island Eastern Corridor (IEC) near Yu Lee Mo Fan Memorial School. Temporary noise barrier observed to be transparent in nature was speculated to be ineffective; and it was observed that only 3 out of the 6 units of temporary noise barrier are installed. The complainant suggested that additional 6 sections of noise barrier shall be installed. The noise emanation was started from 0800hrs and he is a resident at 18 Wharf Road and his rest was adversely affected by the concerned noise emanation. He has contacted the Environmental Protection Department and the Police Force regarding the noise emanation. The Environmental Protection Department has replied that construction works conducted after 0700hrs does not violate statutory requirement while the Police Force has created an ICC complaint case file (2-4495970766) for follow up.</p> <p>ET confirmed with the Resident Site Staff that Concrete breaking works on IEC Eastbound near Pier F8 and Pier F9 was conducted under Contract HY/2009/19 from 0900hrs to 1000hrs on 12 March 2018.</p> <p>Noise mitigation measure including wrapping of breaking head with acoustic material was implemented. Enhancement measures including provision of 2.5m high temporary noise barrier were subsequent implemented on 12 March 2018.</p> <p>According to RSS confirmed information, concrete breaking works on IEC Eastbound near Pier F8 and Pier F9 was conducted under Contract HY/2009/19 from 0900hrs to 1000hrs on 12 March 2018. Noise mitigation measure including wrapping of breaking head with acoustic material</p>	Investigation Report issued on 12 April 2018 and case closed.



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>was implemented. Enhancement measures including provision of 2.5m high temporary noise barrier were subsequent implemented on 12 March 2018.</p> <p>Based on review on relevant site record, noise impact associated with the breaking works on IECL opposite to the concerned location was observed across March 2018 and project related exceedances were recorded at nearby noise monitoring station at YLMF Memorial School across March 2018. Upon identification of the project related exceedance at YLMF memorial school noise monitoring station, the Contractor is requested to adopt remedial and enhancement measures to minimize the noise emanation and avoid noise impact to the nearby sensitive receivers.</p> <p>According to ET follow up checking, the following enhancement measures were proposed and implemented by the Contractor by 16 March 2018 :-</p> <ol style="list-style-type: none">1. Provide additional temporary noise barrier and repair damaged or incomplete temporary noise barrier installed for the breaking works2. Provide additional acoustics screen to the breaking tip in addition to temporary noise barrier installed3. Provide covering of breaker tip with acoustic material for noise reduction4. Conduct breaking works intermittently (No more than 15 mins within a 30 minutes interval) <p>Nevertheless, subsequent to 16 March 2018 it was observed at times that the above mitigation measures were not fully implemented by the Contractor throughout the remaining breaking works period. Upon identification of deficiency in mitigation measures, the Contractor has been requested to rectify any deficiency observed and ensure relevant noise mitigation measures are implemented and the observed deficiencies are rectified prior to resumption of the concerned impact associated works. According to Contractor information, the concerned breaking works have been completed by 26 March 2018.</p>	



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					In view of the public concern and the identified noise concern, the Contractor of HY/2009/19 was reminded that, shall future breaking works be required to be conducted on IECL (at works area located at the East of the noise enclosure), noise mitigation measure including but not limit to provision of temporary noise barrier with adequate height and extend and additional noise screen shall be proposed for ET/IEC review and confirmation prior to conducting the corresponding works to minimize the potential impact to the surroundings. The Contractor is also advised to review the adopt construction method with consideration on alterative PME with reduced noise emanation to minimize the potential noise impact to the surroundings.	



Appendix 10.1

Construction Programme of Individual Contracts

Contract No. HK/2009/01

Wan Chai Development Phase II – Central -Wan Chai Bypass at
Hong Kong Convention and Exhibition Centre

Construction Activities for Three Months Rolling

Construction Activities	January 2018	February 2018	March 2018
Reinstatement of Amenity Area			

Activity ID	Activity Name	Rem Dur	Start	Finish	2018													
					March						April				May			
					18	25	04	11	18	25	01	08	15	22	29	06	13	20
3MRP (Feb 2018 - May 2018)																		
10 - SECTION X OF THE WORKS																		
10.3 - Middle Bridge (Bridge F)																		
10.3.2 - Bridge Construction																		
Bridge F3B																		
1032-2564	Divert 2 Lane Traffic (Stage 2)	0	25-Feb-18*		◆ Divert 2 Lane Traffic (Stage 2)													
Bridge F1B2																		
1032-3880	Bridge F1B2 - Construct Int. Double Noise Encl. Bridge F1B2	8	13-Jan-18 A	28-Feb-18	■ Bridge F1B2 - Construct Int. Double Noise Encl. Bridge F1B2													
1032-3900	Bridge F1B2 - Bridge F1C Deck Road Waterproofing, Surfacing & Marking	7	01-Mar-18	08-Mar-18	■ Bridge F1B2 - Bridge F1C Deck Road Waterproofing, Surfacing & Marking													
Bridge F1B1																		
1032-1780	Bridge F1B1 - Construct Int. Double Noise Encl. Bridge F1B2	15	16-Jan-18 A	08-Mar-18	■ Bridge F1B1 - Construct Int. Double Noise Encl. Bridge F1B2													
1032-1800	Bridge F1B1 - Bridge F1C Deck Road Waterproofing, Surfacing & Marking	7	09-Mar-18	16-Mar-18	■ Bridge F1B1 - Bridge F1C Deck Road Waterproofing, Surfacing & Marking													
Bridge F5																		
1032-4040	Cutting of Deck Between Temp. TD & E/B > Pier F5-F8	12	26-Feb-18	10-Mar-18	■ Cutting of Deck Between Temp. TD & E/B > Pier F5-F8													
1032-4060	Cutting of Deck Between Temp. TD & E/B > Pier F8-F11	12	12-Mar-18	24-Mar-18	■ Cutting of Deck Between Temp. TD & E/B > Pier F8-F11													
1032-4080	Cutting of Deck Between Temp. TD & E/B > Pier F11-F14	12	26-Mar-18	11-Apr-18	■ Cutting of Deck Between Temp. TD & E/B > Pier F11-F14													
1032-4100	Construction Parapet (Northside) > Pier F5-F8	12	05-Mar-18	17-Mar-18	■ Construction Parapet (Northside) > Pier F5-F8													
1032-4120	Construction Parapet (Northside) > Pier F8-F11	12	19-Mar-18	03-Apr-18	■ Construction Parapet (Northside) > Pier F8-F11													
1032-4140	Construction Parapet (Northside) > Pier F11-F14	12	04-Apr-18	18-Apr-18	■ Construction Parapet (Northside) > Pier F11-F14													
1032-4160	Construct Noise Enclosure (Northside) > Pier F5 - F8	24	19-Mar-18	18-Apr-18	■ Construct Noise Enclosure (Northside) > Pier F5 - F8													
1032-4180	Reinstate Deck Pier F8 - F14 (Northside) > Surfacing & Marking	5	19-Apr-18	24-Apr-18	■ Reinstate Deck Pier F8 - F14 (Northside) > Surfacing & Marking													
1032-4200	Reinstate Deck Pier F5 - F8 (Northside) > Surfacing & Marking	5	25-Apr-18	30-Apr-18	■ Reinstate Deck Pier F5 - F8 (Northside) > Surfacing & Marking													
All Middle Bridge F (Common)																		
1032-4240	Fresh Water Main 150DI at Bridge F Deck	39	27-Nov-17 A	09-Apr-18	■ Fresh Water Main 150DI at Bridge F Deck													
1032-4260	Bridge F Sign Gantries and Misc. Mounting Structure/Support	2	26-Dec-17 A	21-Feb-18*	■ Bridge F Sign Gantries and Misc. Mounting Structure/Support													
1032-4356	Sign Gantry (DS06B,DS06A & FADS06) (Nigth work)	50	22-Feb-18	24-Apr-18	■ Sign Gantry (DS06B,DS06A & FADS06) (Nigth work)													
10.5 - Temporary Bridge																		
10.5.3 - Temporary Bridge "TD"																		
1053-1140	Demolition of Temporary Bridge "TD" at VI	32	19-Mar-18	27-Apr-18	■ Demolition of Temporary Bridge "TD" at VI													
10.6 - Tunnel Approach Ramp																		
10.6.1 - Approach Ramp (Excluding Portion IIB)																		
Retaining Walls & Trough Structure B,C & D																		
1061-6860	Construct Retaining Wall E Pile Cap (7 nos)	45	06-Mar-17 A	16-Apr-18	■ Construct Retaining Wall E Pile Cap (7 nos)													
1061-6900	Construct Retaining Wall E1 (Ch 5332 - 5371)	18	17-Apr-18	08-May-18	■ Construct Retaining Wall E1 (Ch 5332 - 5371)													
1061-6989	Parapet at Wall above Retaining Wall E2	14	12-Mar-18	27-Mar-18	■ Parapet at Wall above Retaining Wall E2													
1061-6990	Parapet at Wall above Retaining Wall E1	18	09-May-18	29-May-18	■ Parapet at Wall above Retaining Wall E1													
1061-7020	Falseworks System for Landscape Deck	18	29-Jan-18 A	12-Mar-18	■ Falseworks System for Landscape Deck													
1061-7040	Excavate for Foundation of Retaing Wall D	7	13-Mar-18	20-Mar-18	■ Excavate for Foundation of Retaing Wall D													
1061-7060	Construct Retaining Wall D Footing (Ch 190 - 170)	18	21-Mar-18	13-Apr-18	■ Construct Retaining Wall D Footing (Ch 190 - 170)													

■ Remaining Level of Effort ■ Remaining Work
■ Actual Level of Effort ■ Critical Remaining Work
■ Actual Work ◆ Milestone

Contract HY/2009/19
Three Months Rolling Programme (20.Feb.2018 to 19.May.2018)

Activity ID	Activity Name	Rem Dur	Start	Finish	2018															
					April				May				June							
					18	25	01	08	15	22	29	06	13	20	27	03	10	17	24	
3MRP (Mar 2018 - Jun 2018)																				
10 - SECTION X OF THE WORKS																				
10.3 - Middle Bridge (Bridge F)																				
10.3.2 - Bridge Construction																				
Bridge F1B2																				
1032-3880	Bridge F1B2 - Construct Int. Double Noise Encl. Bridge F1B2	9	13-Jan-18 A	29-Mar-18	[Green Bar] Bridge F1B2 - Construct Int. Double Noise Encl. Bridge F1B2															
1032-3900	Bridge F1B2 - Bridge F1C Deck Road Waterproofing, Surfacing & Marking	7	31-Mar-18	10-Apr-18	[Green Bar] Bridge F1B2 - Bridge F1C Deck Road Waterproofing, Surfacing & Marking															
Bridge F1B1																				
1032-1780	Bridge F1B1 - Construct Int. Double Noise Encl. Bridge F1B2	9	16-Jan-18 A	29-Mar-18	[Green Bar] Bridge F1B1 - Construct Int. Double Noise Encl. Bridge F1B2															
1032-1800	Bridge F1B1 - Bridge F1C Deck Road Waterproofing, Surfacing & Marking	7	31-Mar-18	10-Apr-18	[Green Bar] Bridge F1B1 - Bridge F1C Deck Road Waterproofing, Surfacing & Marking															
Bridge F5																				
1032-4080	Cutting of Deck Between Temp. TD & E/B > Pier F11-F14	6	19-Mar-18 A	26-Mar-18	[Green Bar] Cutting of Deck Between Temp. TD & E/B > Pier F11-F14															
1032-4120	Construction Parapet (Northside) > Pier F8-F11	2	15-Mar-18 A	21-Mar-18	[Green Bar] Construction Parapet (Northside) > Pier F8-F11															
1032-4140	Construction Parapet (Northside) > Pier F11-F14	8	22-Mar-18	31-Mar-18	[Green Bar] Construction Parapet (Northside) > Pier F11-F14															
1032-4160	Construct Noise Enclosure (Northside) > Pier F5 - F8	10	15-Mar-18 A	31-Mar-18	[Green Bar] Construct Noise Enclosure (Northside) > Pier F5 - F8															
1032-4180	Reinstate Deck Pier F8 - F14 (Northside) > Surfacing & Marking	5	03-Apr-18	09-Apr-18	[Green Bar] Reinstate Deck Pier F8 - F14 (Northside) > Surfacing & Marking															
1032-4200	Reinstate Deck Pier F5 - F8 (Northside) > Surfacing & Marking	5	10-Apr-18	14-Apr-18	[Green Bar] Reinstate Deck Pier F5 - F8 (Northside) > Surfacing & Marking															
All Middle Bridge F (Common)																				
1032-4240	Fresh Water Main 150DI at Bridge F Deck	20	27-Nov-17 A	14-Apr-18	[Green Bar] Fresh Water Main 150DI at Bridge F Deck															
1032-4356	Sign Gantry (DS06B,DS06A & FADS06) (Nigth work)	30	22-Feb-18 A	26-Apr-18	[Green Bar] Sign Gantry (DS06B,DS06A & FADS06) (Nigth work)															
10.5 - Temporary Bridge																				
10.5.3 - Temporary Bridge 'TD'																				
1053-1140	Demolition of Temporary Bridge "TD" at VI	32	14-Apr-18	22-May-18	[Green Bar] Demolition of Temporary Bridge "TD" at VI															
10.6 - Tunnel Approach Ramp																				
10.6.1 - Approach Ramp (Excluding Portion IIB)																				
Retaining Walls & Trough Structure B,C & D																				
1061-6860	Construct Retaining Wal E Pile Cap (7 nos)	29	06-Mar-17 A	25-Apr-18	[Green Bar] Construct Retaining Wal E Pile Cap (7 nos)															
1061-6900	Construct Retaining Wal E1 (Ch 5332 - 5371)	15	12-Mar-18 A	14-May-18	[Green Bar] Construct Retaining Wal E1 (Ch 5332 - 5371)															
1061-6990	Parapet at Wall above Retaining Wall E1	15	14-Mar-18 A	31-May-18	[Green Bar] Parapet at Wall above Retaining Wall E1															
1061-7020	Falseworks System for Landscape Deck	8	29-Jan-18 A	28-Mar-18	[Red Bar] Falseworks System for Landscape Deck															
1061-7040	Excavate for Foundation of Retaing Wall D	7	29-Mar-18	09-Apr-18	[Red Bar] Excavate for Foundation of Retaing Wall D															
1061-7060	Construct Retaining Wal D Footing (Ch 190 - 170)	15	10-Apr-18	26-Apr-18	[Green Bar] Construct Retaining Wal D Footing (Ch 190 - 170)															
1061-7080	Construct Retaining Wal D (Ch 190 - 170)	18	27-Apr-18	18-May-18	[Green Bar] Construct Retaining Wal D (Ch 190 - 170)															
1061-7100	Backfilling Works	12	19-May-18	01-Jun-18	[Green Bar] Backfilling Works															
1061-7120	Excavate to Founding Level Trough B Structure	12	31-Mar-18	16-Apr-18	[Red Bar] Excavate to Founding Level Trough B Structure															

█ Remaining Level of Effort █ Remaining Work
█ Actual Level of Effort █ Critical Remaining Work
█ Actual Work ◆ ◆ Milestone

Contract HY/2009/19
Three Months Rolling Programme (20.Mar.2018 to 19.Jun.2018)

Activity ID	Activity Name	Rem Dur	Start	Finish	2018													
					April						May				June			
					18	25	01	08	15	22	29	06	13	20	27	03	10	17
1061-7140	Construct Trough Structure B Base Slab	18	17-Apr-18	08-May-18	Construct Trough Structure B Base Slab													
1061-7160	Construct Trough Structure B Side Walls	18	09-May-18	29-May-18	Construct Trough Structure B Side Walls													
1061-7180	Excavate to Founding Level Trough C Structure	12	10-Apr-18	23-Apr-18	Excavate to Founding Level Trough C Structure													
1061-7200	Construct Trough Structure C Base Slab	15	24-Apr-18	11-May-18	Construct Trough Structure C Base Slab													
1061-7220	Construct Trough Structure C Side Walls	18	10-May-18	30-May-18	Construct Trough Structure C Side Walls													
1061-7240	Road & other Misc Works at Trough D	12	02-Jun-18	15-Jun-18	Road & other Misc													
Landscape Deck																		
1061-7460	Ch 5331 - 5419 > Beam & Deck	14	19-Feb-18 A	07-Apr-18	Ch 5331 - 5419 > Beam & Deck													
1061-7480	Ch 5303 - 5419 > Noise Panel Installations	32	19-Apr-18	26-May-18	Ch 5303 - 5419 > Noise Panel Installations													
10.6.2 - Approach Ramp (Within Portion IIB)																		
Structure																		
Bay 1																		
Wall - Upper Portion																		
A1220	Remove S1 and S2 Strut + Waling	4	03-Apr-18	07-Apr-18	Remove S1 and S2 Strut + Waling													
A1260	Vertical Water Proofing	2	09-Apr-18	10-Apr-18	Vertical Water Proofing													
Bay 2																		
Wall - Upper Portion																		
A1380	Remove S1 and S2 Strut + Waling	4	03-Apr-18	07-Apr-18	Remove S1 and S2 Strut + Waling													
A1420	Vertical Water Proofing	2	09-Apr-18	10-Apr-18	Vertical Water Proofing													
Bay 3																		
Wall - Upper Portion																		
A1540	Remove S1 and S2 Strut + Waling	4	03-Apr-18	07-Apr-18	Remove S1 and S2 Strut + Waling													
A1580	Vertical Water Proofing	2	09-Apr-18	10-Apr-18	Vertical Water Proofing													
Bay 4																		
Wall - Upper Portion																		
A1710	Remove S1 and S2 Strut + Waling	4	03-Apr-18	07-Apr-18	Remove S1 and S2 Strut + Waling													
A1750	Vertical Water Proofing	2	09-Apr-18	10-Apr-18	Vertical Water Proofing													
Bay 5																		
Wall - Lower Portion																		
A1830	Erect and Formwork	3	19-Mar-18 A	22-Mar-18	Erect and Formwork													
A1840	Concreting	1	23-Mar-18	23-Mar-18	Concreting													
A1850	Vertical Water Proofing	1	24-Mar-18	24-Mar-18	Vertical Water Proofing													
A1860	Backfilling	3	26-Mar-18	28-Mar-18	Backfilling													
Wall - Upper Portion																		
A1870	Remove S1 and S2 Strut + Waling	4	03-Apr-18	07-Apr-18	Remove S1 and S2 Strut + Waling													

█ Remaining Level of Effort █ Remaining Work
█ Actual Level of Effort █ Critical Remaining Work
█ Actual Work ◆ Milestone

Contract HY/2009/19
Three Months Rolling Programme (20.Mar.2018 to 19.Jun.2018)

Activity ID	Activity Name	Rem Dur	Start	Finish	2018															
					April				May				June							
					18	25	01	08	15	22	29	06	13	20	27	03	10	17	24	
A1880	Erect Working Platform and Rebar Fixing	2	24-Mar-18	26-Mar-18																
A1890	Erect and Formwork	3	27-Mar-18	29-Mar-18																
A1900	Concreting	1	31-Mar-18	31-Mar-18																
A1910	Vertical Water Proofing	2	09-Apr-18	10-Apr-18																
Landscape Deck																				
1062-1240	Construct LD Column - Portion IIB (10nos)	9	12-Mar-18 A	29-Mar-18																
1062-1260	Construct Landscape Deck Beam/Slab Bay C1 & C2	18	14-Mar-18 A	12-Apr-18																
1062-1280	Construct Noise Panel Trough A (within Portion IIB)	30	20-Apr-18	25-May-18																
Road Works																				
1062-1300	Approach Ramp Road Drainage (within Portion IIB)	24	12-May-18	08-Jun-18																
1062-1320	Approach Ramp Profile Barrier (within Portion IIB)	24	12-May-18	08-Jun-18																
1062-1340	Approach Ramp Street Furniture (within Portion IIB)	24	12-May-18	08-Jun-18																
1062-1360	Approach Ramp TCSS/E&M Ducts and Supports (within Portion IIB)	24	12-May-18	08-Jun-18																
1062-1380	Approach Ramp Road Surfacing & Marking (within Portion IIB)	10	09-Jun-18	21-Jun-18																

Remaining Level of Effort Remaining Work
 Actual Level of Effort Critical Remaining Work
 Actual Work Milestone

Contract HY/2009/19
Three Months Rolling Programme (20.Mar.2018 to 19.Jun.2018)

Activity ID	Activity Name	Original Duration	Start	Finish	2018												
					Feb	Mar	Apr	May	Jun								
Total		1876d	21-Mar-13 A	21-Jun-18													
DWP-08 - (2) - Update Progress As of 20 Feb 18		1876d	21-Mar-13 A	21-Jun-18													
Works in KD8		24d	05-Feb-18 A	27-Feb-18 A													
TS3W - Remove Temporary Reclamation		24d	05-Feb-18 A	27-Feb-18 A													
Stage 7 - Remove D-wall W4D13, 14 & W4D12, W4D15 - 16 + W3D8 - W3D11 & Seawall Reinstatement		24d	05-Feb-18 A	27-Feb-18 A													
Reinstatement of Remaining Vertical Seawall by Land Plants		24d	05-Feb-18 A	27-Feb-18 A													
MW_1610	Pour concrete behind 5th layer of facing stone	1d	05-Feb-18 A	05-Feb-18 A													
MW_1630	Erect Formwork for coping	3d	06-Feb-18 A	09-Feb-18 A													
MW_1640	Pour concrete for coping	1d	10-Feb-18 A	10-Feb-18 A													
MW_1660	Lay footpath paving blocks	4d	11-Feb-18 A	14-Feb-18 A													
MW_1650	Backfill up to formation level (6 layers)	13d	26-Feb-18 A	27-Feb-18 A													
Works in KD6		132d	30-Aug-17 A	20-Mar-18													
Works in SR8 (Open Cut Method)		132d	30-Aug-17 A	20-Mar-18													
SR8 (Zone C) - Ch. 528 to Ch. 368		74d	30-Aug-17 A	20-Mar-18													
Zone C - Tunnel Structure		74d	30-Aug-17 A	20-Mar-18													
Egress Passage - EP01		74d	30-Aug-17 A	20-Mar-18													
A9050	Steel Railing - Fabrication & Installation	74d	30-Aug-17 A	20-Mar-18													
SR8 (Zone B) - Ch.385.000 to Ch.317.500 - (Inside Victoria Park to Tunnel Portal)		16d	21-Feb-18 A	16-Mar-18													
SR8 (Zone B) Tunnel - ELS / CCT / BF Works (7 Bays Ch. 385.000 to Ch.317.500)		16d	21-Feb-18 A	16-Mar-18													
Portal Structure		16d	21-Feb-18 A	16-Mar-18													
Pump House		7d	21-Feb-18 A	28-Feb-18 A													
Remaining Works inside Pump Sump E		7d	21-Feb-18 A	28-Feb-18 A													
Pump Sump E Hand Rail		7d	21-Feb-18 A	28-Feb-18 A													
EXW_2530	Installation of handrail (agreed with CC contract)	7d	21-Feb-18 A	28-Feb-18 A													
Remaining Works in Zone B		15d	28-Feb-18 A	16-Mar-18													
Egress Passage		15d	28-Feb-18 A	16-Mar-18													
EXW_2550	Railing installation (2 nos. - 10m)	15d	28-Feb-18 A	16-Mar-18													
Works in KD9 (Include Re-provisioning Works of KD4,KD5)		185d	23-Oct-17 A	15-May-18													
External Works Under KD9		185d	25-Oct-17 A	15-May-18													
Zone 1		90d	15-Dec-17 A	27-Mar-18													
Drainage Alignment Confirmation for MH72, 73, 74 due to Tree T1106		90d	15-Dec-17 A	27-Mar-18													
EXW_1125	Drawing Confirmation and construction for MH2-74A and associated drainage	8d	15-Dec-17 A	25-Mar-18													
EXW_1145	Pedestrian walkway open to public during Christmas and CNY	90d	23-Jan-18 A	27-Mar-18													
Zone 2		35d	25-Oct-17 A	04-Apr-18													
EXW_1890	Irrigation system construction	15d	25-Oct-17 A	04-Apr-18													
EXW_1880	Boundary fence Installation	30d	01-Nov-17 A	04-Apr-18													
Zone 3		35d	03-Mar-18	16-Apr-18													
Traffic Island		35d	03-Mar-18	16-Apr-18													
EXW_2050	Directional sign DS17 steel frame	7d	03-Mar-18*	10-Mar-18													
EXW_2060	New VMS6 steel frame	7d	12-Mar-18	19-Mar-18													
EXW_2070	TCSS and lighting at island	7d	20-Mar-18	26-Mar-18													
EXW_2080	JTIS (3 nos. footings, 1 no. concrete plinth)	14d	27-Mar-18	16-Apr-18													
Zone 4 up to Elderly Facilities		90d	30-Jan-18 A	15-May-18													

Activity ID	Activity Name	Original Duration	Start	Finish	2018											
					Feb	Mar	Apr	May	Jun							
Elderly Facilities V/039 Received on 22 Jun 2017																
EXW_2270	Facilities fabrication	90d	30-Jan-18 A	15-May-18	Facilities fabrication											
Additional Walkway & Arbour V/040 Received on 22 Aug 2017																
EXW_2300	Arbour confirmation and fabrication	60d	15-Feb-18 A	16-Mar-18	Arbour confirmation and fabrication											
EXW_2310	Associated drainage works for the walkway	20d	17-Mar-18	12-Apr-18	Associated drainage works for the walkway											
Reverting Traffic for IEC,VP Rd & TF St & Seawall Reinstatement (KD9)																
TTA Revert Traffic Back to Original Alignment																
East Bound TTA - IEC East Bound, Victoria Park Road & footpath along Sea Side																
TTM Stage 1 - IEC (East Bound)																
Reinstatement Existing Structure																
EB_1020	Install metal parapet on parapet wall (30m)	6d	28-Feb-18	05-Mar-18	Install metal parapet on parapet wall (30m)											
TTM Stage 2 - Revert Traffic back to Original Victoria Road																
Existing Bridge Parapet Reinstatement																
EB_1180	Install metal parapet on parapet wall (40m)	4d	06-Mar-18	09-Mar-18	Install metal parapet on parapet wall (40m)											
TTM Stage 3 - Reinstatement of Footpath along Seafront																
Reinstatement Works in Traffic Deck Part A																
EB_1540	Break two concrete footings	2d	31-Jan-18 A	16-Mar-18	Break two concrete footings											
EB_1520	Break pipe piles and cut sheet pile	6d	10-Feb-18 A	26-Feb-18 A	Break pipe piles and cut sheet pile											
EB_1530	Backfill Subbase material up to Formation Level (Avg. 1.5m height, by SRT method of 0.3m each layer, 5 layers)	3d	17-Mar-18	19-Mar-18	Backfill Subbase material up to Formation Level (Avg. 1.5m height, by SRT method of 0.3m each layer, 5 layers)											
Reinstatement of Existing Gas Main																
EB_1560	Excavation for DN400mm Gas main	3d	20-Mar-18	22-Mar-18	Excavation for DN400mm Gas main											
EB_1570	Laying DN400mm gas main by HKCG at VPR footpath	14d	23-Mar-18	05-Apr-18	Laying DN400mm gas main by HKCG at VPR footpath											
West Bound - IEC West Bound & Tsing fung Street																
TTM Stage 2 - Revert Traffic back to Original Tsing Fung Street																
Existing Bridge Parapet Reinstatement																
IECW_1140	Install metal parapet on parapet wall (60m)	5d	28-Feb-18	04-Mar-18	Install metal parapet on parapet wall (60m)											
TTM Stage 3 - Reinstatement of Victoria Park																
Reinstatement Works in Traffic Deck																
IECW_1390	Cut pipe piles and sheet pile	5d	18-Jan-18 A	13-Mar-18	Cut pipe piles and sheet pile											
IECW_1400	Backfill General Fill Material up to Formation Level (Avg. 1.5m height, by SRT method of 0.3m each layer, 5 layers)	3d	14-Mar-18	16-Mar-18	Backfill General Fill Material up to Formation Level (Avg. 1.5m height, by SRT method of 0.3m each layer, 5 layers)											
Reinstatement Works inside Victoria Park																
IECW_1440	Reinstatement of Boundary Fence	21d	29-Jan-18 A	17-Mar-18	Reinstatement of Boundary Fence											
IECW_1460	Cutting sheet pile to 1.5m below finish slope profile (MS 169B)	10d	19-Mar-18	28-Mar-18	Cutting sheet pile to 1.5m below finish slope profile (MS 169B)											
IECW_1470	Slope Reinstatement of Victoria Park	21d	26-Mar-18	23-Apr-18	Slope Reinstatement of Victoria Park											
Completion of Minor Outstanding / Remaining Works for KD9																
West Bound - Completion of Minor Outstanding / Remaining Works for KD9																
Minor Reinstatement Works for Tsing Fung Street																
IECW_1530	Laying Public Lighting duct	6d	18-Mar-18	23-Mar-18	Laying Public Lighting duct											
IECW_1540	Installation of public lighting post and connection by HyD	7d	24-Mar-18	30-Mar-18	Installation of public lighting post and connection by HyD											
IECW_1550	Well compact road formation level and subbase for SRT	6d	24-Mar-18	29-Mar-18	Well compact road formation level and subbase for SRT											
Minor Reinstatement Works in IEC West Bound																
IECW_1600	Replacement of new movement joint at IEC W/B (Sun midnight only)	8d	28-Feb-18	07-Mar-18	Replacement of new movement joint at IEC W/B (Sun midnight only)											
IECW_1630	Repairing of 300 dia. concrete pipeline by lining under slow lane of IEC W/B	2d	28-Feb-18*	01-Mar-18	Repairing of 300 dia. concrete pipeline by lining under slow lane of IEC W/B											
IECW_1610	Repairing of extg conc deck surface after milling of temp asphalt at IEC W/B and E/B (Sun midnight only)	59d	08-Mar-18	05-May-18	Repairing of extg conc deck surface after milling of ten											

Activity ID	Activity Name	Original Duration	Start	Finish	2018					
					Feb	Mar	Apr	May	Jun	
Works in Victoria Park (KD4, KD5, KD9)										
Re-Provisioning Works										
Nursery Compound										
Nursery compound										
ABWF										
Finishes & Waterproofing										
VP_NC_1500	External wall tile cleaning	3d	23-Oct-17 A	20-Mar-18	External wall tile cleaning					
VP_NC_1420	Painting to wall & ceiling in general (final coat)	4d	15-Mar-18*	19-Mar-18	Painting to wall & ceiling in general (final coat)					
Switch room Cut-out Frame & Chequer Plate										
VP_NC_1690	Installation	1d	13-Feb-18 A	14-Feb-18 A	Installation					
Signage										
VP_NC_1720	Installation	7d	21-Feb-18 A	28-Feb-18 A	Installation					
Metal Fence										
VP_NC_1820	Installation	30d	15-Jan-18 A	29-Mar-18	Installation					
E&M										
VP_NC_1890	Form WR1 submission	7d	09-Feb-18 A	13-Feb-18 A	Form WR1 submission					
VP_NC_1900	Expected power on date	7d	14-Feb-18 A	14-Feb-18 A	Expected power on date					
Fire Services										
VP_NC_1960	Pump and water pipe installation	10d	22-Dec-17 A	10-Mar-18	Pump and water pipe installation					
VP_NC_1980	Hose Reel installation, Breakglass and Alarm	3d	10-Feb-18 A	13-Feb-18 A	Hose Reel installation, Breakglass and Alarm					
VP_NC_1930	FS pipe connection from u/g to water meter room	2d	24-Feb-18 A	28-Feb-18 A	FS pipe connection from u/g to water meter room					
Plumbing and Flushing Water Supplies										
VP_NC_2080	Cleaning of potable water pipe and sampling to WSD	7d	17-Feb-18 A	26-Feb-18 A	Cleaning of potable water pipe and sampling to WSD					
VP_NC_2100	WSD Inspection	14d	28-Feb-18	15-Mar-18	WSD Inspection					
GRP Water Tank Installation										
VP_NC_2130	Final As-fitted drawing submission to WSD	7d	30-Jan-18 A	06-Feb-18 A	Final drawing submission to WSD					
External Works Aside Nursery Compound										
Drainage										
VP_NC_2150	U channel at toilet	2d	30-Jan-18 A	31-Jan-18 A	U channel					
VP_NC_2190	SS angle to shower room u channel	1d	31-Jan-18 A	31-Jan-18 A	SS angle to shower room u channel					
VP_NC_2140	Drainage work at External area	15d	28-Feb-18	16-Mar-18	Drainage work at External area					
Water Works										
VP_NC_2220	FS Fresh & Salt Water, Fresh Water and Irrigation System	15d	07-Feb-18 A	27-Feb-18 A	FS Fresh & Salt Water, Fresh Water and Irrigation System					
External Works Around Nursery Compound										
VP_NC_2250	Reinstatement of Existing Boundary Fence Wall Around Nursery Compound	45d	28-Feb-18	24-Apr-18	Reinstatement of Existing Boundary Fence Wall Around Nursery Compound					
KD10 - Preservation and Protection of Trees										
PPT_0000	Preservation and Protection of Existing Trees	1088d	21-Mar-13 A	21-Jun-18	Preservation and Protection of Existing Trees					
KD15 & KD8 - Mooring Components Upkeep (CBTS and ATS)										
MAR_3020	Mooring Upkeep at Portion X(10) & XVI(16) - CBTS	979d	15-May-14 A	28-Feb-18	Mooring Upkeep at Portion X(10) & XVI(16) - CBTS					

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018			
						Feb	Mar	Apr	May
Update 2018-02-20 CWB(CC) - Commissioning Contract (SA)									
PRELIMINARIES AND GENERAL REQUIREMENTS									
Salient Key Dates and Milestones									
Contract Key Dates									
KD007	KD7 - Completion of Section 2 of the Works (1437 days) - include EOT (80 days)	0		03-Feb-18 A		▲			
KD008	KD8 - Completion of Section 3 of the Works (1437 days) - include EOT (80 days)	0		03-Feb-18 A		▲			
Anticipated Completion Dates									
KD01	KD1 - Achievement of Stage 1 (1177 days) - include EOT No.3 (123 days)	0		05-Feb-18 A		▲			
KD02	KD2 - Achievement of Stage 2 (1232 days)	0		15-May-18*	-305			▲	◆
KD03	KD3 - Achievement of Stage 3 (1318 days) - include EOT (140 days)	0		15-May-18*	-219		▲		◆
Possession Dates and Vacation Dates									
PO-IIa	Possession of Portion IIa (Day 1) - WVB below +6.5mPD	1329	28-Feb-14 A	20-Mar-18	-269				
PO-III	Possession of Portion III (Day 120) - CH1805-2600	1209	28-Jun-14 A	20-Mar-18	-284				
PO-Ib	Possession of Portion Ib (Day 242) - CH1580-1805	1087	28-Oct-14 A	20-Mar-18	-264				
PO-IXd	Possession of Portion IXd (Day 266) - CH4600-4860	1063	21-Nov-14 A	20-Mar-18	-195				
PO-XI	Possession of Portion XI (Day 296) - EVS	1033	21-Dec-14 A	20-Mar-18	180				
PO-IIc	Possession of Portion IIc (Day 336) - CH1360-1580	993	30-Jan-15 A	20-Mar-18	-269				
PO-IIb	Possession of Portion IIb (Day 336) - WVB above +6.5mPD	669	30-Jan-15 A	20-Mar-18	-269				
PO-IXa	Possession of Portion IXa (Day 392) - CH4860-5150	937	27-Mar-15 A	20-Mar-18	-195				
PO-Va	Possession of Portion V (Day 607) - CH2950-3210	722	28-Oct-15 A	20-Mar-18	-284				
PO-VII_a1	Possession of Portion VII (Day 762) - CH3911-4250 (below -6.0mPD)	659	30-Dec-15 A	20-Mar-18	-203				
PO-Vc	Possession of Portion V (Day 607) - CH3210-3250	658	15-Jan-16 A	20-Mar-18	-265				
PO-VIb_b1	Possession of Portion VIb (Day 761) - CH3428-3625 (E/B)	619	18-Feb-16 A	20-Mar-18	-279				
PO-VIb_b2	Possession of Portion VIb (Day 761) - CH3428-3625 (W/B)	568	29-Feb-16 A	20-Mar-18	-264				

- ◆ Current Milestone
- Level of Effort
- ▲ Baseline Milestone
- Actual Work
- Critical Remaining Work
- Remaining Work
- Project Baseline

Leighton Contractors (Asia) Limited

Programme Update 48 (February 2018)

THREE MONTH ROLLING

Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 1 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018				
						Feb	Mar	Apr	May	
PO-Xa_1	Possession of Portion Xa (Day 650) - ADB Southern Portion (AECOM letter ref: 2015007890T)	589	07-Mar-16 A	20-Mar-18	-323					
PO-Xb_1	Possession of Portion Xb (Day 804) - ADB Northern Portion	589	07-Mar-16 A	20-Mar-18	-323					
PO-Vb1	Possession of Portion V (Day 607) - SR3	587	11-Mar-16 A	20-Mar-18	180					
PO-Ia	Possession of Portion Ia (Day 789) - SCB / SCP1 / SCP2 / Rumsey Street Flyover	600	28-Mar-16 A	20-Mar-18	-307					
PO-VII_a2	Possession of Portion VII (Day 762) - CH3800-3911 (below -6.0mPD)	567	31-Mar-16 A	20-Mar-18	-250					
PO-IXc_1	Possession of Portion IXc (Day 712) - EVB above 3.6mPD - Relinquished on 12 Apr 2016	445	29-Jul-16 A	20-Mar-18	-274					
PO-IXb_1	Possession of Portion IXb (Day 712) - EVB (below +3.6mPD to tunnel top slab) - Relinquished on 12 Apr 2016	445	05-Aug-16 A	20-Mar-18	-274					
PO-VIa_a	Possession of Portion VIa (Day 823) - CH3250-3283	425	15-Aug-16 A	20-Mar-18	-269					
PO-Vb2_a	Possession of Portion V (Day 607) - SR2	456	15-Aug-16 A	20-Mar-18	-265					
PO-VIc_a	Possession of Portion VIc (Day 761) - CH3770-3800 (Access Shaft Opening)	391	23-Sep-16 A	20-Mar-18	-264					
PO-VIb_c	Possession of Portion VIb (Day 761) - CH3625-3770	391	23-Sep-16 A	20-Mar-18	-279					
PO-IVa1	Possession of Portion IVa (Day 930) - CH2600-2720	323	30-Nov-16 A	20-Mar-18	-271					
PO-IVb2	Possession of Portion IVb (Day 930) - MVB (GL D-H)	233	28-Feb-17 A	20-Mar-18	-320					
PO-VIIIa_a	Possession of Portion VIIIa (Day 929) - CH4530-4591 W/B	233	28-Feb-17 A	20-Mar-18	-245					
PO-VIIIa	Possession of Portion VIIIa (Day 929) - CH4250-4600 (Remaining)	241	12-Mar-17 A	20-Mar-18	-245					
PO-VIIIb	Possession of Portion VIIIb (Day 929) - SR8 (CH700-350)	233	12-Mar-17 A	20-Mar-18	-192					
PO-VIIIc	Possession of Portion VIIIc (Day 1039) - SR8 (CH350-310) / SCP4	233	12-Mar-17 A	20-Mar-18	-241					
PO-IVa2_a	Possession of Portion IVa (Day 930) - CH2720-2950	241	12-Mar-17 A	20-Mar-18	-267					
PO-IVb1	Possession of Portion IVb (Day 930) - MVB (GL A-C)	239	14-Mar-17 A	20-Mar-18	-320					
PO-IVa2_b	Possession of Portion IVa (Day 930) - SR1	203	30-Mar-17 A	20-Mar-18	-267					
PO-Vb2_b	Possession of Portion V (Day 607) - SCP3	182	03-Jul-17 A	20-Mar-18	-265					
PO-VIb_a	Possession of Portion VIb (Day 761) - CH3400-3428	80	31-Jul-17 A	20-Mar-18	-264					
PO-VIa_b	Possession of Portion VIa (Day 823) - CH3283-3400	80	31-Jul-17 A	20-Mar-18	-284					
PO-IVc	Possession of Portion IVc (Day 1144) - MVB (above +5.0mPD)	111	20-Feb-18	10-Jun-18	-262					

- Current Milestone
- Level of Effort
- Remaining Work
- Project Baseline
- Baseline Milestone
- Actual Work
- Critical Remaining Work

Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING

Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 2 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018											
						Feb			Mar			Apr			May		
Submissions and Approvals																	
Initial General Submission																	
10168	Submission of CMC 3DVR	30	20-Mar-18	18-Apr-18	-74												
DETAILED DESIGN OF WORKS																	
Permanent Works Design and Engineering																	
Green Roof on EVB																	
2166	EVB Roof - Engineer review & Approval; Consent to Proceed Construction	24	18-Apr-16 A	06-Mar-18	-279												
Green Wall on ADB																	
10238	ADB Green Wall - Engineer review & Approval; Consent to Proceed Construction	24	07-Mar-16 A	08-Mar-18	-269												
Landscaping & Associated Irrigation System																	
10268	Landscaping - Engineer review & Approval; Consent to Proceed Construction	24	07-Mar-16 A	08-Mar-18	-238												
PROCUREMENT, MANUFACTURING & DELIVERIES																	
Procurement; Manufacturing; Deliveries																	
Green Roof on EVB																	
Shop Drawings																	
12846	EVB Green Roof - Shop Drawings review the Engineer	30	03-Aug-17 A	27-Feb-18	-342												
2230	EVB Green Roof - Obtain Approval for Shop Drawings	0		27-Feb-18	-342												
Procurement & Fabrication																	
2232	EVB Green Roof - Confirm design of embed items	0	07-Mar-18		-349												
2234	EVB Green Roof - Embed fabrication & delivery	30	07-Mar-18	05-Apr-18	-349												
2236	EVB Green Roof - Commence embed installation	0	06-Apr-18		-349												
2238	EVB Green Roof - Green Roof Fabrication & delivery	30	06-Apr-18	05-May-18	-349												
2240	EVB Green Roof - Commence installation	0	06-May-18		-349												
Landscaping and Associated Irrigation System																	

- Current Milestone
- Remaining Work
- Level of Effort
- Project Baseline
- Baseline Milestone
- Actual Work
- Critical Remaining Work

Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 3 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

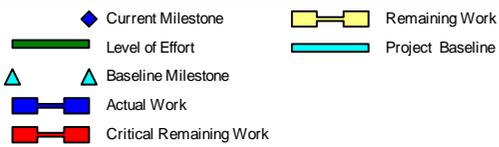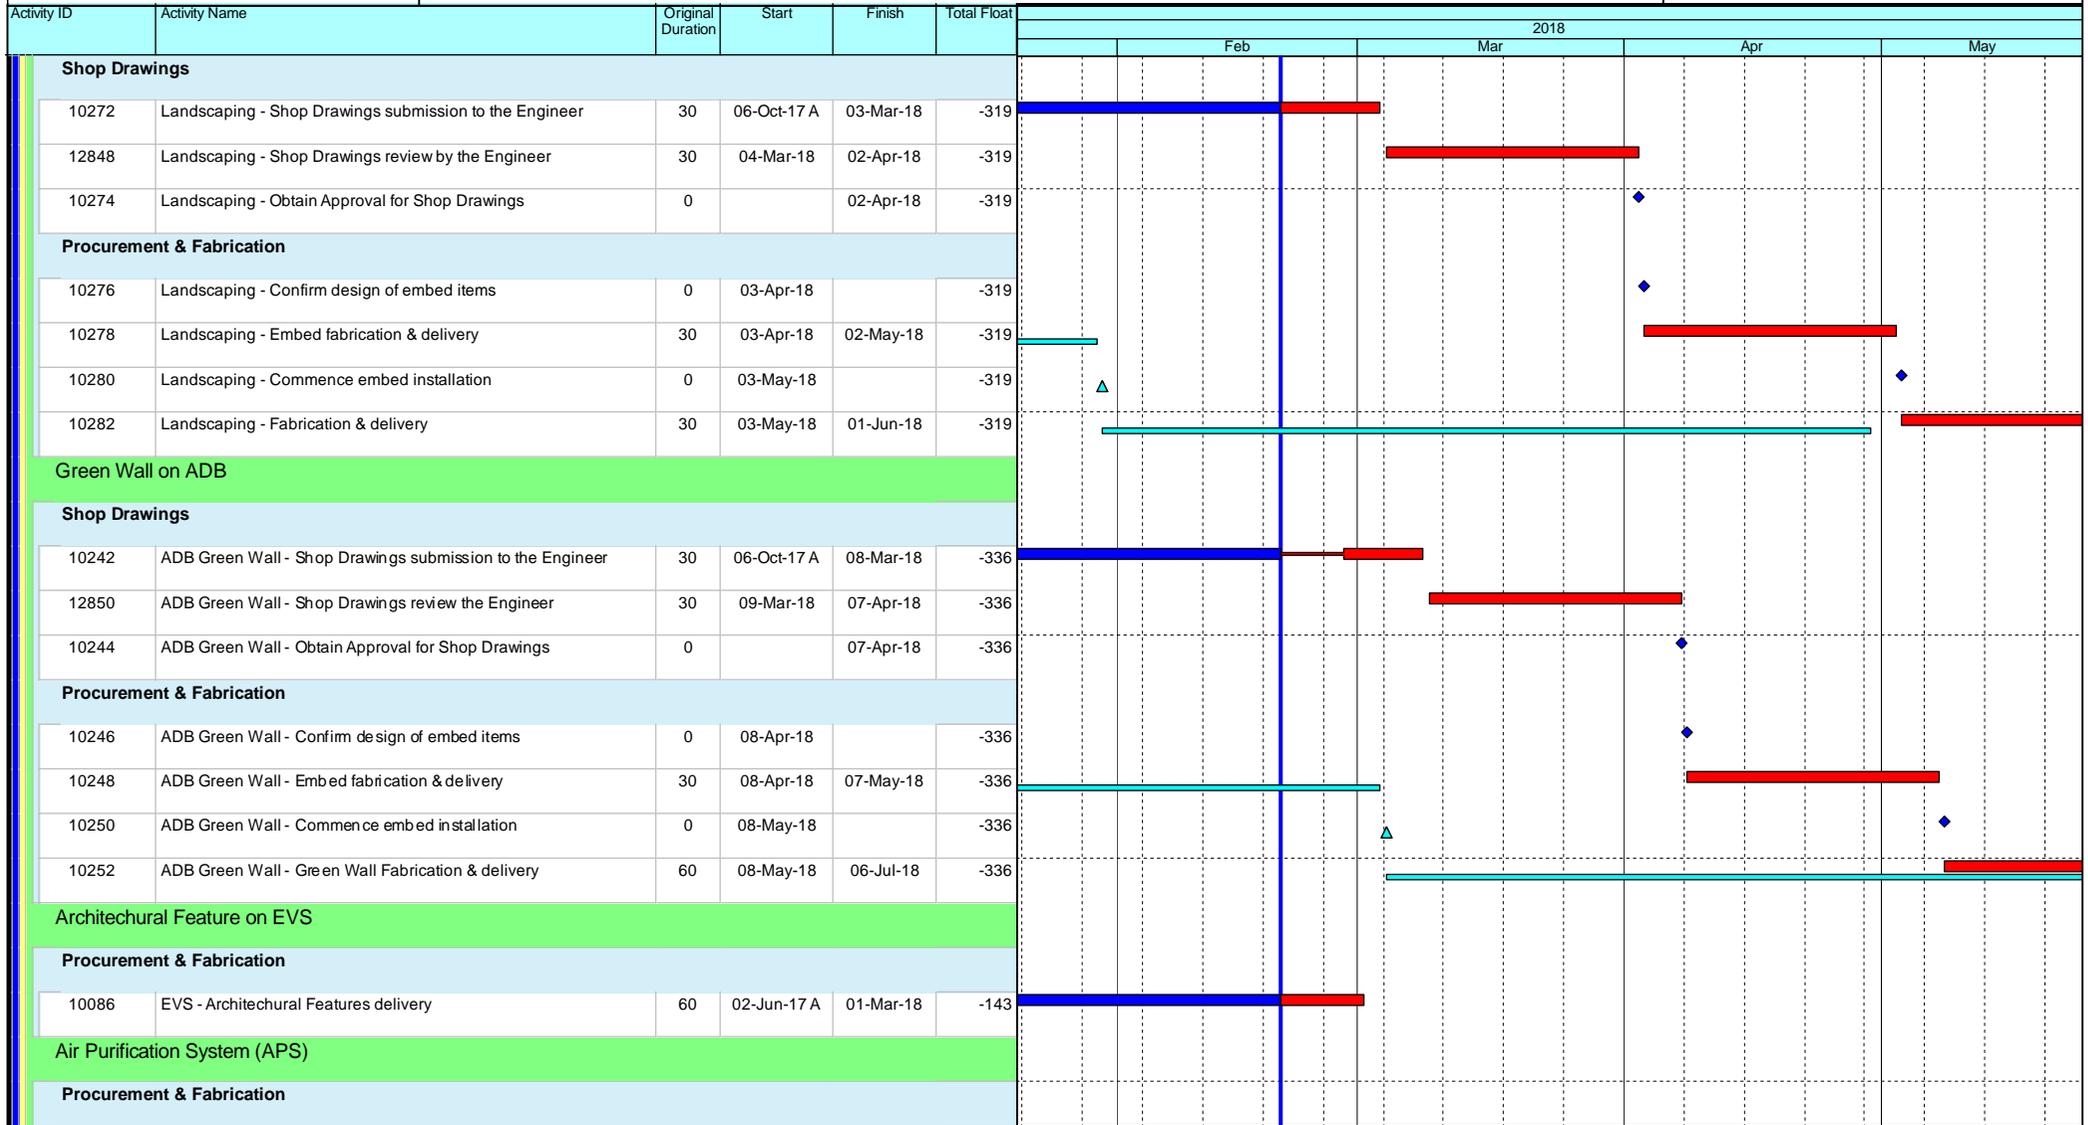TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING

Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 4 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018				
						Feb	Mar	Apr	May	
13664	APS - Ship to HK Store (3rd Batch)	80	03-Aug-17 A	01-Mar-18	-138					
2368	APS - QA Stored Equipment	6	23-Aug-17 A	01-Mar-18	-138					
CONSTRUCTION										
West Ventilation Building (WVB - related)										
Tunnel Section (WVB-related)										
Portion Ia, IIc [CH840 to CH1360]										
13086a	Request for VO / instruction for TCSS equipment installation and cabling (Ganty FADS01) (Ref: H2613-LJV-LE-4022)	24	04-Oct-16 A	15-Mar-18	-162					
13086	TCSS cabling and sign face installation (FADS01)	40	16-Mar-18	07-May-18	-162					
Westbound										
5000	MEP(WB) - (CH840 to CH1360) E&M 1st Fix	29	05-Jun-17 A	01-Mar-18	-134					
5008	MEP(WB) - (CH840 to CH1360) E&M 2nd Fix (include Sump A)	58	12-Jun-17 A	22-Mar-18	-152					
5016	MEP(WB) - (CH840 to CH1360) E&M Final Fix	24	23-Mar-18	24-Apr-18	-152					
5024	MEP(WB) - (CH840 to CH1360) TCSS Field equip & cable installation	18	03-Apr-18	24-Apr-18	-152					
Eastbound										
6100	MEP(EB) - (CH840 to CH1360) E&M 1st Fix	29	01-Mar-17 A	01-Mar-18	-134					
6102	MEP(EB) - (CH840 to CH1360) E&M 2nd Fix (include Sump A)	58	22-May-17 A	22-Mar-18	-152					
6104	MEP(EB) - (CH840 to CH1360) E&M Final Fix	24	23-Mar-18	24-Apr-18	-152					
6106	MEP(EB) - (CH840 to CH1360) TCSS Field equip & cable installation	18	03-Apr-18	24-Apr-18	-152					
West Ventilation Building (WVB)										
RC Structures and Metal Roof										
Metal Roof										
10454	WVB - Touch up (Steel structure)	12	24-Jan-18 A	05-Feb-18 A						
10456	WVB - Touch up (Roof cladding)	12	23-Feb-18	08-Mar-18	-189					
Metal Roof Eastern Side (M.J. East)										

- Current Milestone
- Level of Effort
- Baseline Milestone
- Actual Work
- Critical Remaining Work
- Remaining Work
- Project Baseline

Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 5 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

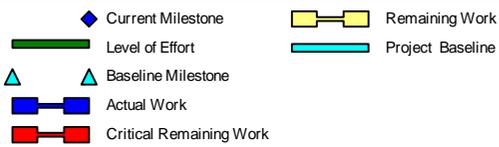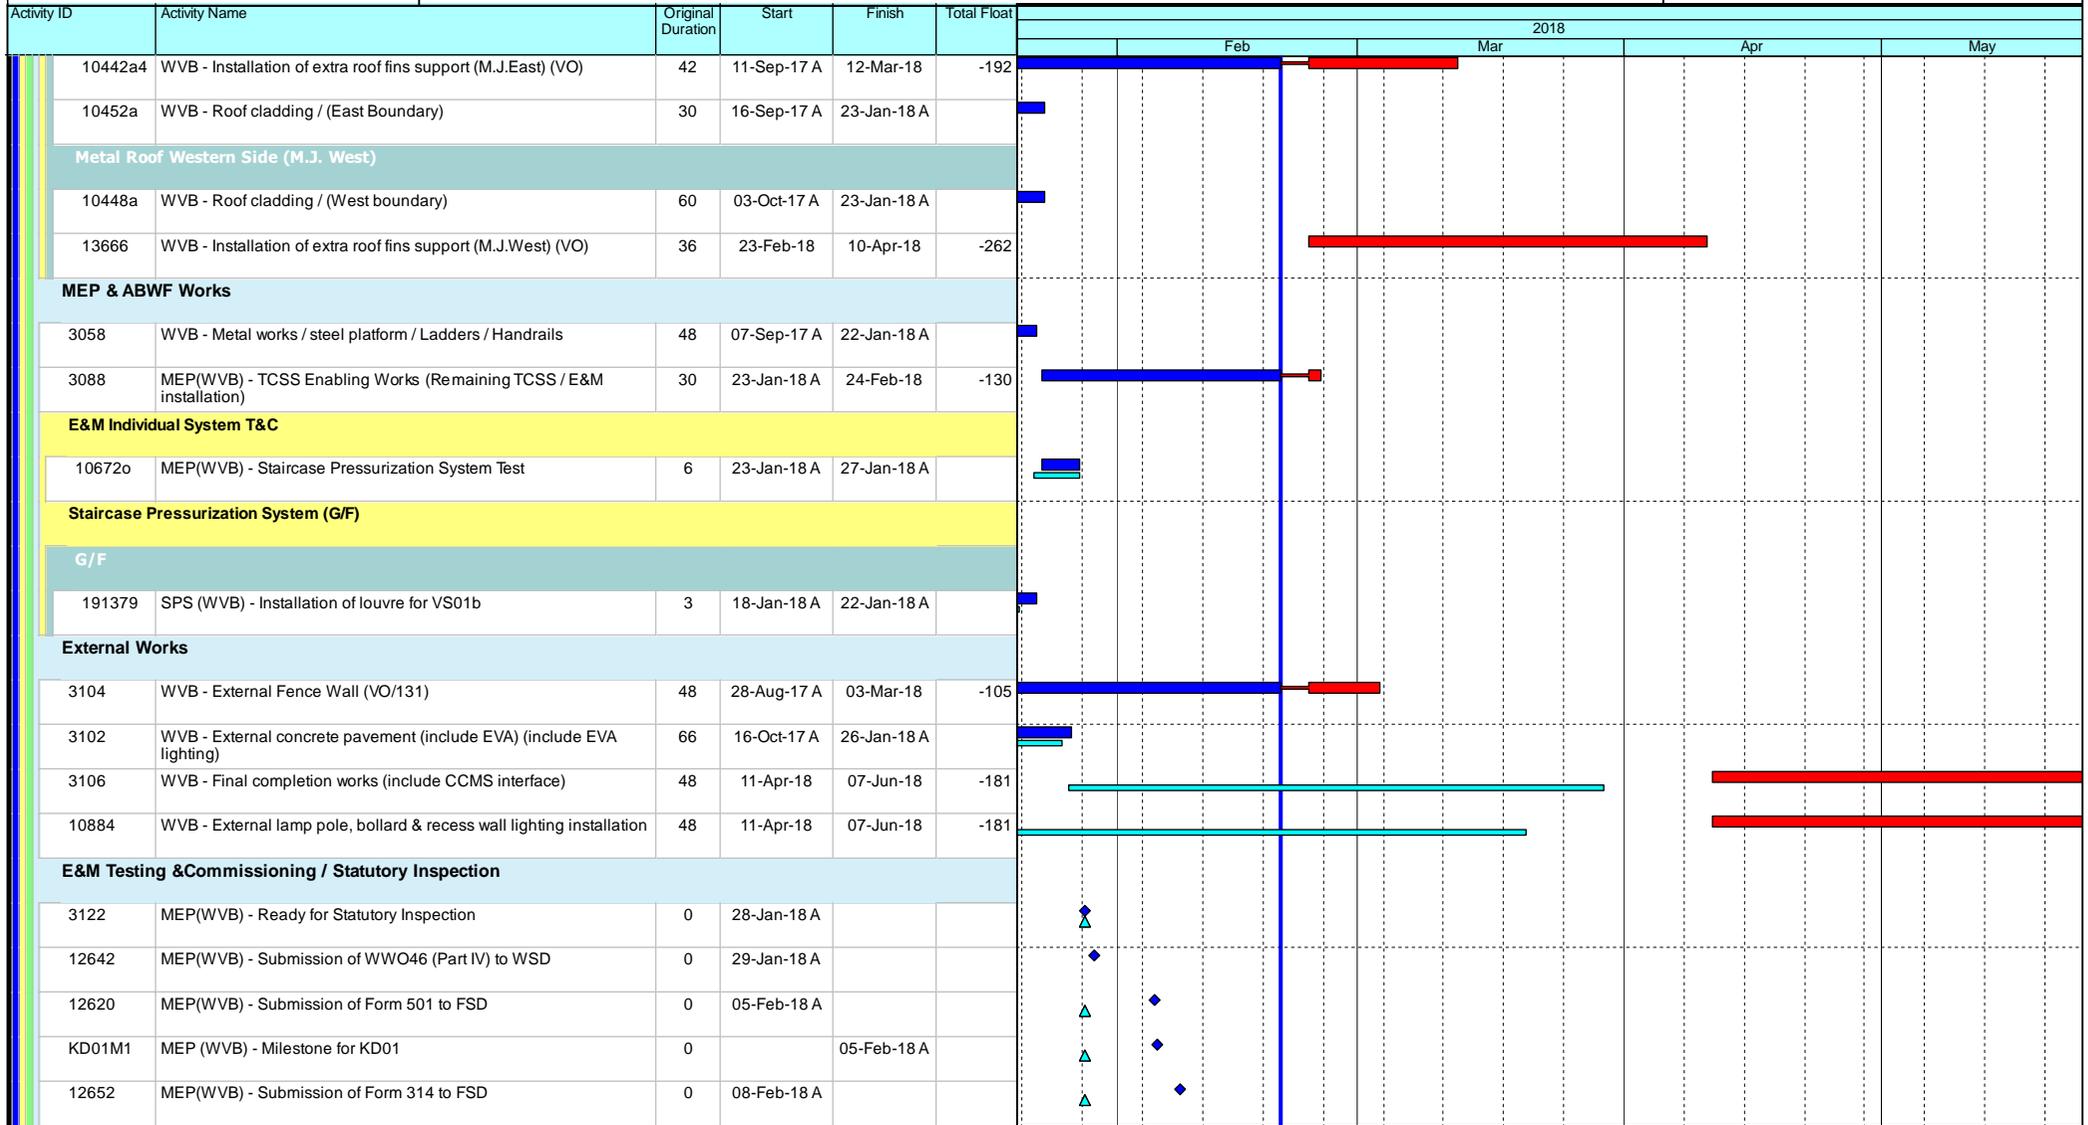TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 6 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

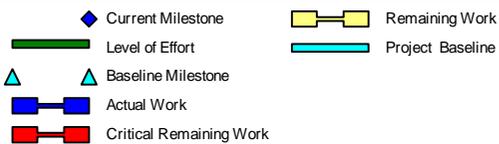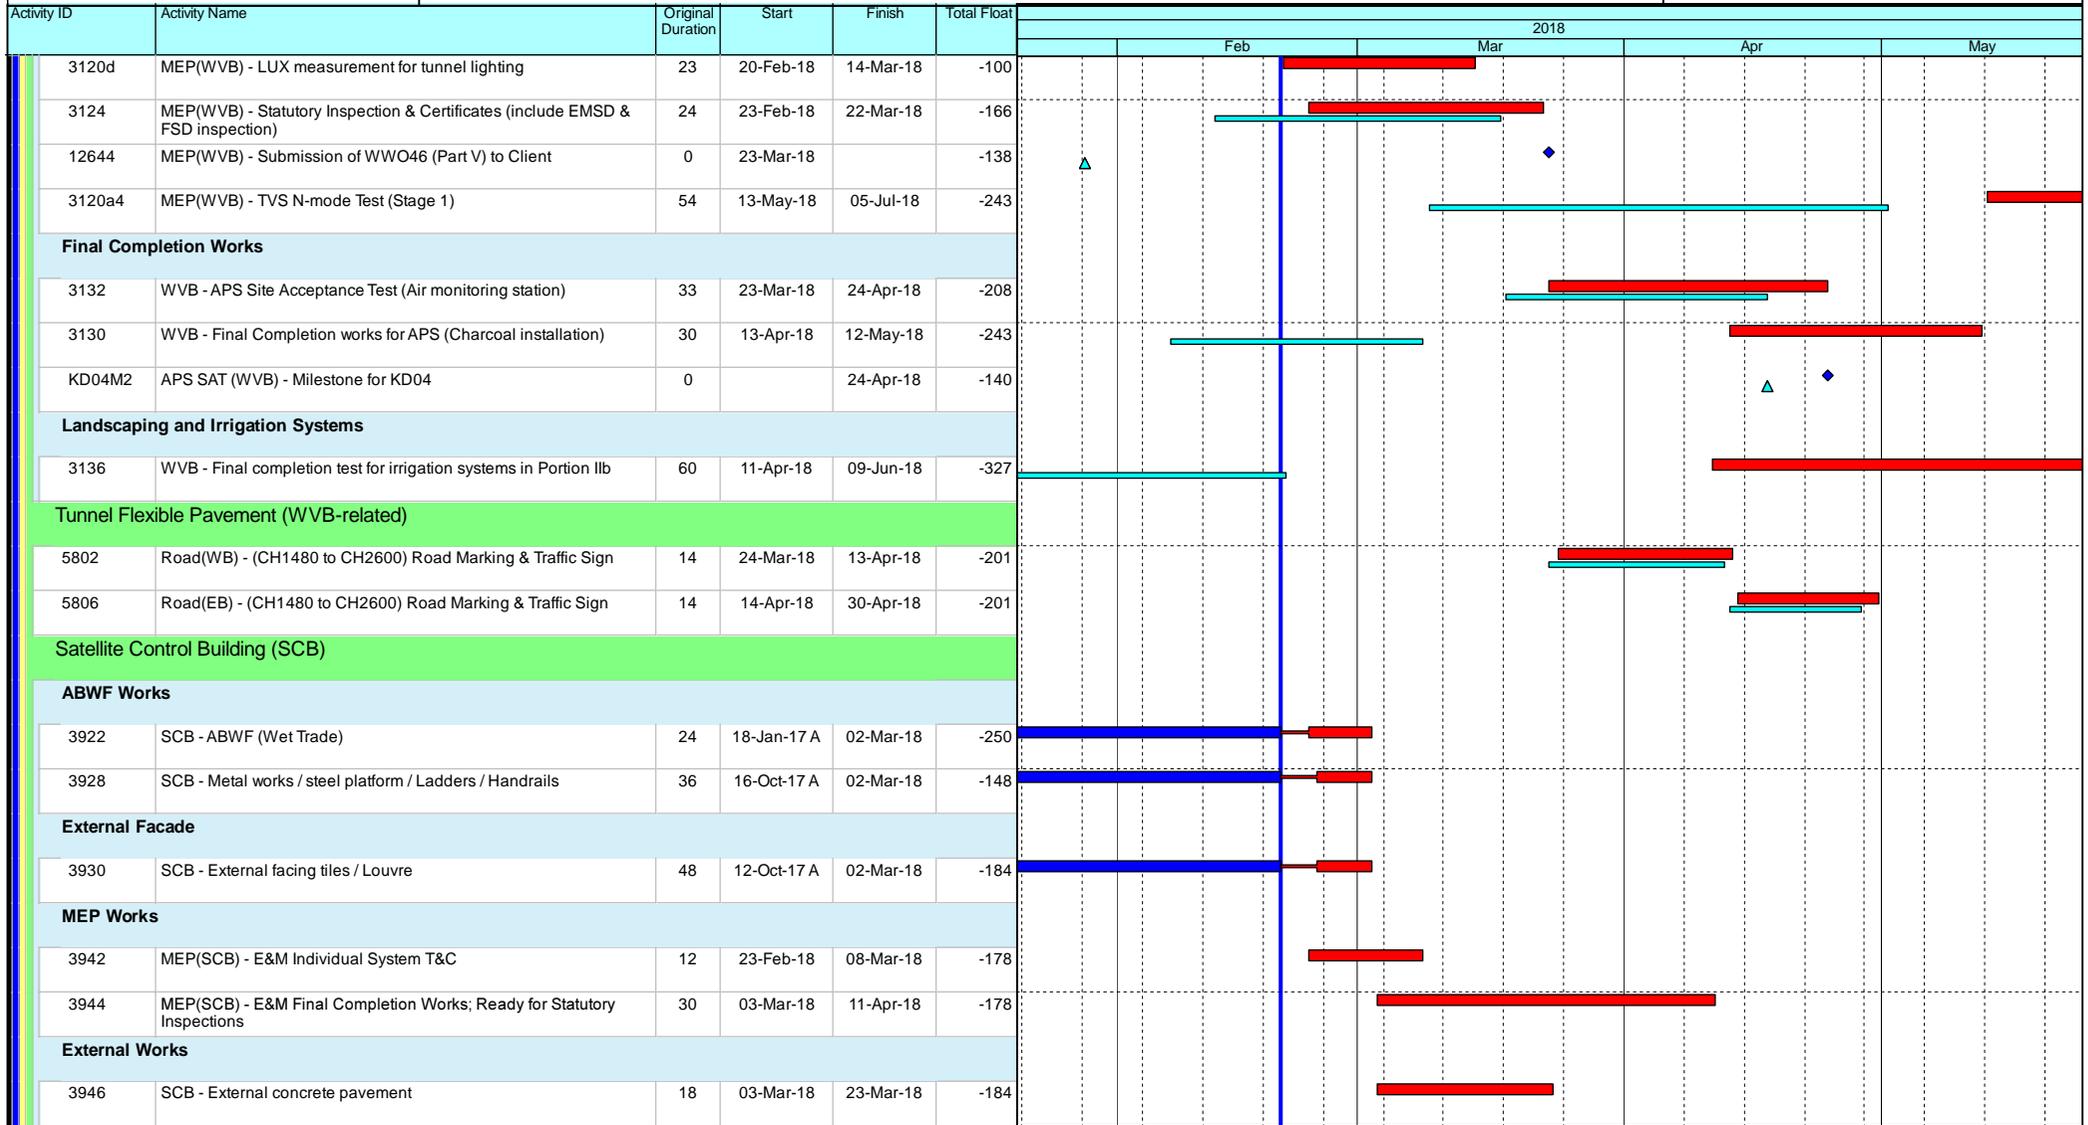TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 7 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

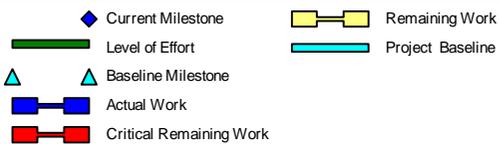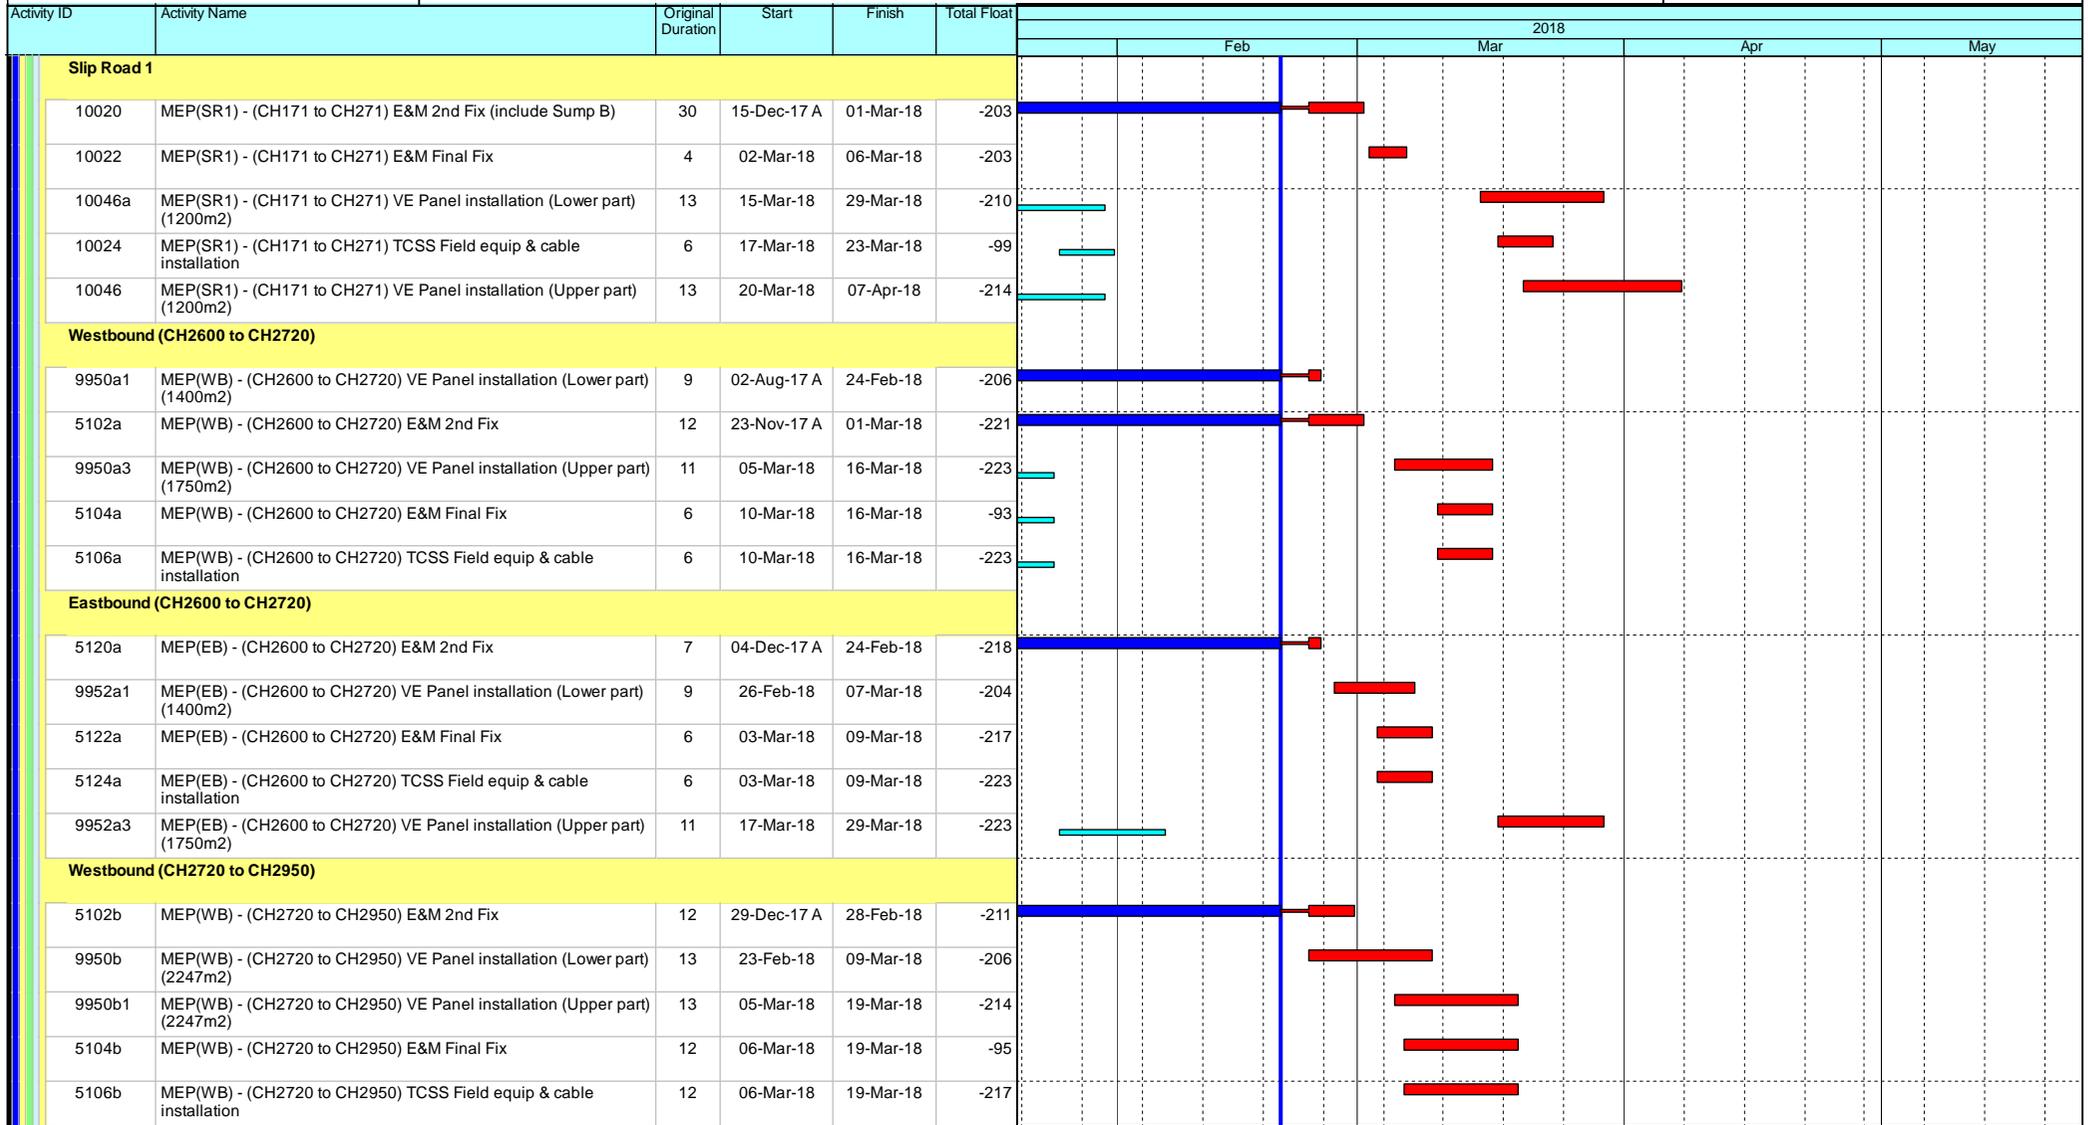TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING


Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 9 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

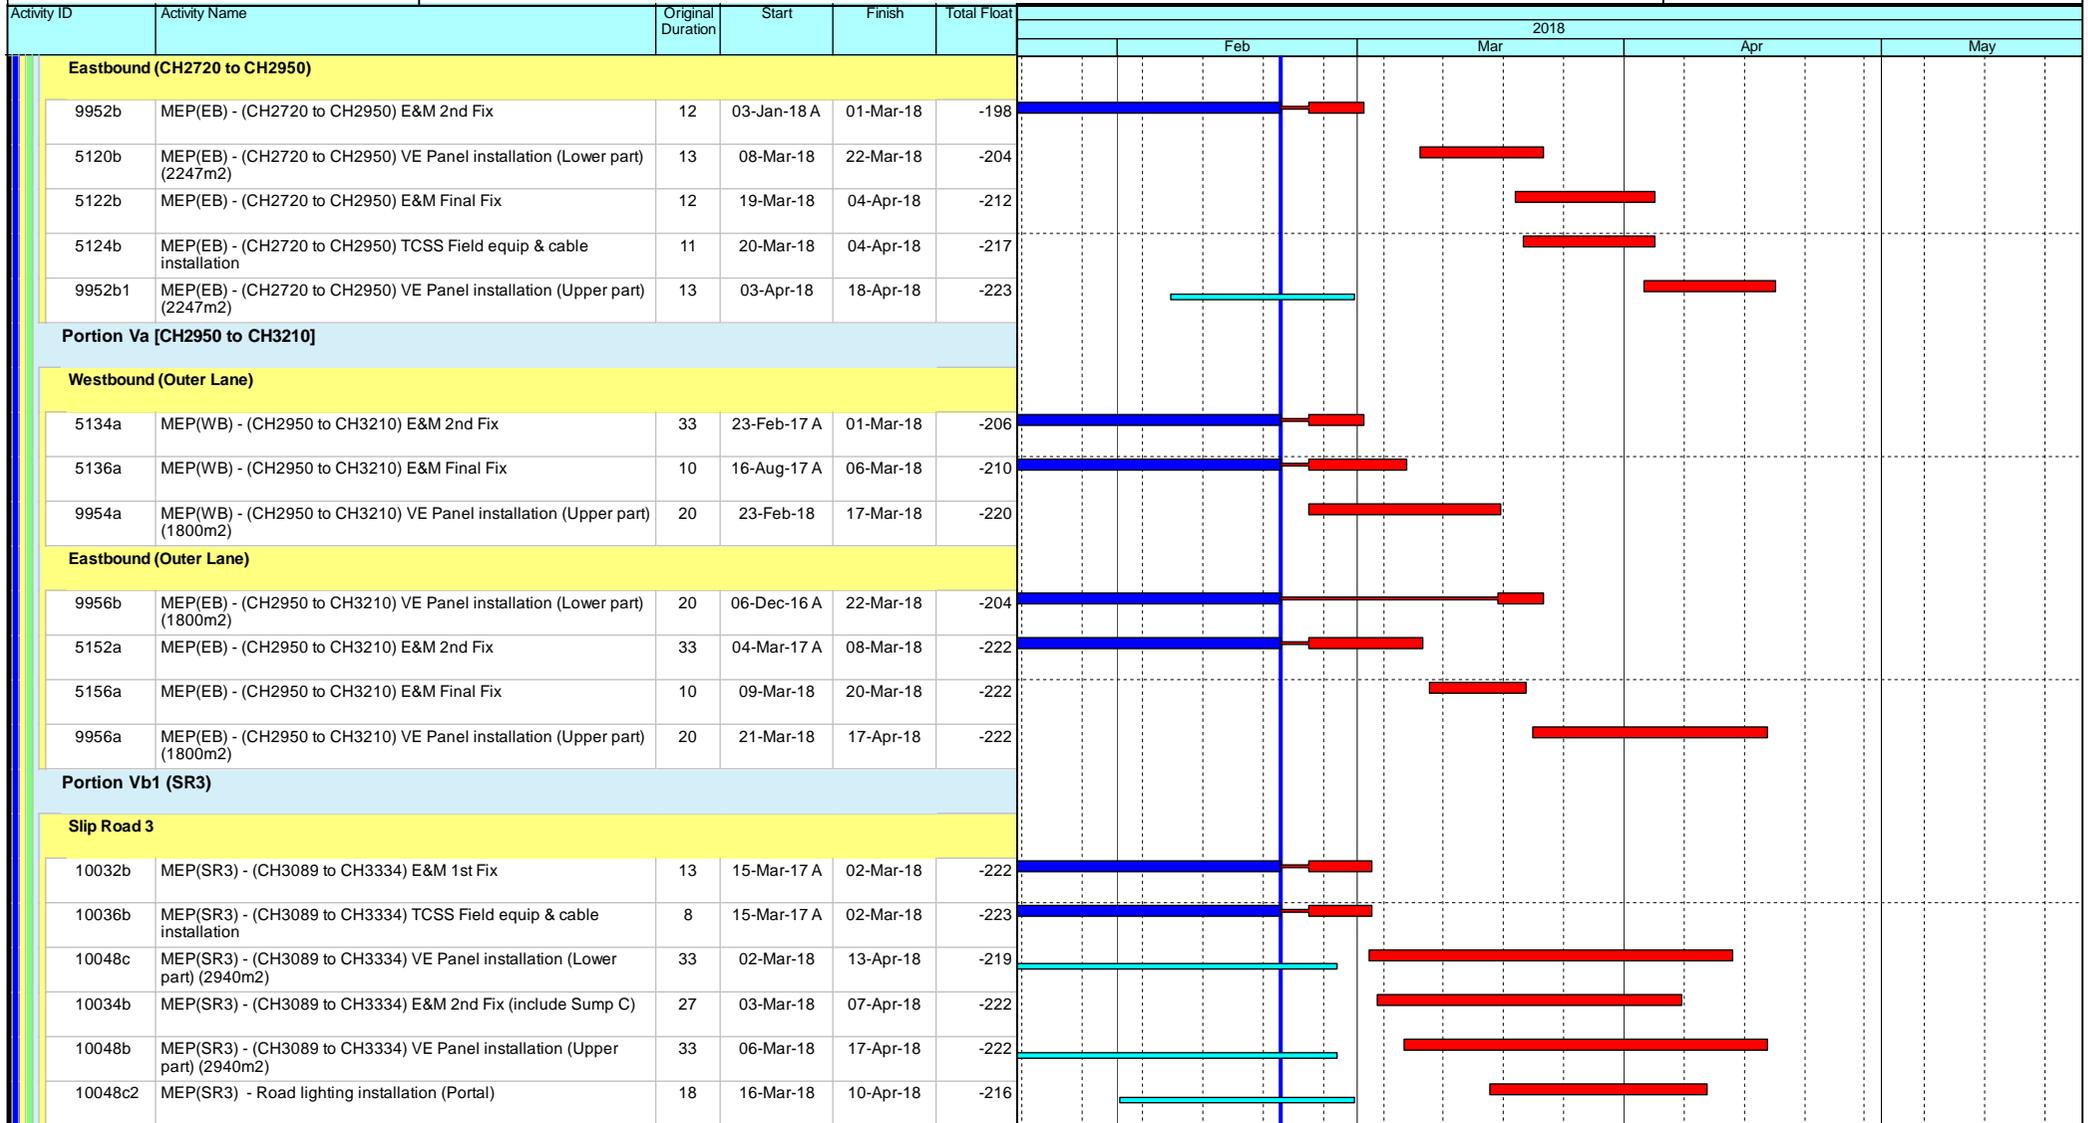TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING

Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 10 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018											
						Feb			Mar			Apr			May		
10038b	MEP(SR3) - (CH3089 to CH3334) E&M Final Fix	8	09-Apr-18	17-Apr-18	-222												
Portion Vb2 (SR2 / SCP3)																	
Slip Road 2																	
10050b	MEP(SR2) - (CH3114 to CH3257) E&M 1st Fix	8	08-Mar-17 A	27-Feb-18	-184												
10056b	MEP(SR2) - (CH3114 to CH3257) TCSS Field equip & cable installation	5	16-Mar-17 A	27-Feb-18	-217												
10052b	MEP(SR2) - (CH3114 to CH3257) E&M 2nd Fix (include Sump F)	40	15-Jun-17 A	23-Mar-18	-205												
10064b2	MEP(SR2) - Road lighting installation (Portal)	18	23-Feb-18	15-Mar-18	-216												
10054b	MEP(SR2) -(CH3114 to CH3257) E&M Final Fix	5	24-Mar-18	29-Mar-18	-145												
10064b	MEP(SR2) - (CH3114 to CH3257) VE Panel installation (Upper part) (1716m2)	18	12-Apr-18	03-May-18	-152												
10064c	MEP(SR2) - (CH3114 to CH3257) VE Panel installation (Lower part) (1716m2)	18	12-Apr-18	03-May-18	-152												
Portion Vc [CH3210 to CH3250]																	
Westbound (Outer Lane)																	
5134c	MEP(WB) - (CH3210 to CH3250) E&M 2nd Fix	18	23-Feb-17 A	05-Mar-18	-199												
5136c	MEP(WB) - (CH3210 to CH3250) E&M Final Fix	10	06-Mar-18	16-Mar-18	-199												
9954c	MEP(WB) - (CH3210 to CH3250) VE Panel installation (Upper part) (1800m2)	20	19-Mar-18	14-Apr-18	-220												
Eastbound (Outer Lane)																	
5152c	MEP(EB) - (CH3210 to CH3250) E&M 2nd Fix	18	02-Mar-17 A	05-Mar-18	-199												
5156c	MEP(EB) - (CH3210 to CH3250) E&M Final Fix	10	06-Mar-18	16-Mar-18	-199												
9956c	MEP(EB) - (CH3210 to CH3250) VE Panel installation (Upper part) (1800m2)	20	10-Apr-18	03-May-18	-152												
Portion VIa [CH3250 to CH3283]																	
Westbound																	
5166a	MEP(WB) - (CH3250 to CH3283) E&M 2nd Fix	6	27-Nov-17 A	27-Feb-18	-217												
9958a1	MEP(WB) - (CH3250 to CH3283) VE Panel installation (Lower part) (528m2)	6	23-Feb-18	01-Mar-18	-219												
5170a	MEP(WB) - (CH3250 to CH3283) TCSS Field equip & cable installation	5	28-Feb-18	05-Mar-18	-217												

- Current Milestone
- Level of Effort
- Baseline Milestone
- Actual Work
- Critical Remaining Work
- Remaining Work
- Project Baseline

Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 11 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

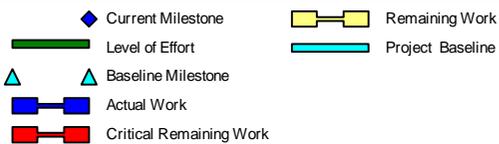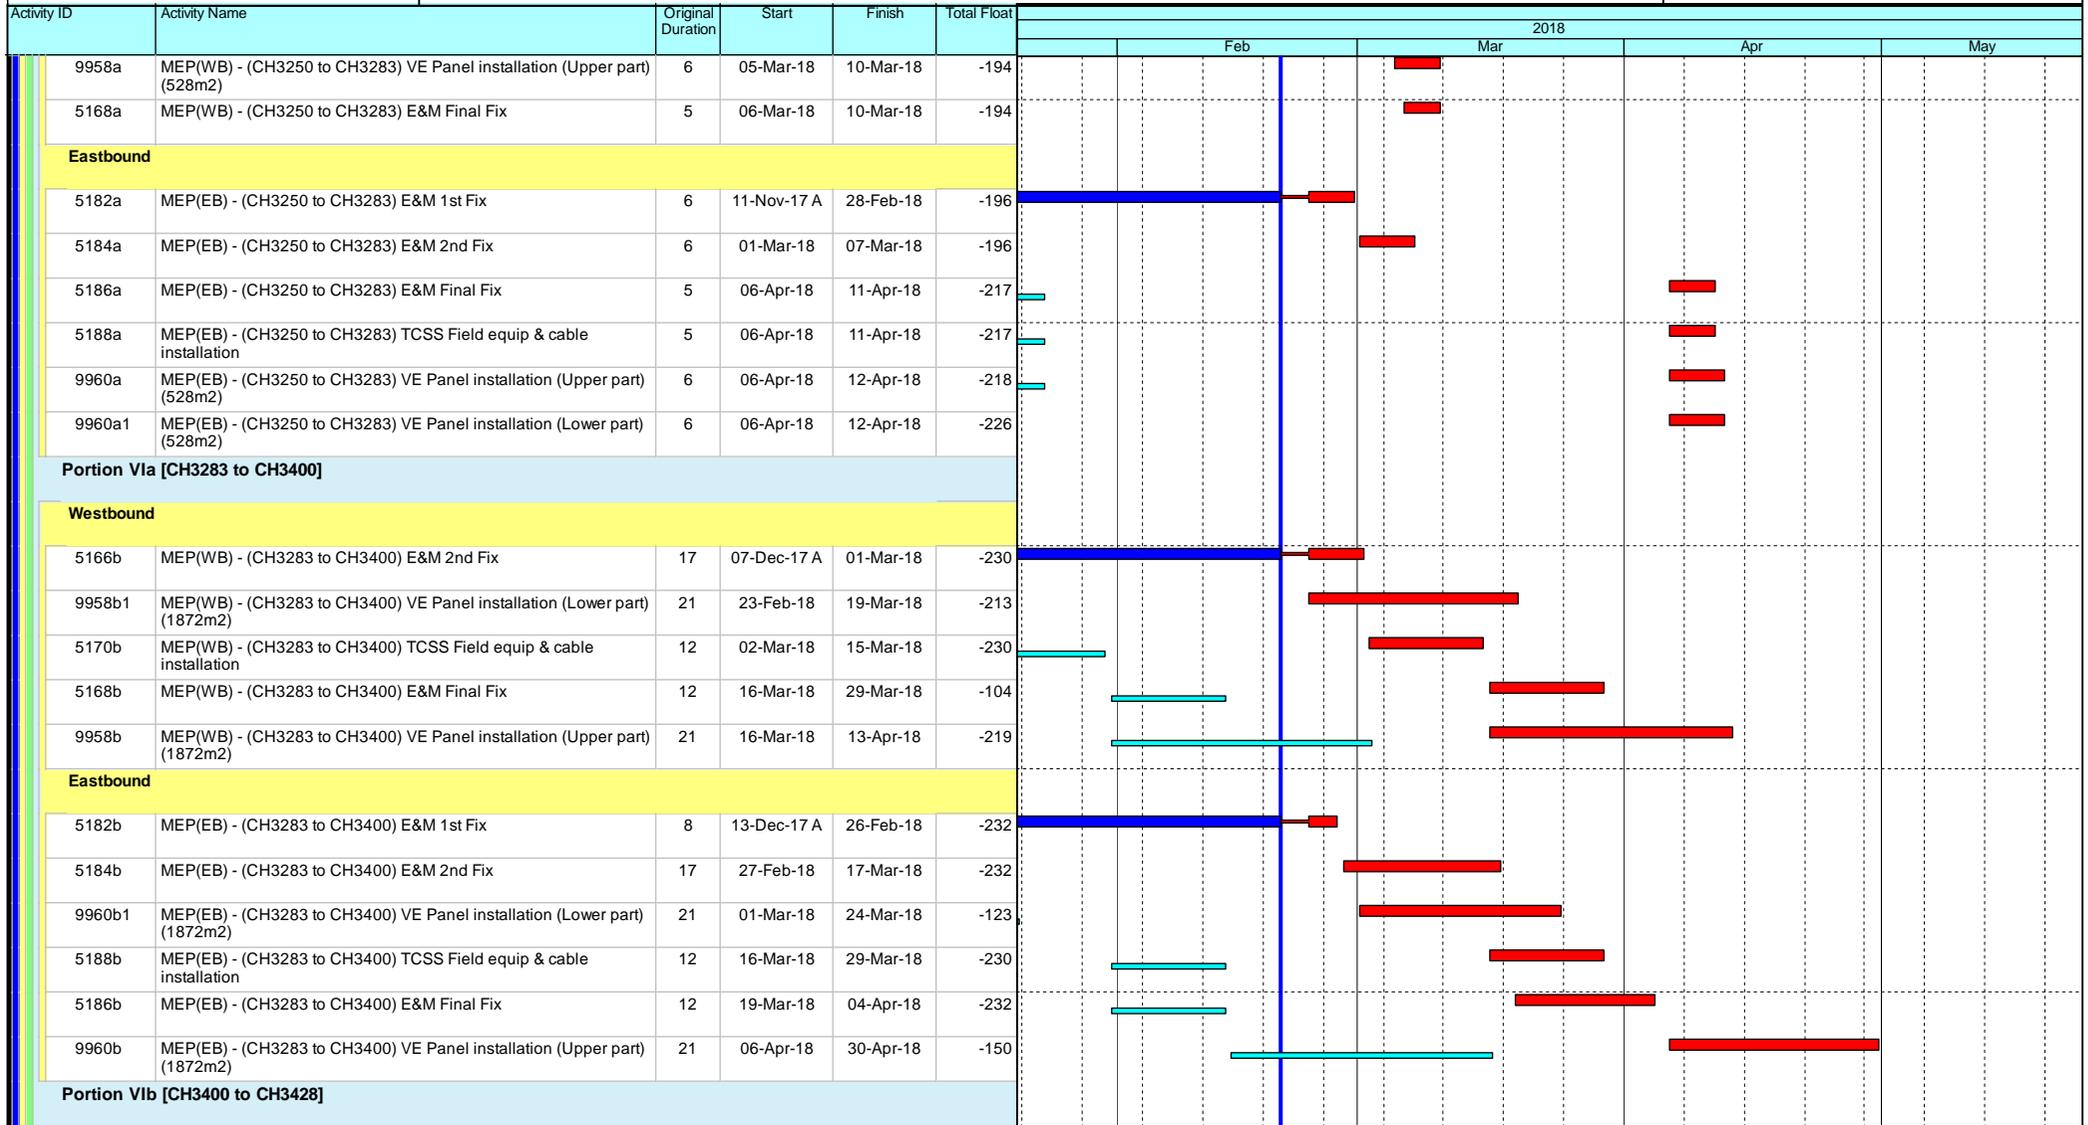TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 12 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

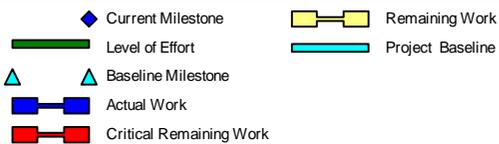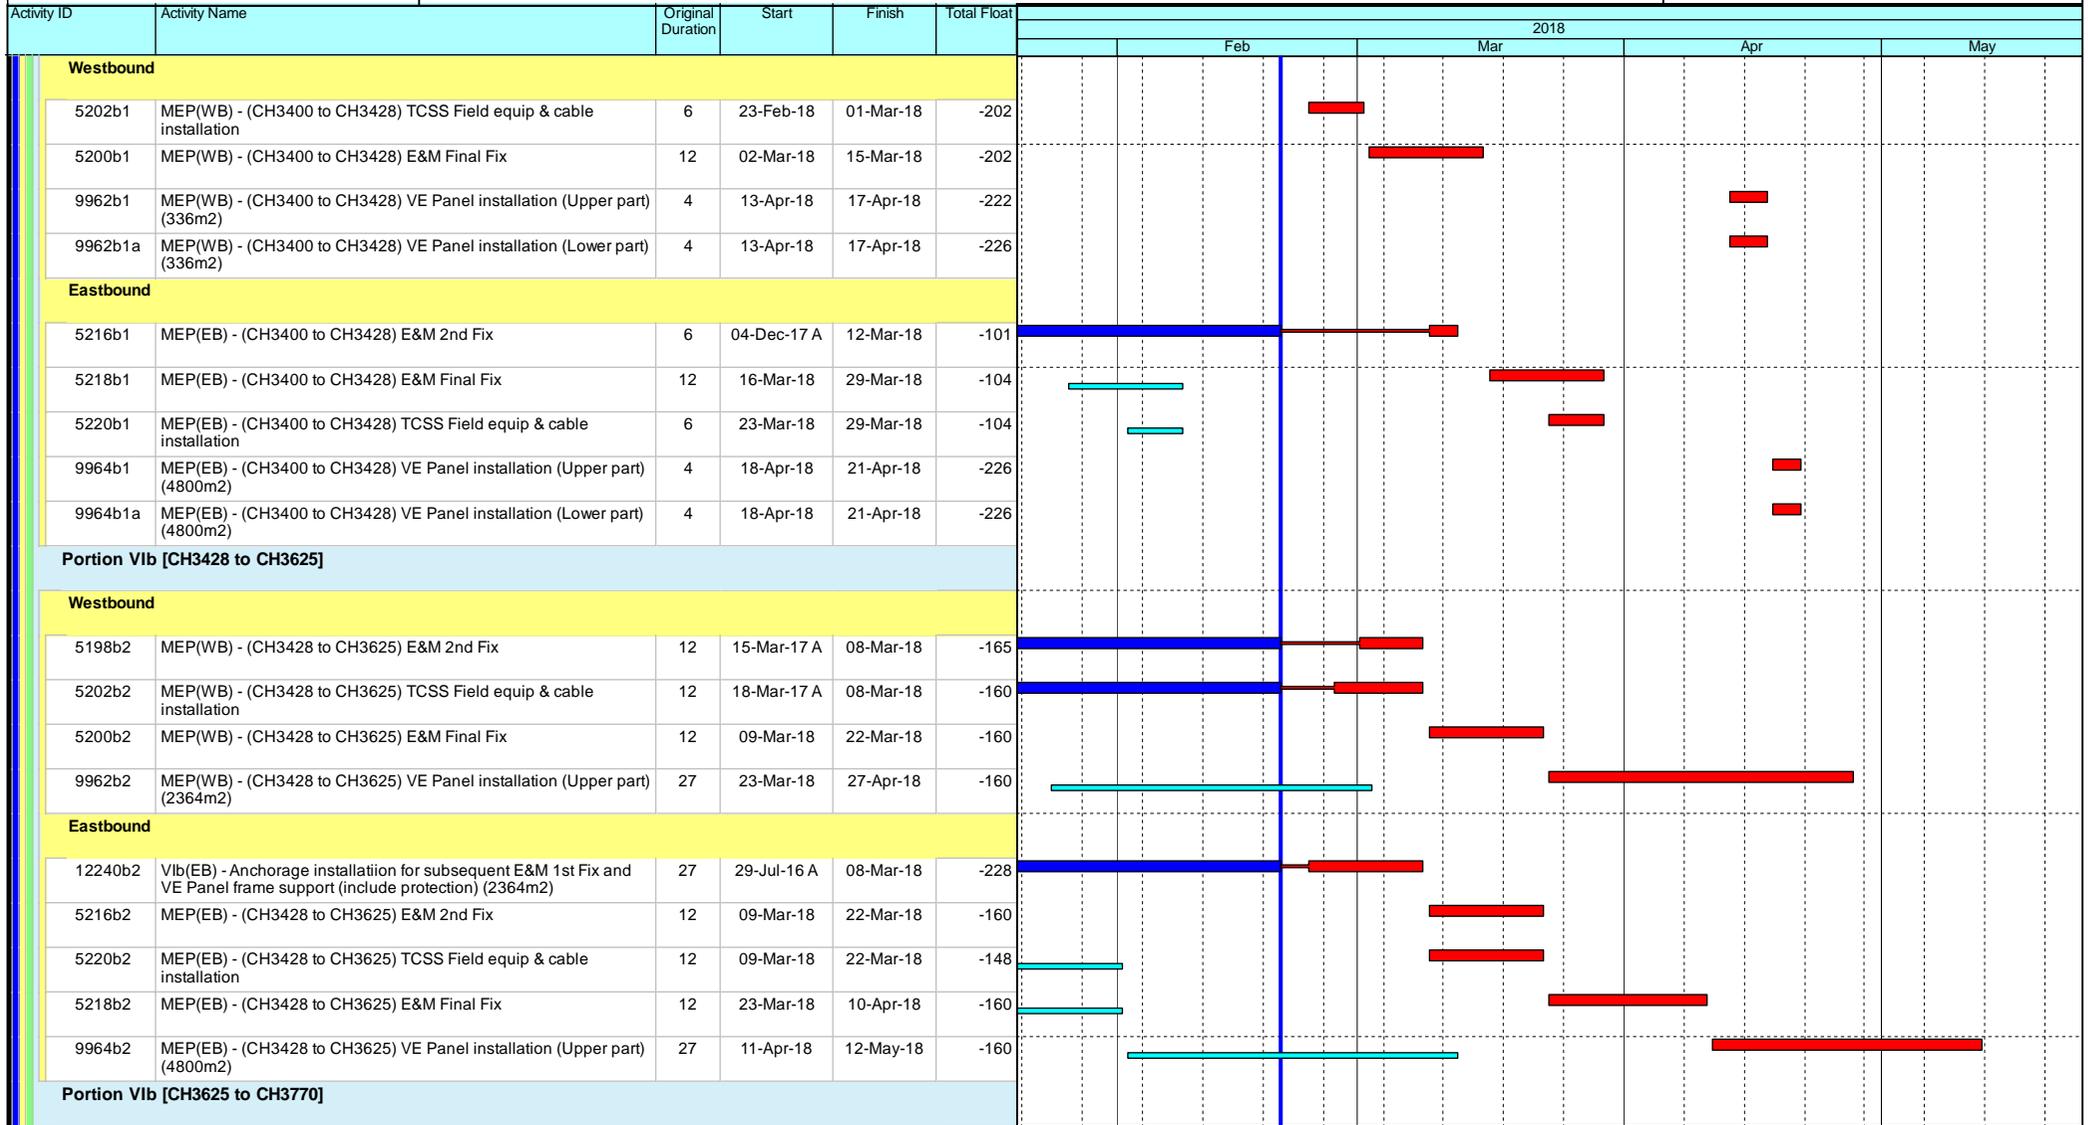TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING


Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 13 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

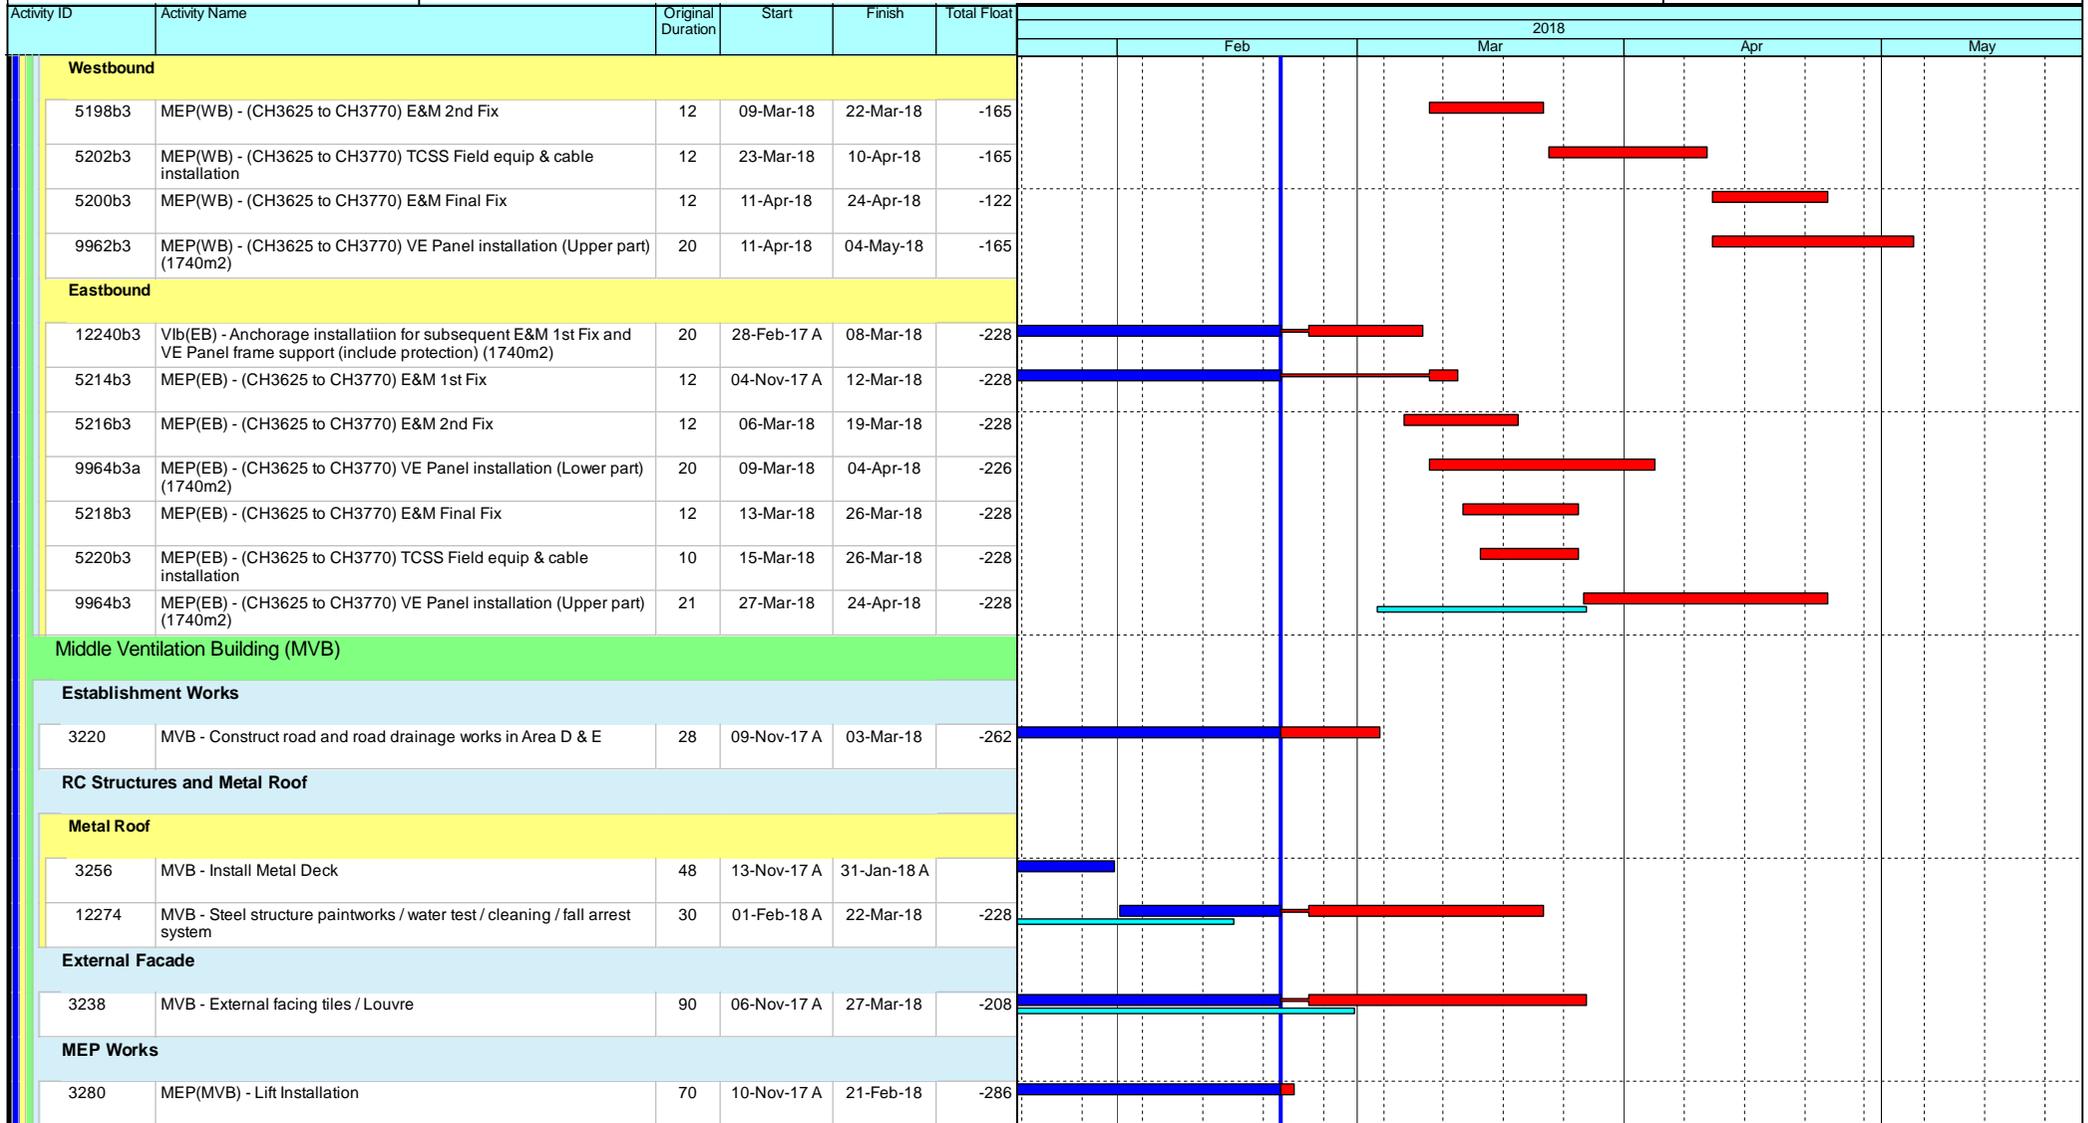TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING


Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 14 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

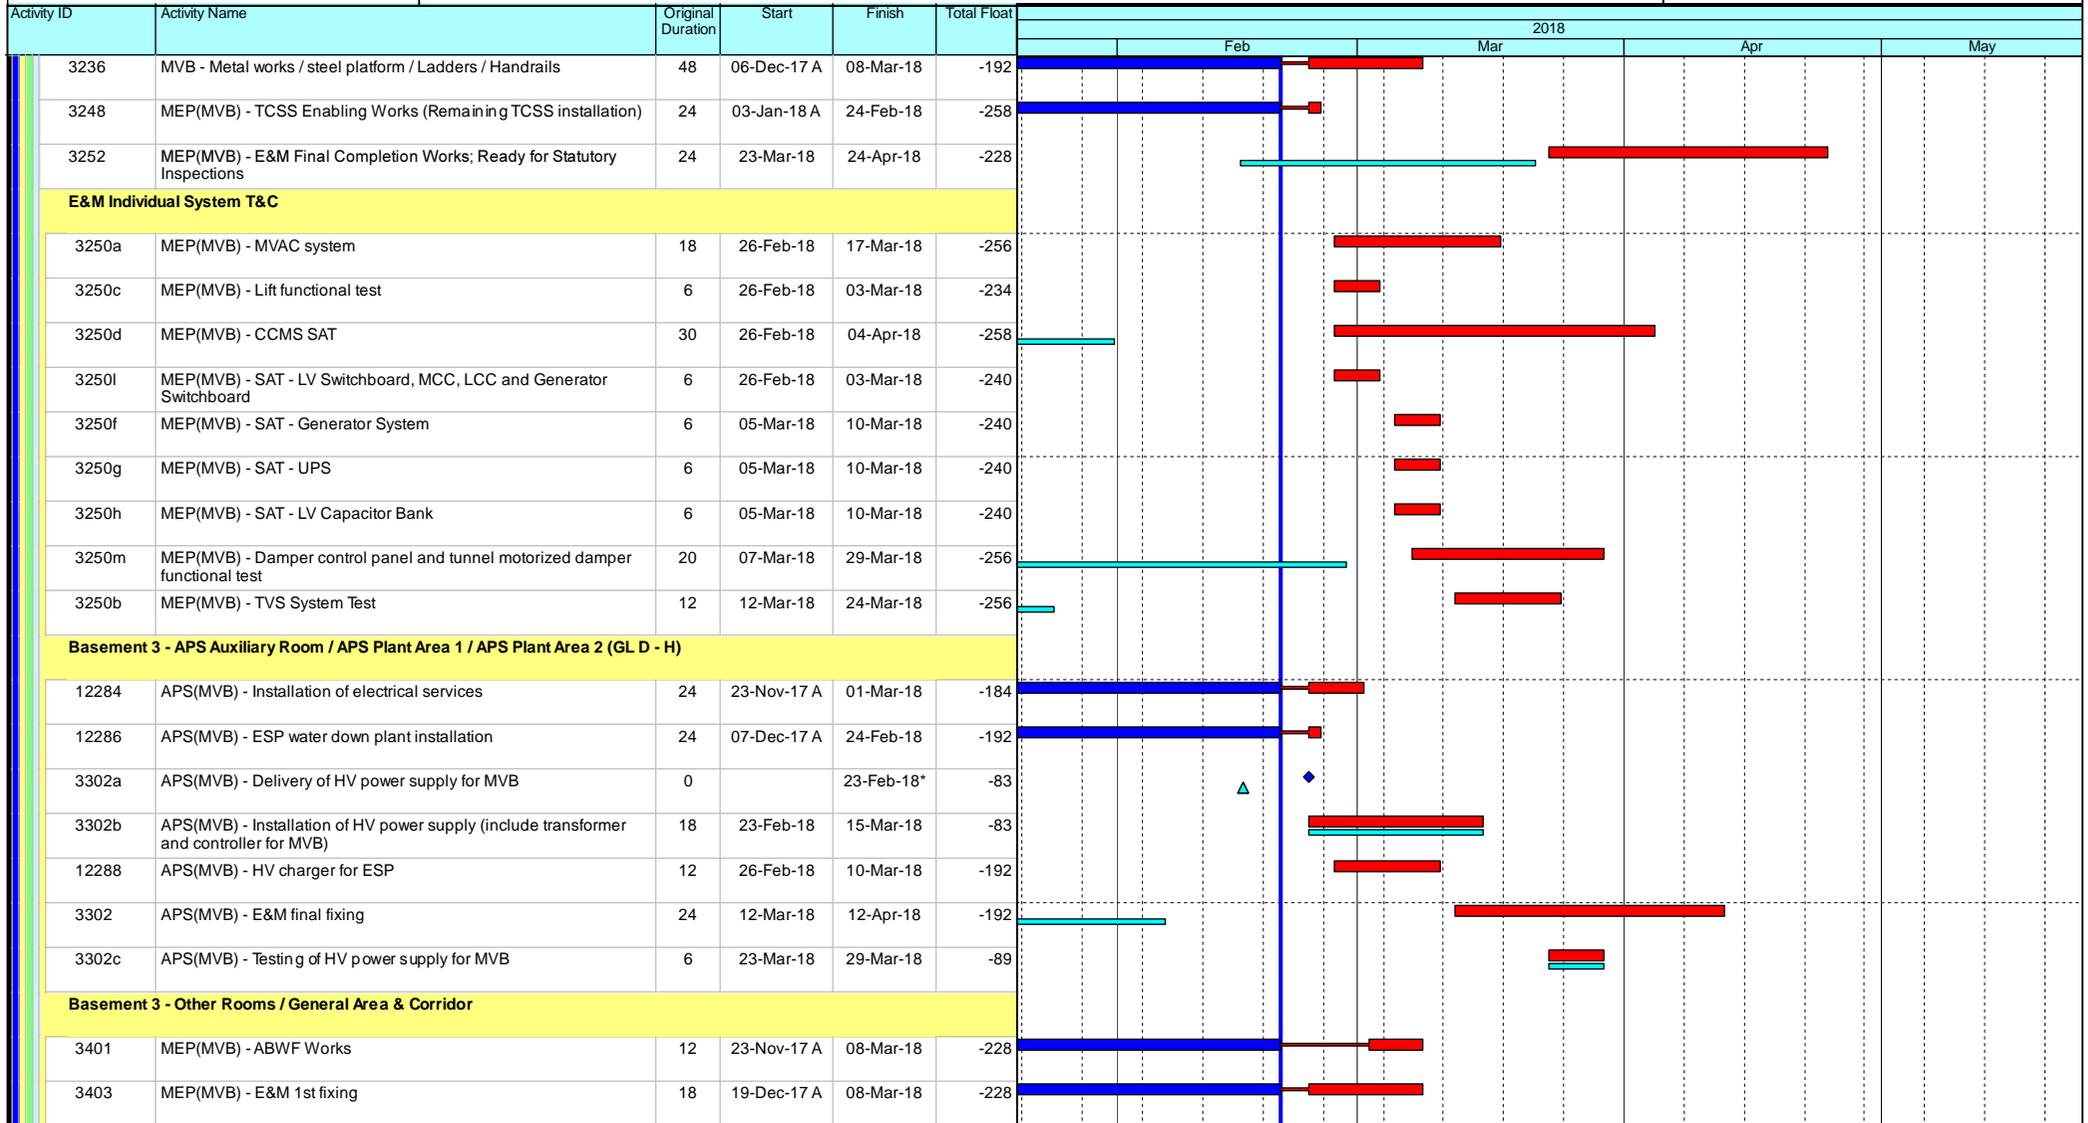TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING


Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 15 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

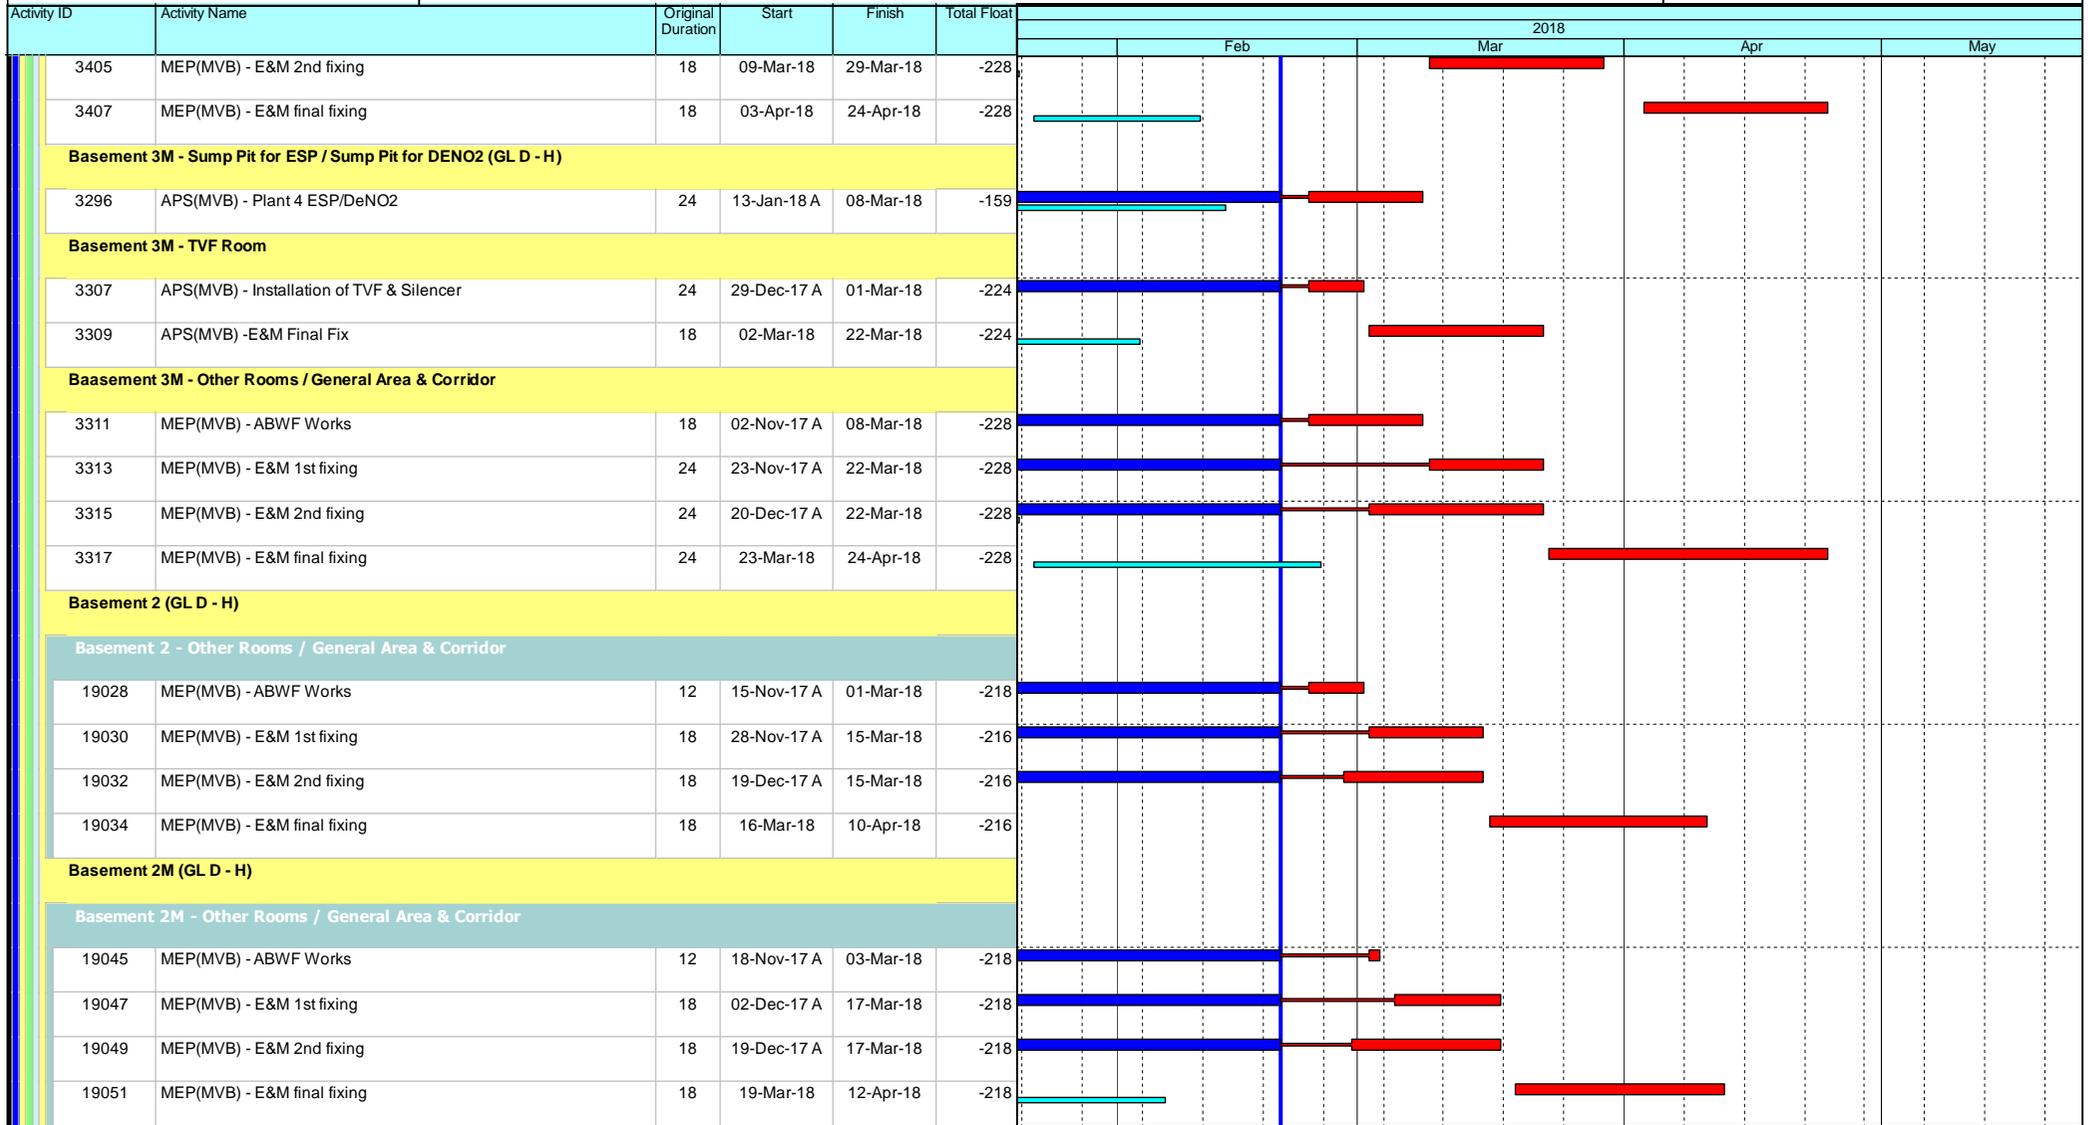TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING


Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 16 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

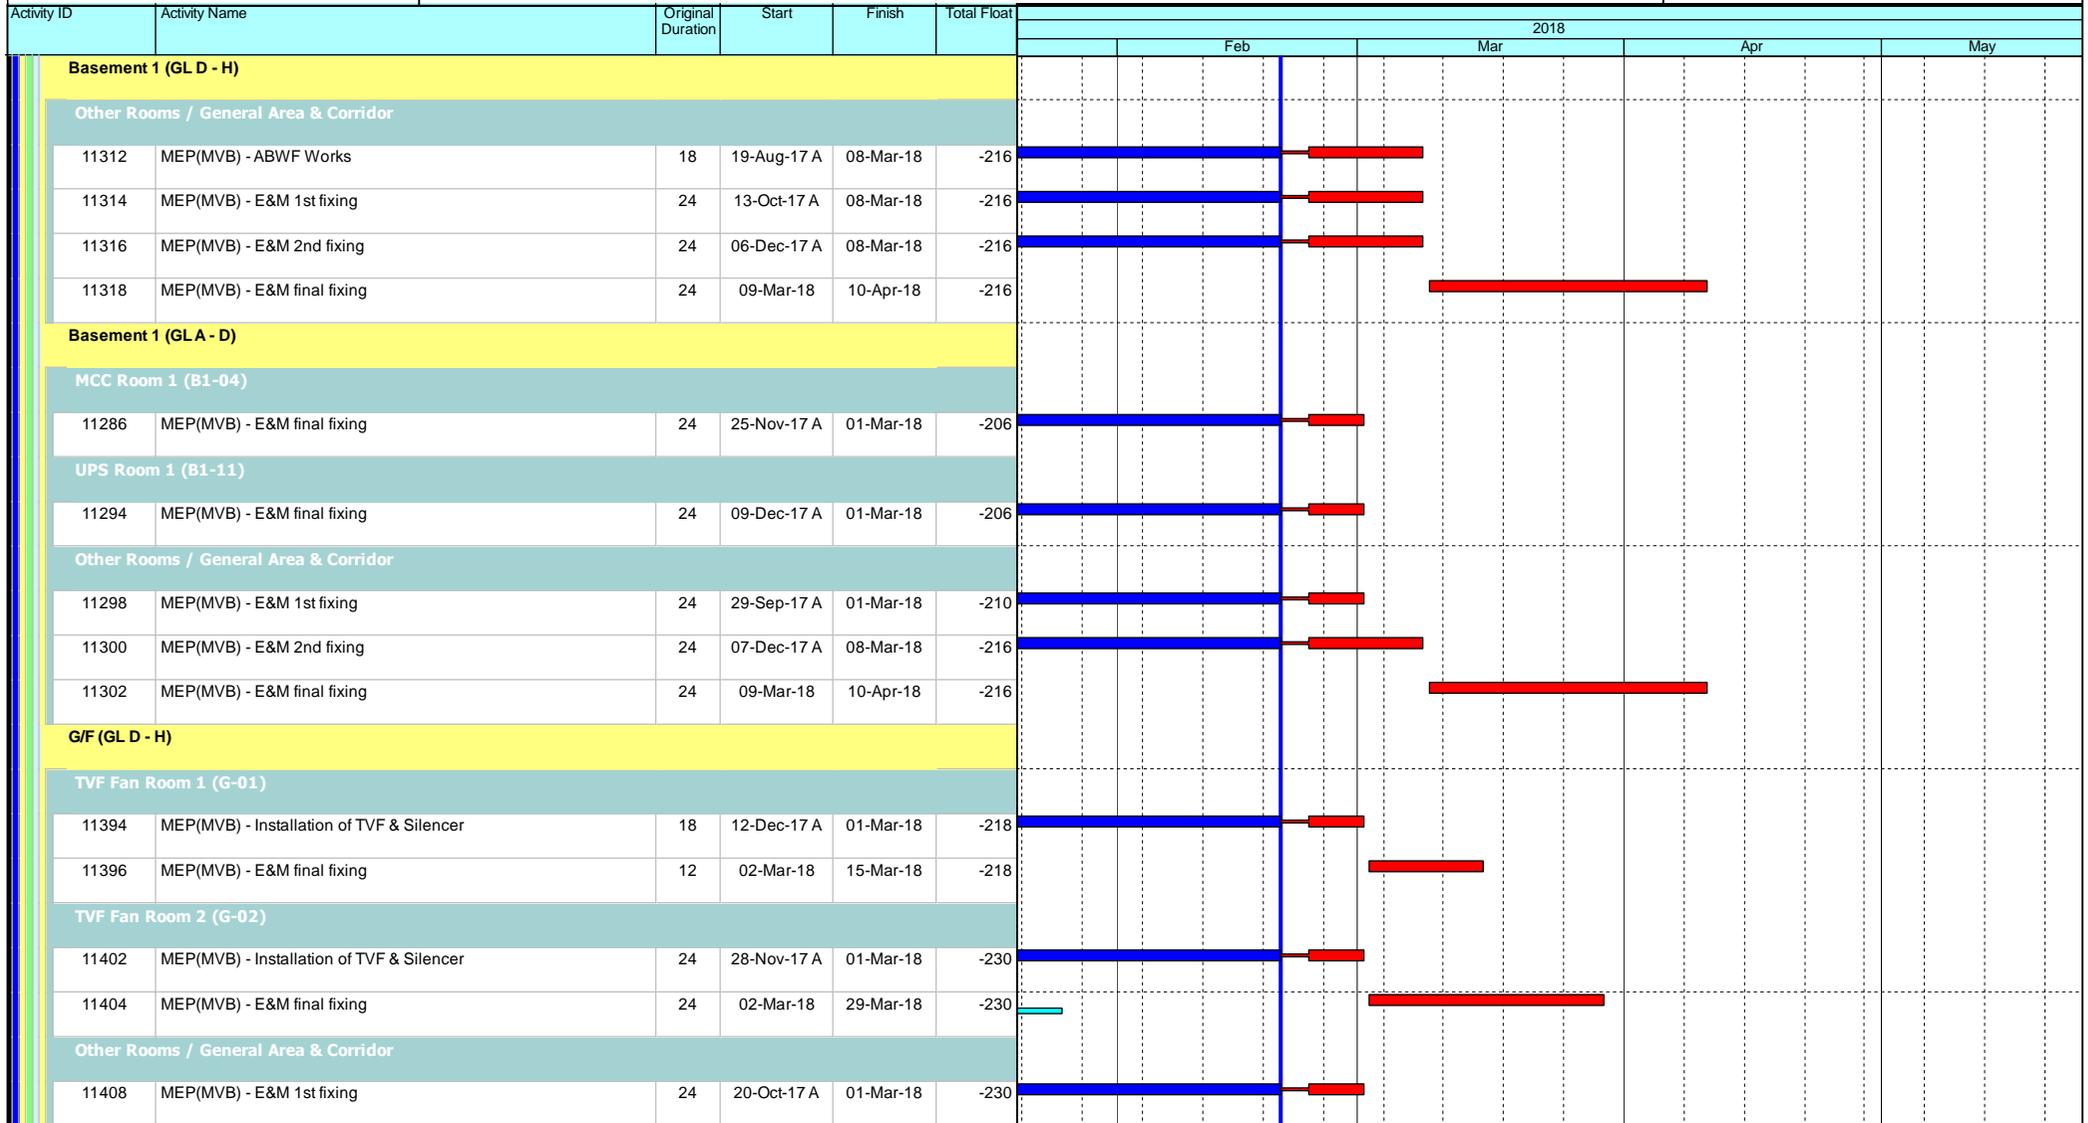TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 17 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

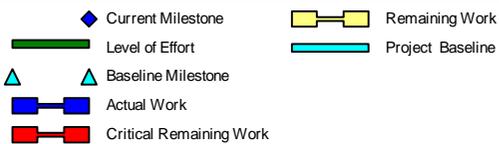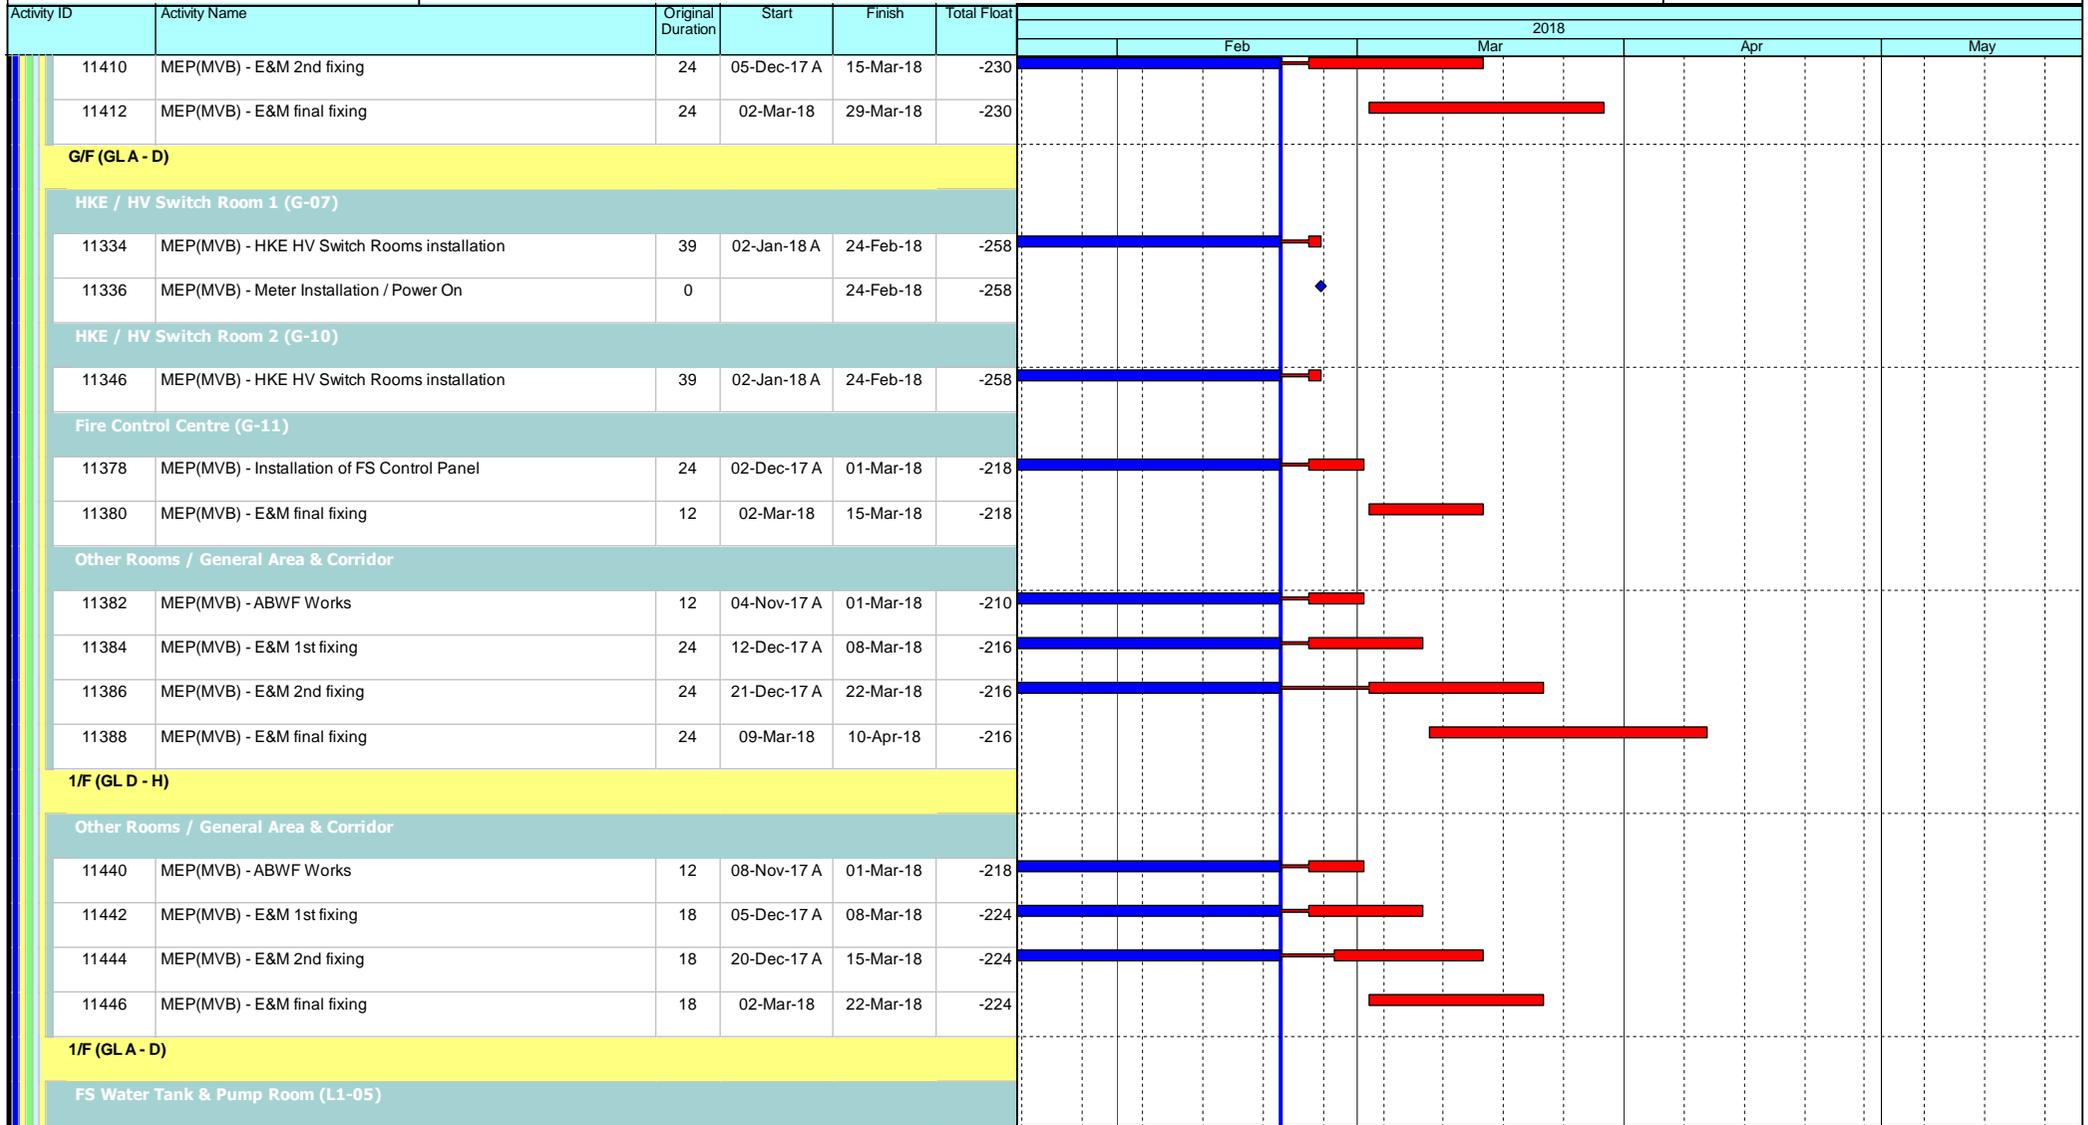TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING


Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 18 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

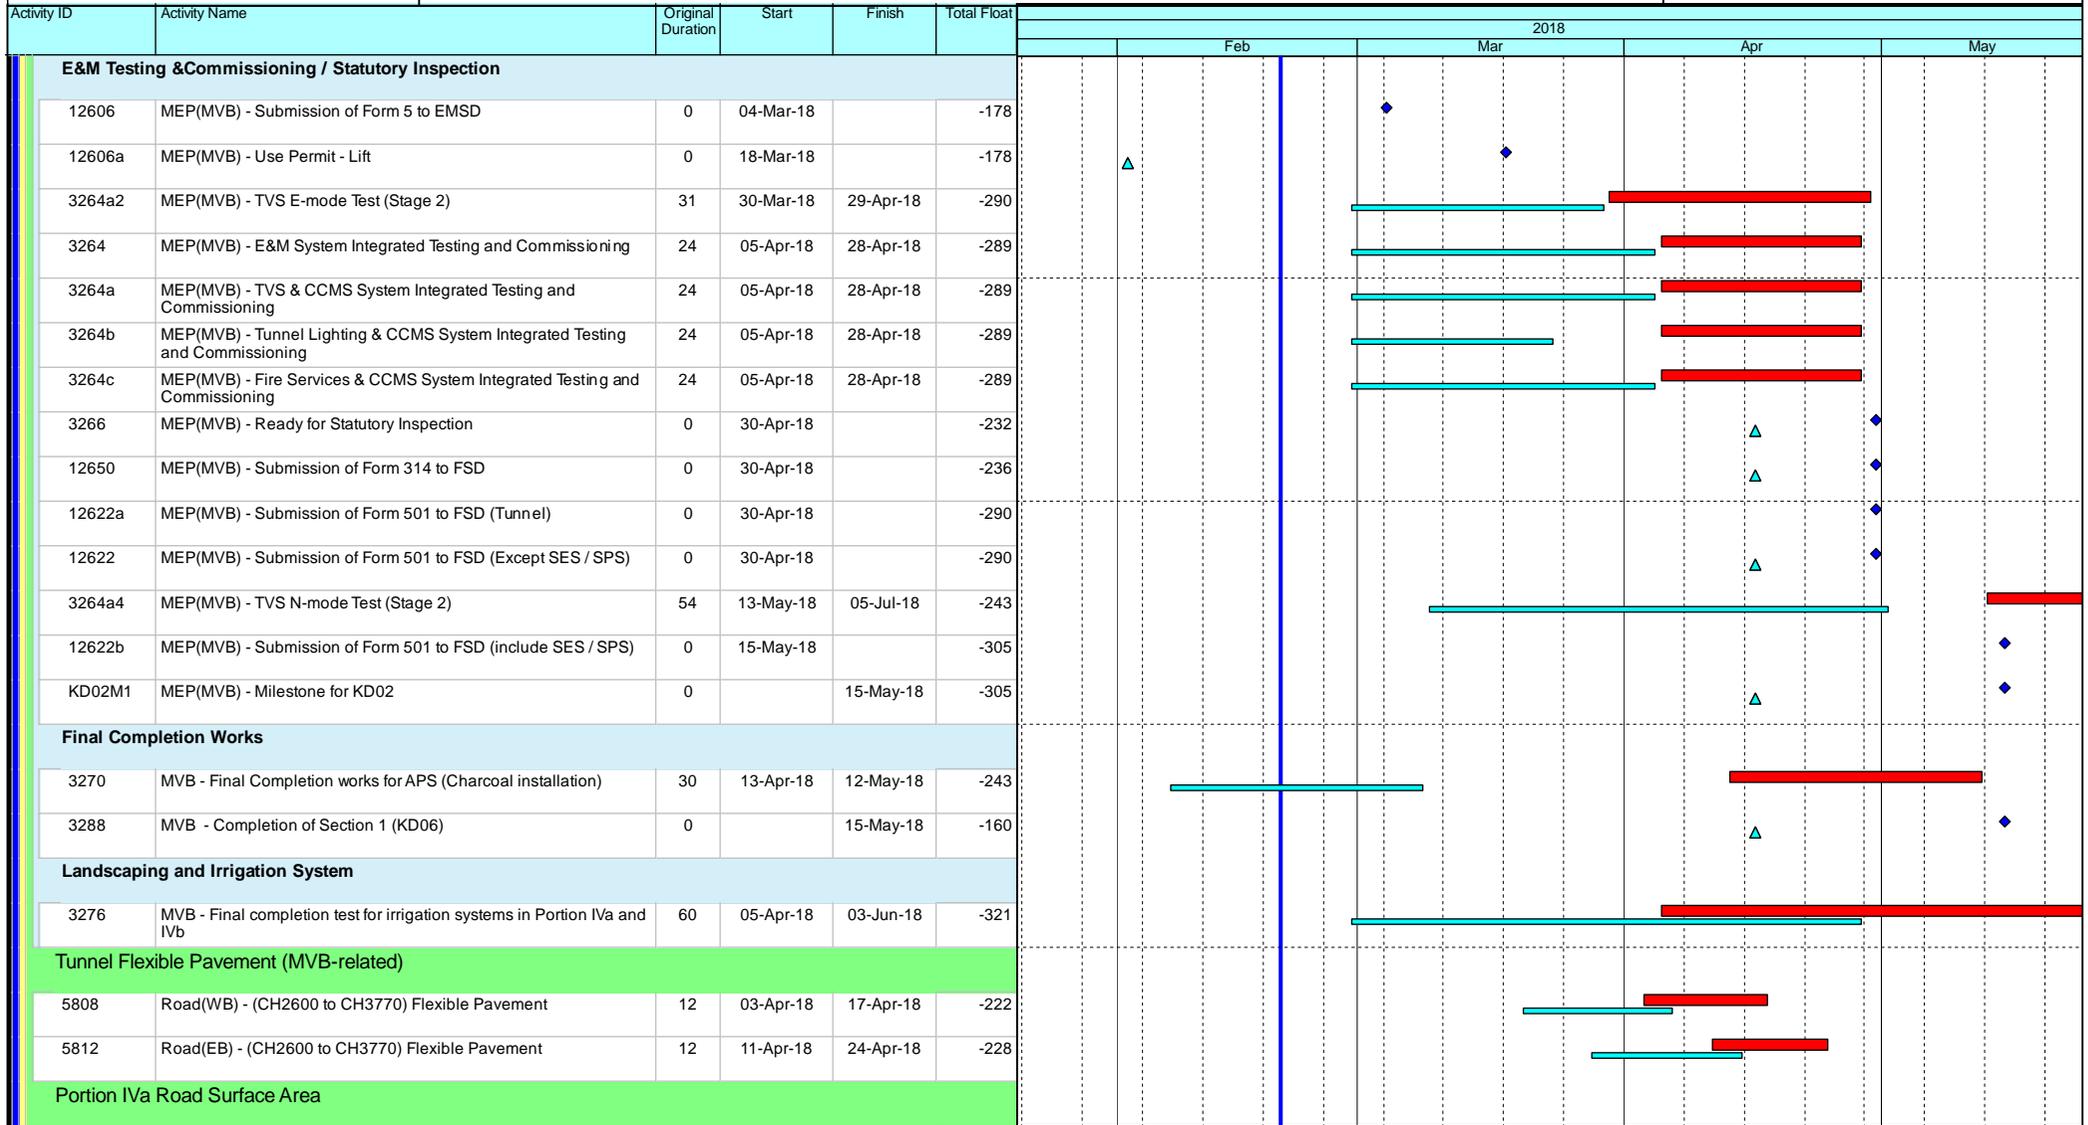TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING

Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 21 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018			
						Feb	Mar	Apr	May
19046	TCSS equipment installation & cabling	96	02-Nov-17 A	01-Mar-18	-200				
19052	Lighting equipment Testing & Commissioning	24	15-Dec-17 A	01-Mar-18	-66				
19048	TCSS equipment Testing & Commissioning	72	02-Mar-18	31-May-18	-200				
Satellite Control Point 3									
SCP3									
3766	MEP(SCP3) - E&M Final Fix	12	12-Dec-17 A	01-Mar-18	-139				
10110	MEP(SCP3) - TCSS Enabling Works (Remaining TCSS installation)	12	23-Feb-18	08-Mar-18	-140				
3774	SCP3 - Metal works / Glazing / Louver / Handrails	12	02-Mar-18	15-Mar-18	-139				
3768	MEP(SCP3) - E&M Individual System T&C	12	16-Mar-18	29-Mar-18	-139				
3770	MEP(SCP3) - E&M Final Completion Works; Ready for Statutory Inspections	12	03-Apr-18	17-Apr-18	-139				
KD02M2	MEP(SCP3) - Milestone for KD06	0		17-Apr-18	-139				
East Ventilation Building (EVB - related)									
Tunnel Section (EVB-related)									
Portion 1ic [CH3770 to CH3800]									
Westbound									
5202c	MEP(WB) - (CH3770 to CH3800) E&M 2nd Fix	12	01-Dec-17 A	15-Mar-18	-120				
5198c	MEP(WB) - (CH3770 to CH3800) TCSS Field equip & cable installation	5	09-Mar-18	14-Mar-18	-228				
9962c	MEP(WB) - (CH3770 to CH3800) VE Panel installation (Upper part) (450m2)	5	09-Mar-18	14-Mar-18	-197				
5200c	MEP(WB) - (CH3770 to CH3800) E&M Final Fix	12	16-Mar-18	29-Mar-18	-120				
Eastbound									
5220c	MEP(EB) - (CH3770 to CH3800) E&M 2nd Fix	12	21-Dec-17 A	12-Mar-18	-212				
5216c	MEP(EB) - (CH3770 to CH3800) TCSS Field equip & cable installation	5	09-Mar-18	14-Mar-18	-202				
9964c1	MEP(EB) - (CH3770 to CH3800) VE Panel installation (Lower part) (450m2)	5	09-Mar-18	14-Mar-18	-210				
5218c	MEP(EB) - (CH3770 to CH3800) E&M Final Fix	12	13-Mar-18	26-Mar-18	-212				

- Current Milestone
- Remaining Work
- Level of Effort
- Project Baseline
- Baseline Milestone
- Actual Work
- Critical Remaining Work

Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 22 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

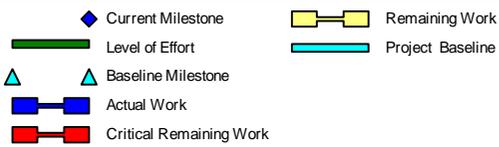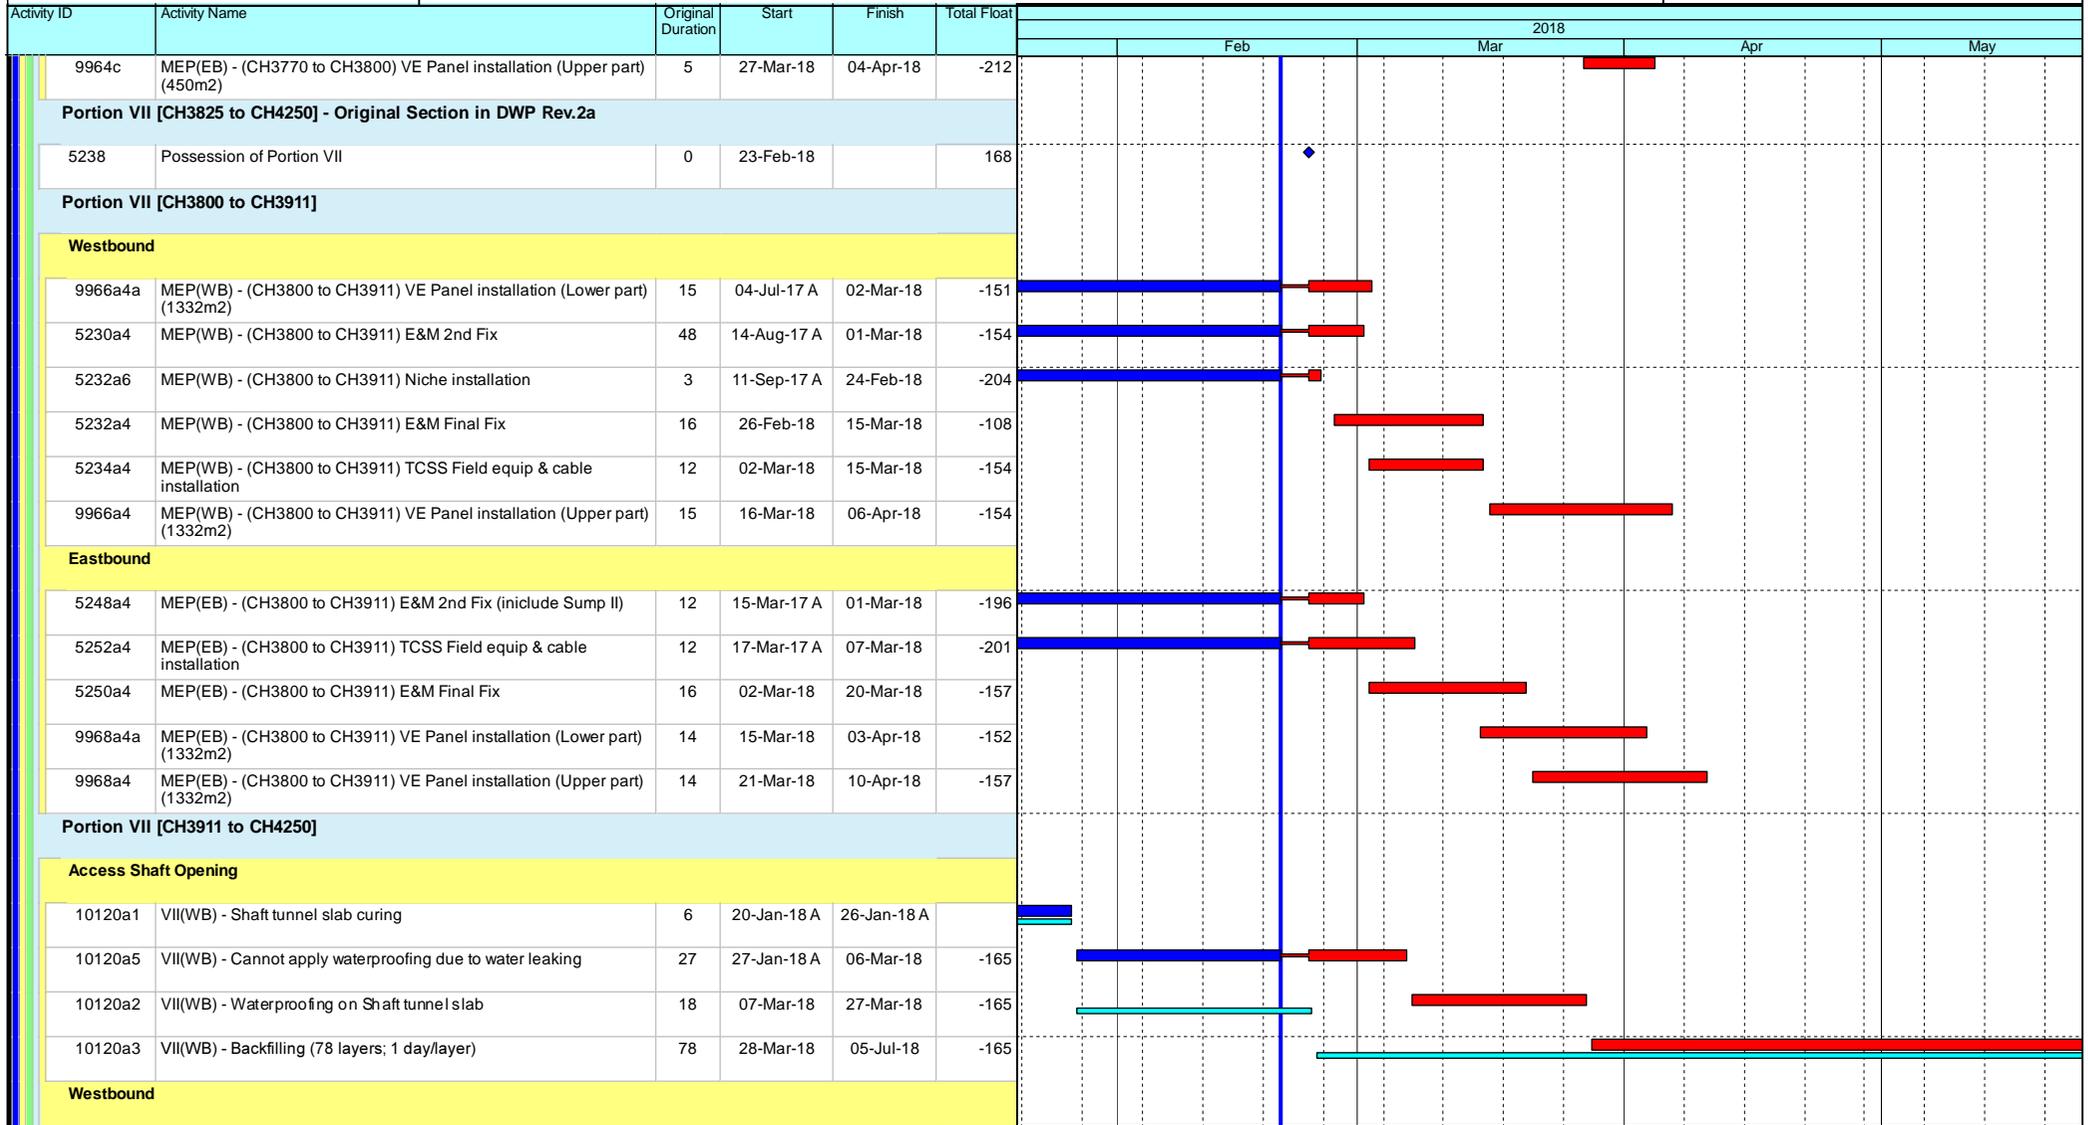TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING

Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 23 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018				
						Feb	Mar	Apr	May	
5314	MEP(EB) - (CH4600 to CH4860) E&M Final Fix	9	10-Mar-18	20-Mar-18	-149					
Portion IXa [CH4860 to CH5150]										
Westbound										
5326	MEP(WB) - (CH4860 to CH5150) E&M 2nd Fix (include Sump E)	32	22-May-17 A	08-Mar-18	-112					
9978a	MEP(WB) - (CH4860 to CH5150) VE Panel installation (Lower part) (3288m2)	37	07-Jun-17 A	15-Mar-18	-139					
5330	MEP(WB) - (CH4860 to CH5150) TCSS Field equip & cable installation	9	29-Dec-17 A	20-Mar-18	-112					
9978	MEP(WB) - (CH4860 to CH5150) VE Panel installation (Upper part) (3288m2)	37	23-Feb-18	11-Apr-18	-158					
5328	MEP(WB) - (CH4860 to CH5150) E&M Final Fix	10	09-Mar-18	20-Mar-18	-112					
Eastbound										
5344	MEP(EB) - (CH4860 to CH5150) E&M 2nd Fix (include Sump E)	32	12-Dec-17 A	01-Mar-18	-145					
9980	MEP(EB) - (CH4860 to CH5150) VE Panel installation (Upper part) (3288m2)	37	23-Feb-18	11-Apr-18	-158					
9980a	MEP(EB) - (CH4860 to CH5150) VE Panel installation (Lower part) (3288m2)	37	23-Feb-18	11-Apr-18	-158					
5346	MEP(EB) - (CH4860 to CH5150) E&M Final Fix	10	09-Mar-18	20-Mar-18	-112					
5348	MEP(EB) - (CH4860 to CH5150) TCSS Field equip & cable installation	9	10-Mar-18	20-Mar-18	-112					
Portion VIIIb [SR8 CH500 to CH350]										
Slip Road 8										
5356a	MEP(SR8) - (CH500 to CH350) E&M 1st Fix	12	03-Jan-18 A	01-Mar-18	-155					
5358a	MEP(SR8) - (CH500 to CH350) E&M 2nd Fix (include Sump D)	24	03-Jan-18 A	08-Mar-18	-161					
5362a	MEP(SR8) - (CH500 to CH350) TCSS Field equip & cable installation	11	15-Jan-18 A	01-Mar-18	-150					
12828a1	MEP(SR8) - (CH500 to CH350) VE Panel installation (Lower part) (600m2)	8	23-Feb-18	03-Mar-18	-129					
5360a	MEP(SR8) - (CH500 to CH350) E&M Final Fix	12	01-Mar-18	14-Mar-18	-161					
12828a	MEP(SR8) - (CH500 to CH350) VE Panel installation (Upper part) (750m2)	9	05-Mar-18	14-Mar-18	-138					
Portion VIIIc [SR8 CH350 to CH210]										
Slip Road 8										

- ◆ Current Milestone
- ▬ Level of Effort
- ▲ Baseline Milestone
- ▬ Actual Work
- ▬ Critical Remaining Work
- ▬ Remaining Work
- ▬ Project Baseline

Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 26 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

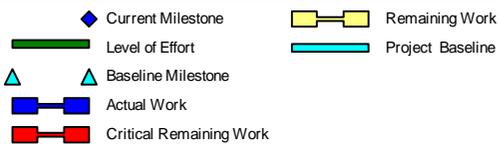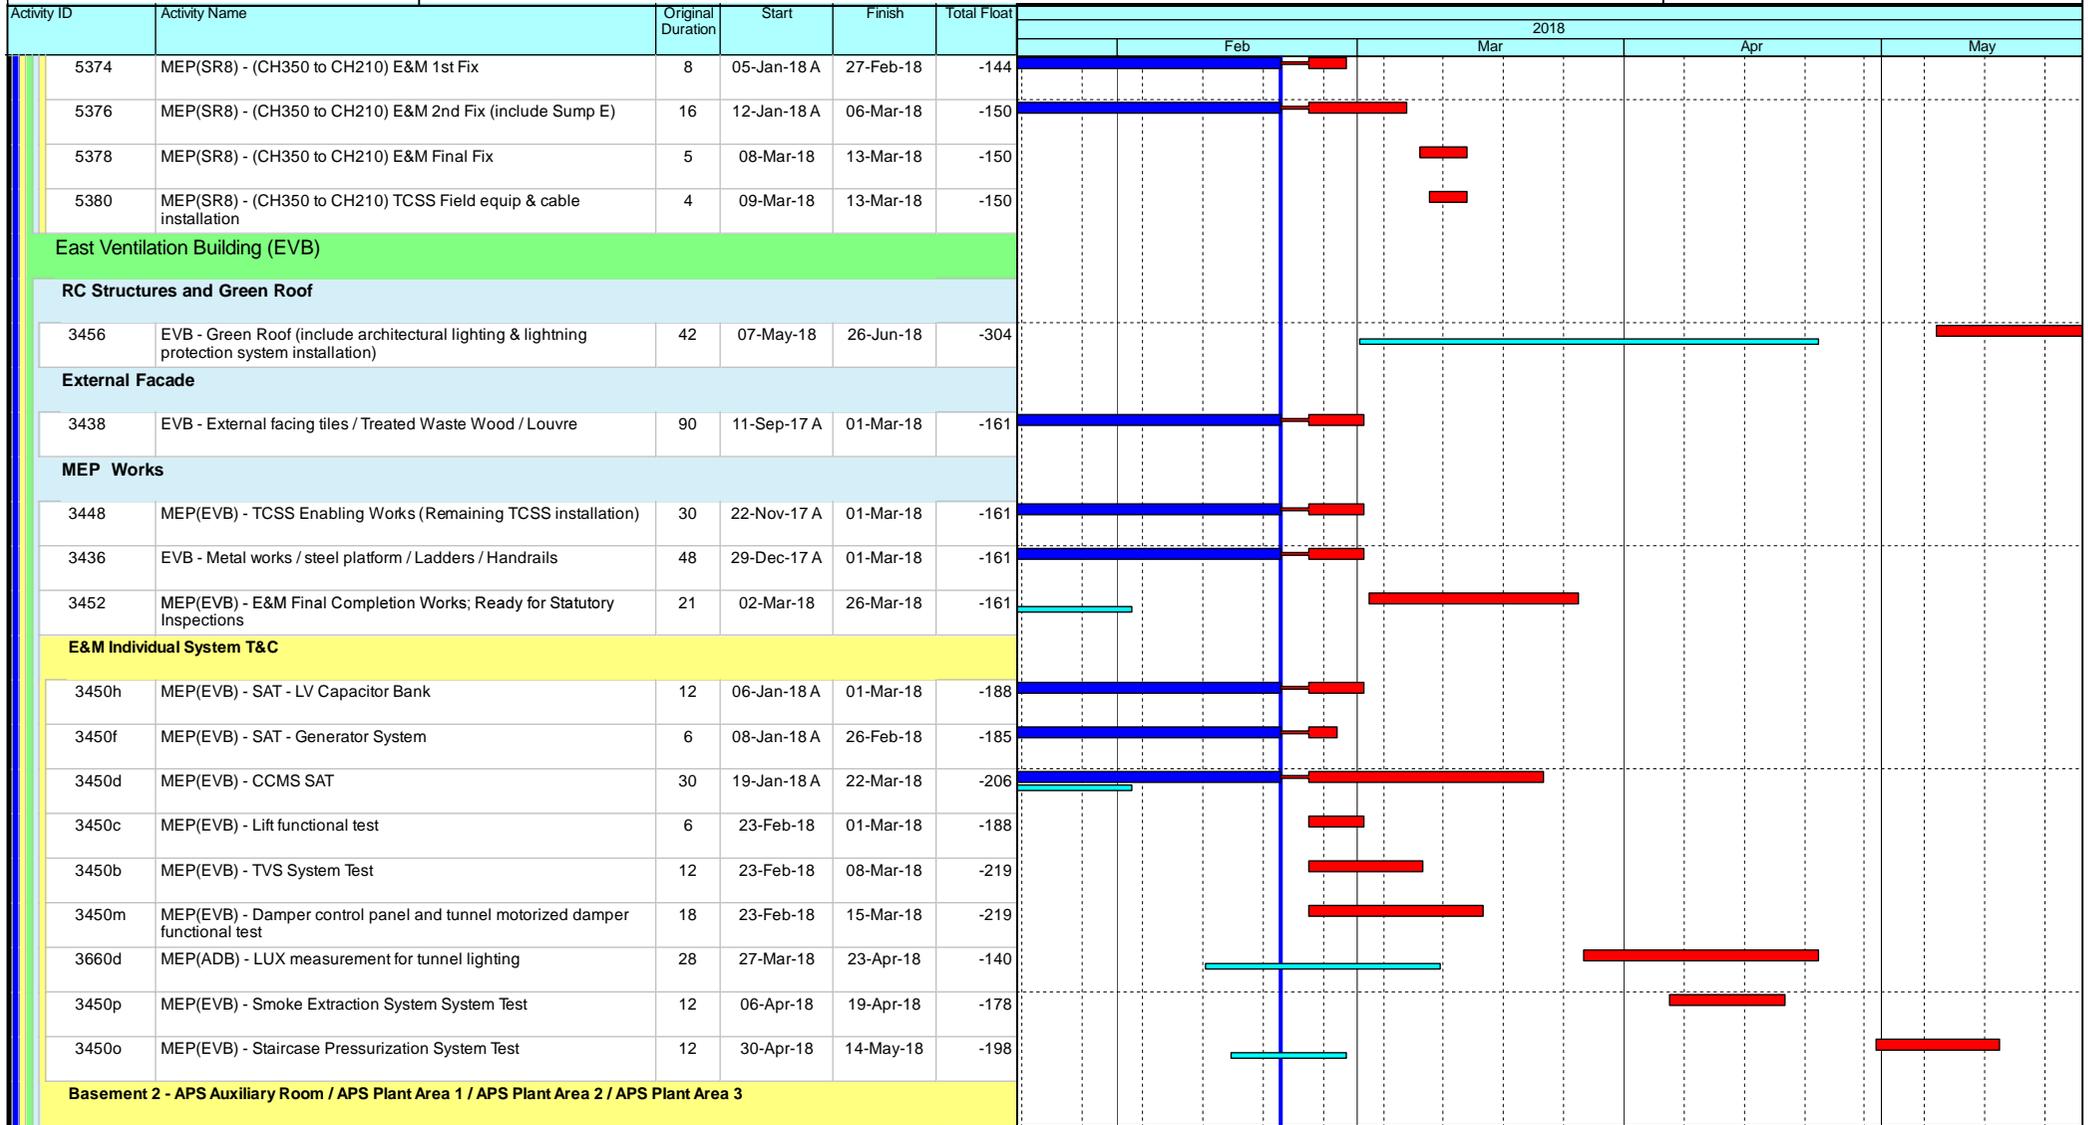TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING


Project ID: H2613-U048
Baseline: SA01
Layout: Update Three Month Rolling
U048
Page 27 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

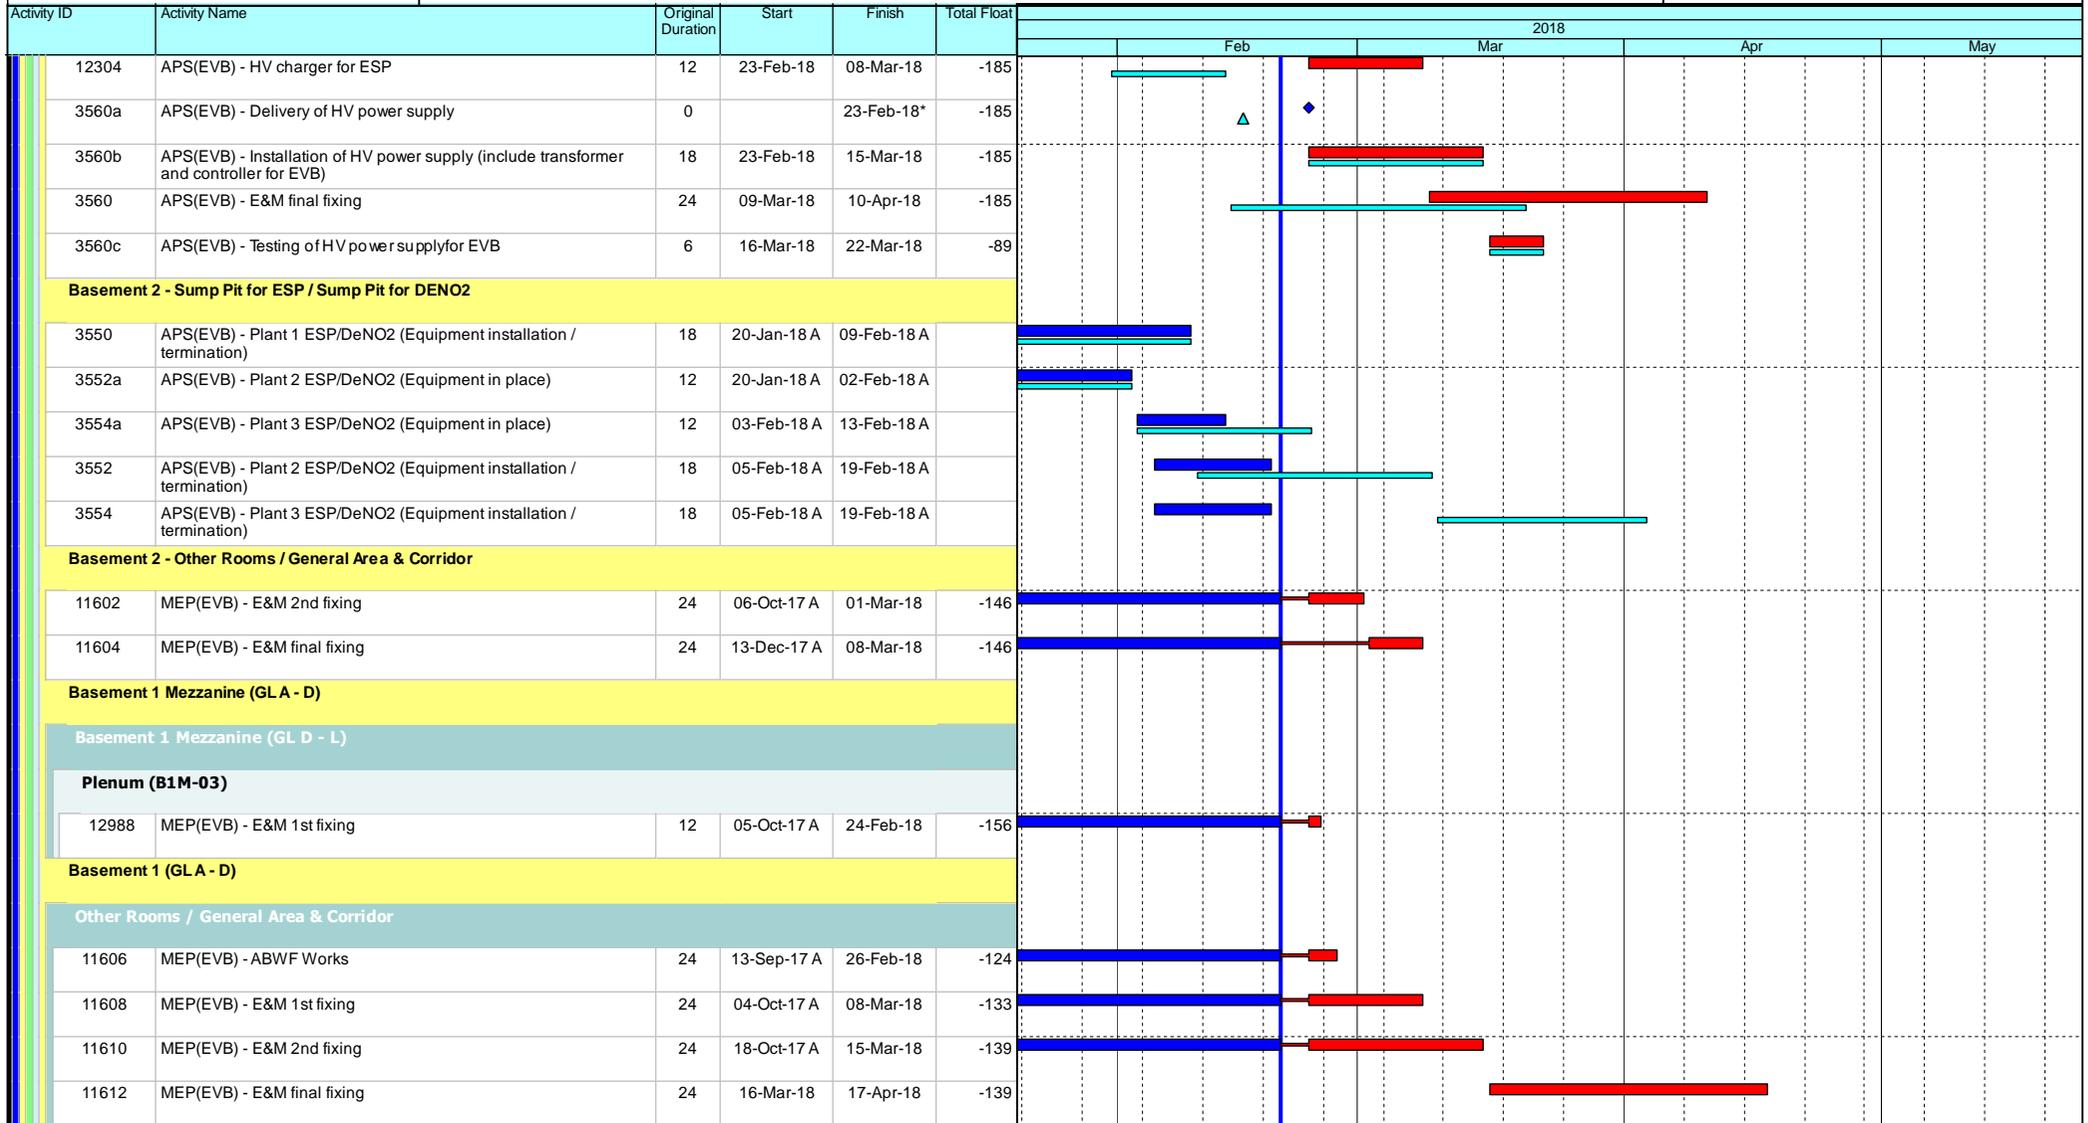TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 28 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

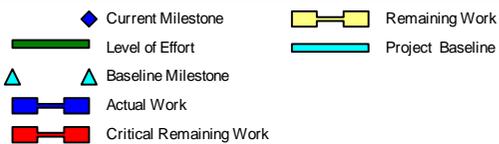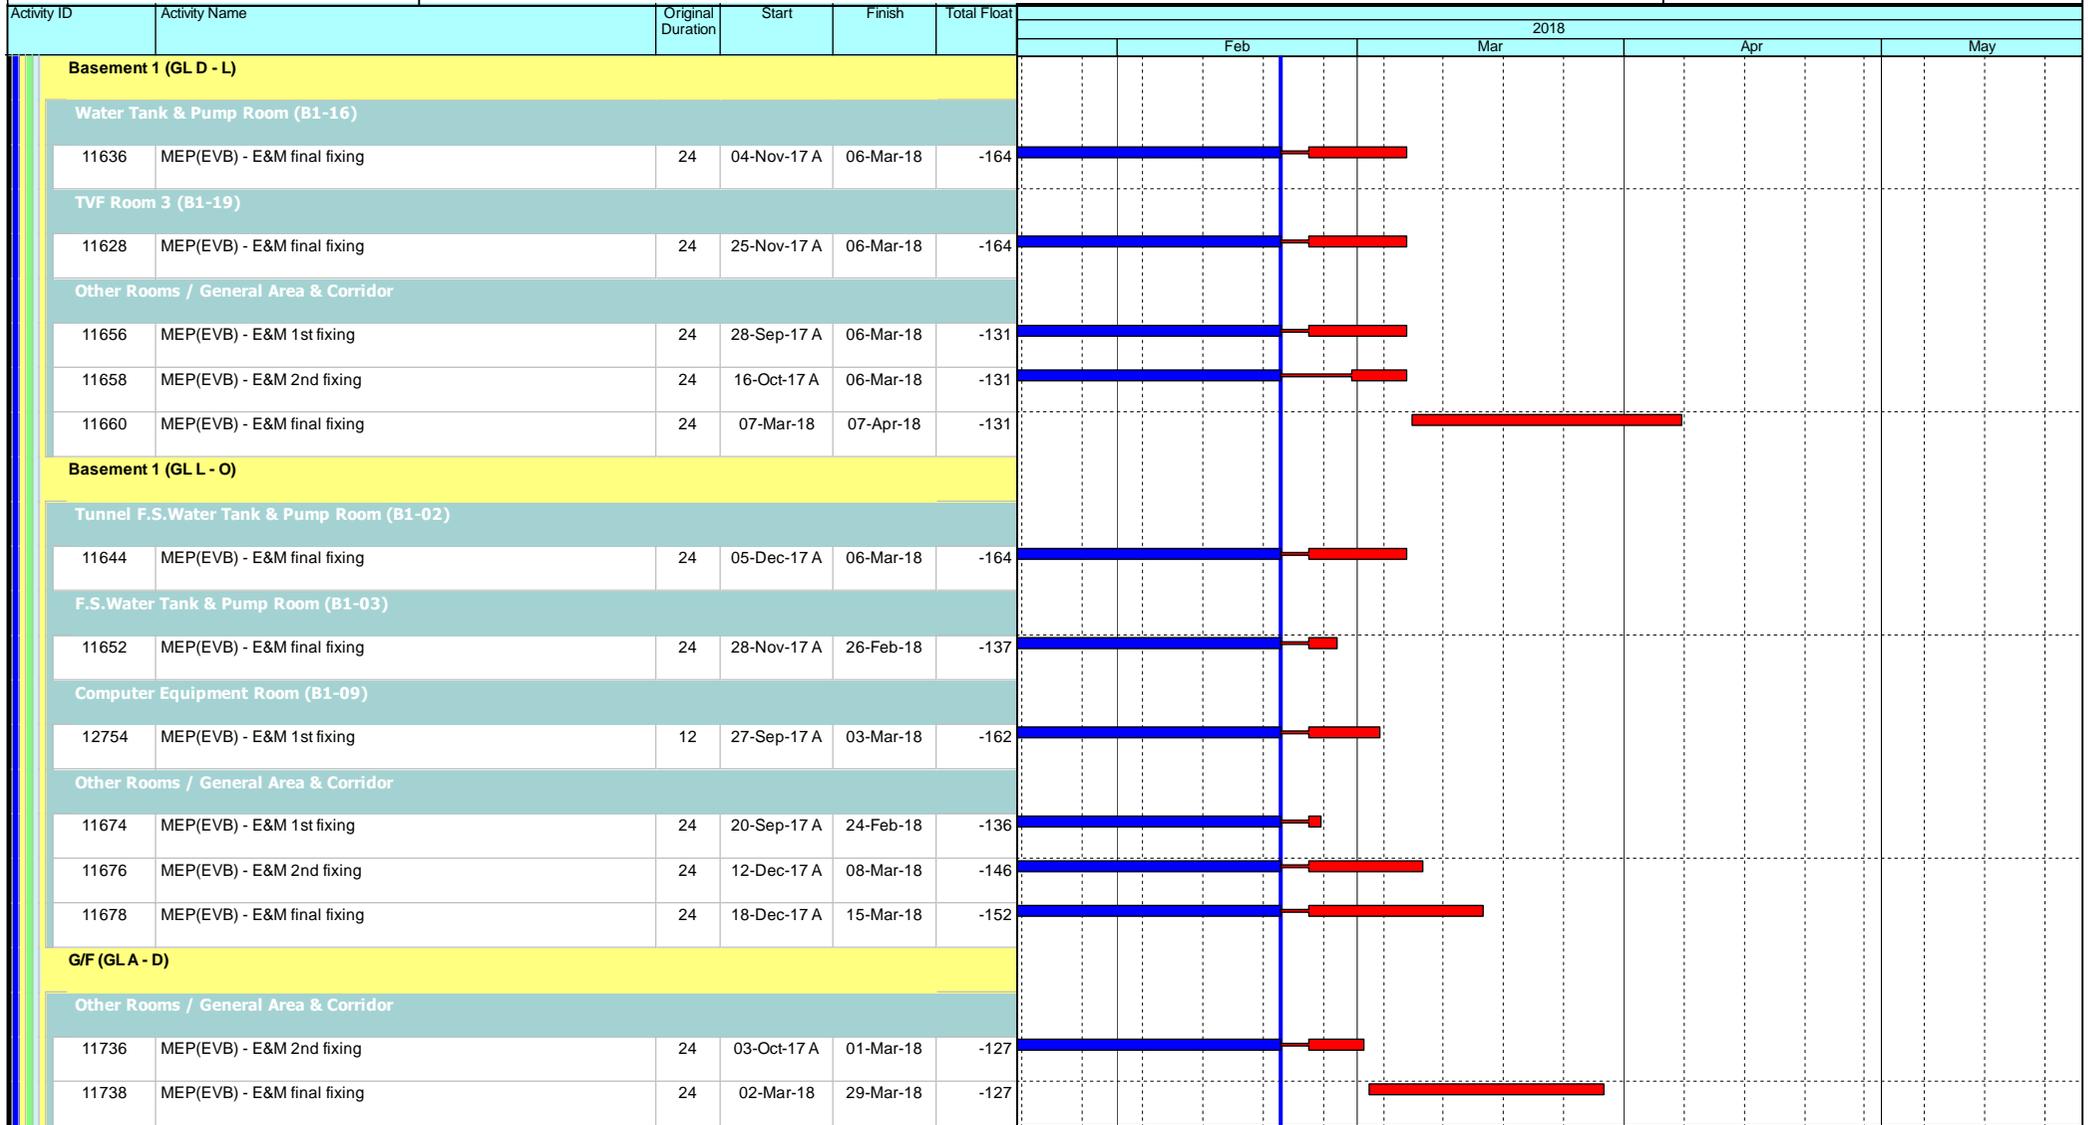TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING


Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 29 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

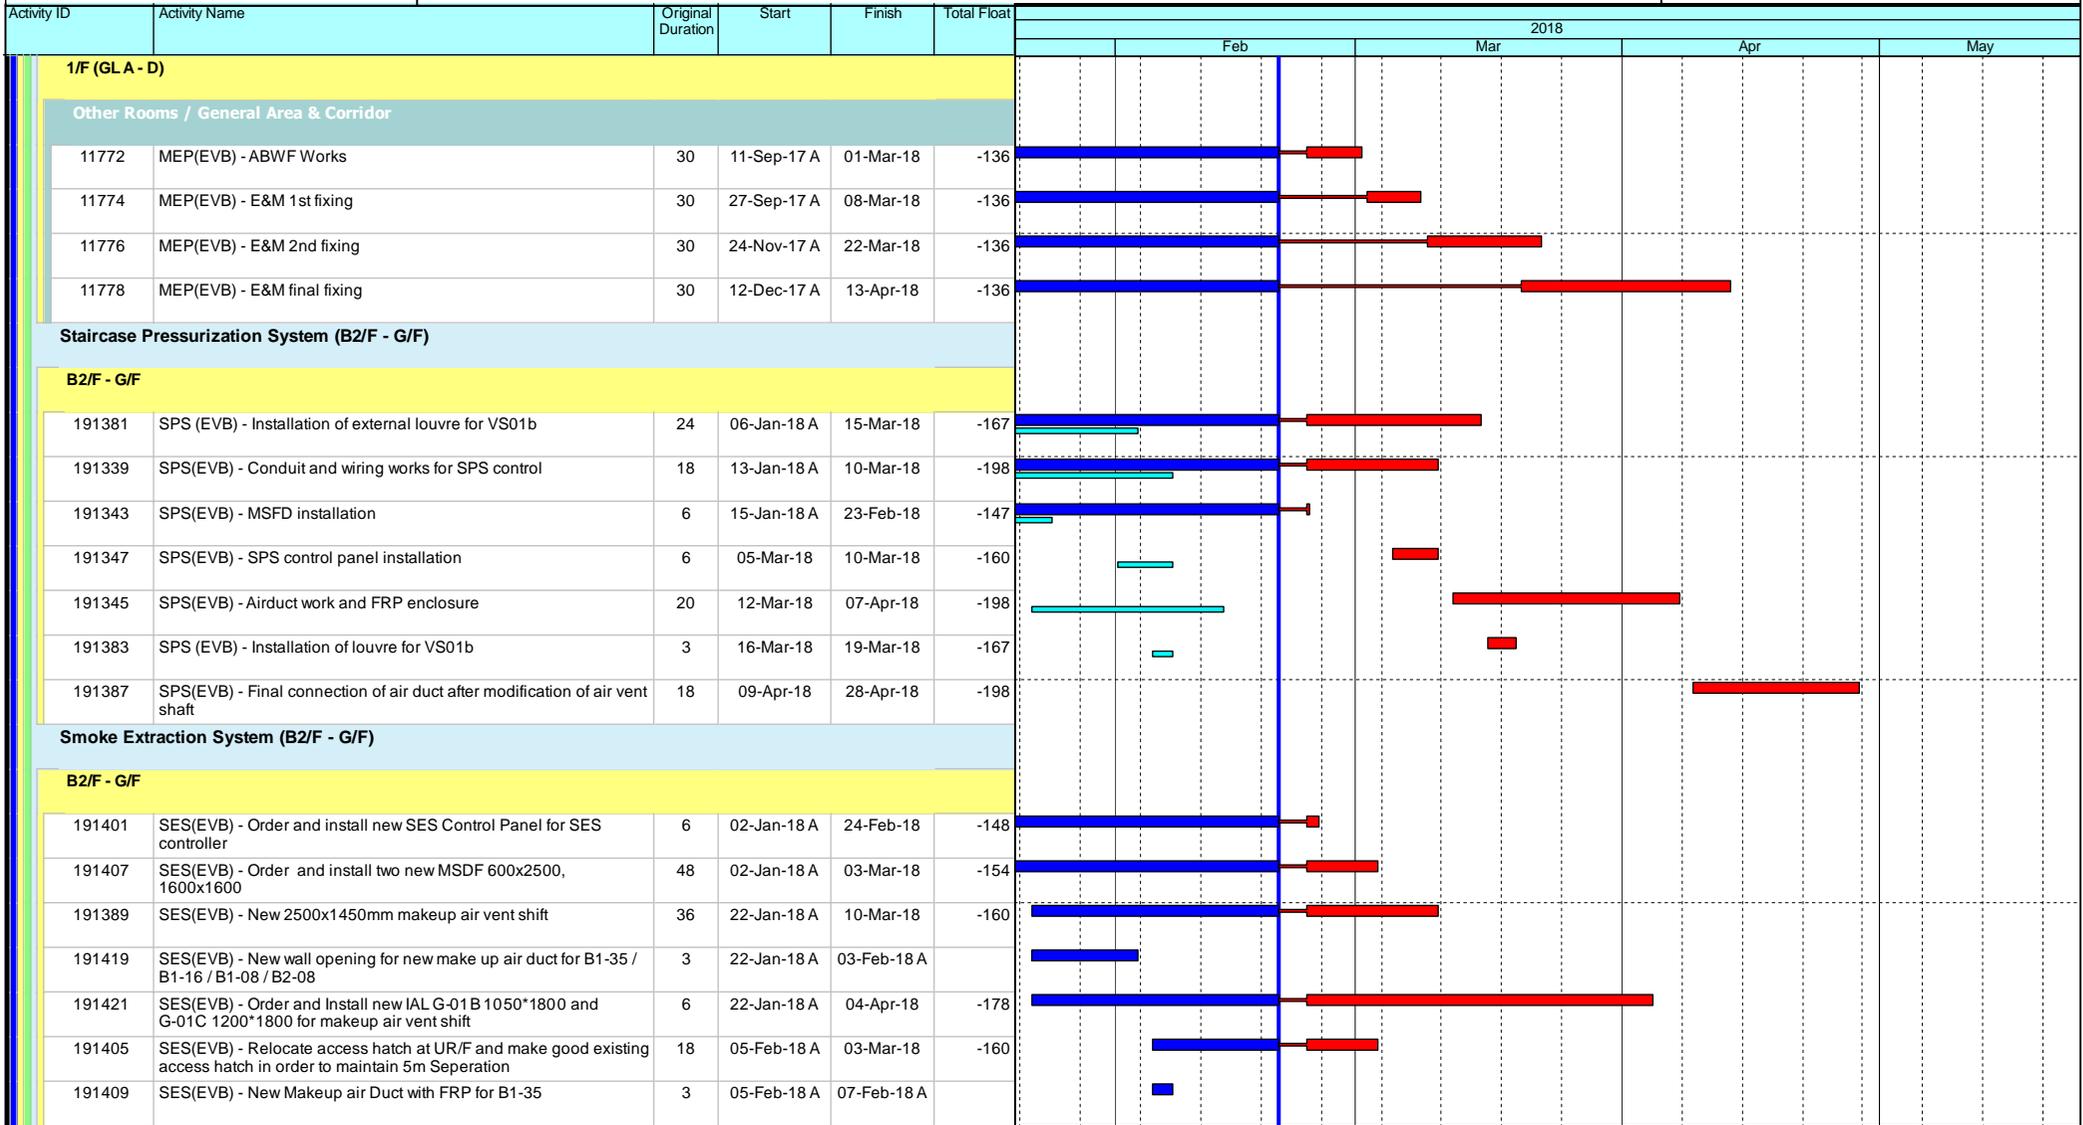TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



- Current Milestone
- Level of Effort
- Baseline Milestone
- Actual Work
- Critical Remaining Work
- Remaining Work
- Project Baseline

Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 30 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

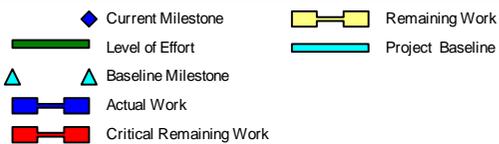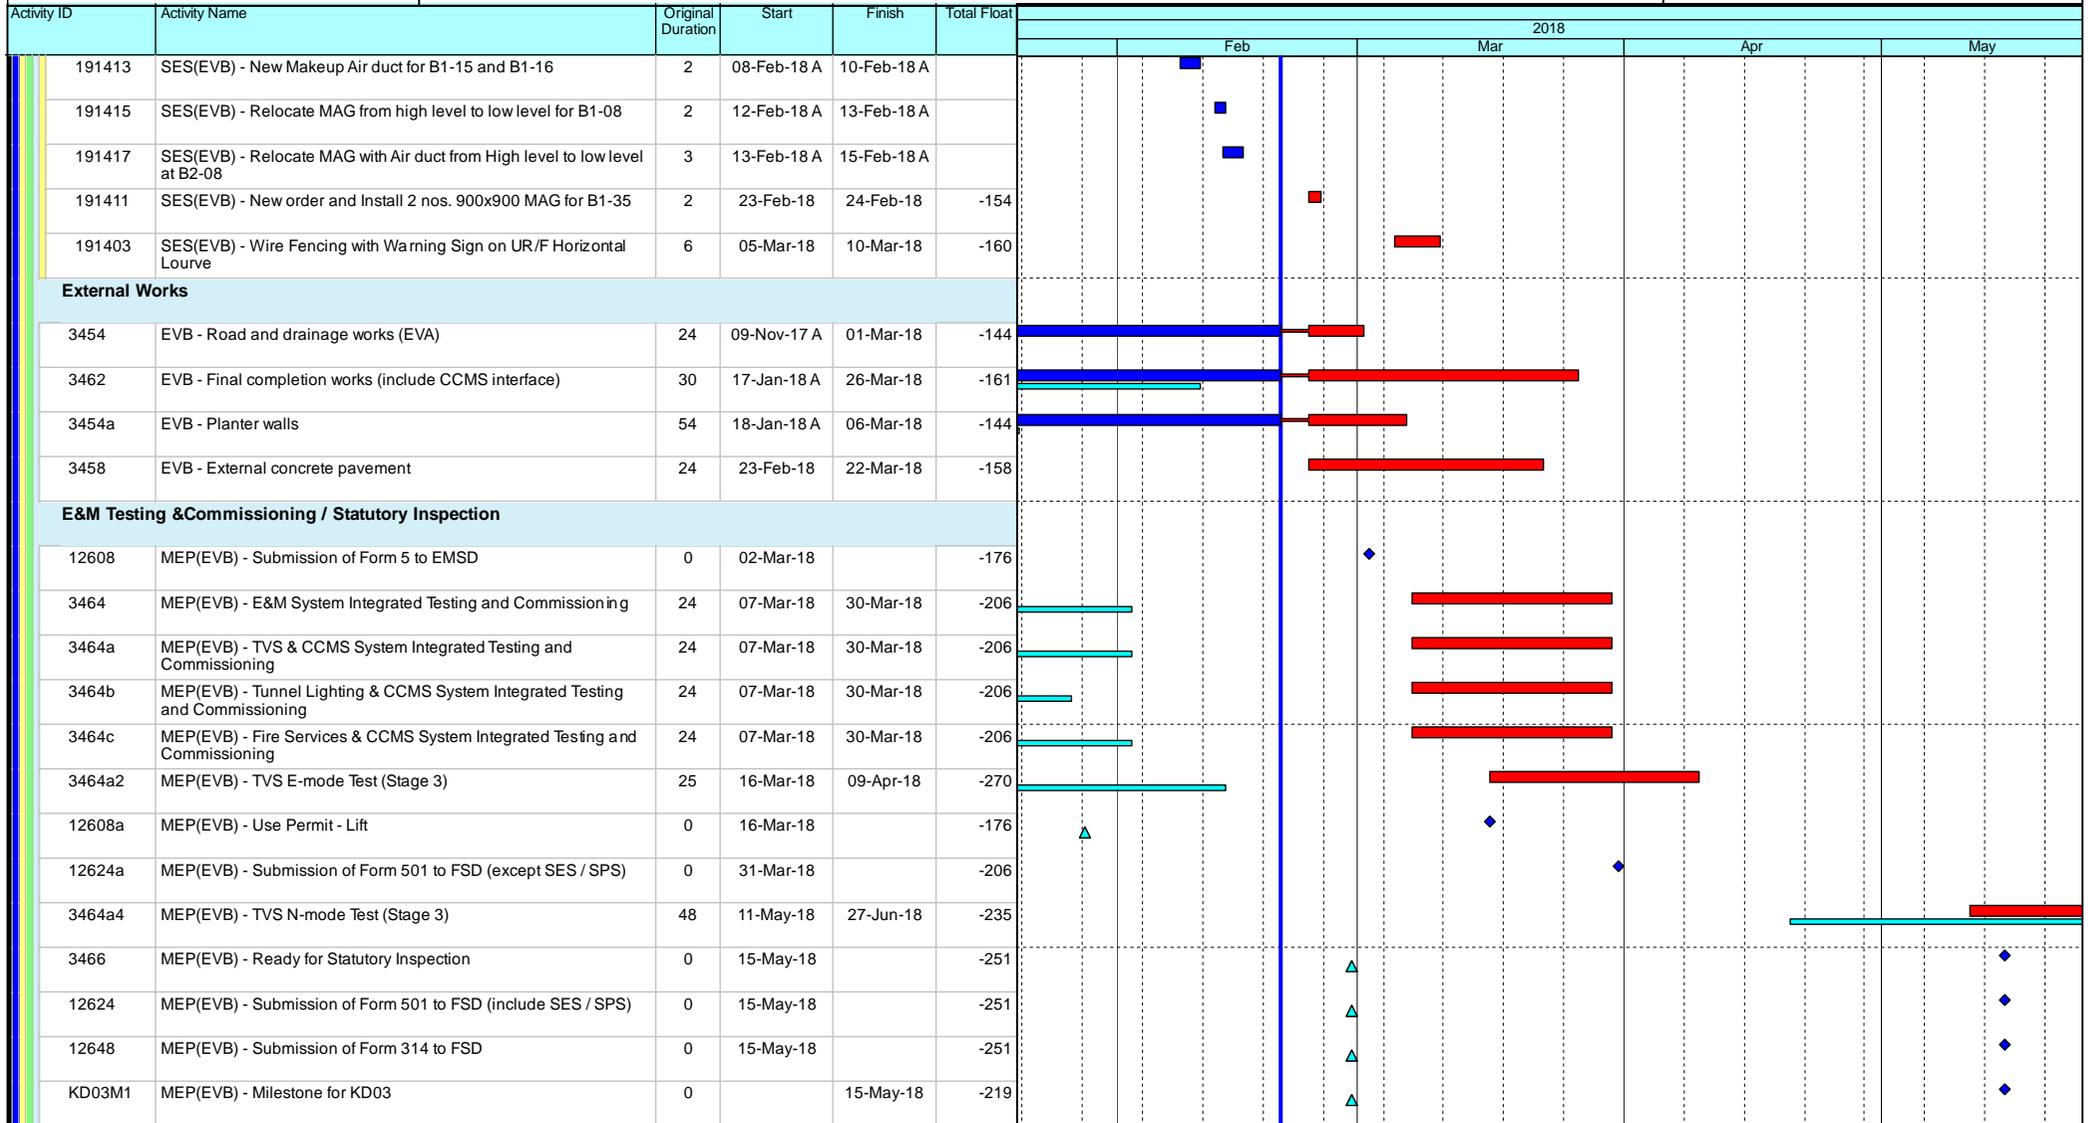TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING


Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 31 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

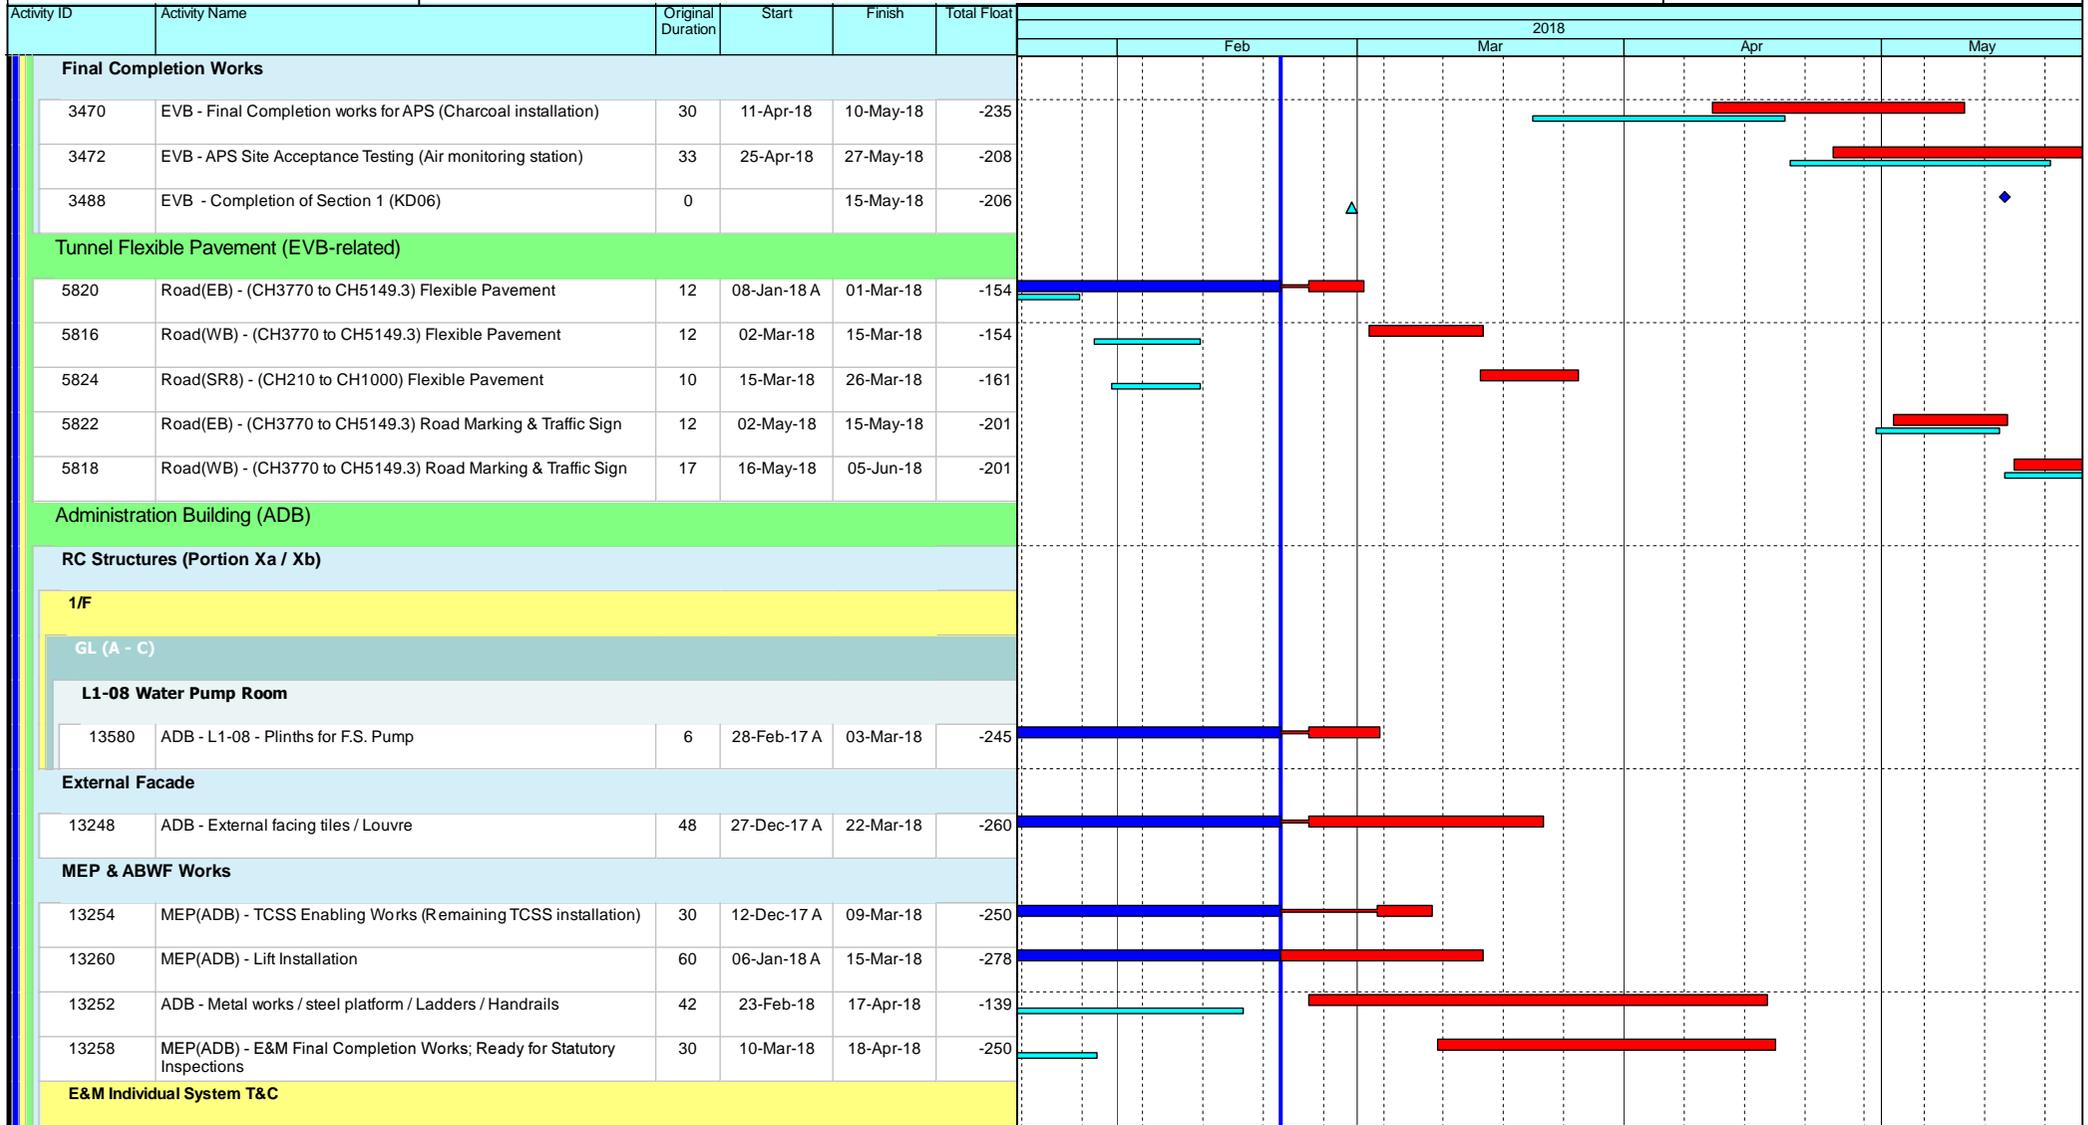TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 32 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

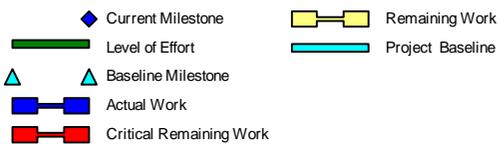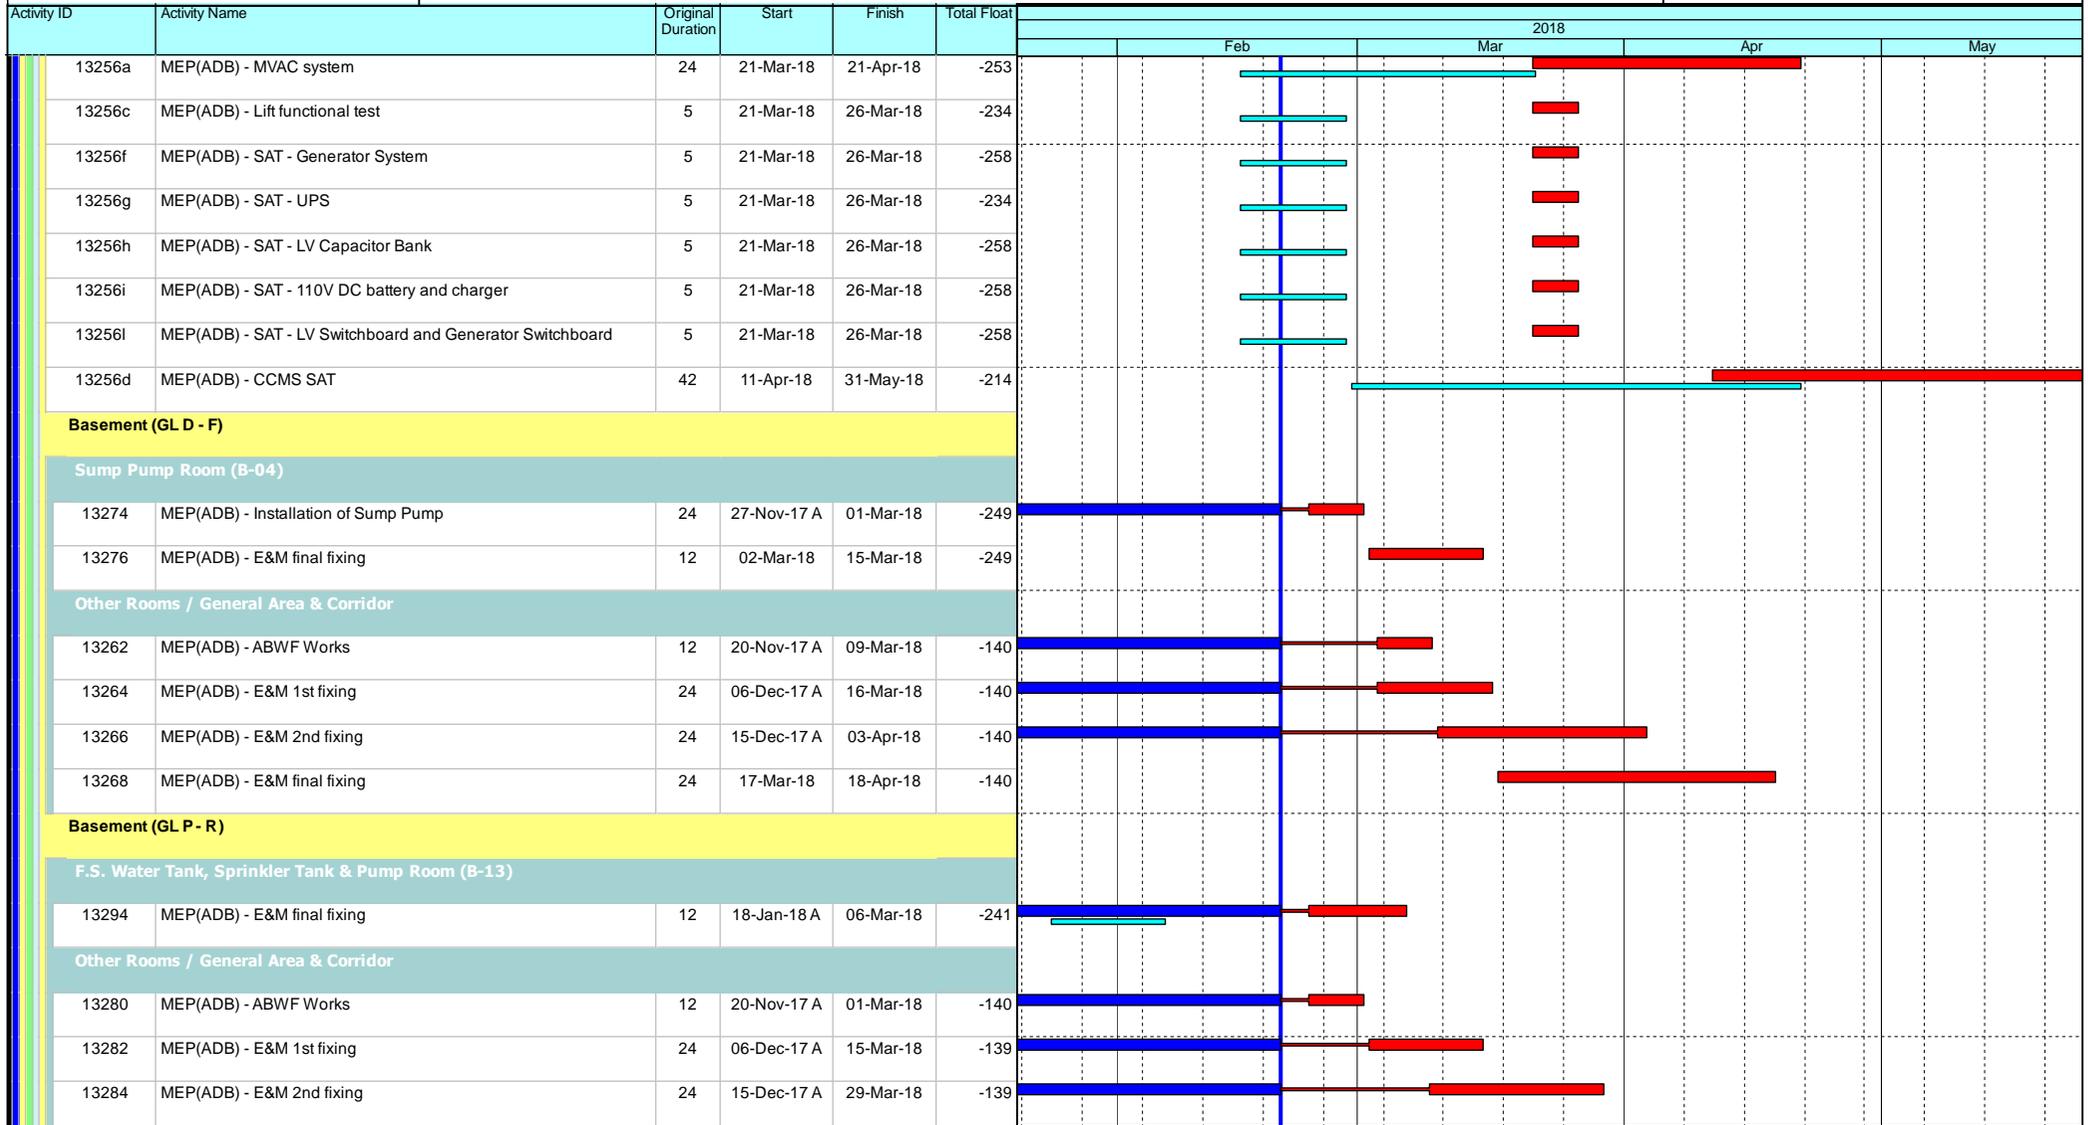TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING


Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 33 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

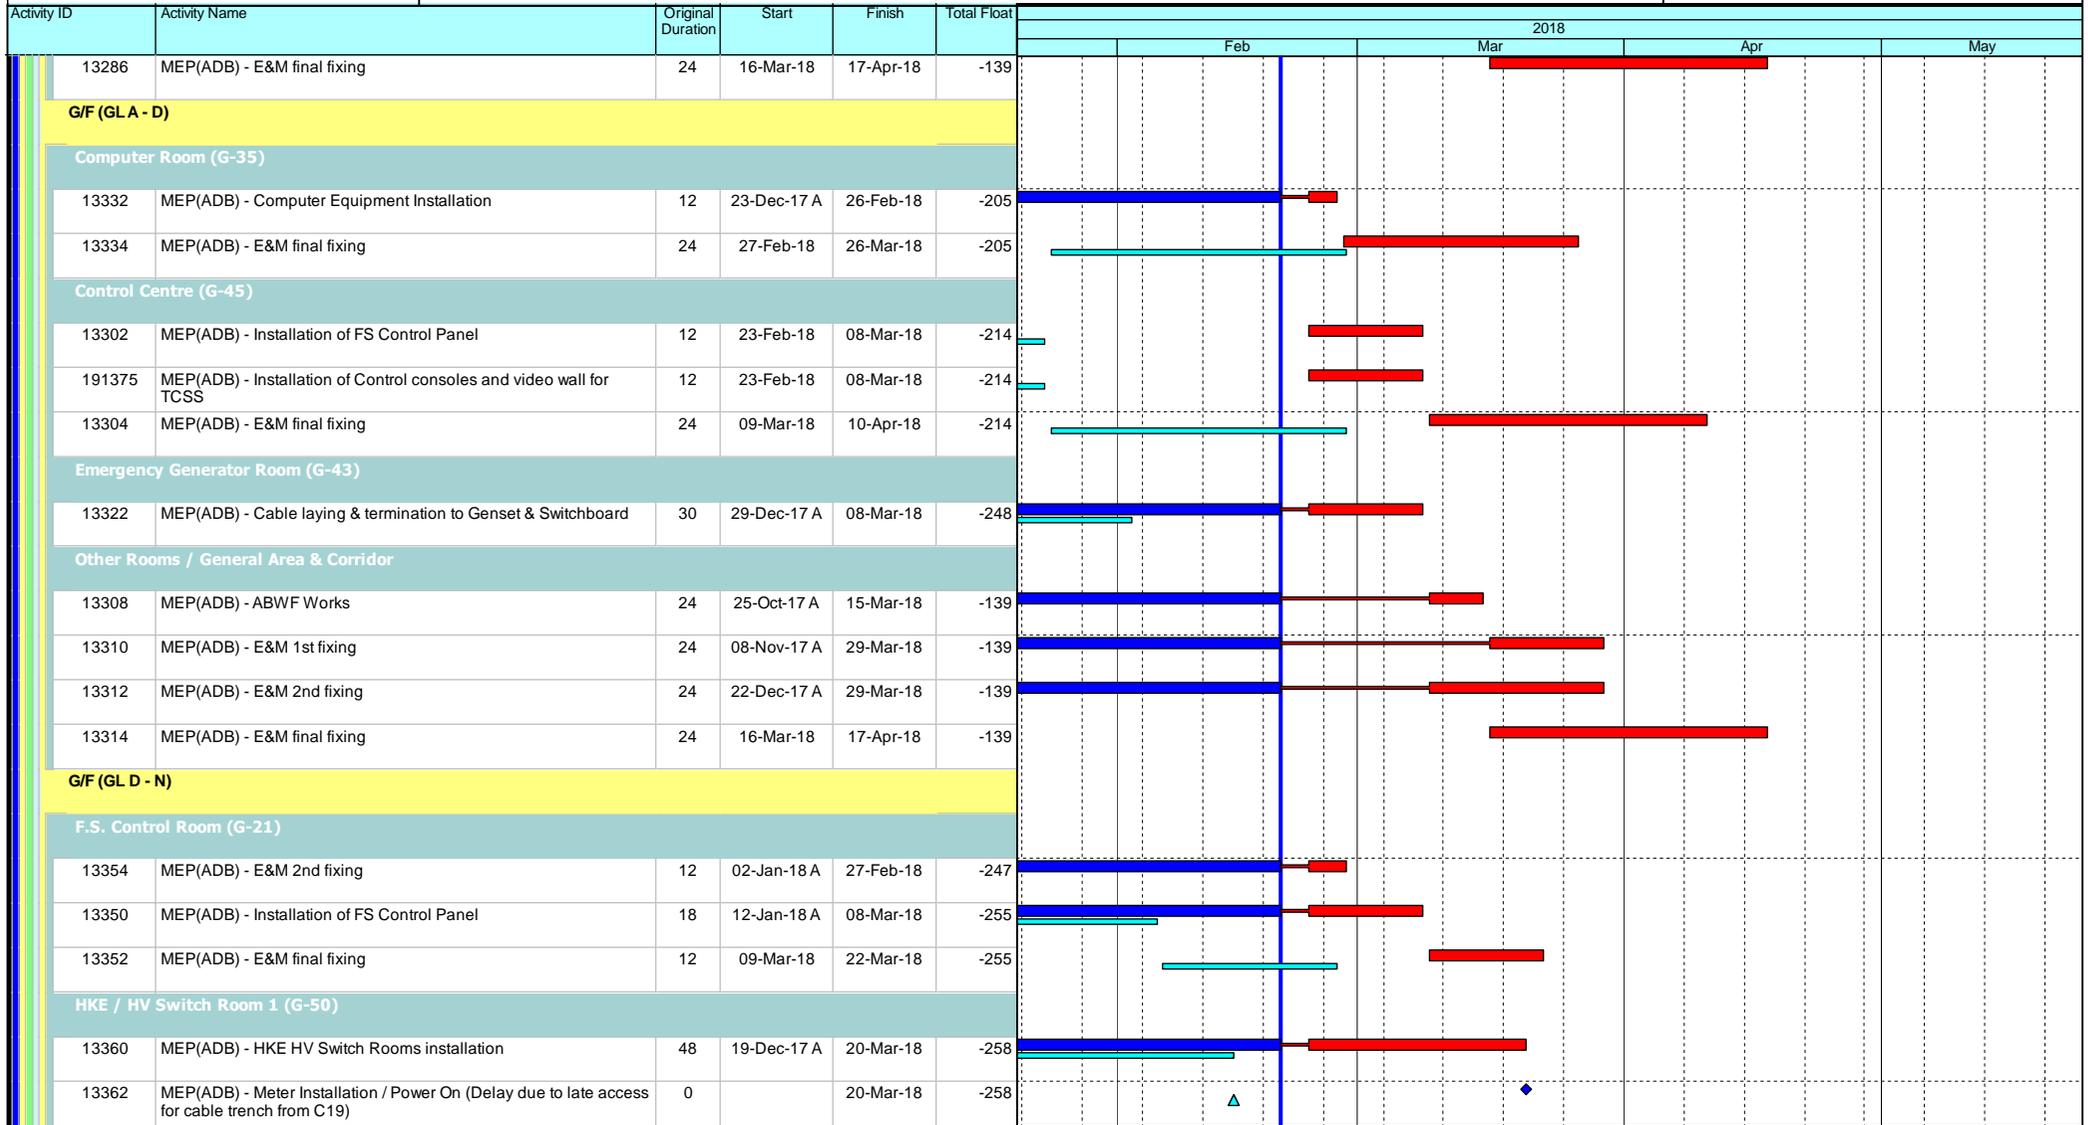TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 34 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

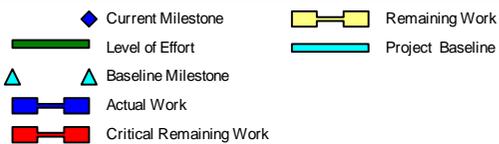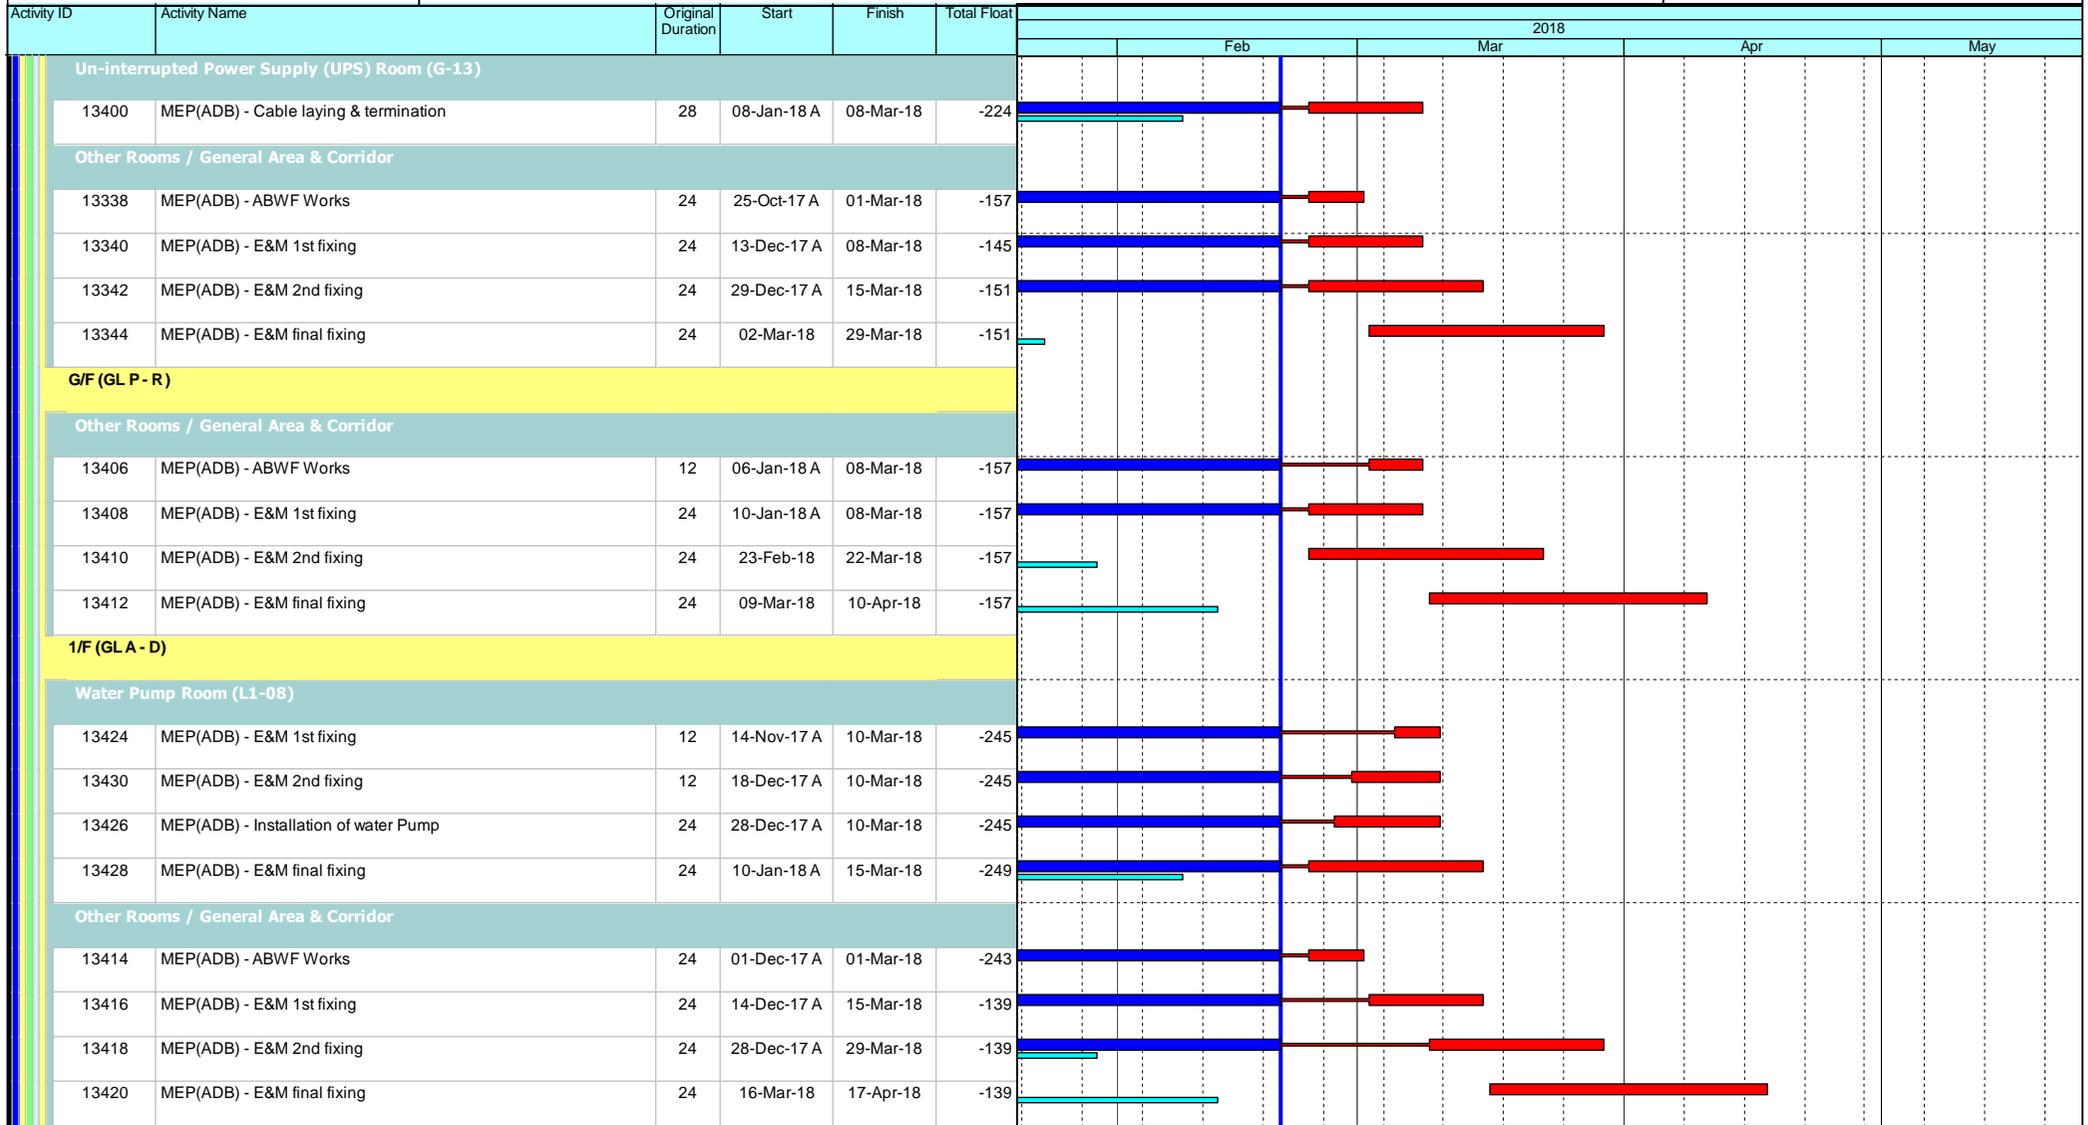TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 35 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

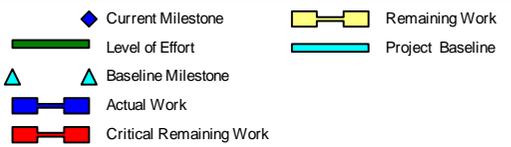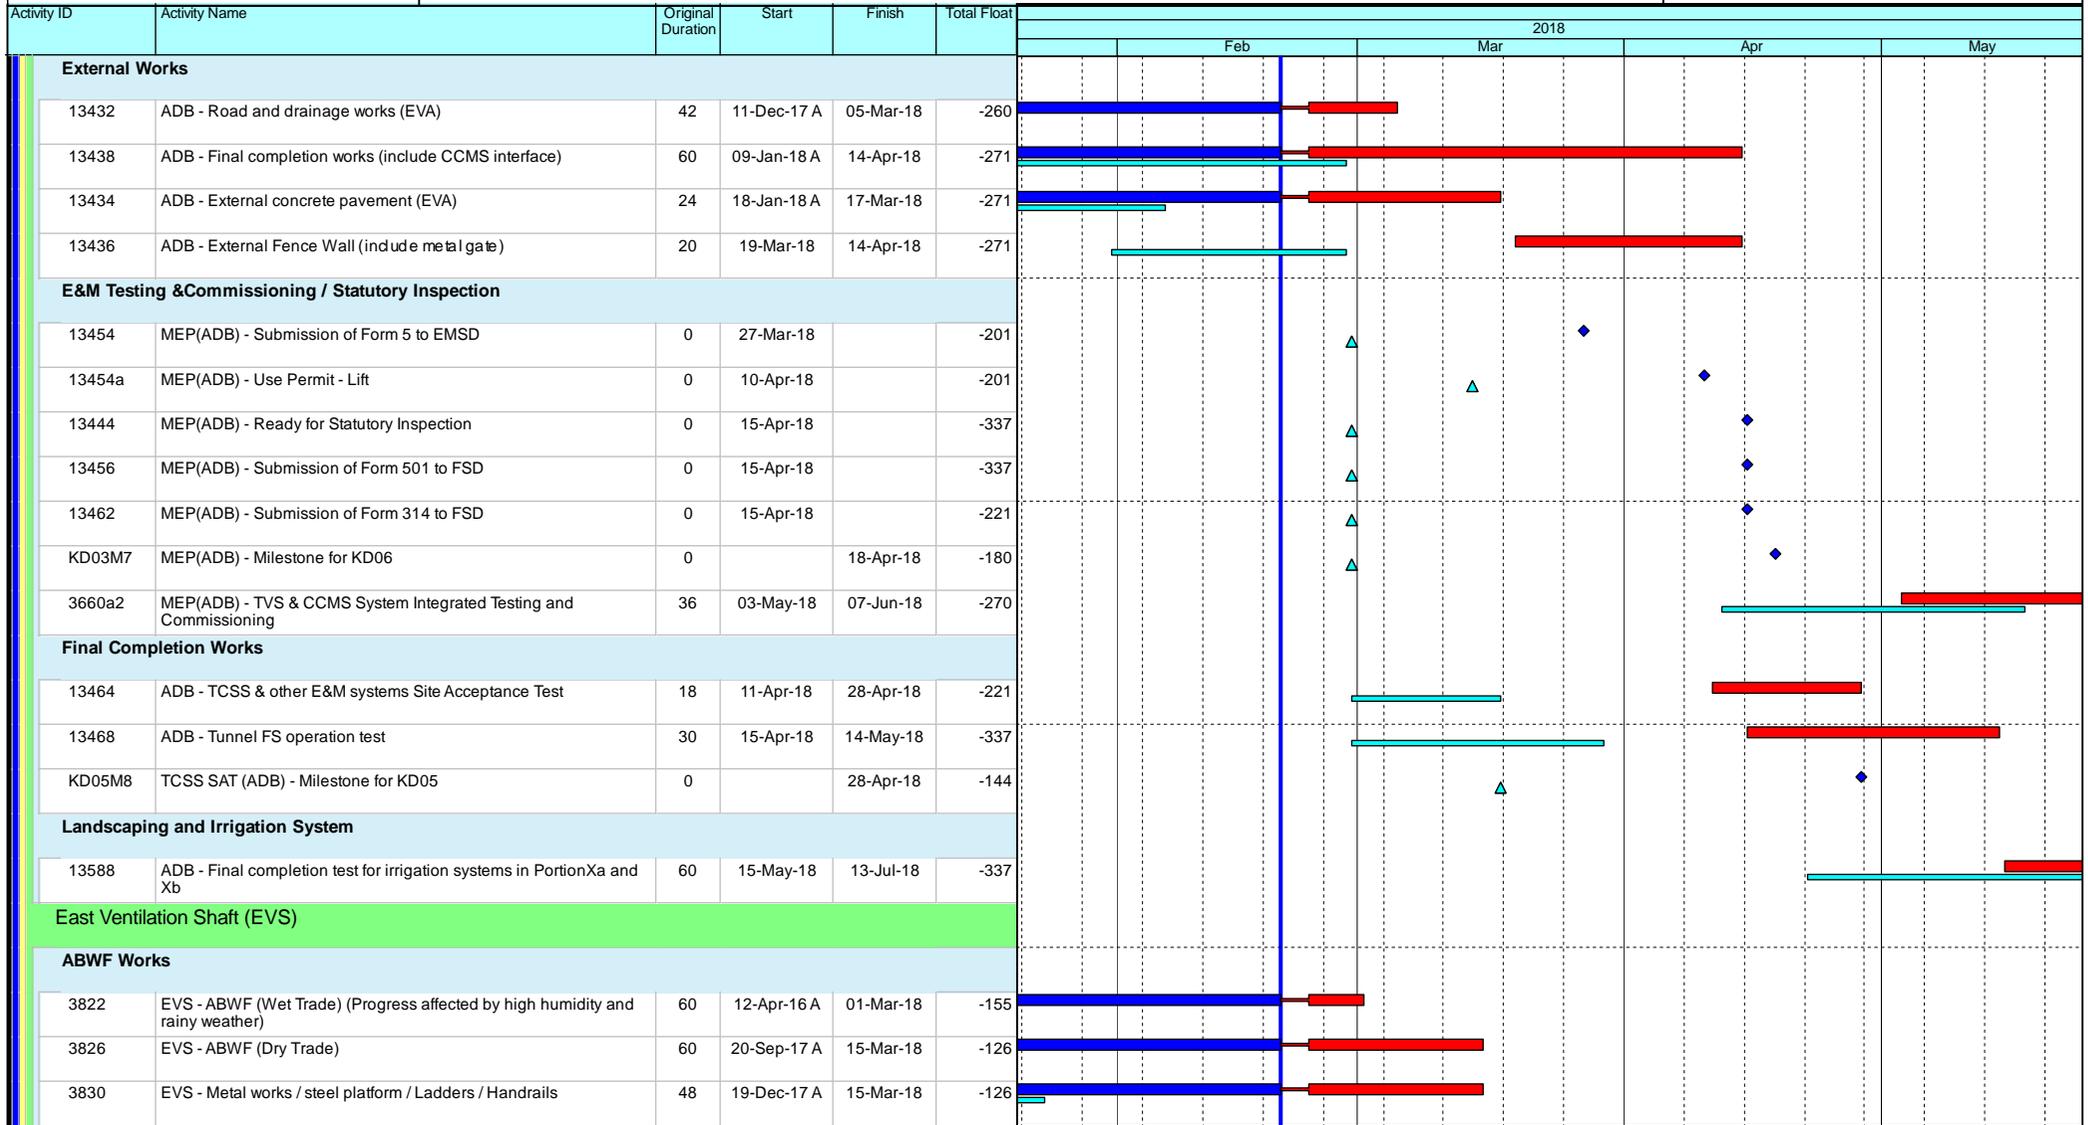TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING


Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 36 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

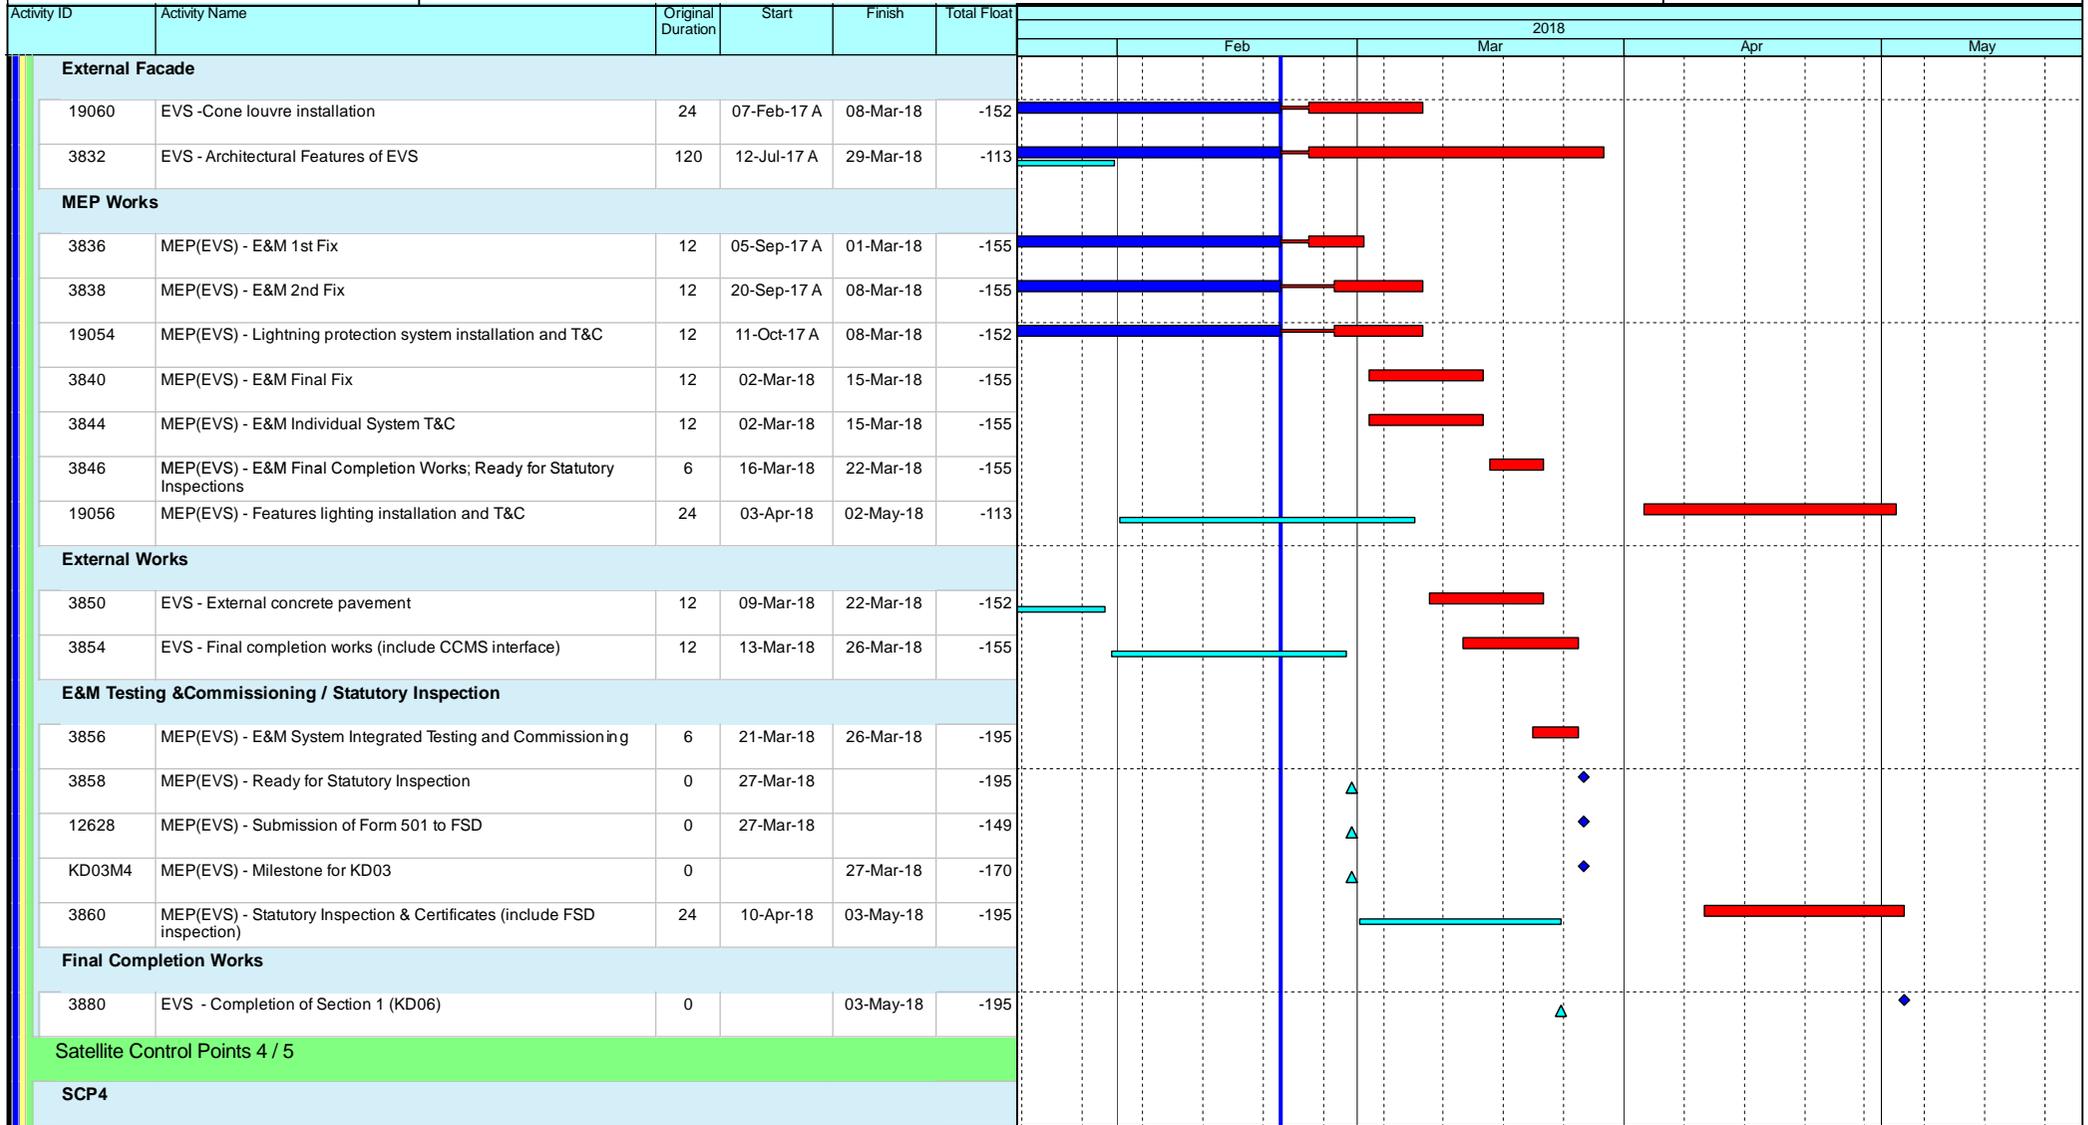TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING

Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 37 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018					
						Feb	Mar	Apr	May		
3778	SCP4 - Initial Site Survey	6	23-Feb-18	01-Mar-18	-196						
3778a	SCP4 - Construction details from AECOM	0	23-Feb-18*		-196						
3780	SCP4 - Erect Hoarding	6	02-Mar-18	08-Mar-18	-196						
3782	SCP4 - Mobilisation and setup	12	09-Mar-18	22-Mar-18	-196						
3784	SCP4 - Construct SCP RC Structures	24	23-Mar-18	24-Apr-18	-196						
3786	SCP4 - ABWF Works	24	25-Apr-18	24-May-18	-196						
3798	SCP4 - External Works	24	25-Apr-18	24-May-18	-143						
3788	MEP(SCP4) - E&M 1st Fix	18	27-Apr-18	18-May-18	-196						
10112	MEP(SCP4) - TCSS Enabling Works (Remaining TCSS installation)	18	27-Apr-18	18-May-18	-196						
3790	MEP(SCP4) - E&M 2nd Fix	18	08-May-18	29-May-18	-155						
3824	SCP4 - Metal works / Glazing / Louver / Handrails	18	10-May-18	31-May-18	-149						
3792	MEP(SCP4) - E&M Final Fix	18	17-May-18	07-Jun-18	-155						
SCP5											
3828	SCP5 - Mobilization for Area B	0	23-Feb-18		-207						
3848	SCP5 - Initial Site Survey	6	23-Feb-18	01-Mar-18	-207						
3827	C19 allow access for SCP5 construction	0	23-Feb-18*		-207						
3827a	Construction details from AECOM	0	23-Feb-18*		168						
3852	SCP5 - Erect Hoarding	4	02-Mar-18	06-Mar-18	-207						
3868	SCP5 - Mobilisation and setup	2	07-Mar-18	08-Mar-18	-207						
3870a	SCP5 - Construct walls upto R/F - Falseworks & Formwork	4	09-Mar-18	13-Mar-18	-207						
3870b	SCP5 - Construct walls upto R/F - Rebar fixing	3	14-Mar-18	16-Mar-18	-207						
3870c	SCP5 - Construct walls upto R/F - Close formwork	4	17-Mar-18	21-Mar-18	-207						
3870d	SCP5 - Construct beams & slab upto R/F - Scaffolding, falsework & formwork	4	22-Mar-18	26-Mar-18	-207						
3870e	SCP5 - Construct beams & slab upto R/F - Rebar fixing	3	27-Mar-18	29-Mar-18	-207						

-  Current Milestone
-  Level of Effort
-  Baseline Milestone
-  Actual Work
-  Critical Remaining Work
-  Remaining Work
-  Project Baseline

Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 38 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

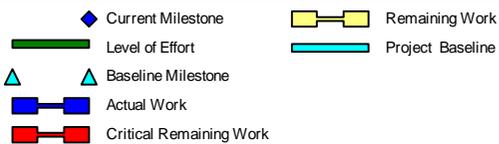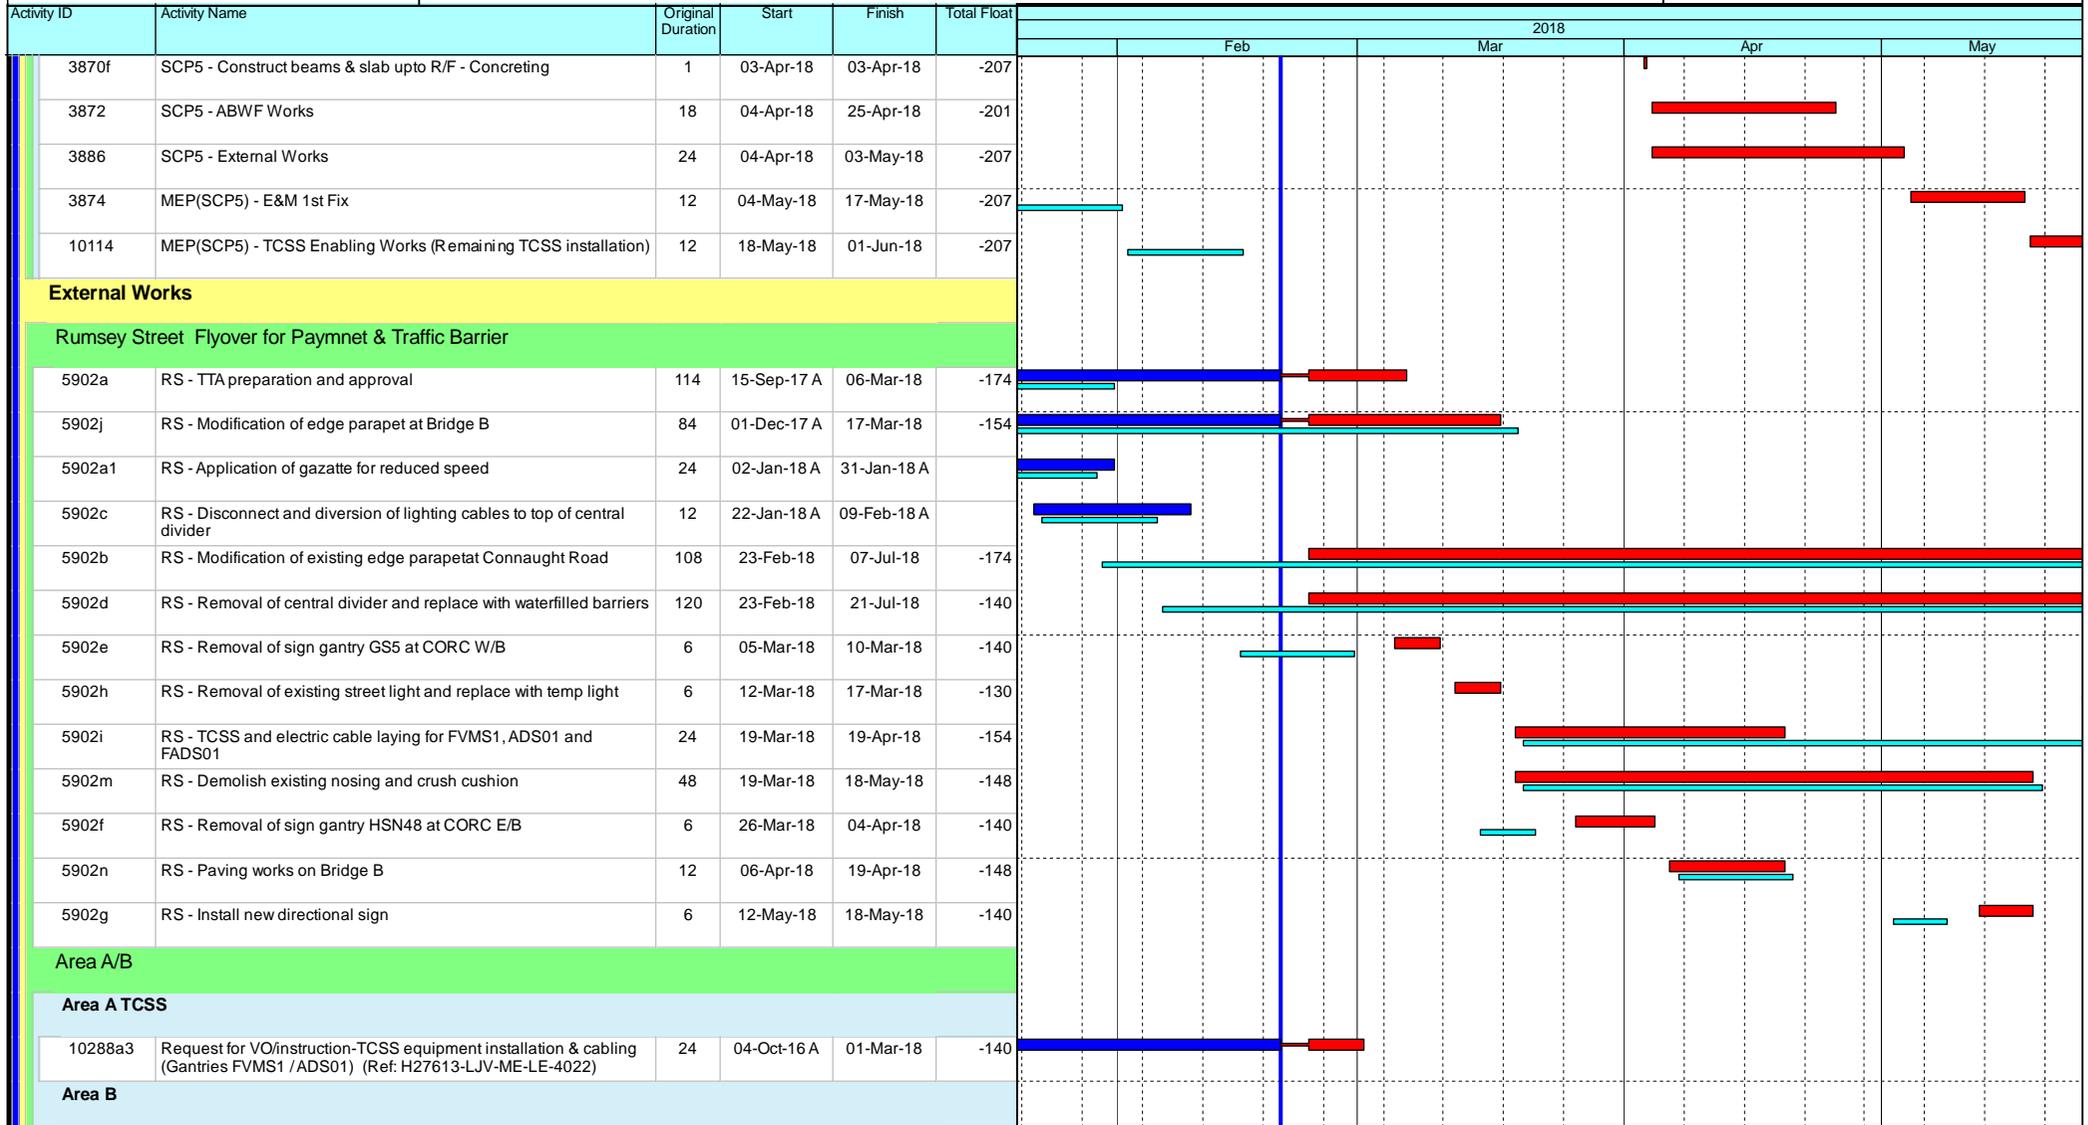TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 39 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

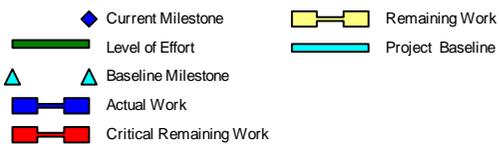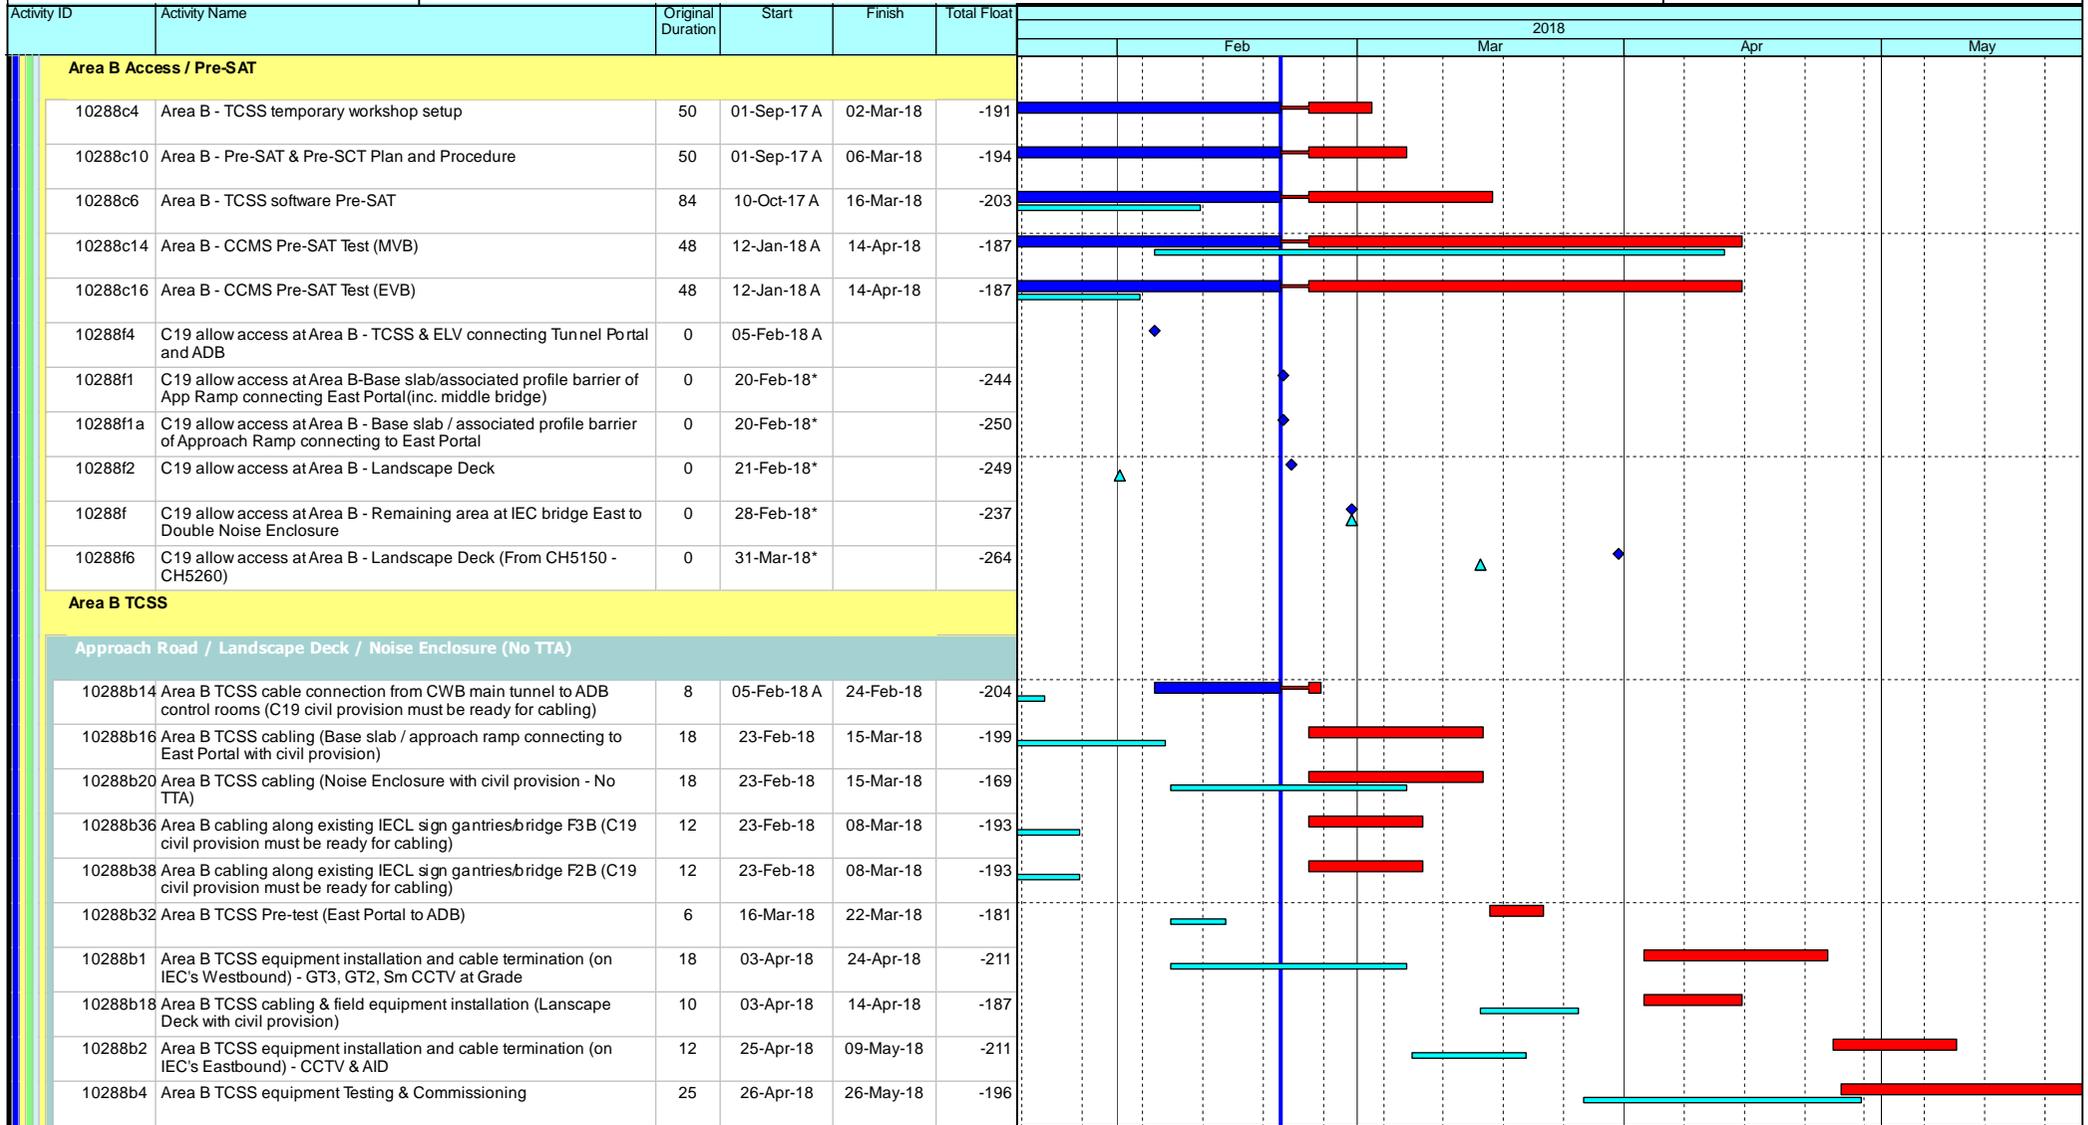TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING

Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 40 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018			
						Feb	Mar	Apr	May
10288b22	Area B TCSS equipment installation and cable termination (on IEC's Westbound) - DS06B	9	10-May-18	19-May-18	-211				
Noise Enclosure (Live Traffic, TTA) - Night Shift									
10288b6b	Area B FADS06 sign face installation	4	02-Apr-18*	05-Apr-18	-249				
10288b6	Area B TCSS equipment installation and cable termination (on IEC's Westbound) - FADS06	10	06-Apr-18	17-Apr-18	-198				
10288b6c	Area B DS06A sign face installation	1	15-Apr-18*	15-Apr-18	-255				
10288b6a	Area B TCSS equipment installation and cable termination (on IEC's Westbound) - DS06A	6	16-Apr-18	21-Apr-18	-202				
10288b10	Area B TCSS equipment installation and cable termination (on IEC's Eastbound) - FADS08A	6	18-Apr-18	24-Apr-18	-190				
10288b8	Area B TCSS equipment Testing & Commissioning	20	23-Apr-18	16-May-18	-202				
Existing IEC (Live Traffic, TTA) - Night Shift									
10288b24	ADS06 A-frame and main beam completion by C19	0		18-Mar-18*	-231				
10288b30	Area B TCSS cabling (Existing IEC with civil provision)	24	19-Mar-18	19-Apr-18	-186				
10288b24	Area B TCSS equipment installation and cable termination (on IEC's Westbound) - ADS06	10	19-Mar-18	29-Mar-18	-166				
10288b24	Area B TCSS equipment installation and cable termination (on IEC's Westbound) - VMS7	14	25-Apr-18	11-May-18	-190				
10288b26	Area B TCSS equipment Testing & Commissioning	12	17-May-18	31-May-18	-202				
Area B Tunnel Lighting									
Landscape Deck									
10288c1	Area B Tunnel Lighting (Landscape Deck) - Brackets / Cable Containment / Conduit / Junction Box installation	18	23-Feb-18	15-Mar-18	-202				
10288d2	Area B Tunnel Lighting (Landscape Deck) - Bracket installation (Cable Trench)	18	23-Feb-18	15-Mar-18	-202				
10288d3	Area B Tunnel Lighting (Landscape Deck) - Cable laying (Cable Trench)	24	03-Apr-18	02-May-18	-191				
10288c8	Area B Tunnel Lighting (Landscape Deck) - Brackets/Cable Containment/Conduit/Junction Box installation (CH5150-CH5260)	30	03-Apr-18	09-May-18	-214				
10288c2	Area B Tunnel Lighting (Landscape Deck) - Tunnel Lighting installation (Base / Reinforcement lighting)	34	13-Apr-18	24-May-18	-214				
10288d1	Area B Tunnel Lighting (Landscape Deck) - Cable laying / Control cable wiring (High Level)	42	21-Apr-18	11-Jun-18	-214				
10288d5	Area B Tunnel Lighting (Landscape Deck) - Cable termination (Cable Trench)	17	03-May-18	23-May-18	-191				
10288d4	Area B Tunnel Lighting (Landscape Deck) - Cable termination (High Level)	38	05-May-18	20-Jun-18	-214				

- ◆ Current Milestone
- ▬ Level of Effort
- ▲ Baseline Milestone
- ▬ Actual Work
- ▬ Critical Remaining Work
- ▬ Remaining Work
- ▬ Project Baseline

Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING



Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 41 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

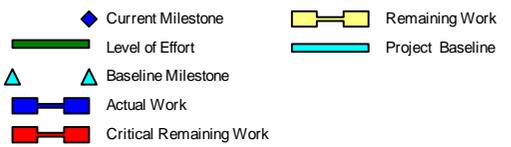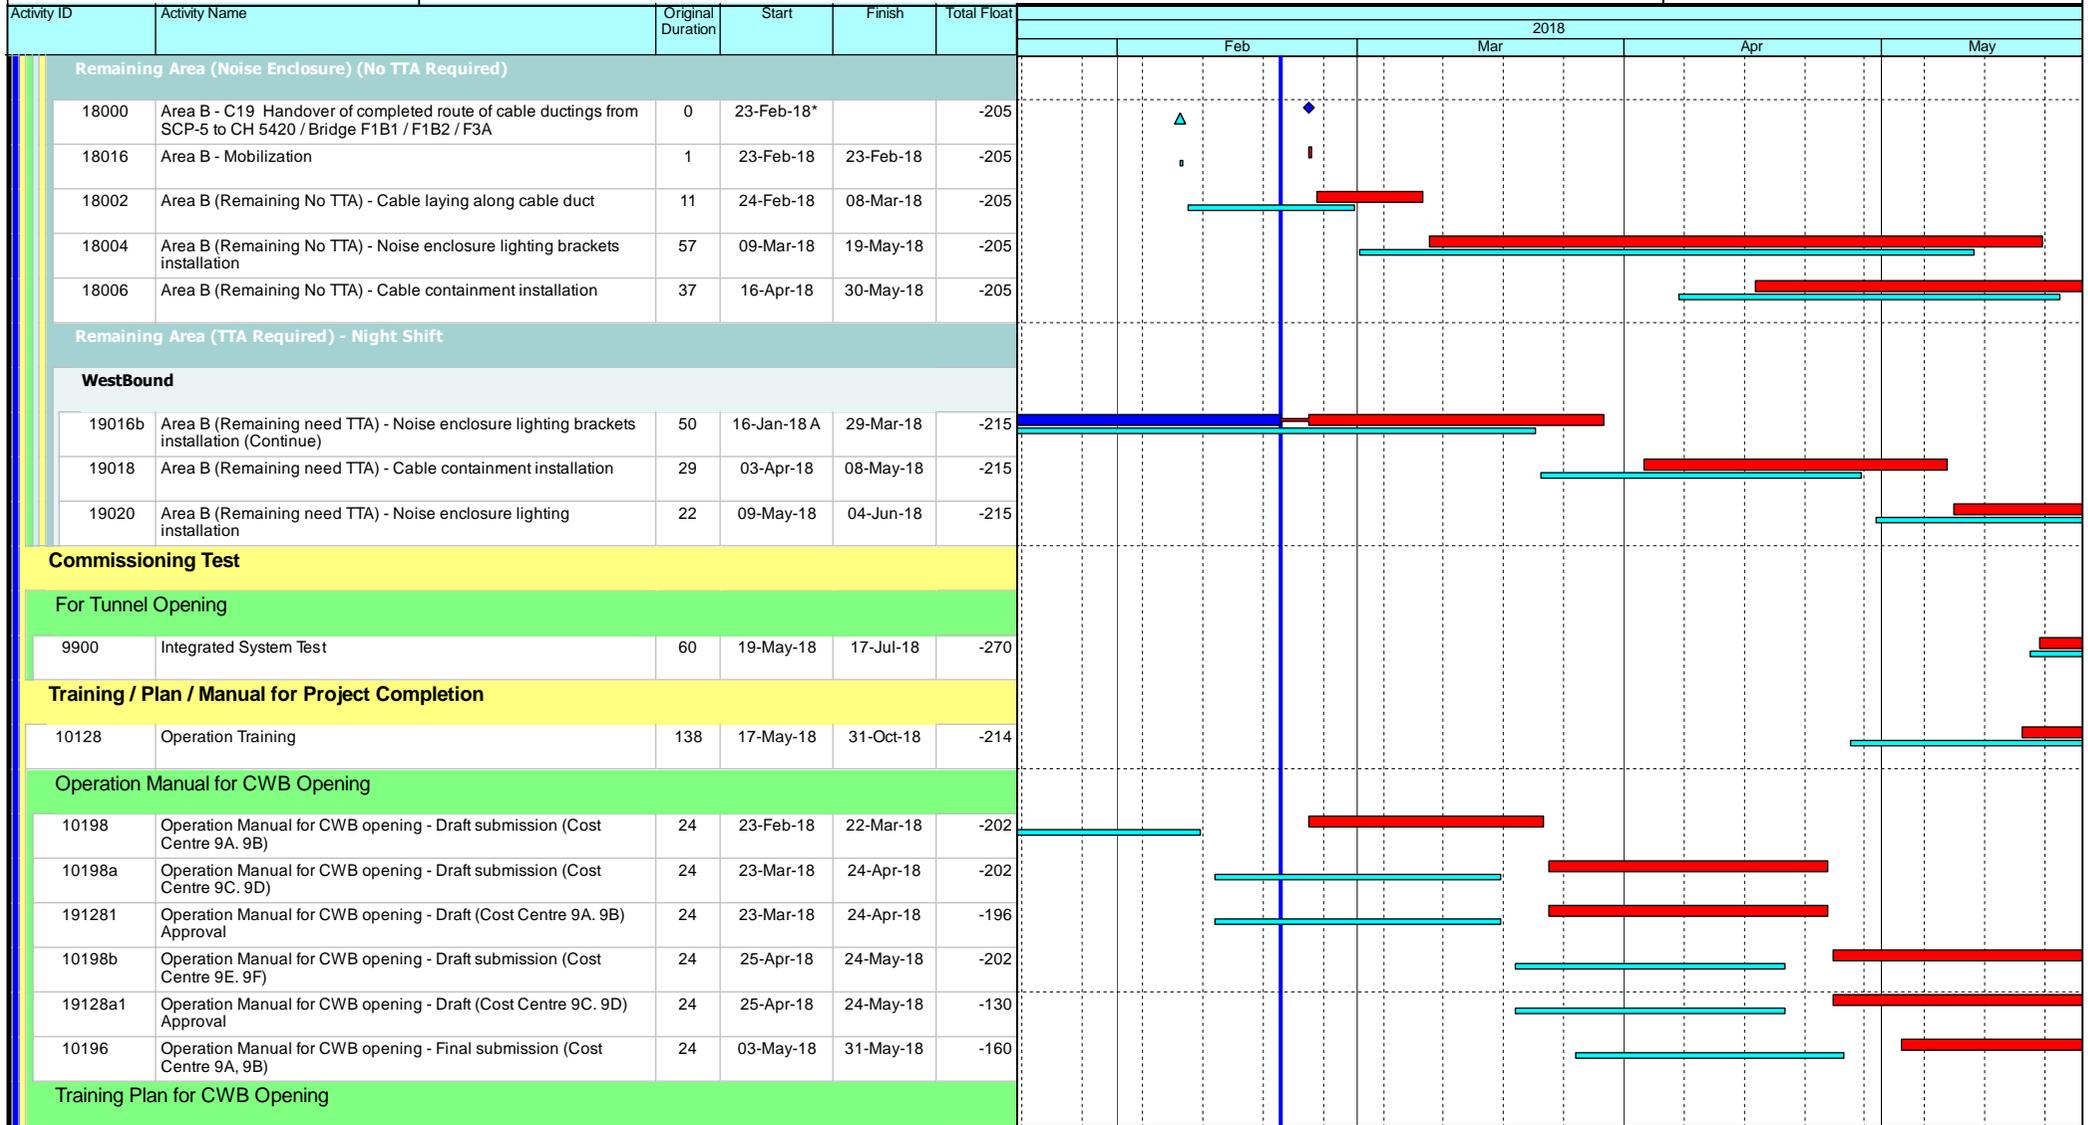TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING


Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 42 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Feb-18

CWB(CC) - Commissioning Contract

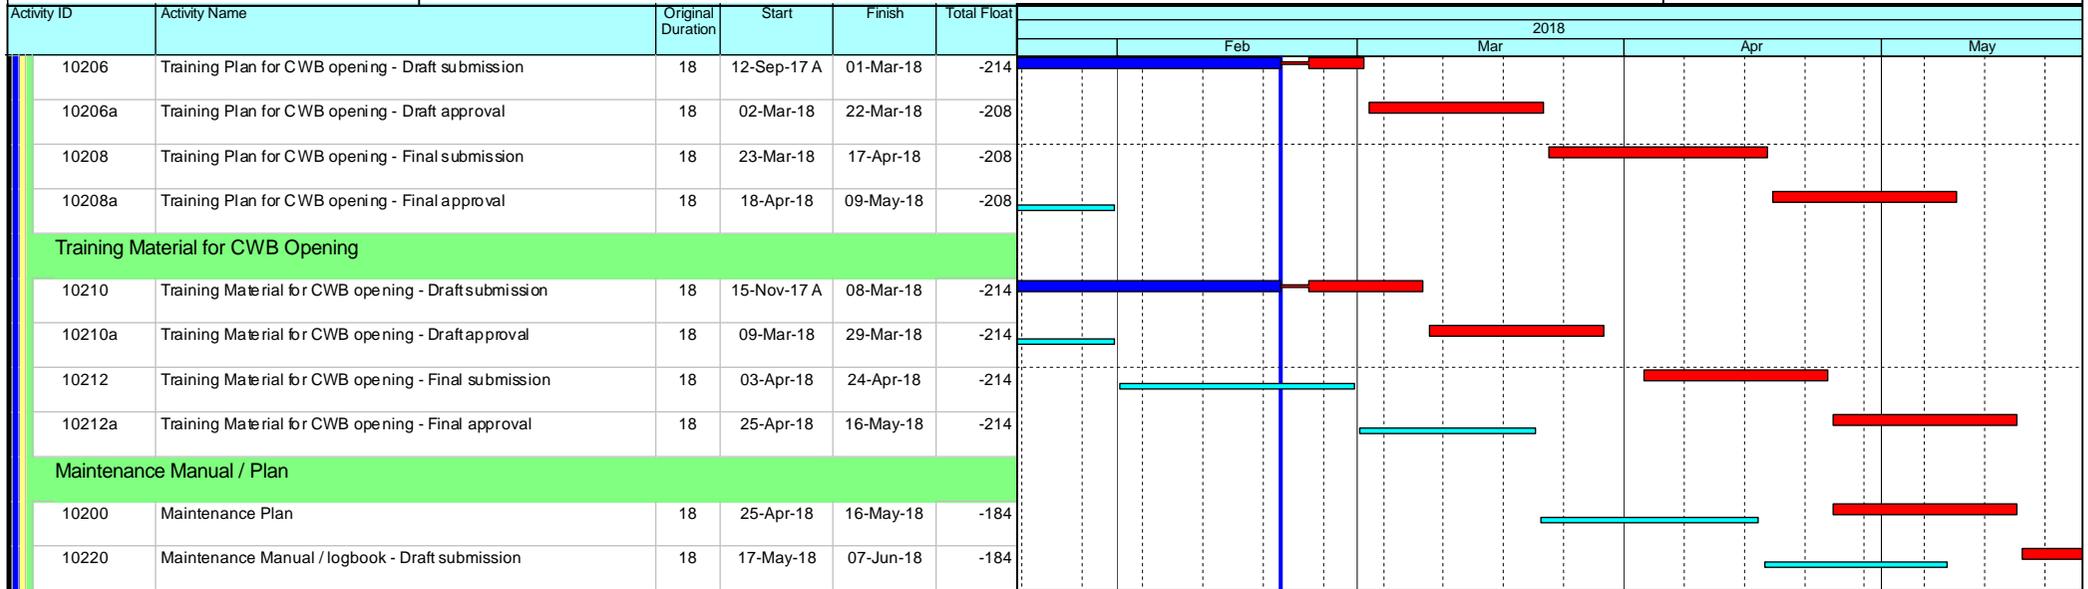TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



- Current Milestone
- Level of Effort
- Baseline Milestone
- Actual Work
- Critical Remaining Work
- Remaining Work
- Project Baseline

Leighton Contractors (Asia) Limited Programme Update 48 (February 2018) THREE MONTH ROLLING

Project ID: H2613-U048
 Baseline: SA01
 Layout: Update Three Month Rolling
 U048
 Page 43 of 43

Date	Revision	Checked	Appro...
20-Jan-18	U047	AT	CW
20-Feb-18	U048	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018			
						Mar	Apr	May	Jun
Update 2018-03-20 CWB(CC) - Commissioning Contract (SA)									
PRELIMINARIES AND GENERAL REQUIREMENTS									
Salient Key Dates and Milestones									
Anticipated Completion Dates									
KD02	KD2 - Achievement of Stage 2 (1232 days)	0		16-May-18*	-306		▲	◆	
KD03	KD3 - Achievement of Stage 3 (1318 days) - include EOT (140 days)	0		16-May-18*	-220	▲		◆	
Possession Dates and Vacation Dates									
PO-IIa	Possession of Portion IIa (Day 1) - WVB below +6.5mPD	1329	28-Feb-14 A	17-Apr-18	-223	[Gantt bar: blue to red, ending in yellow]			
PO-III	Possession of Portion III (Day 120) - CH1805-2600	1209	28-Jun-14 A	17-Apr-18	-273	[Gantt bar: blue to red]			
PO-Ib	Possession of Portion Ib (Day 242) - CH1580-1805	1087	28-Oct-14 A	17-Apr-18	-223	[Gantt bar: blue to red]			
PO-IXd	Possession of Portion IXd (Day 266) - CH4600-4860	1063	21-Nov-14 A	17-Apr-18	-217	[Gantt bar: blue to red]			
PO-XI	Possession of Portion XI (Day 296) - EVS	1033	21-Dec-14 A	17-Apr-18	152	[Gantt bar: blue to yellow]			
PO-IIc	Possession of Portion IIc (Day 336) - CH1360-1580	993	30-Jan-15 A	17-Apr-18	-223	[Gantt bar: blue to red]			
PO-IIb	Possession of Portion IIb (Day 336) - WVB above +6.5mPD	669	30-Jan-15 A	17-Apr-18	-223	[Gantt bar: blue to red]			
PO-IXa	Possession of Portion IXa (Day 392) - CH4860-5150	937	27-Mar-15 A	17-Apr-18	-217	[Gantt bar: blue to red]			
PO-Va	Possession of Portion V (Day 607) - CH2950-3210	722	28-Oct-15 A	17-Apr-18	-273	[Gantt bar: blue to red]			
PO-VII_a1	Possession of Portion VII (Day 762) - CH3911-4250 (below -6.0mPD)	659	30-Dec-15 A	17-Apr-18	-217	[Gantt bar: blue to red]			
PO-Vc	Possession of Portion V (Day 607) - CH3210-3250	658	15-Jan-16 A	17-Apr-18	-158	[Gantt bar: blue to red]			
PO-VIb_b1	Possession of Portion VIb (Day 761) - CH3428-3625 (E/B)	619	18-Feb-16 A	17-Apr-18	-199	[Gantt bar: blue to red]			
PO-VIb_b2	Possession of Portion VIb (Day 761) - CH3428-3625 (W/B)	568	29-Feb-16 A	17-Apr-18	-182	[Gantt bar: blue to red]			
PO-Xa_1	Possession of Portion Xa (Day 650) - ADB Southern Portion (AECOM letter ref: 2015007890T)	589	07-Mar-16 A	17-Apr-18	-349	[Gantt bar: blue to red]			
PO-Xb_1	Possession of Portion Xb (Day 804) - ADB Northern Portion	589	07-Mar-16 A	17-Apr-18	-349	[Gantt bar: blue to red]			
PO-Vb1	Possession of Portion V (Day 607) - SR3	587	11-Mar-16 A	17-Apr-18	152	[Gantt bar: blue to yellow]			
PO-Ia	Possession of Portion Ia (Day 789) - SCB / SCP1 / SCP2 / Rumsey Street Flyover	600	28-Mar-16 A	17-Apr-18	-327	[Gantt bar: blue to red]			

- ◆ Current Milestone
- Level of Effort
- ▲ Baseline Milestone
- Actual Work
- Critical Remaining Work
- Remaining Work
- Project Baseline

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 1 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018			
						Mar	Apr	May	Jun
PO-VII_a2	Possession of Portion VII (Day 762) - CH3800-3911 (below -6.0mPD)	567	31-Mar-16 A	17-Apr-18	-213				
PO-IXc_1	Possession of Portion IXc (Day 712) - EVB above 3.6mPD - Relinquished on 12 Apr 2016	445	29-Jul-16 A	17-Apr-18	-293				
PO-IXb_1	Possession of Portion IXb (Day 712) - EVB (below +3.6mPD to tunnel top slab) - Relinquished on 12 Apr 2016	445	05-Aug-16 A	17-Apr-18	-293				
PO-VIa_a	Possession of Portion VIa (Day 823) - CH3250-3283	425	15-Aug-16 A	17-Apr-18	-182				
PO-Vb2_a	Possession of Portion V (Day 607) - SR2	456	15-Aug-16 A	17-Apr-18	-206				
PO-VIc_a	Possession of Portion VIc (Day 761) - CH3770-3800 (Access Shaft Opening)	391	23-Sep-16 A	17-Apr-18	-199				
PO-VIb_c	Possession of Portion VIb (Day 761) - CH3625-3770	391	23-Sep-16 A	17-Apr-18	-199				
PO-IVa1	Possession of Portion IVa (Day 930) - CH2600-2720	323	30-Nov-16 A	17-Apr-18	-220				
PO-IVb2	Possession of Portion IVb (Day 930) - MVB (GL D-H)	233	28-Feb-17 A	17-Apr-18	-330				
PO-VIIIa_a	Possession of Portion VIIIa (Day 929) - CH4530-4591 W/B	233	28-Feb-17 A	17-Apr-18	-273				
PO-VIIIa	Possession of Portion VIIIa (Day 929) - CH4250-4600 (Remaining)	241	12-Mar-17 A	17-Apr-18	-273				
PO-VIIIb	Possession of Portion VIIIb (Day 929) - SR8 (CH700-350)	233	12-Mar-17 A	17-Apr-18	-193				
PO-VIIIc	Possession of Portion VIIIc (Day 1039) - SR8 (CH350-310) / SCP4	233	12-Mar-17 A	17-Apr-18	-204				
PO-IVa2_a	Possession of Portion IVa (Day 930) - CH2720-2950	241	12-Mar-17 A	17-Apr-18	-220				
PO-IVb1	Possession of Portion IVb (Day 930) - MVB (GL A-C)	239	14-Mar-17 A	17-Apr-18	-330				
PO-IVa2_b	Possession of Portion IVa (Day 930) - SR1	203	30-Mar-17 A	17-Apr-18	-220				
PO-Vb2_b	Possession of Portion V (Day 607) - SCP3	182	03-Jul-17 A	17-Apr-18	-206				
PO-VIb_a	Possession of Portion VIb (Day 761) - CH3400-3428	80	31-Jul-17 A	17-Apr-18	-155				
PO-VIa_b	Possession of Portion VIa (Day 823) - CH3283-3400	80	31-Jul-17 A	17-Apr-18	-273				
PO-IVc	Possession of Portion IVc (Day 1144) - MVB (above +5.0mPD)	111	20-Mar-18	08-Jul-18	-275				
Submissions and Approvals									
Initial General Submission									
10168	Submission of CMC 3DVR	30	20-Mar-18	18-Apr-18	-74				
DETAILED DESIGN OF WORKS									

- Current Milestone
- Remaining Work
- Level of Effort
- Project Baseline
- Baseline Milestone
- Actual Work
- Critical Remaining Work

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 2 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018					
						Mar	Apr	May	Jun		
Permanent Works Design and Engineering											
Green Roof on EVB											
2166	EVB Roof - Engineer review & Approval; Consent to Proceed Construction	24	18-Apr-16 A	03-Apr-18	-279						
Green Wall on ADB											
10238	ADB Green Wall - Engineer review & Approval; Consent to Proceed Construction	24	07-Mar-16 A	26-Mar-18	-268						
Landscaping & Associated Irrigation System											
10268	Landscaping - Engineer review & Approval; Consent to Proceed Construction	24	07-Mar-16 A	06-Apr-18	-259						
PROCUREMENT, MANUFACTURING & DELIVERIES											
Procurement; Manufacturing; Deliveries											
Green Roof on EVB											
Shop Drawings											
12846	EVB Green Roof - Shop Drawings review the Engineer	30	03-Aug-17 A	27-Mar-18	-341						
2230	EVB Green Roof - Obtain Approval for Shop Drawings	0		27-Mar-18	-341						
Procurement & Fabrication											
2232	EVB Green Roof - Confirm design of embed items	0	04-Apr-18		-348						
2234	EVB Green Roof - Embed fabrication & delivery	20	04-Apr-18	23-Apr-18	-348						
2236	EVB Green Roof - Commence embed installation	0	24-Apr-18		-348						
2238	EVB Green Roof - Green Roof Fabrication & delivery	20	24-Apr-18	13-May-18	-348						
2240	EVB Green Roof - Commence installation	0	14-May-18		-348						
Landscaping and Associated Irrigation System											
Shop Drawings											
10272	Landscaping - Shop Drawings submission to the Engineer	30	06-Oct-17 A	31-Mar-18	-347						
12848	Landscaping - Shop Drawings review by the Engineer	30	01-Apr-18	30-Apr-18	-347						
10274	Landscaping - Obtain Approval for Shop Drawings	0		30-Apr-18	-347						

- Current Milestone
- Remaining Work
- Level of Effort
- Project Baseline
- Baseline Milestone
- Actual Work
- Critical Remaining Work

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 3 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018					
						Mar	Apr	May	Jun		
Procurement & Fabrication											
10276	Landscaping - Confirm design of embed items	0	01-May-18		-347						
10278	Landscaping - Embed fabrication & delivery	30	01-May-18	30-May-18	-347						
10280	Landscaping - Commence embed installation	0	31-May-18		-347						
10282	Landscaping - Fabrication & delivery	30	31-May-18	29-Jun-18	-347						
Green Wall on ADB											
Shop Drawings											
10242	ADB Green Wall - Shop Drawings submission to the Engineer	30	06-Oct-17 A	29-Mar-18	-335						
12850	ADB Green Wall - Shop Drawings review the Engineer	18	30-Mar-18	16-Apr-18	-335						
10244	ADB Green Wall - Obtain Approval for Shop Drawings	0		16-Apr-18	-335						
Procurement & Fabrication											
10246	ADB Green Wall - Confirm design of embed items	0	17-Apr-18		-335						
10248	ADB Green Wall - Embed fabrication & delivery	30	17-Apr-18	16-May-18	-335						
10250	ADB Green Wall - Commence embed installation	0	17-May-18		-335						
10252	ADB Green Wall - Green Wall Fabrication & delivery	52	17-May-18	07-Jul-18	-335						
Architectural Feature on EVS											
Procurement & Fabrication											
10086	EVS - Architectural Features delivery	60	02-Jun-17 A	29-Mar-18	-185						
Air Purification System (APS)											
Procurement & Fabrication											
13664	APS - Ship to HK Store (3rd Batch)	80	03-Aug-17 A	29-Mar-18	-165						
2368	APS - QA Stored Equipment	6	23-Aug-17 A	29-Mar-18	-165						
CONSTRUCTION											
West Ventilation Building (WVB - related)											

- ◆ Current Milestone
- ▬ Level of Effort
- ▲ Baseline Milestone
- ▬ Actual Work
- ▬ Critical Remaining Work
- ▬ Remaining Work
- ▬ Project Baseline

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 4 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

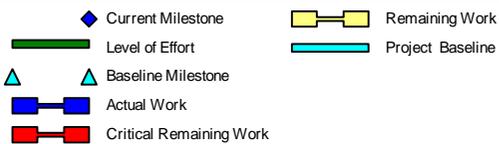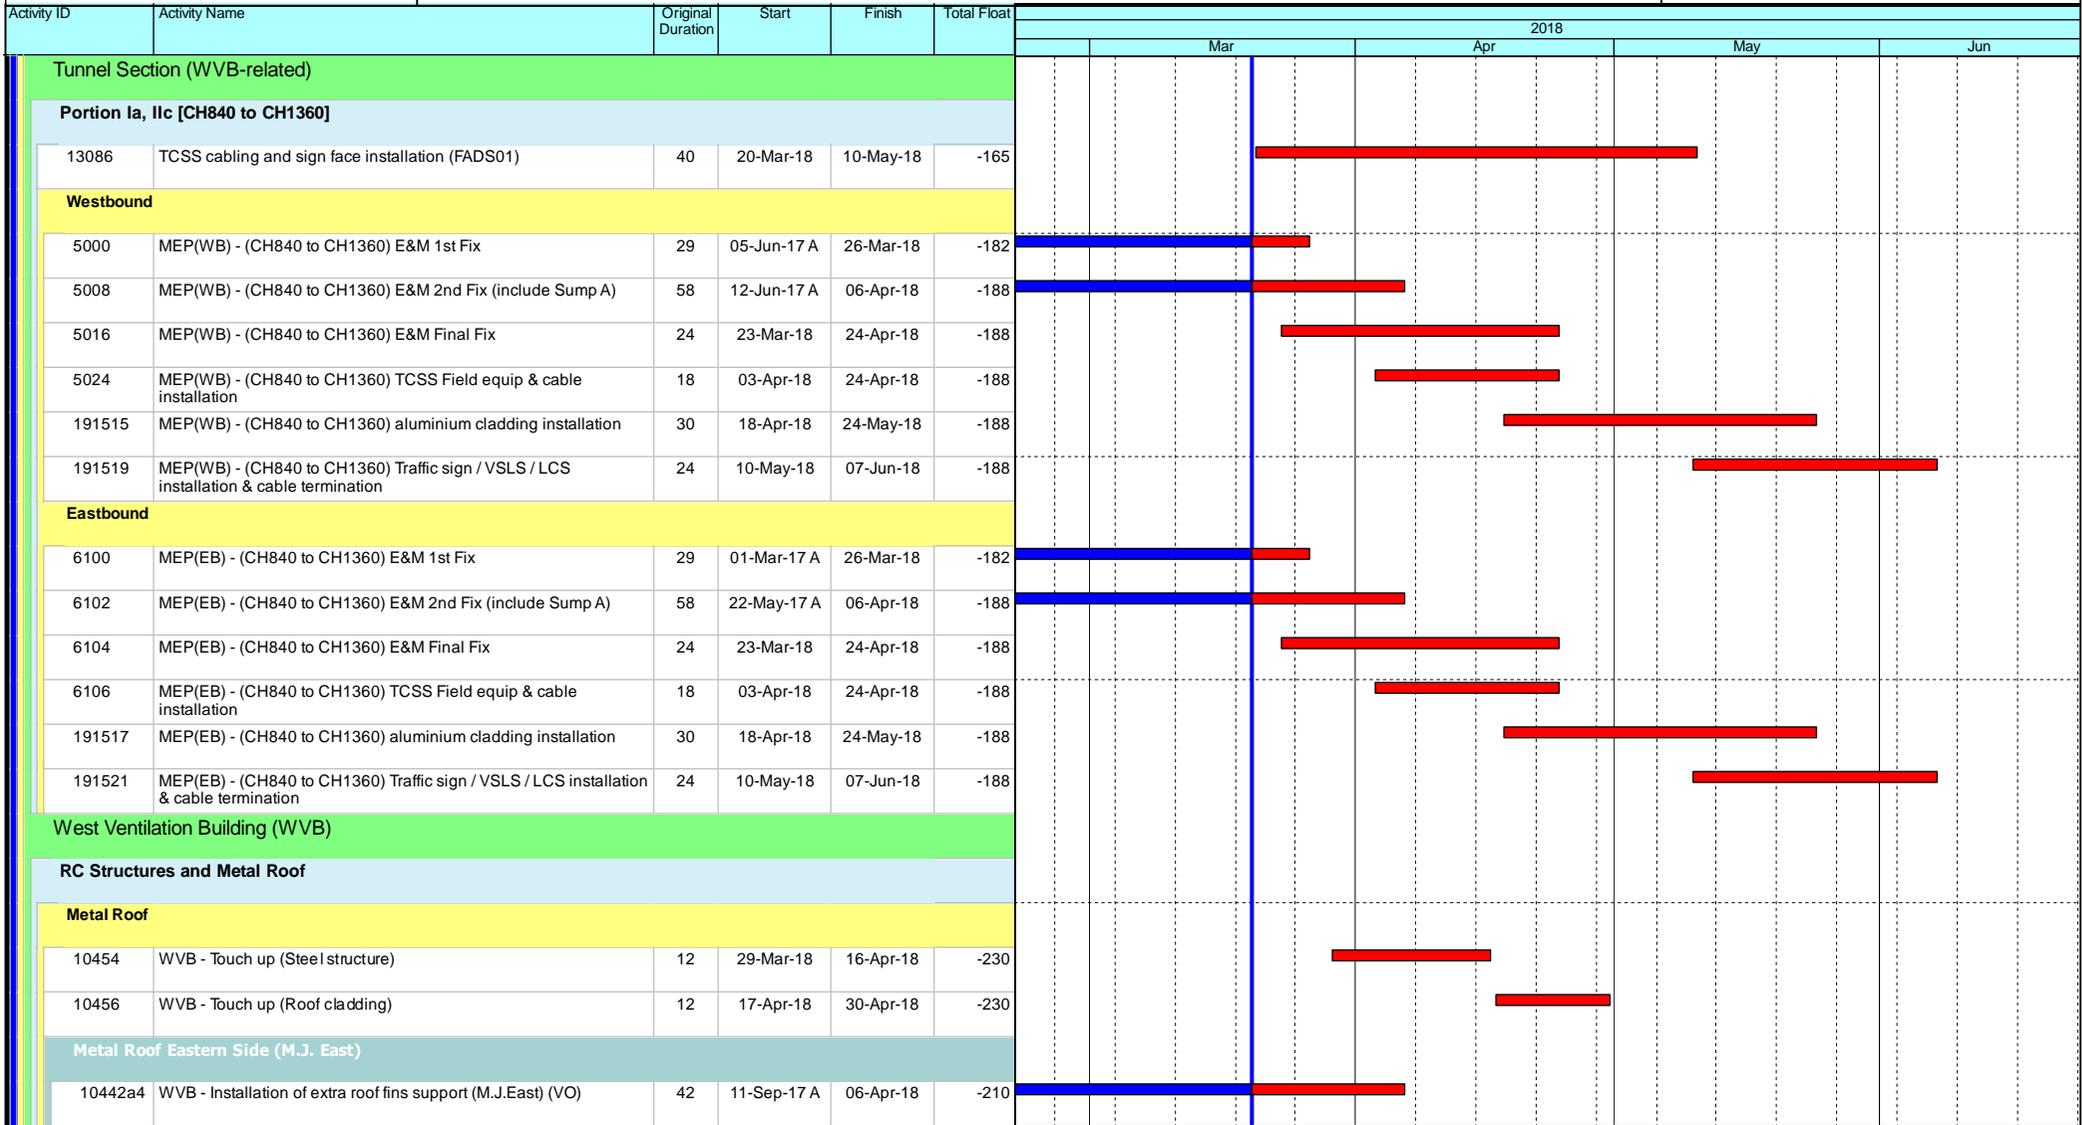TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 5 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

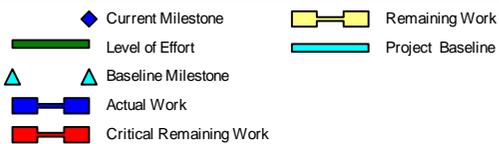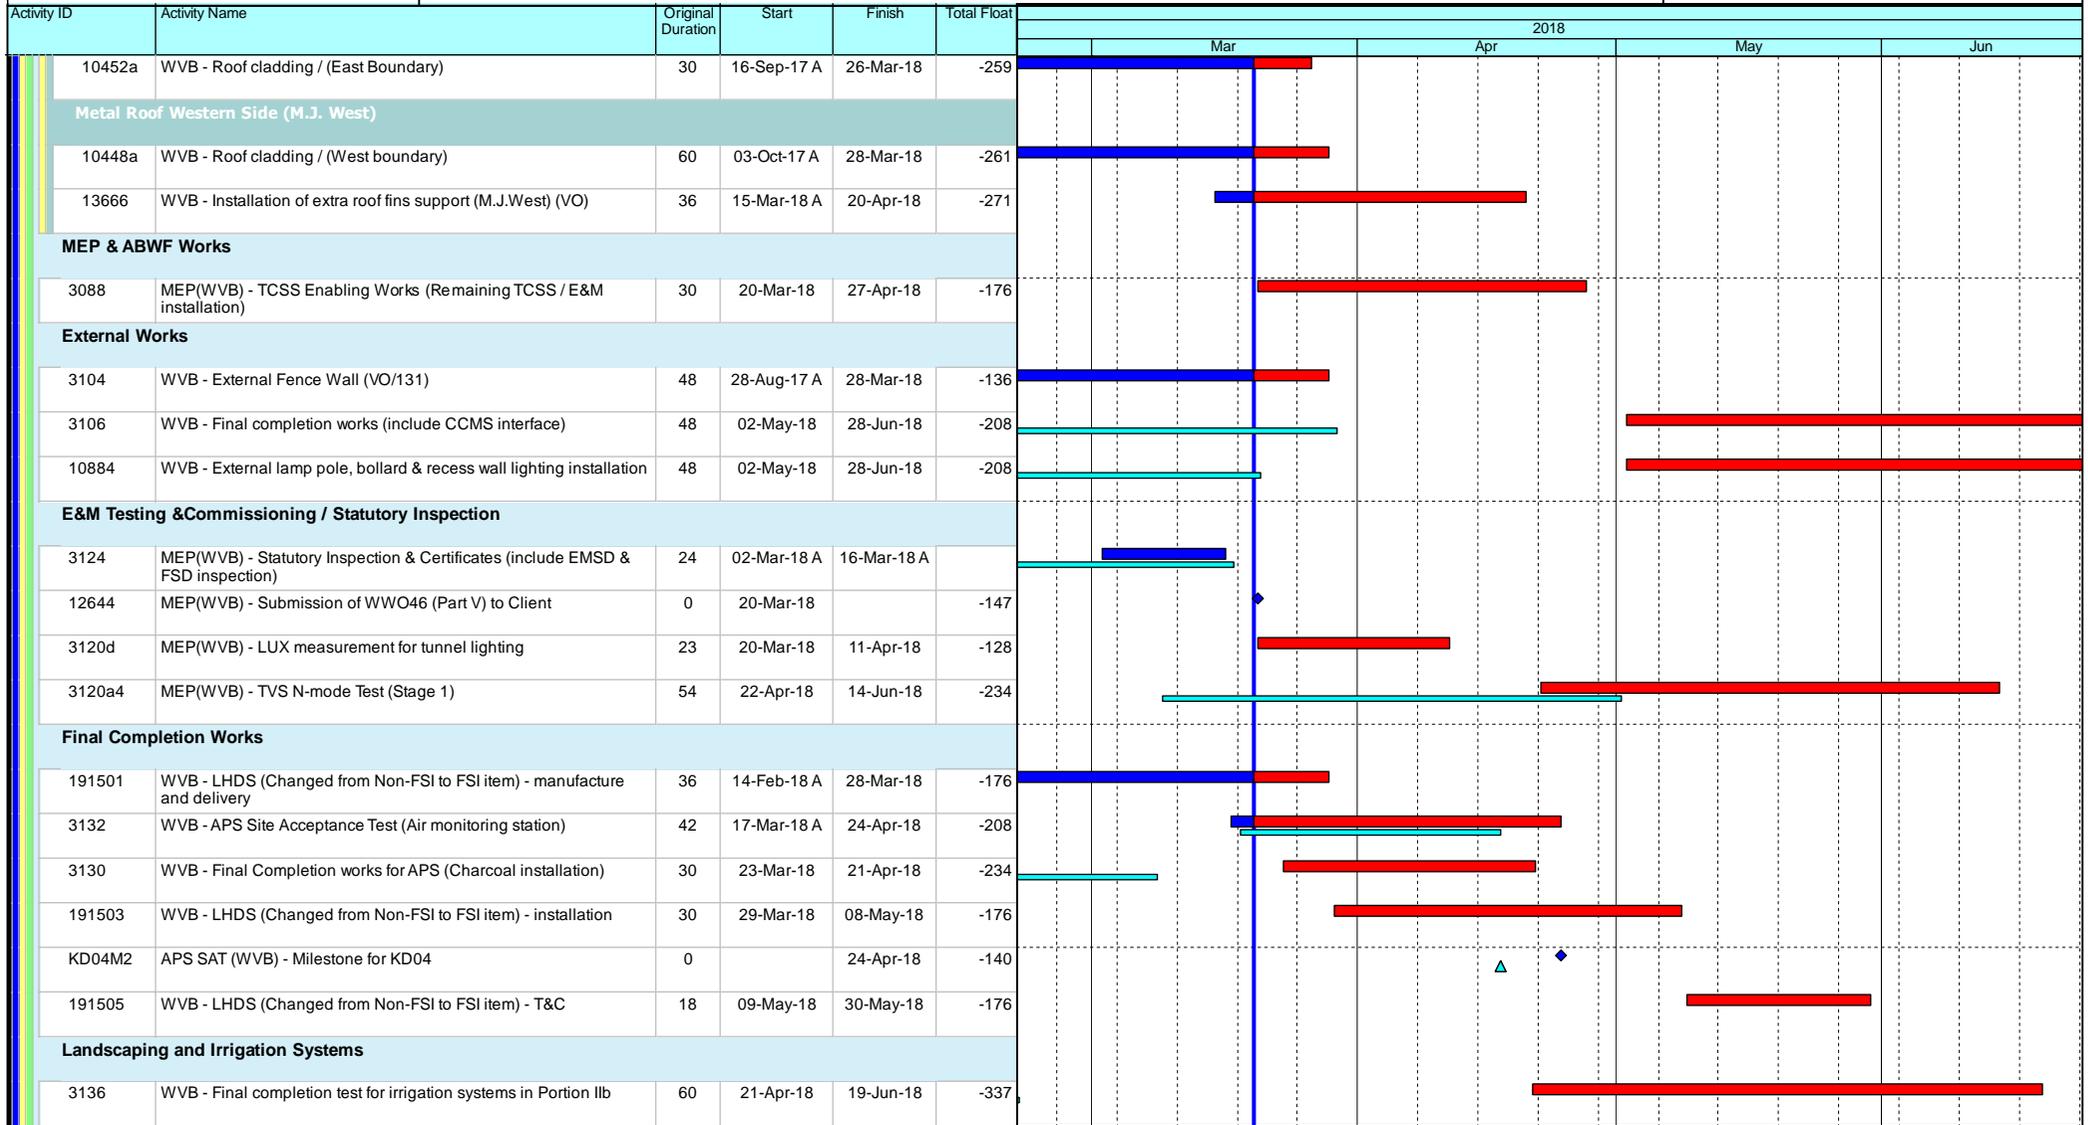TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 6 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018				
						Mar	Apr	May	Jun	
Tunnel Flexible Pavement (WVB-related)										
5802	Road(WB) - (CH1480 to CH2600) Road Marking & Traffic Sign	14	05-Jun-18	21-Jun-18	-232					
Satellite Control Building (SCB)										
ABWF Works										
3922	SCB - ABWF (Wet Trade)	24	18-Jan-17 A	07-Mar-18 A						
3928	SCB - Metal works / steel platform / Ladders / Handrails	36	16-Oct-17 A	08-Mar-18 A						
External Facade										
3930	SCB - External facing tiles / Louvre	48	12-Oct-17 A	26-Mar-18	-188					
MEP Works										
3942	MEP(SCB) - E&M Individual System T&C	12	20-Mar-18	06-Apr-18	-202					
3944	MEP(SCB) - E&M Final Completion Works; Ready for Statutory Inspections	30	20-Mar-18	27-Apr-18	-194					
External Works										
3946	SCB - External concrete pavement	18	12-Mar-18 A	28-Mar-18	-190					
3948	SCB - Final completion works (include CCMS interface)	18	29-Mar-18	23-Apr-18	-190					
E&M Testing & Commissioning										
3950	MEP(SCB) - E&M System Integrated Testing and Commissioning	30	07-Apr-18	06-May-18	-254					
KD01M4	MEP (SCB) - Milestone for KD06	0		23-Apr-18	-139					
Final Completion Works										
3958	SCB - TCSS & other E&M systems Site Acceptance Test	45	07-May-18	20-Jun-18	-254					
Satellite Control Points 1 / 2										
SCP1										
3722	SCP1 - External Works	30	18-Nov-17 A	14-Mar-18 A						
3711	SCP1 - Metal works / Glazing / Louver / Handrails	24	26-Feb-18 A	26-Mar-18	-158					
10106	MEP(SCP1) - TCSS Enabling Works (Remaining TCSS installation)	18	02-Mar-18 A	16-Mar-18 A						

- ◆ Current Milestone
- ▬ Level of Effort
- ▬ Actual Work
- ▬ Critical Remaining Work
- ▬ Remaining Work
- ▬ Project Baseline
- ▲ Baseline Milestone

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING


Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 7 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

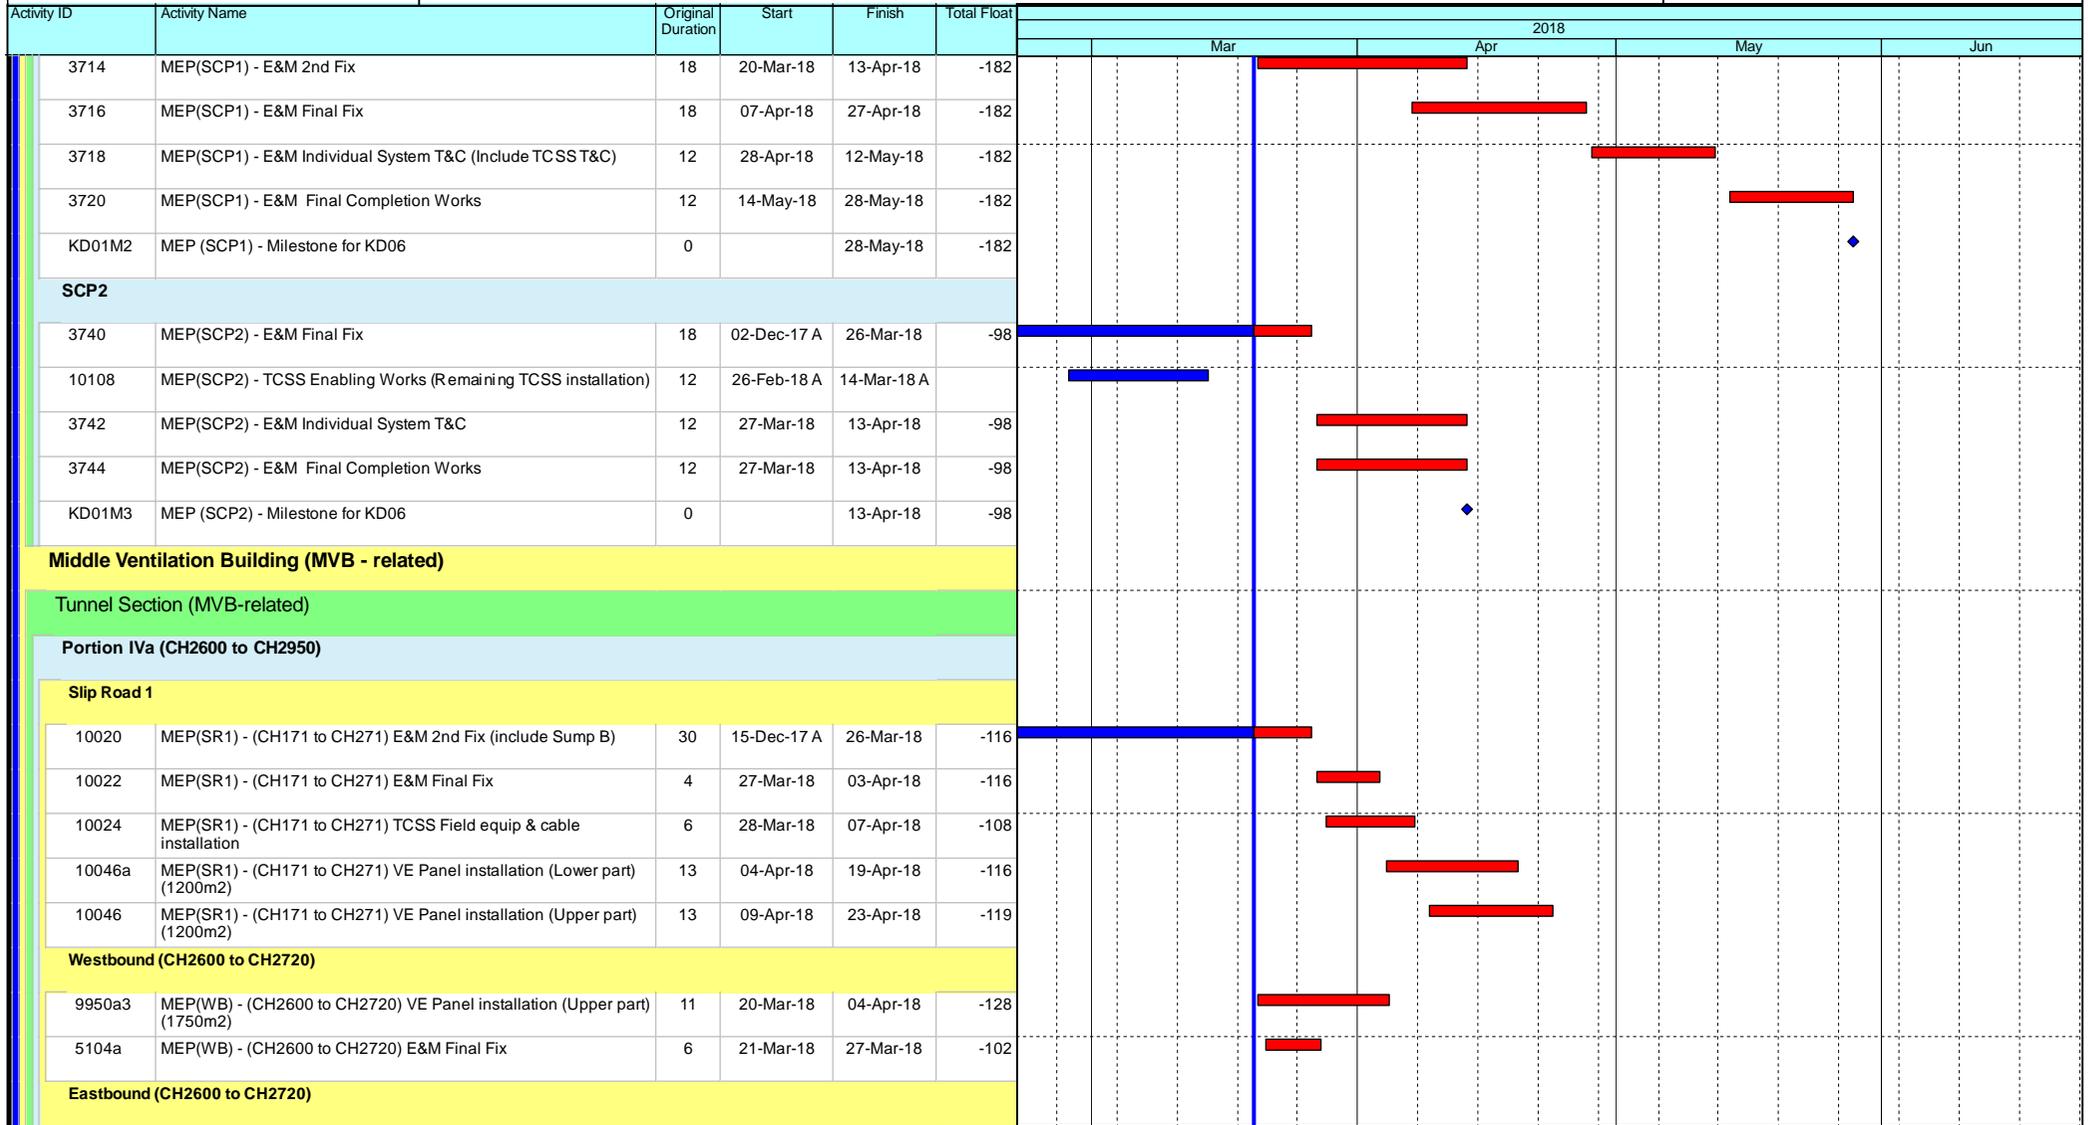TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 8 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018			
						Mar	Apr	May	Jun
5122a	MEP(EB) - (CH2600 to CH2720) E&M Final Fix	6	21-Mar-18	27-Mar-18	-124				
9952a3	MEP(EB) - (CH2600 to CH2720) VE Panel installation (Upper part) (1750m2)	11	06-Apr-18	18-Apr-18	-128				
Westbound (CH2720 to CH2950)									
5104b	MEP(WB) - (CH2720 to CH2950) E&M Final Fix	12	20-Mar-18	06-Apr-18	-107				
9950b1	MEP(WB) - (CH2720 to CH2950) VE Panel installation (Upper part) (2247m2)	13	20-Mar-18	07-Apr-18	-119				
Eastbound (CH2720 to CH2950)									
5122b	MEP(EB) - (CH2720 to CH2950) E&M Final Fix	12	20-Mar-18	06-Apr-18	-105				
9952b1	MEP(EB) - (CH2720 to CH2950) VE Panel installation (Upper part) (2247m2)	13	19-Apr-18	04-May-18	-128				
Portion Va [CH2950 to CH3210]									
Westbound (Outer Lane)									
5134a	MEP(WB) - (CH2950 to CH3210) E&M 2nd Fix	33	23-Feb-17 A	26-Mar-18	-131				
5136a	MEP(WB) - (CH2950 to CH3210) E&M Final Fix	10	16-Aug-17 A	03-Apr-18	-135				
9954a	MEP(WB) - (CH2950 to CH3210) VE Panel installation (Upper part) (1800m2)	20	20-Mar-18	16-Apr-18	-145				
Eastbound (Outer Lane)									
5152a	MEP(EB) - (CH2950 to CH3210) E&M 2nd Fix	33	04-Mar-17 A	06-Apr-18	-135				
5156a	MEP(EB) - (CH2950 to CH3210) E&M Final Fix	10	07-Apr-18	18-Apr-18	-135				
9956a	MEP(EB) - (CH2950 to CH3210) VE Panel installation (Upper part) (1800m2)	20	19-Apr-18	12-May-18	-135				
Portion Vb1 (SR3)									
Slip Road 3									
10032b	MEP(SR3) - (CH3089 to CH3334) E&M 1st Fix	13	15-Mar-17 A	27-Mar-18	-147				
10036b	MEP(SR3) - (CH3089 to CH3334) TCSS Field equip & cable installation	8	15-Mar-17 A	27-Mar-18	-124				
10048c	MEP(SR3) - (CH3089 to CH3334) VE Panel installation (Lower part) (2940m2)	33	27-Mar-18	09-May-18	-144				
10034b	MEP(SR3) - (CH3089 to CH3334) E&M 2nd Fix (include Sump C)	27	28-Mar-18	03-May-18	-147				
10048b	MEP(SR3) - (CH3089 to CH3334) VE Panel installation (Upper part) (2940m2)	33	03-Apr-18	12-May-18	-147				

- ◆ Current Milestone
- ▬ Level of Effort
- ▬ Actual Work
- ▬ Critical Remaining Work
- ▬ Remaining Work
- ▬ Project Baseline
- ▲ Baseline Milestone

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING


Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 9 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

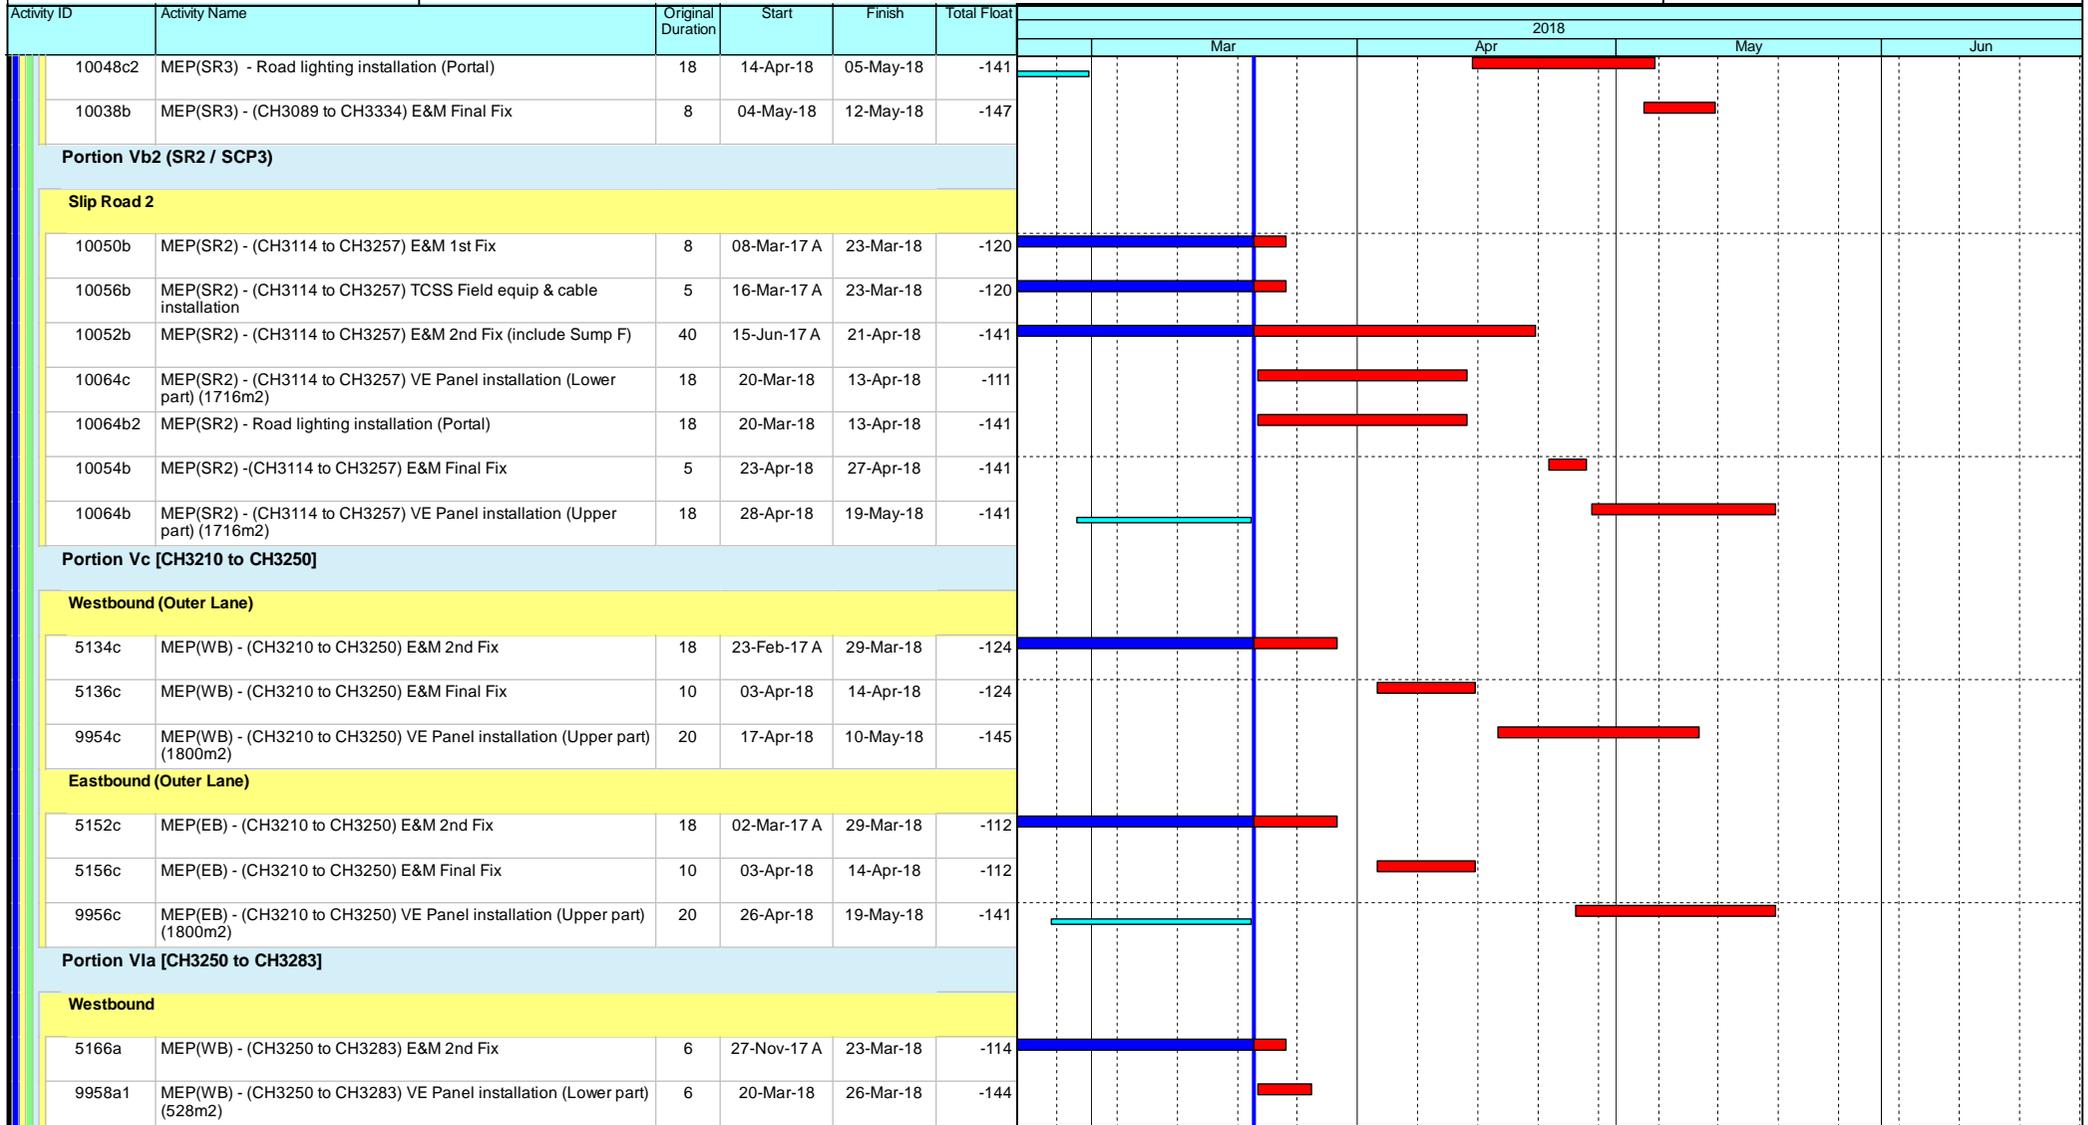TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 10 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

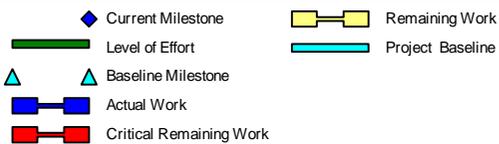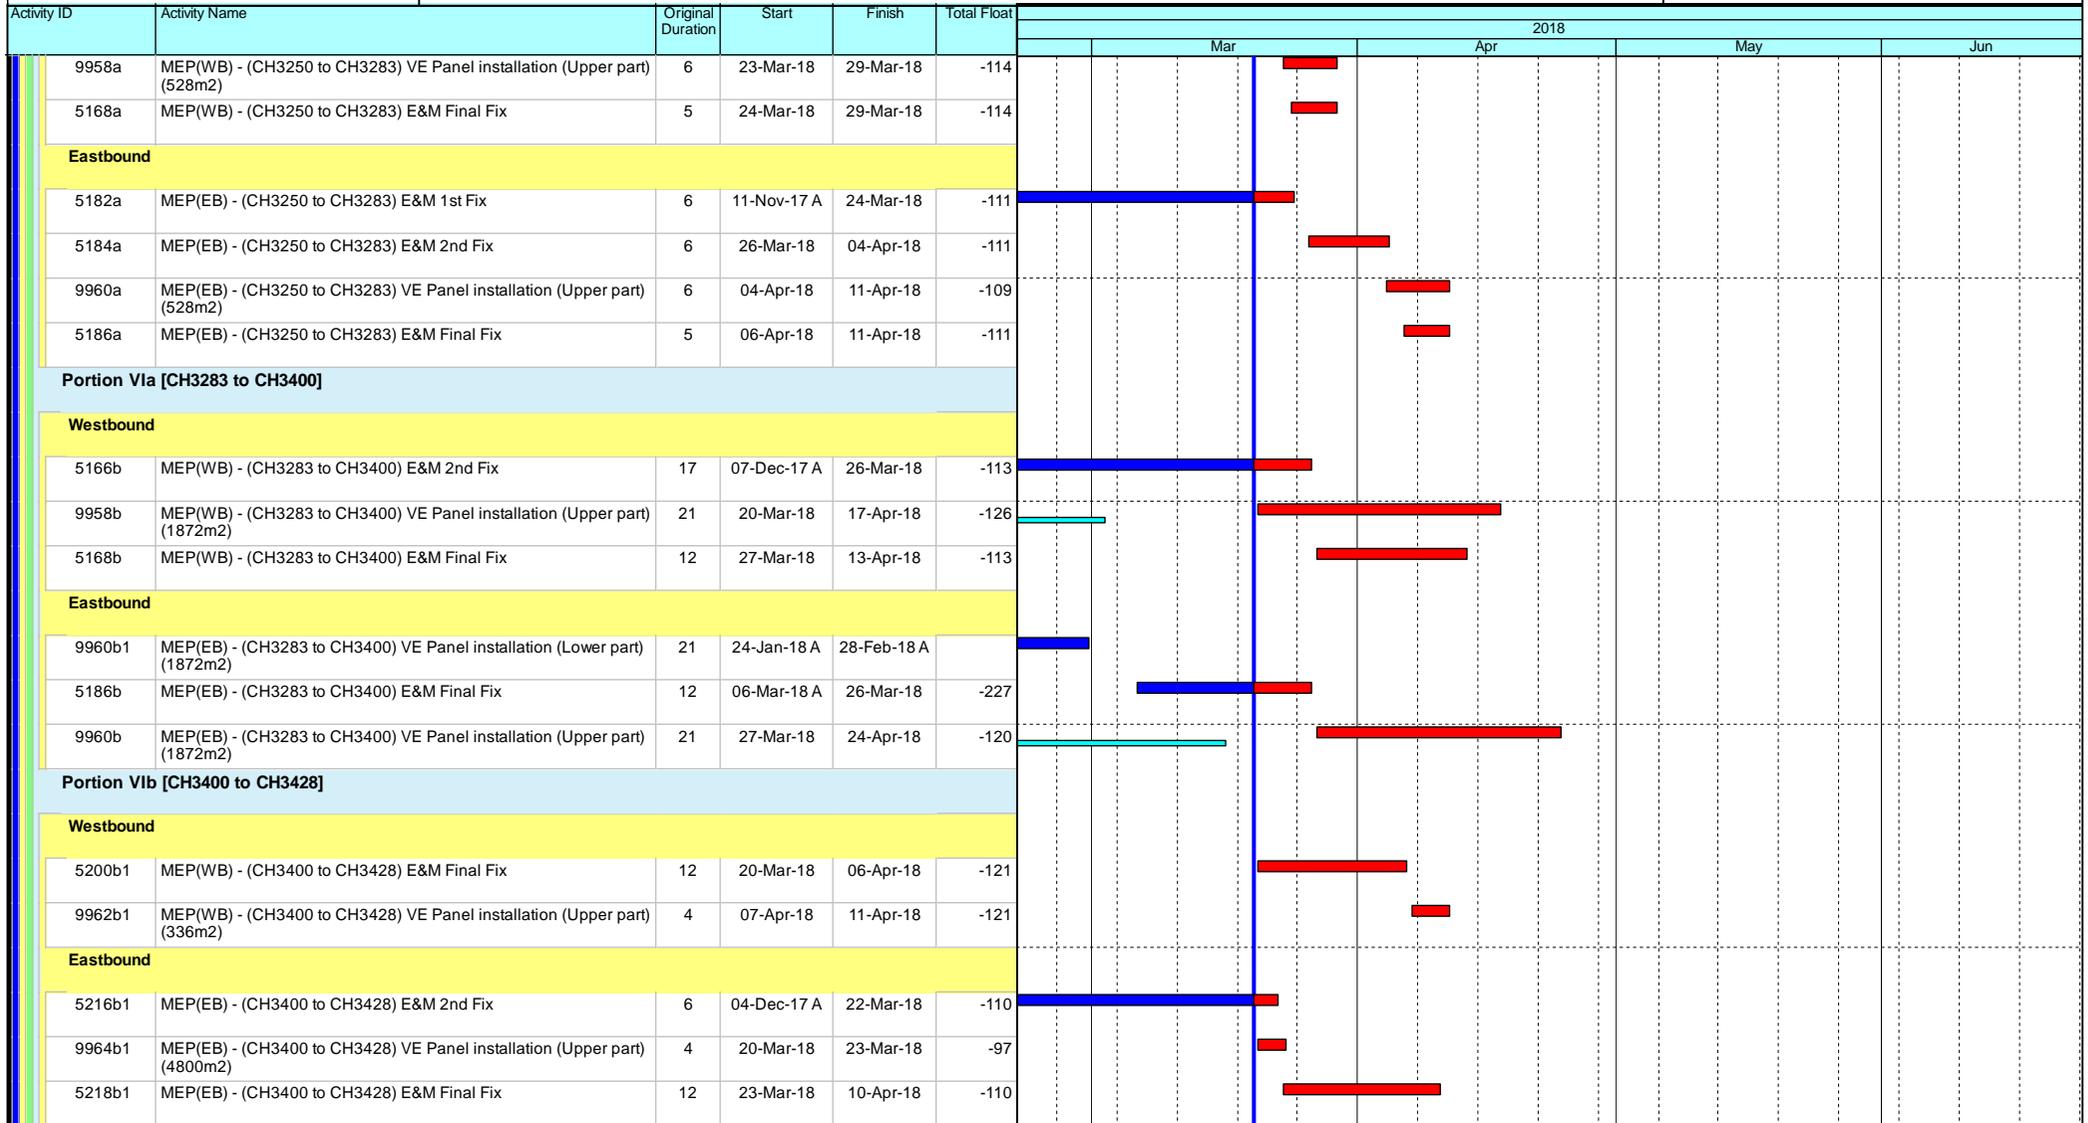TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING


Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 11 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

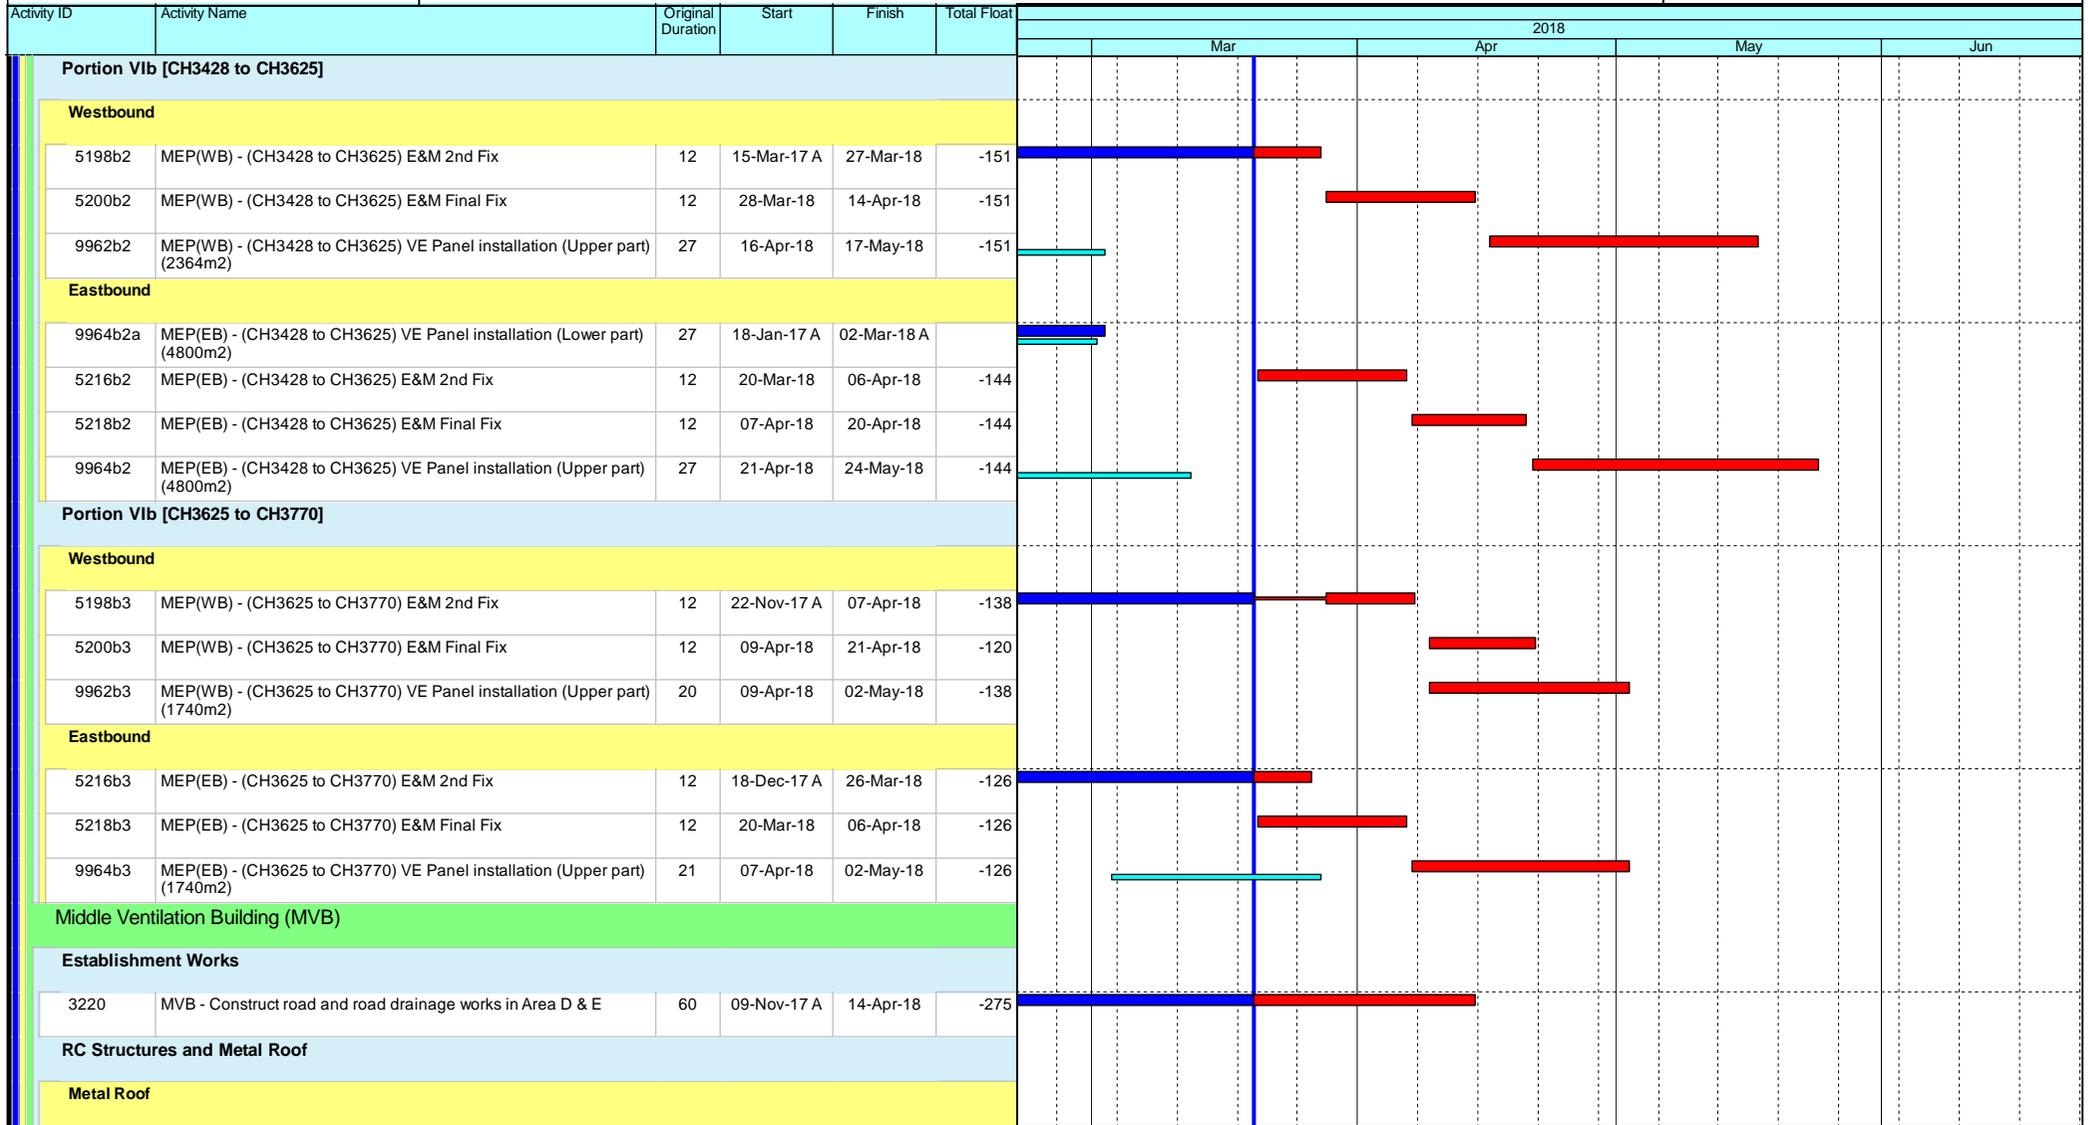TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 12 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

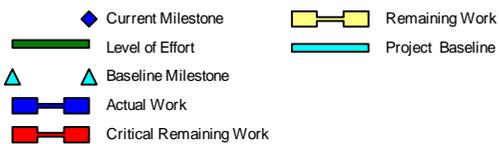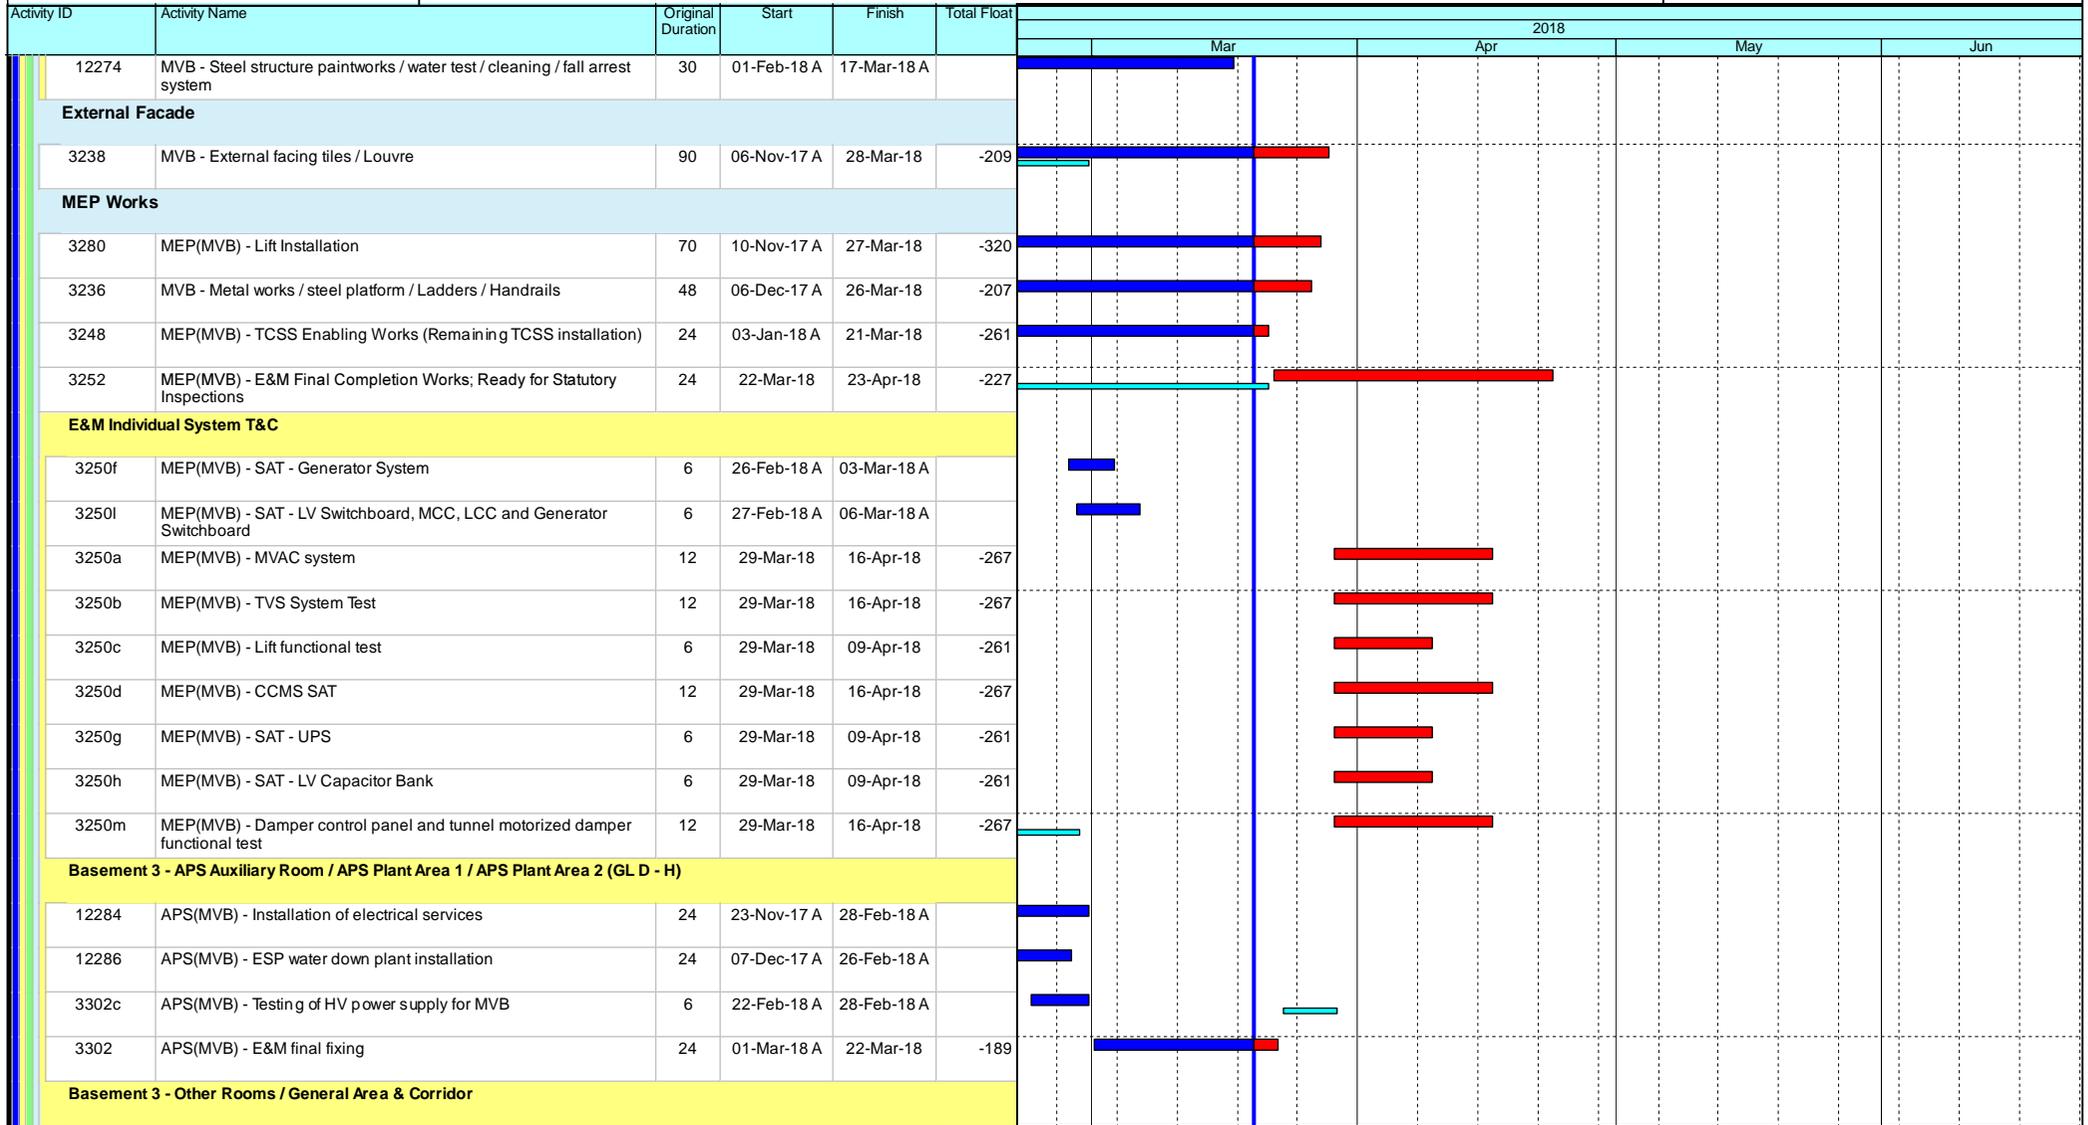TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 13 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018			
						Mar	Apr	May	Jun
3401	MEP(MVB) - ABWF Works	12	23-Nov-17 A	07-Mar-18 A					
3403	MEP(MVB) - E&M 1st fixing	18	19-Dec-17 A	26-Feb-18 A					
3405	MEP(MVB) - E&M 2nd fixing	18	14-Feb-18 A	10-Mar-18 A					
3407	MEP(MVB) - E&M final fixing	18	12-Mar-18 A	26-Mar-18	-207				
Basement 3M - Sump Pit for ESP / Sump Pit for DENO2 (GL D - H)									
3296	APS(MVB) - Plant 4 ESP/DeNO2	24	13-Jan-18 A	03-Apr-18	-187				
Basement 3M - TVF Room									
3307	APS(MVB) - Installation of TVF & Silencer	24	29-Dec-17 A	26-Mar-18	-227				
3309	APS(MVB) -E&M Final Fix	18	07-Mar-18 A	06-Apr-18	-233				
Basement 3M - Other Rooms / General Area & Corridor									
3311	MEP(MVB) - ABWF Works	18	02-Nov-17 A	26-Mar-18	-207				
3313	MEP(MVB) - E&M 1st fixing	24	23-Nov-17 A	26-Mar-18	-207				
3315	MEP(MVB) - E&M 2nd fixing	24	20-Dec-17 A	03-Apr-18	-211				
3317	MEP(MVB) - E&M final fixing	24	07-Feb-18 A	13-Apr-18	-219				
Basement 2 (GL D - H)									
Basement 2 - Other Rooms / General Area & Corridor									
19028	MEP(MVB) - ABWF Works	12	15-Nov-17 A	26-Mar-18	-207				
19030	MEP(MVB) - E&M 1st fixing	18	28-Nov-17 A	03-Apr-18	-211				
19032	MEP(MVB) - E&M 2nd fixing	18	19-Dec-17 A	06-Apr-18	-213				
19034	MEP(MVB) - E&M final fixing	18	12-Feb-18 A	11-Apr-18	-217				
Basement 2M (GL D - H)									
Basement 2M - Other Rooms / General Area & Corridor									
19045	MEP(MVB) - ABWF Works	12	18-Nov-17 A	26-Mar-18	-207				
19047	MEP(MVB) - E&M 1st fixing	18	02-Dec-17 A	03-Apr-18	-211				

- Current Milestone
- Level of Effort
- Baseline Milestone
- Actual Work
- Critical Remaining Work
- Remaining Work
- Project Baseline

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 14 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

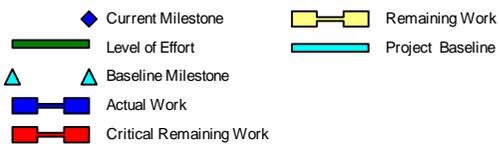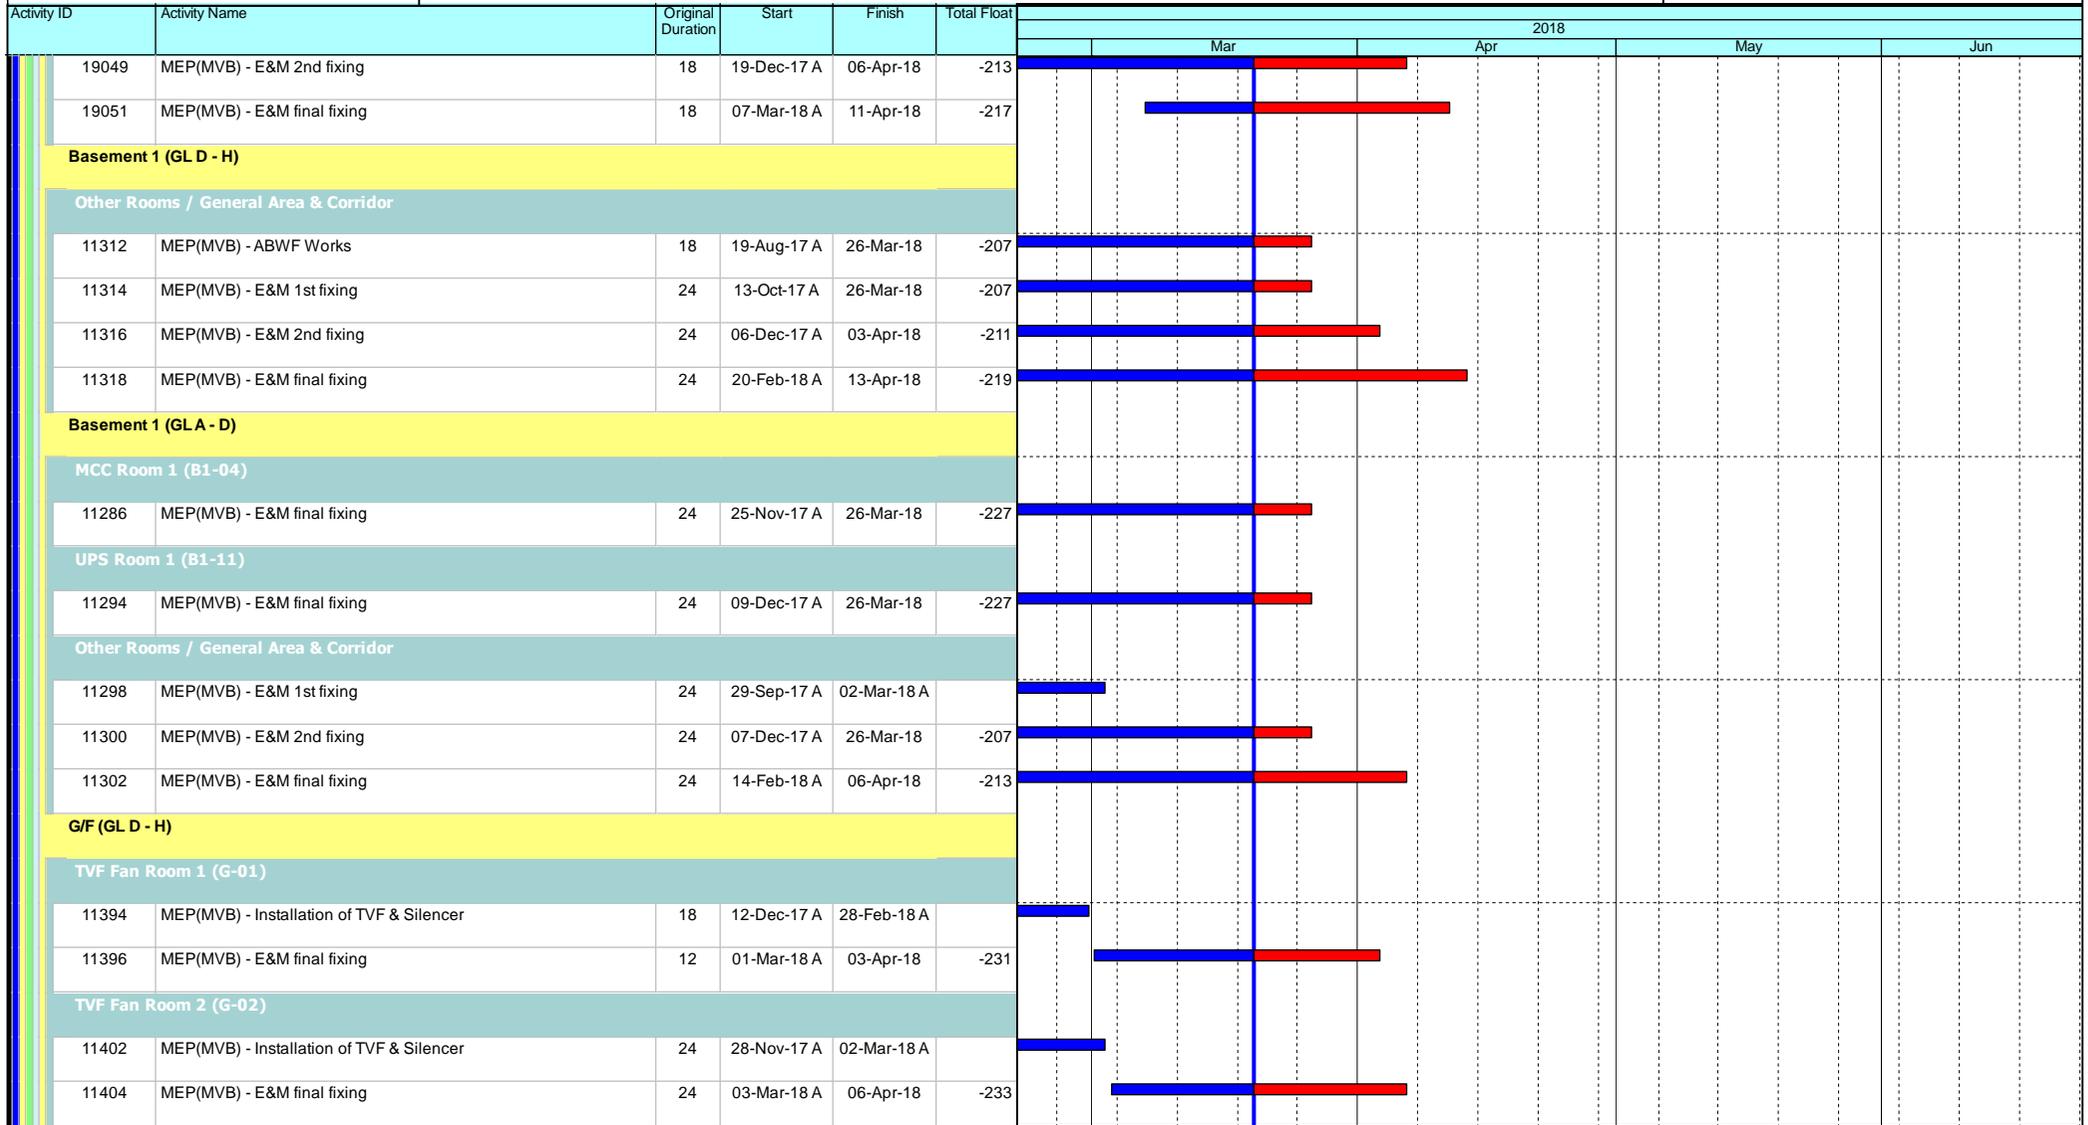TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 15 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

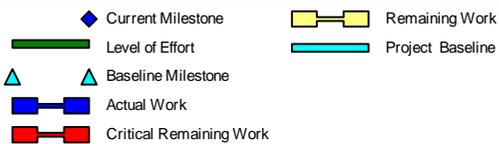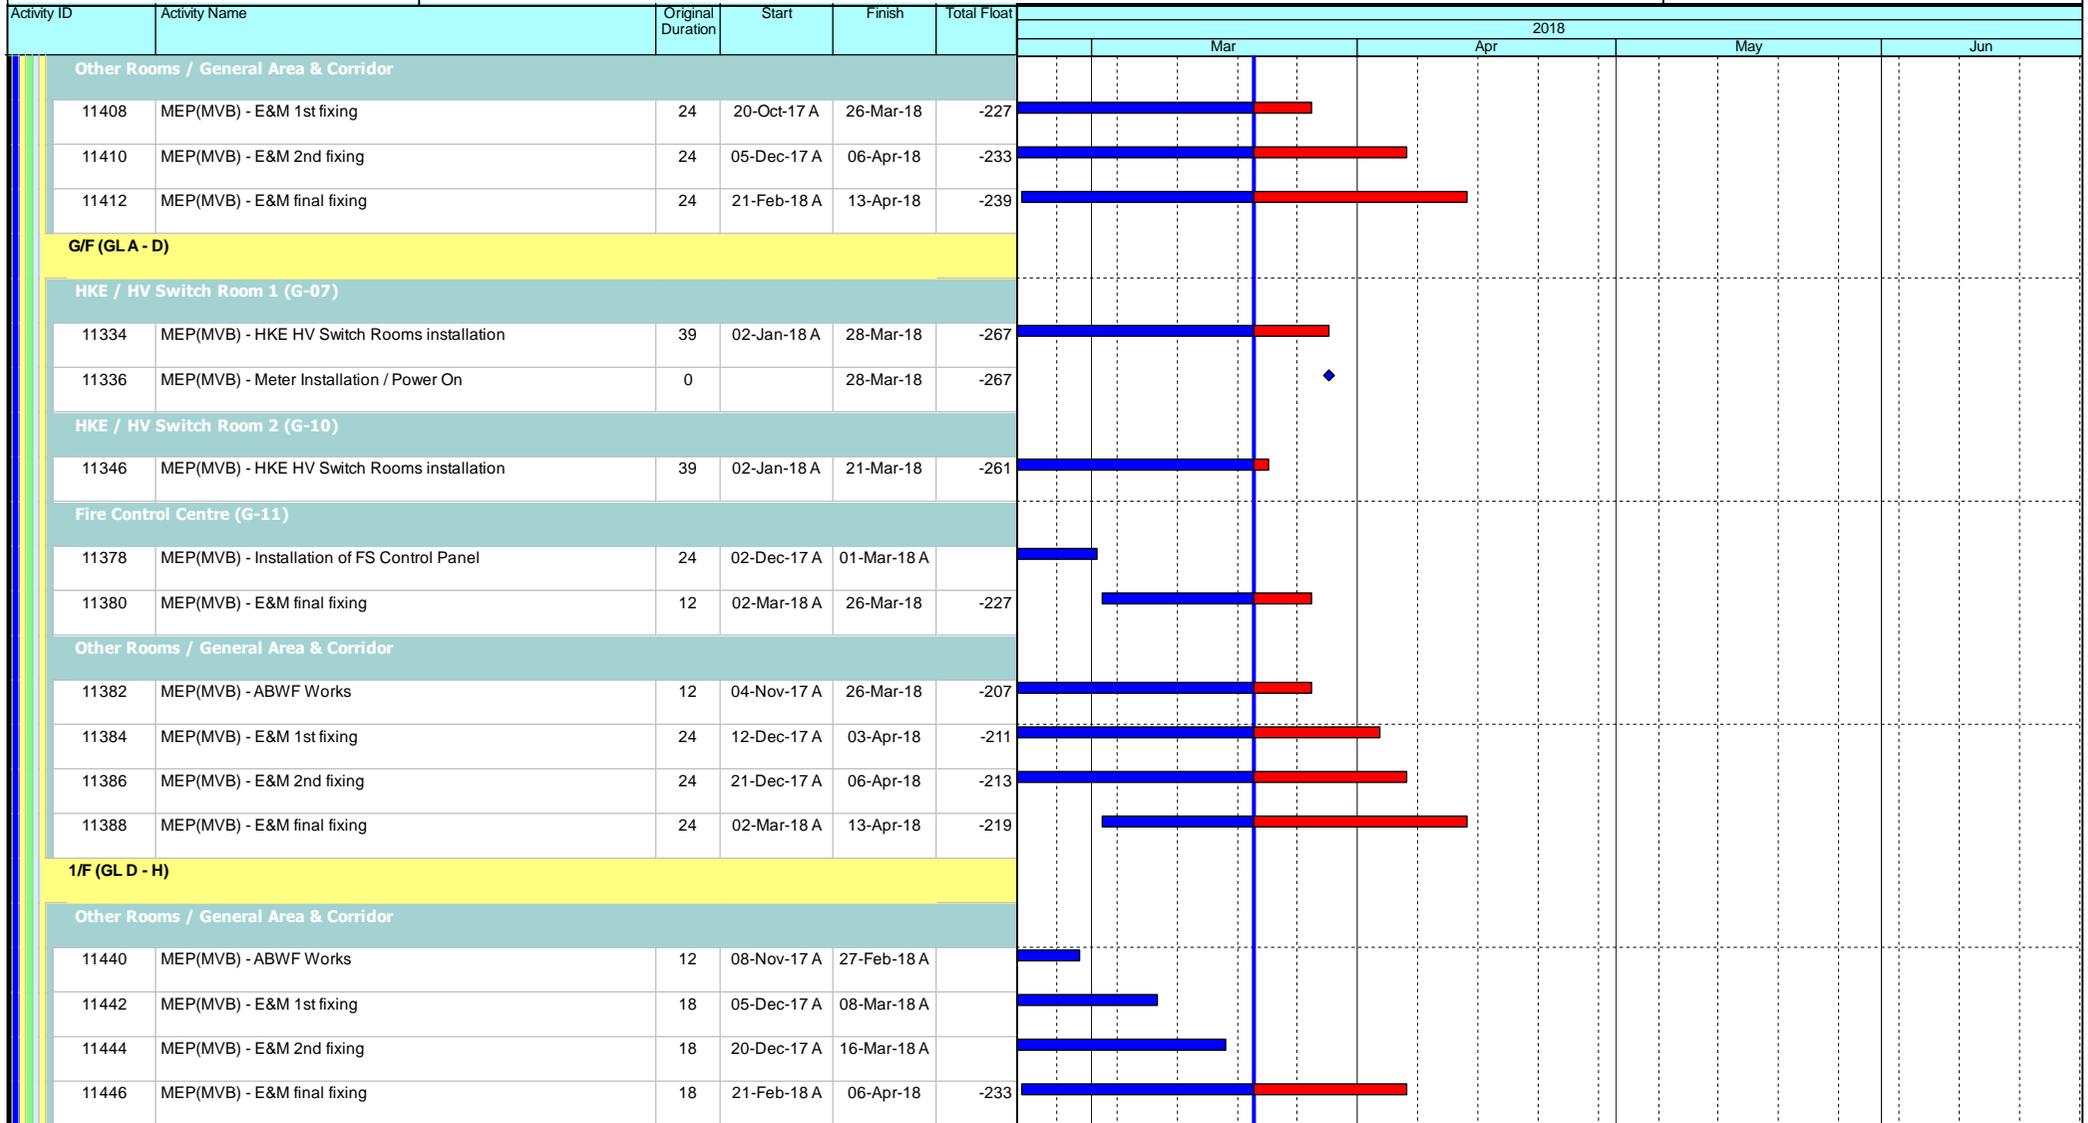TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 16 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

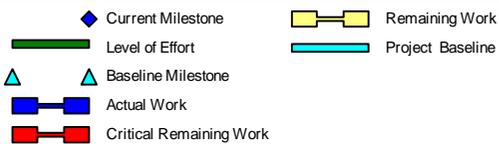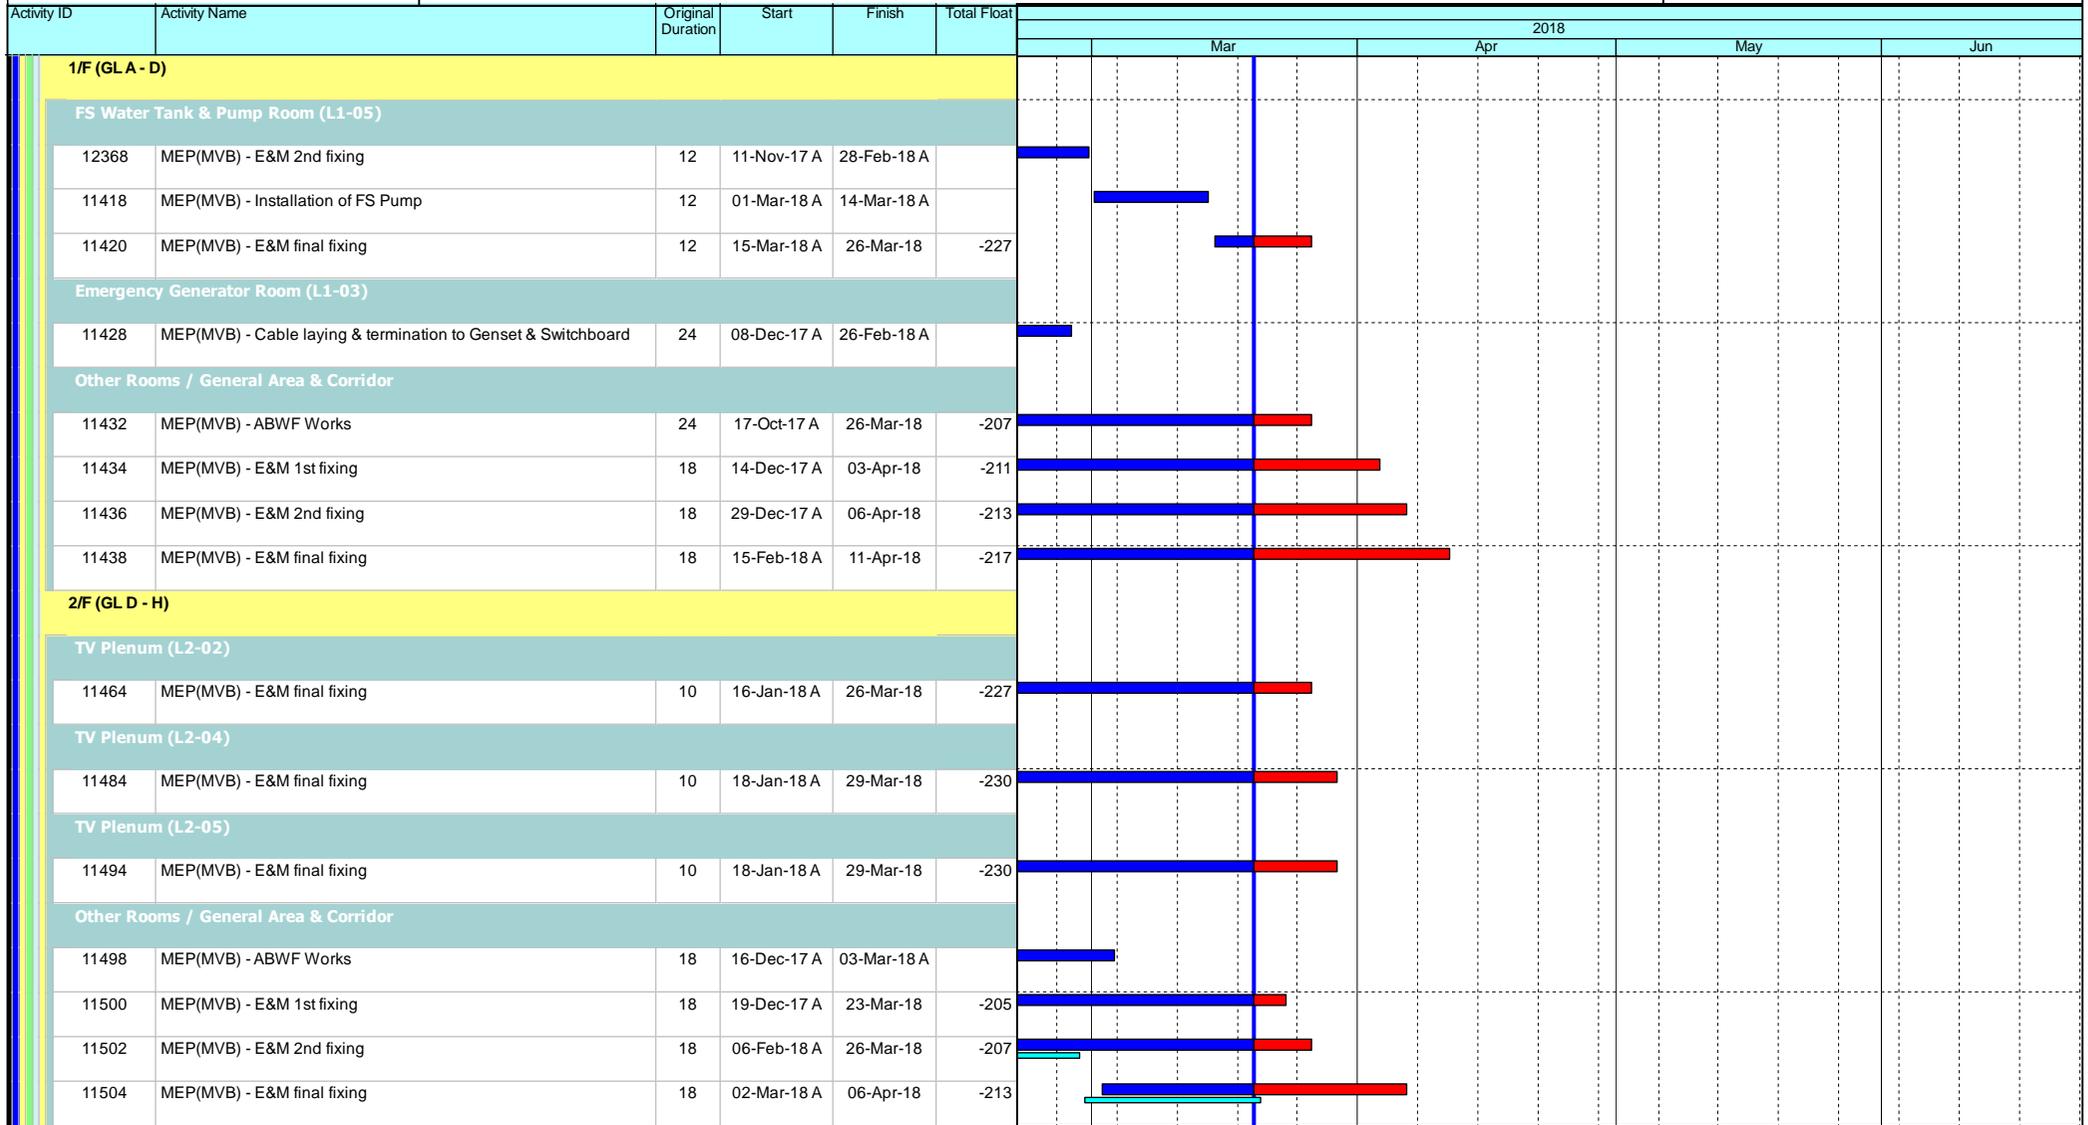TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 17 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

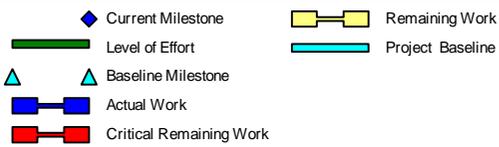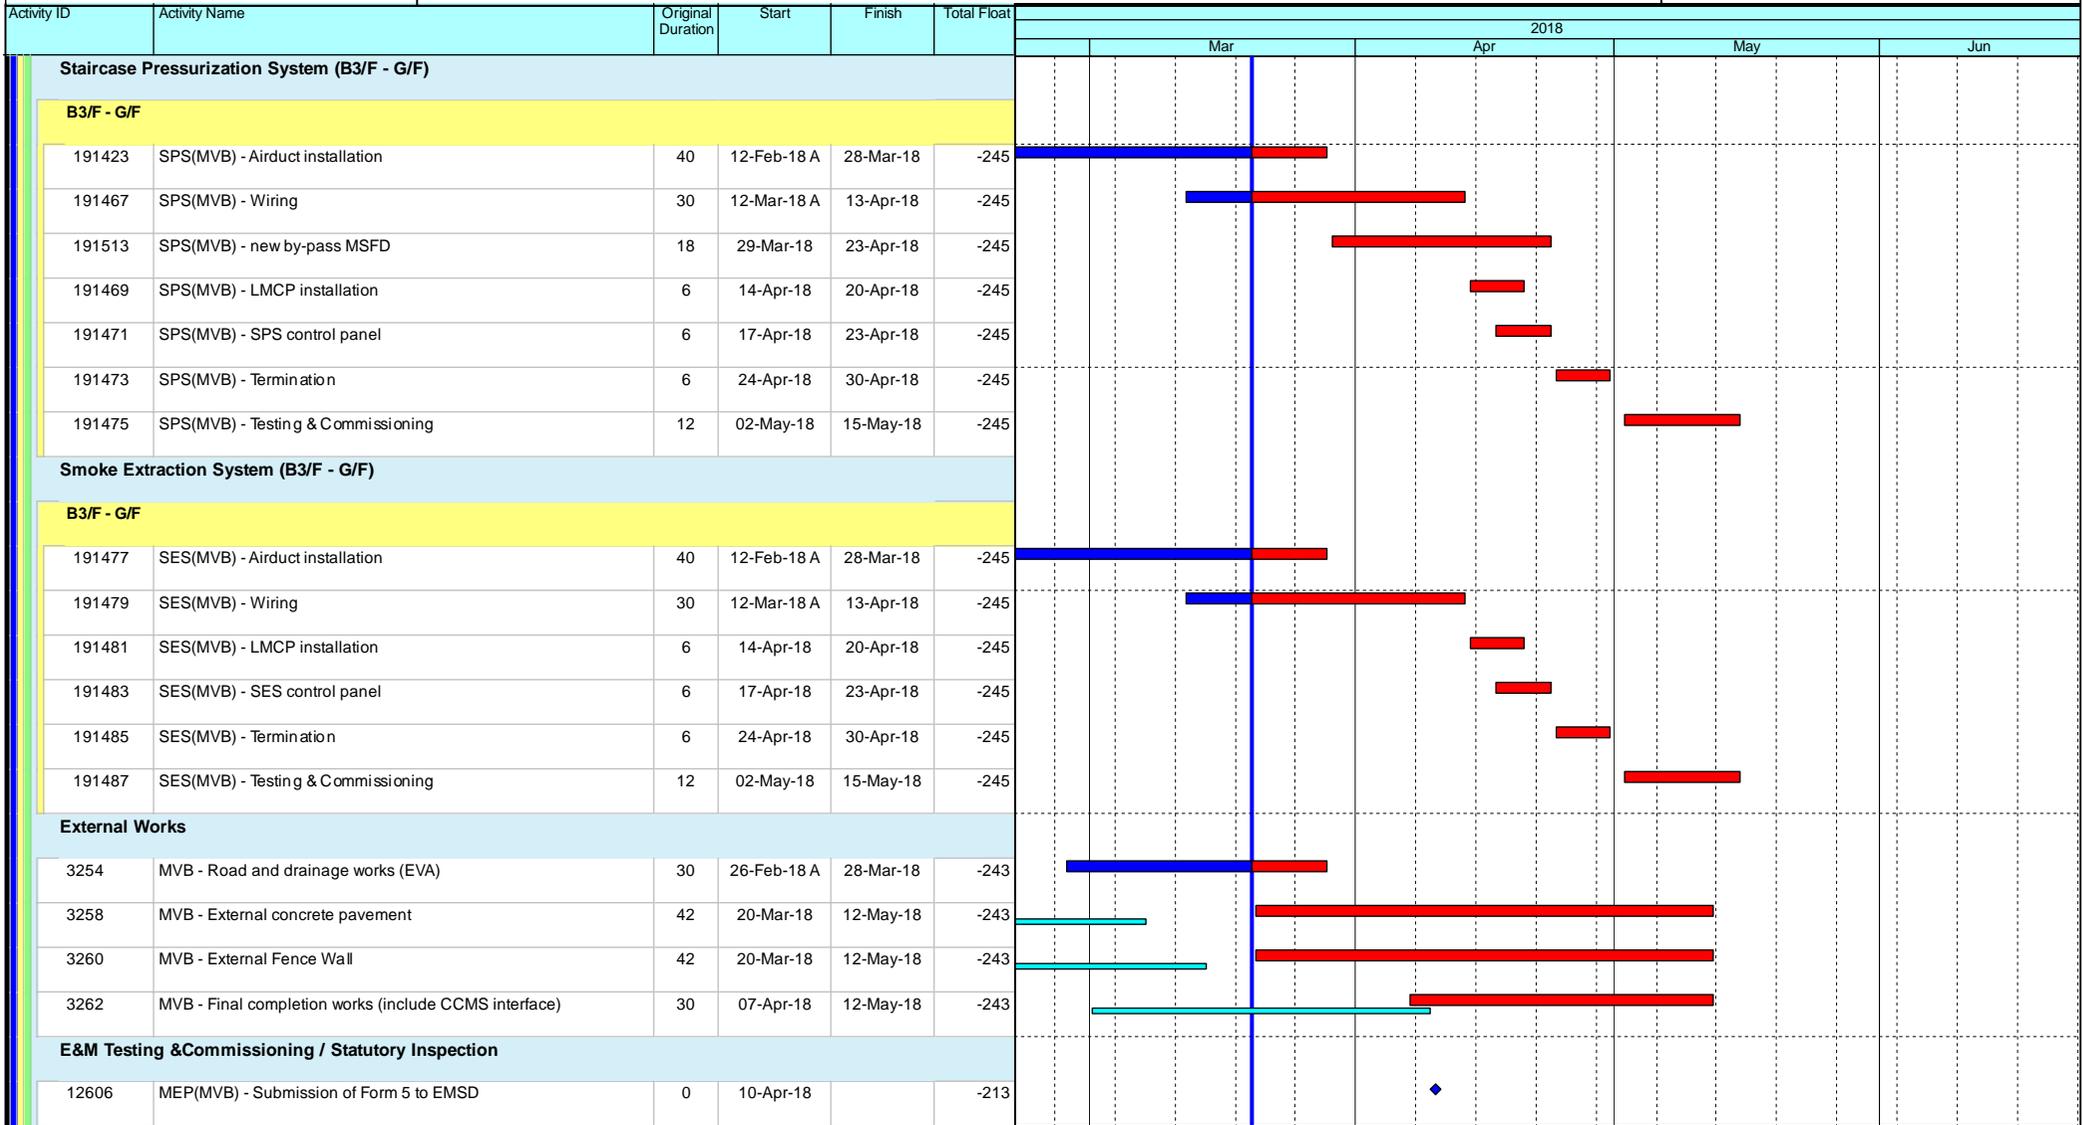TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 18 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

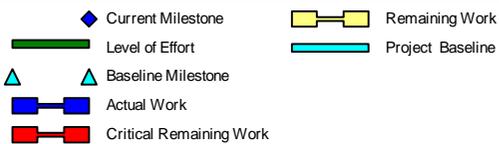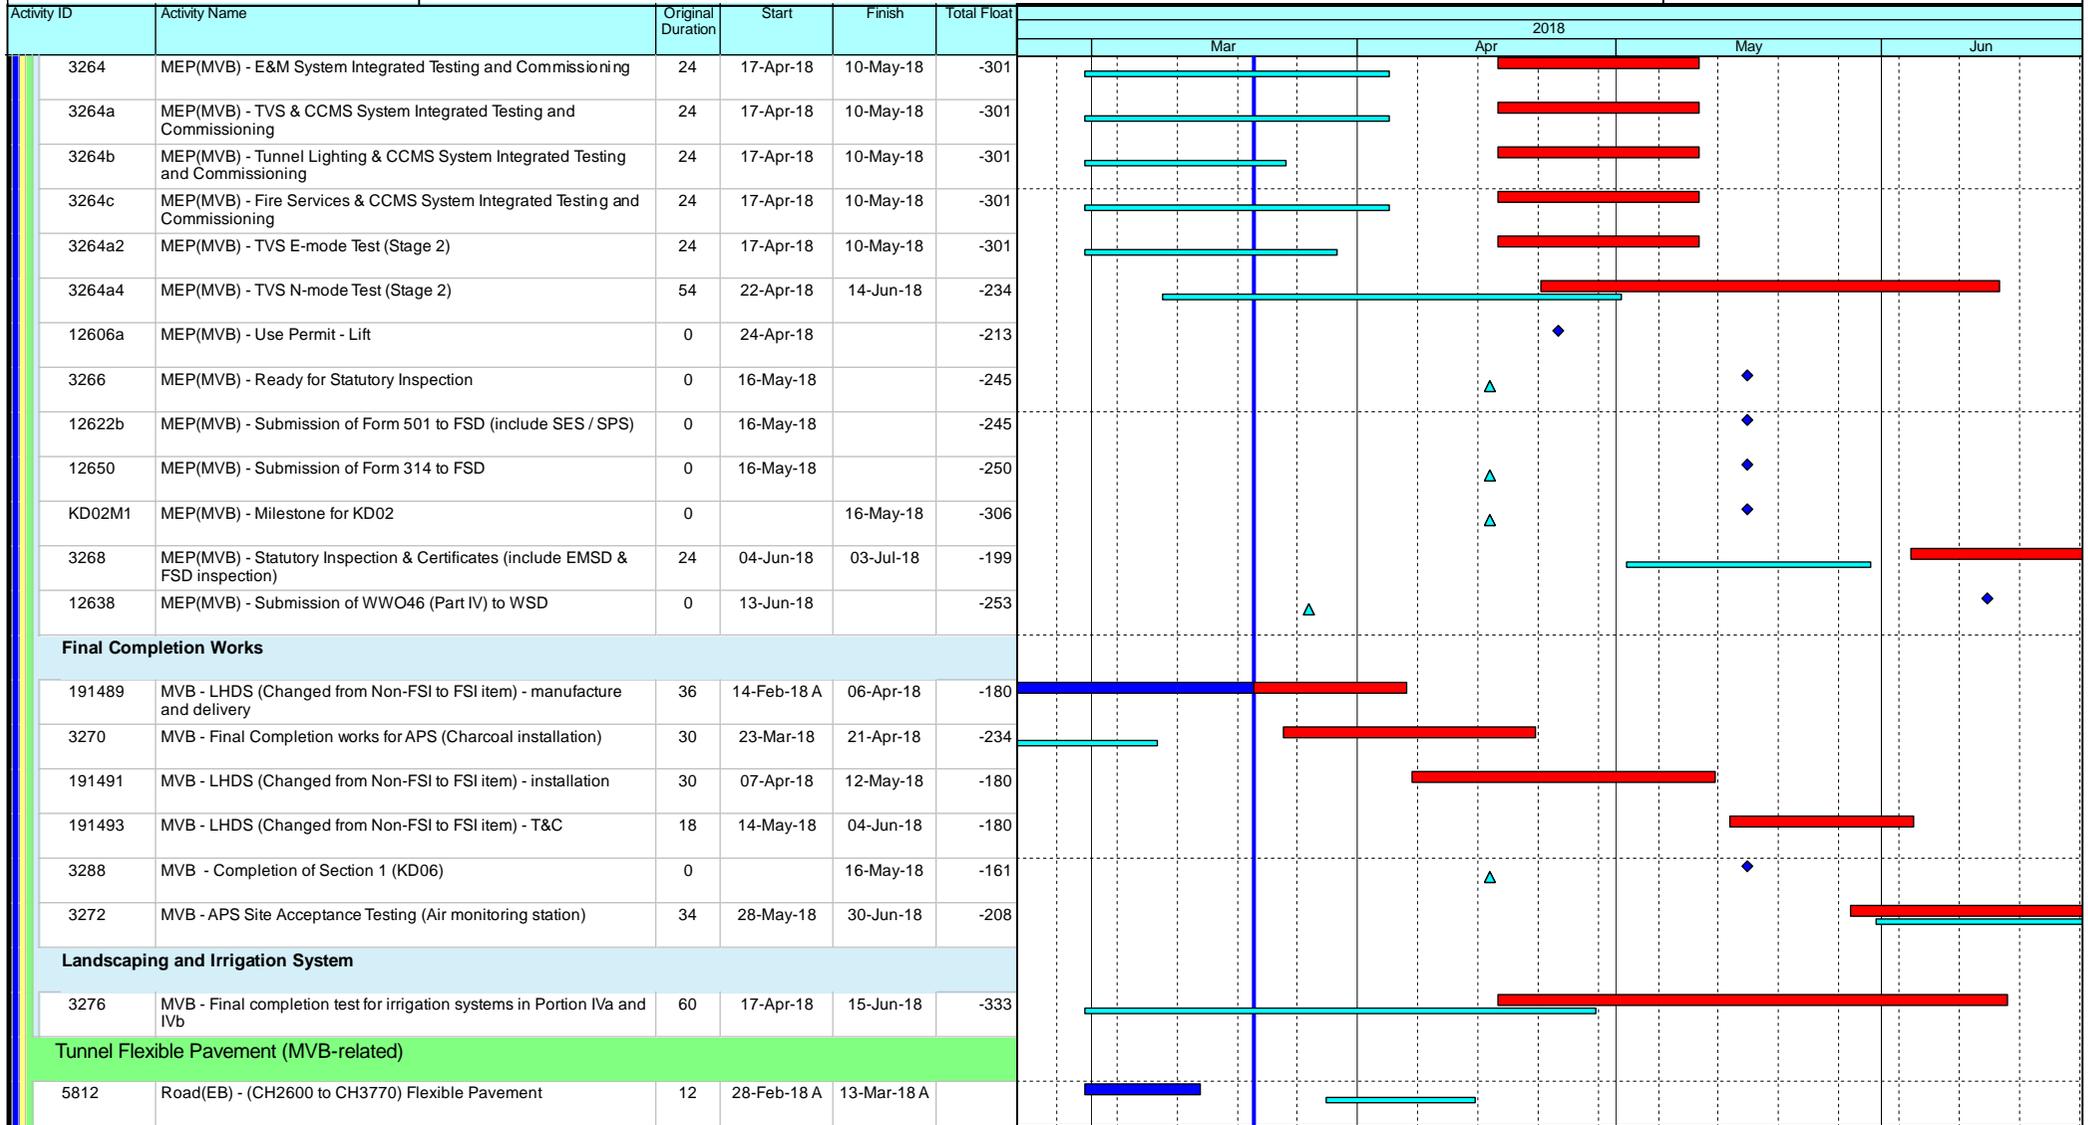TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 19 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

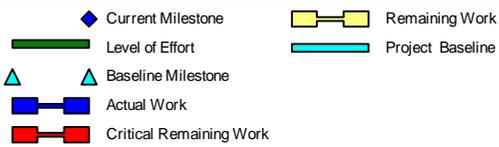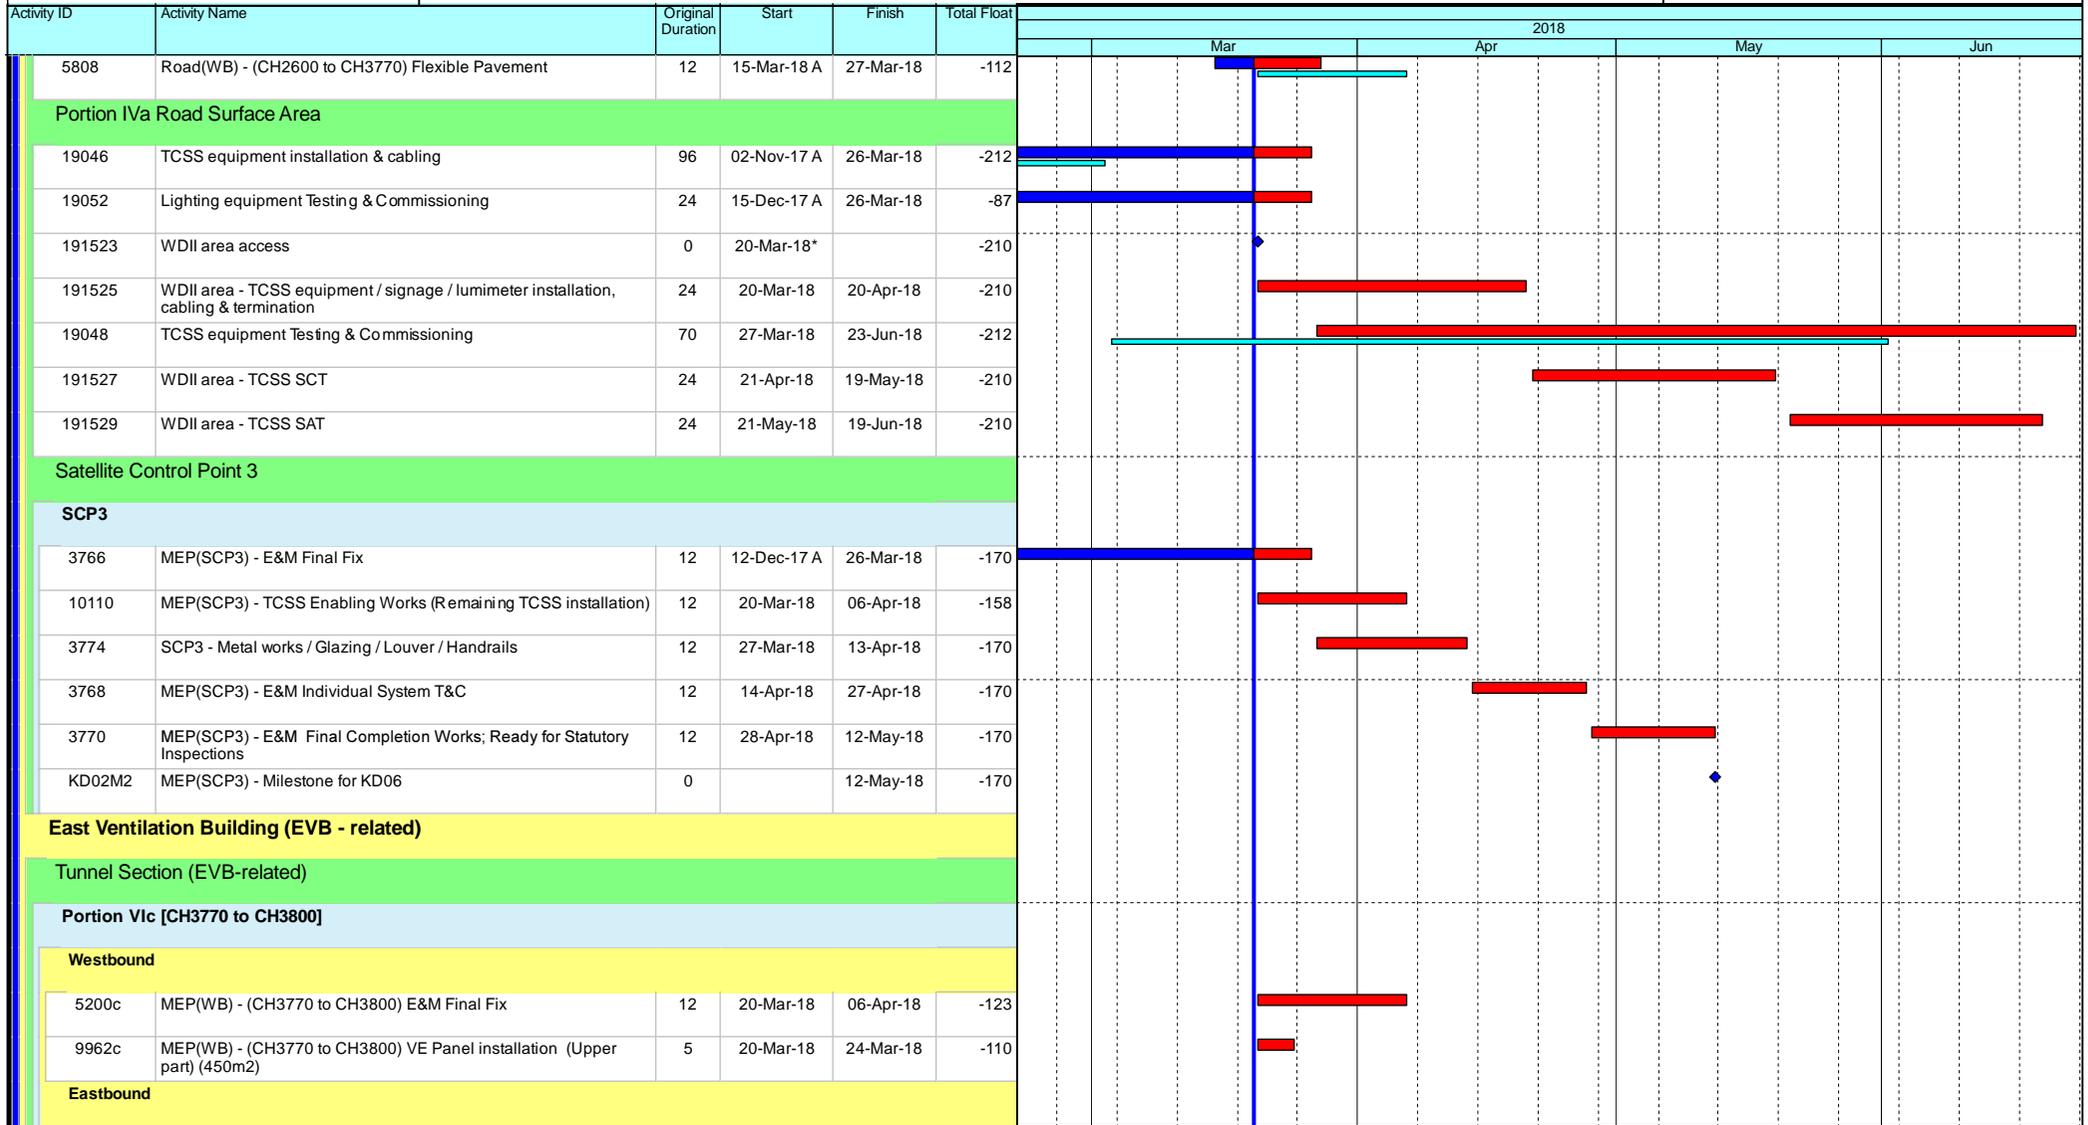TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
Baseline: SA01
Layout: Update Three Month Rolling
U049
Page 20 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

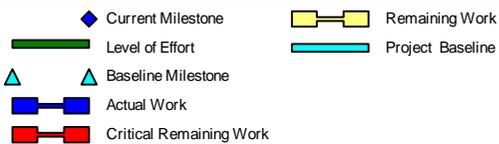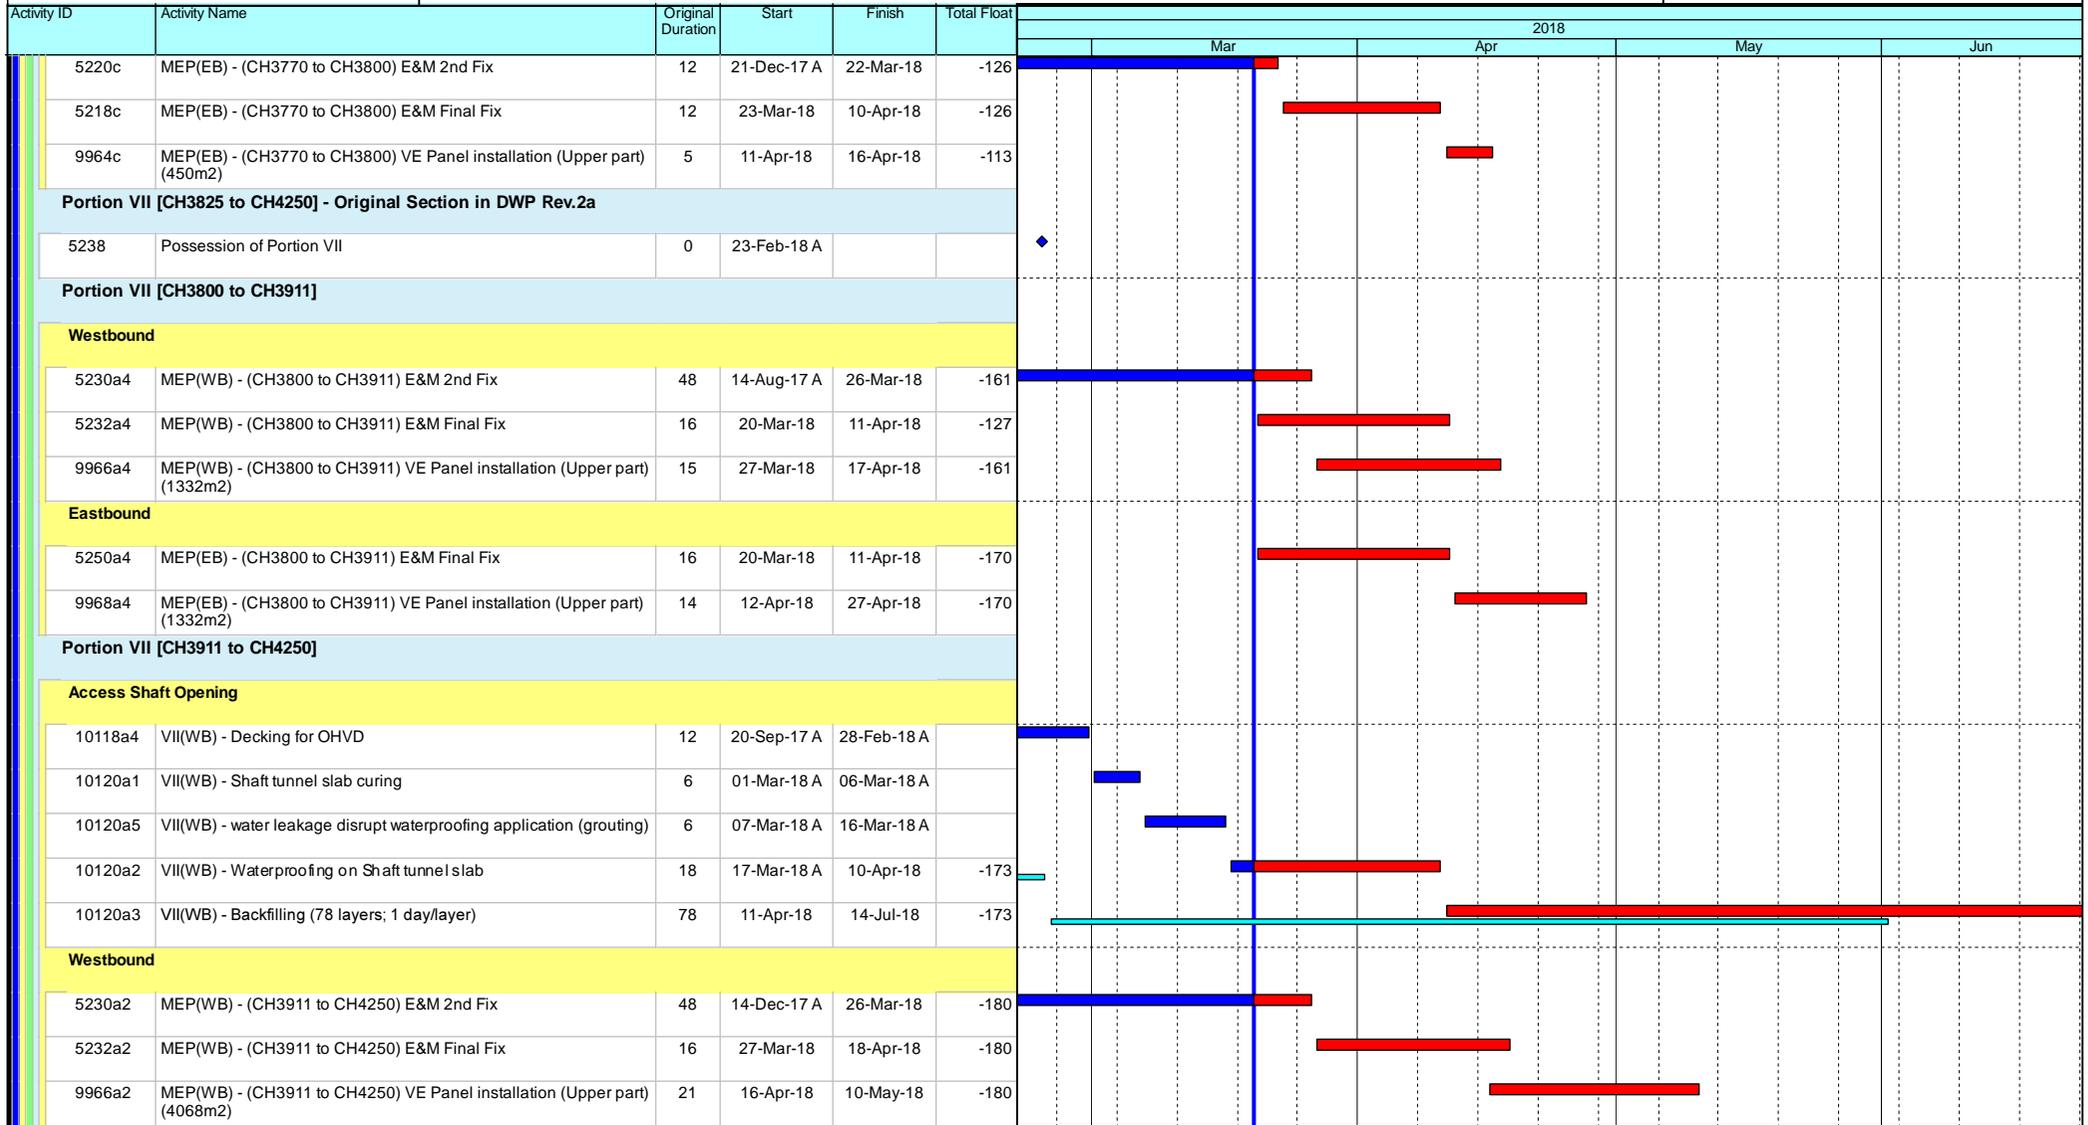TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 21 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

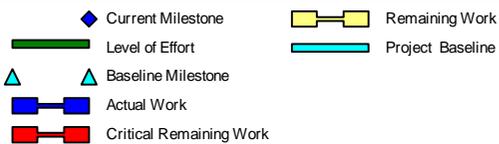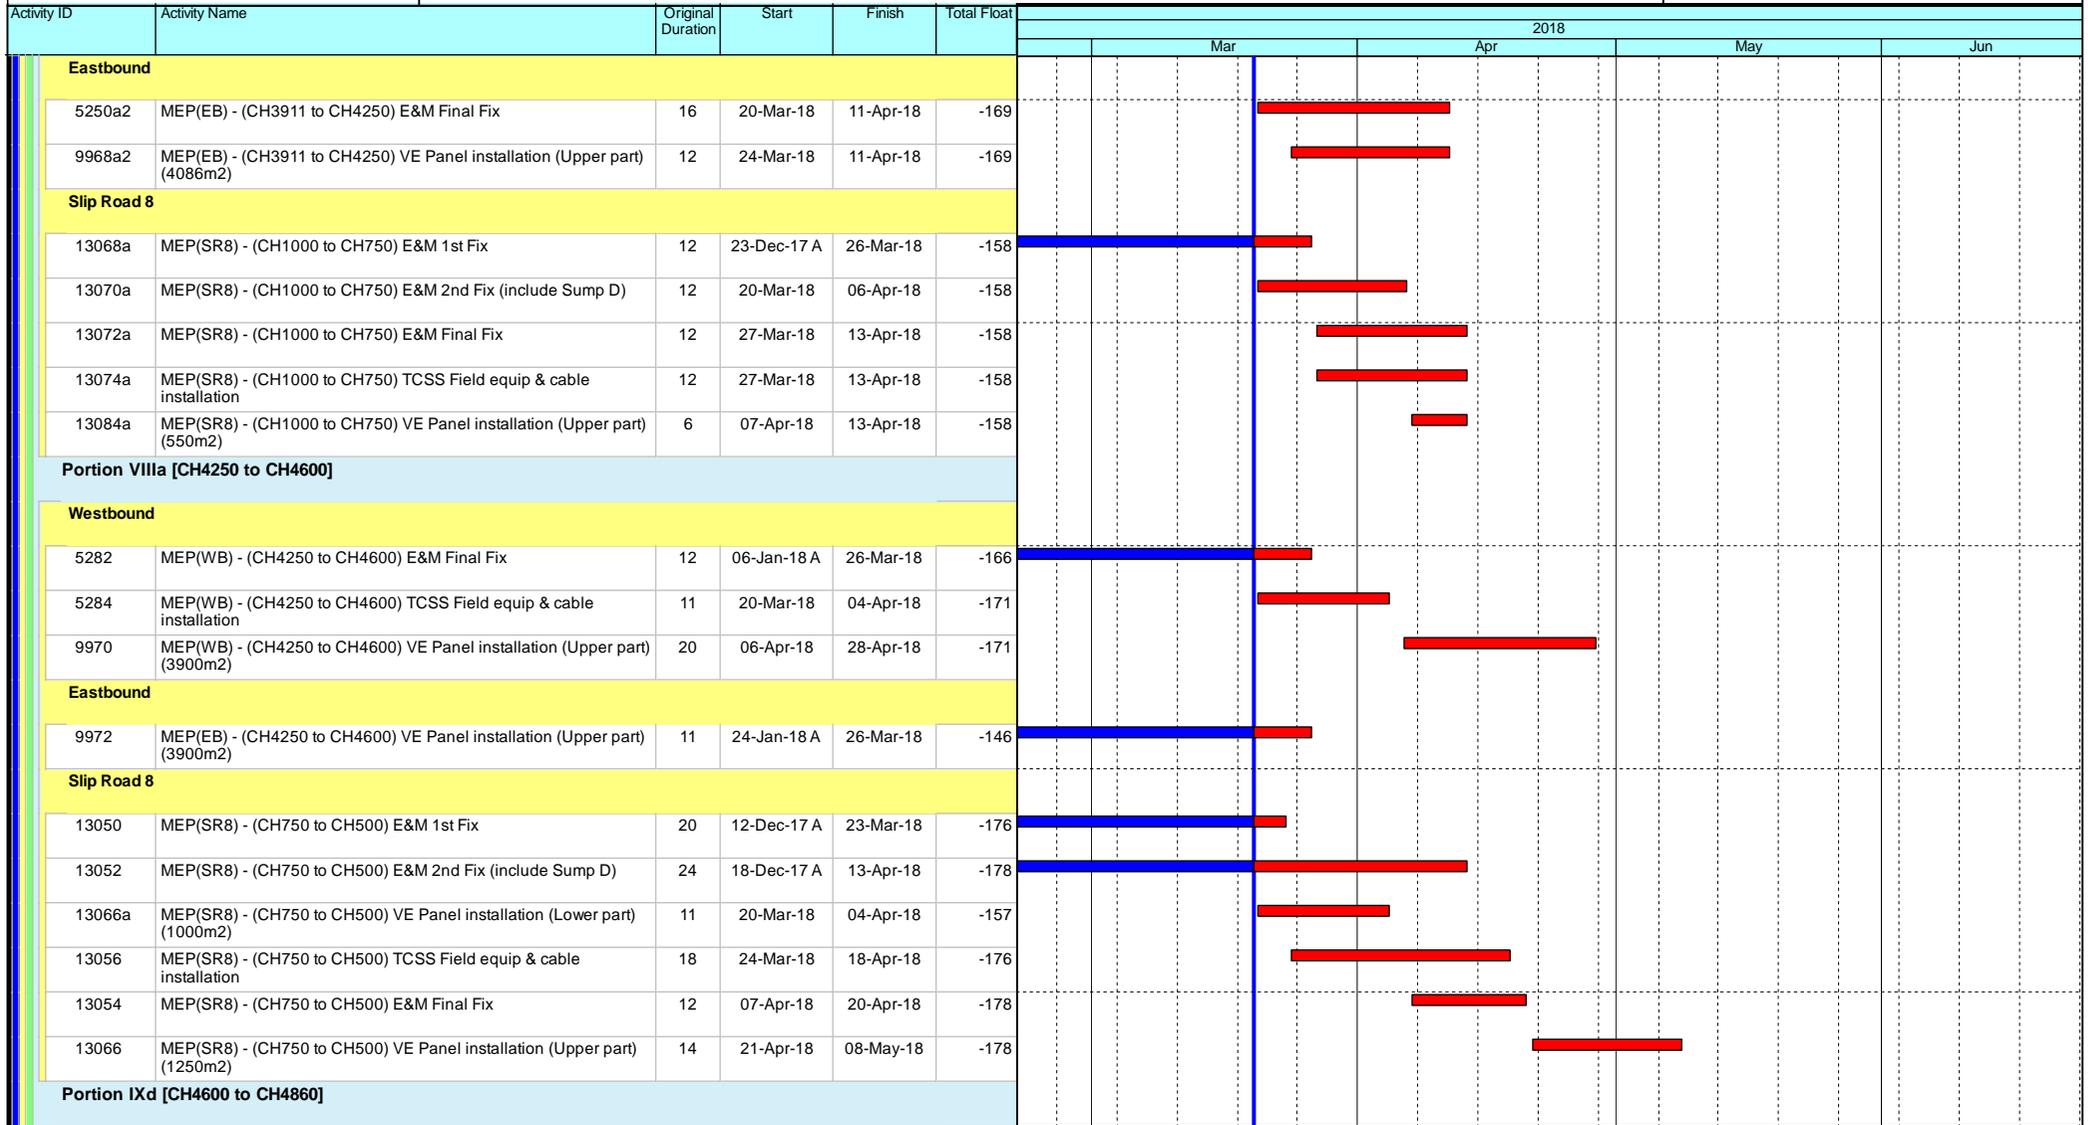TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 22 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018					
						Mar	Apr	May	Jun		
Westbound											
5296	MEP(WB) - (CH4600 to CH4860) E&M Final Fix	9	20-Mar-18	29-Mar-18	-161		■				
9974	MEP(WB) - (CH4600 to CH4860) VE Panel installation (Upper part) (3300m2)	17	24-Mar-18	17-Apr-18	-161		■	■			
Eastbound											
5312	MEP(EB) - (CH4600 to CH4860) E&M 2nd Fix	29	05-Dec-17 A	26-Mar-18	-161	■	■				
9976a	MEP(EB) - (CH4600 to CH4860) VE Panel installation (Lower part) (3300m2)	37	23-Feb-18 A	14-Mar-18 A		■					
9976	MEP(EB) - (CH4600 to CH4860) VE Panel installation (Upper part) (3300m2)	37	20-Mar-18	07-May-18	-177		■	■			
5314	MEP(EB) - (CH4600 to CH4860) E&M Final Fix	9	27-Mar-18	10-Apr-18	-161		■				
Portion IXa [CH4860 to CH5150]											
Westbound											
5328	MEP(WB) - (CH4860 to CH5150) E&M Final Fix	10	20-Mar-18	03-Apr-18	-121		■				
9978	MEP(WB) - (CH4860 to CH5150) VE Panel installation (Upper part) (3288m2)	37	20-Mar-18	07-May-18	-177		■	■			
Eastbound											
5346	MEP(EB) - (CH4860 to CH5150) E&M Final Fix	10	20-Mar-18	03-Apr-18	-121		■				
9980	MEP(EB) - (CH4860 to CH5150) VE Panel installation (Upper part) (3288m2)	37	20-Mar-18	07-May-18	-177		■	■			
5348	MEP(EB) - (CH4860 to CH5150) TCSS Field equip & cable installation	9	21-Mar-18	03-Apr-18	-121		■				
Portion VIIIb [SR8 CH500 to CH350]											
Slip Road 8											
5362a	MEP(SR8) - (CH500 to CH350) TCSS Field equip & cable installation	11	15-Jan-18 A	26-Feb-18 A		■					
5360a	MEP(SR8) - (CH500 to CH350) E&M Final Fix	12	20-Mar-18	06-Apr-18	-165		■				
12828a	MEP(SR8) - (CH500 to CH350) VE Panel installation (Upper part) (750m2)	9	23-Mar-18	06-Apr-18	-152		■				
Portion VIIIc [SR8 CH350 to CH210]											
Slip Road 8											
5374	MEP(SR8) - (CH350 to CH210) E&M 1st Fix	8	05-Jan-18 A	23-Mar-18	-163	■	■				

- ◆ Current Milestone
- Level of Effort
- ▲ Baseline Milestone
- Actual Work
- Critical Remaining Work
- Remaining Work
- Project Baseline

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 23 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018			
						Mar	Apr	May	Jun
5376	MEP(SR8) - (CH350 to CH210) E&M 2nd Fix (include Sump E)	16	12-Jan-18 A	03-Apr-18	-169				
5378	MEP(SR8) - (CH350 to CH210) E&M Final Fix	5	06-Apr-18	11-Apr-18	-169				
5380	MEP(SR8) - (CH350 to CH210) TCSS Field equip & cable installation	4	07-Apr-18	11-Apr-18	-169				
East Ventilation Building (EVB)									
RC Structures and Green Roof									
3456	EVB - Green Roof (include architectural lighting & lightning protection system installation)	42	14-May-18	04-Jul-18	-304				
External Facade									
3438	EVB - External facing tiles / Treated Waste Wood / Louvre	90	11-Sep-17 A	26-Mar-18	-180				
MEP Works									
3448	MEP(EVB) - TCSS Enabling Works (Remaining TCSS installation)	30	22-Nov-17 A	26-Mar-18	-180				
3436	EVB - Metal works / steel platform / Ladders / Handrails	48	29-Dec-17 A	26-Mar-18	-180				
3452	MEP(EVB) - E&M Final Completion Works; Ready for Statutory Inspections	21	27-Mar-18	24-Apr-18	-180				
E&M Individual System T&C									
3450h	MEP(EVB) - SAT - LV Capacitor Bank	12	06-Jan-18 A	27-Feb-18 A					
3450f	MEP(EVB) - SAT - Generator System	6	08-Jan-18 A	22-Feb-18 A					
3450d	MEP(EVB) - CCMS SAT	30	19-Jan-18 A	26-Mar-18	-202				
3450b	MEP(EVB) - TVS System Test	12	21-Feb-18 A	26-Mar-18	-208				
3450m	MEP(EVB) - Damper control panel and tunnel motorized damper functional test	18	08-Mar-18 A	06-Apr-18	-208				
3450p	MEP(EVB) - Smoke Extraction System System Test	12	09-Mar-18 A	26-Mar-18	-159				
3450c	MEP(EVB) - Lift functional test	6	20-Mar-18	26-Mar-18	-202				
3660d	MEP(ADB) - LUX measurement for tunnel lighting	28	20-Mar-18	16-Apr-18	-133				
3450o	MEP(EVB) - Staircase Pressurization System Test	12	02-May-18	15-May-18	-197				
Basement 2 - APS Auxiliary Room / APS Plant Area 1 / APS Plant Area 2 / APS Plant Area 3									
3560c	APS(EVB) - Testing of HV power supply for EVB	6	15-Feb-18 A	21-Feb-18 A					

- Current Milestone
- Level of Effort
- Baseline Milestone
- Actual Work
- Critical Remaining Work
- Remaining Work
- Project Baseline

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 24 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

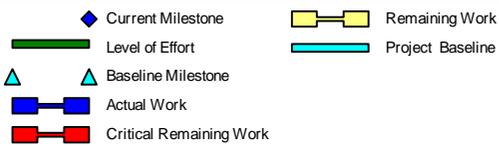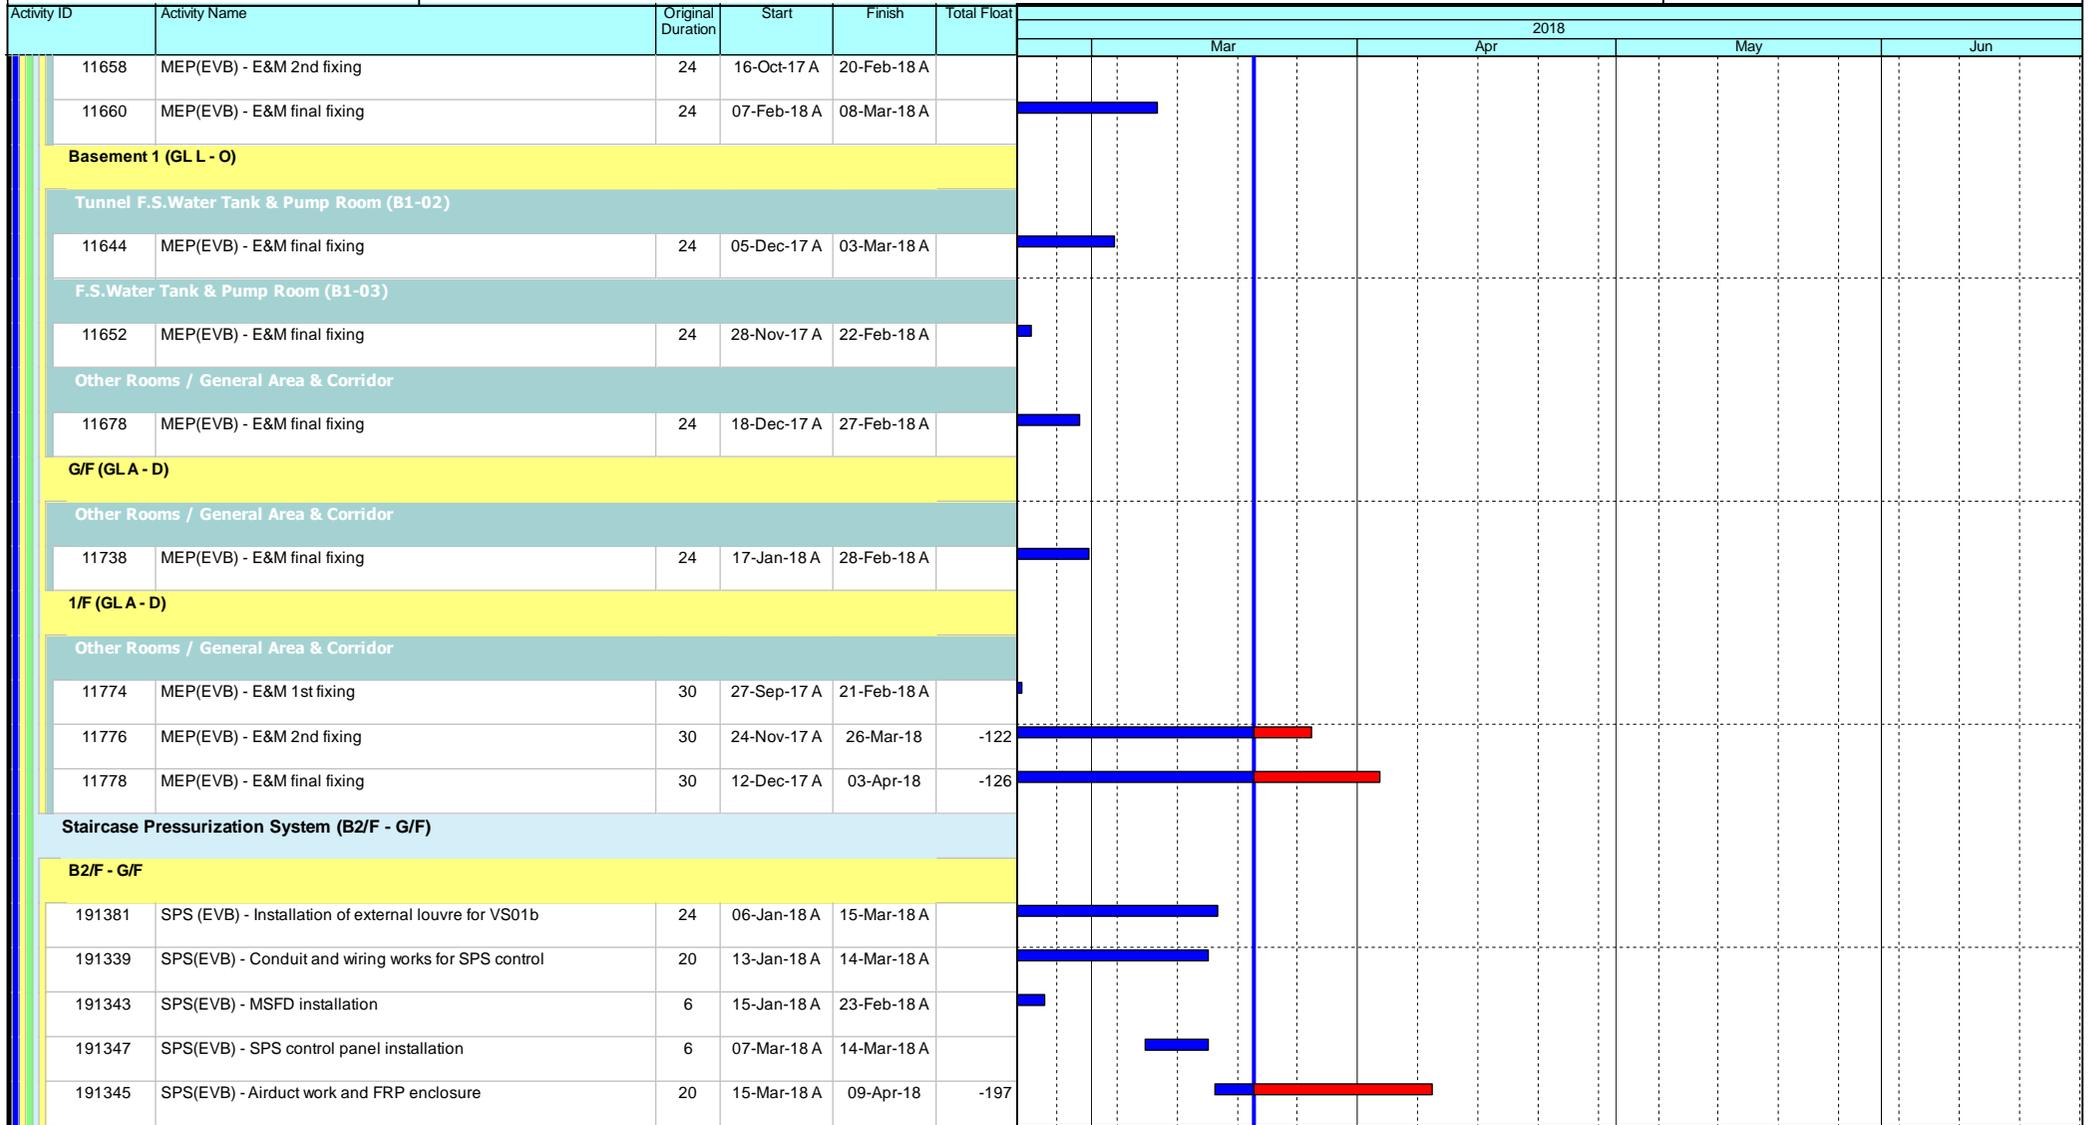TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 26 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018																	
						Mar			Apr			May			Jun								
191383	SPS (EVB) - Installation of louvre for VS01b	3	15-Mar-18 A	19-Mar-18 A																			
191387	SPS(EVB) - Final connection of air duct after modification of air vent shaft	18	10-Apr-18	30-Apr-18	-197																		
Smoke Extraction System (B2/F - G/F)																							
B2/F - G/F																							
191401	SES(EVB) - Order and install new SES Control Panel for SES controller	6	02-Jan-18 A	26-Feb-18 A																			
191407	SES(EVB) - Order and install two new MSDF 600x2500, 1600x1600	48	02-Jan-18 A	05-Mar-18 A																			
191389	SES(EVB) - New 2500x1450mm makeup air vent shift	36	22-Jan-18 A	10-Mar-18 A																			
191421	SES(EVB) - Order and Install new IAL G-01 B 1050*1800 and G-01C 1200*1800 for makeup air vent shift	6	22-Jan-18 A	08-Mar-18 A																			
191405	SES(EVB) - Relocate access hatch at UR/F and make good existing access hatch in order to maintain 5m Separation	18	05-Feb-18 A	03-Mar-18 A																			
191411	SES(EVB) - New order and Install 2 nos. 900x900 MAG for B1-35	2	23-Feb-18 A	26-Feb-18 A																			
191403	SES(EVB) - Wire Fencing with Warning Sign on UR/F Horizontal Louvre	6	05-Mar-18 A	10-Mar-18 A																			
External Works																							
3454	EVB - Road and drainage works (EVA)	24	09-Nov-17 A	23-Mar-18	-157																		
3462	EVB - Final completion works (include CCMS interface)	30	17-Jan-18 A	13-Apr-18	-171																		
3454a	EVB - Planter walls	54	18-Jan-18 A	10-Mar-18 A																			
3458	EVB - External concrete pavement	24	24-Feb-18 A	26-Mar-18	-159																		
E&M Testing & Commissioning / Statutory Inspection																							
3464	MEP(EVB) - E&M System Integrated Testing and Commissioning	36	24-Mar-18	28-Apr-18	-233																		
3464a	MEP(EVB) - TVS & CCMS System Integrated Testing and Commissioning	36	24-Mar-18	28-Apr-18	-233																		
3464b	MEP(EVB) - Tunnel Lighting & CCMS System Integrated Testing and Commissioning	24	24-Mar-18	16-Apr-18	-221																		
3464c	MEP(EVB) - Fire Services & CCMS System Integrated Testing and Commissioning	36	24-Mar-18	28-Apr-18	-233																		
12608	MEP(EVB) - Submission of Form 5 to EMSD	0	27-Mar-18		-199																		
3464a2	MEP(EVB) - TVS E-mode Test (Stage 3)	25	07-Apr-18	01-May-18	-236																		
12608a	MEP(EVB) - Use Permit - Lift	0	10-Apr-18		-199																		

- ◆ Current Milestone
- ▬ Level of Effort
- ▲ Baseline Milestone
- ▬ Actual Work
- ▬ Critical Remaining Work
- ▬ Remaining Work
- ▬ Project Baseline

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 27 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018			
						Mar	Apr	May	Jun
3464a4	MEP(EVB) - TVS N-mode Test (Stage 3)	48	10-May-18	26-Jun-18	-246				
3466	MEP(EVB) - Ready for Statutory Inspection	0	16-May-18		-250	▲		◆	
12624	MEP(EVB) - Submission of Form 501 to FSD (include SES / SPS)	0	16-May-18		-250	▲		◆	
12648	MEP(EVB) - Submission of Form 314 to FSD	0	16-May-18		-250	▲		◆	
KD03M1	MEP(EVB) - Milestone for KD03	0		16-May-18	-220	▲		◆	
3468	MEP(EVB) - Statutory Inspection & Certificates (include EMSD & FSD inspection)	24	31-May-18	28-Jun-18	-196				
12634	MEP(EVB) - Submission of WWO46 (Part IV) to WSD	0	08-Jun-18		-248				◆
Final Completion Works									
191495	MVB - LHDS (Changed from Non-FSI to FSI item) - manufacture and delivery	36	14-Feb-18 A	19-Apr-18	-191				
3470	EVB - Final Completion works for APS (Charcoal installation)	30	10-Apr-18	09-May-18	-246				
191497	MVB - LHDS (Changed from Non-FSI to FSI item) - installation	30	20-Apr-18	26-May-18	-191				
3472	EVB - APS Site Acceptance Testing (Air monitoring station)	33	25-Apr-18	27-May-18	-208				
3488	EVB - Completion of Section 1 (KD06)	0		16-May-18	-218	▲		◆	
KD04M4	APS SAT (EVB) - Milestone for KD04	0		27-May-18	-173			▲	◆
191499	MVB - LHDS (Changed from Non-FSI to FSI item) - T&C	18	28-May-18	16-Jun-18	-191				
Tunnel Flexible Pavement (EVB-related)									
5816	Road(WB) - (CH3770 to CH5149.3) Flexible Pavement	12	18-Jan-18 A	14-Mar-18 A					
Administration Building (ADB)									
External Facade									
13248	ADB - External facing tiles / Louvre	48	27-Dec-17 A	20-Apr-18	-280				
MEP & ABWF Works									
13254	MEP(ADB) - TCSS Enabling Works (Remaining TCSS installation)	30	12-Dec-17 A	26-Mar-18	-264				
13260	MEP(ADB) - Lift Installation	60	06-Jan-18 A	12-Apr-18	-306				
13252	ADB - Metal works / steel platform / Ladders / Handrails	42	13-Feb-18 A	16-Apr-18	-148				

- ◆ Current Milestone
- ▬ Level of Effort
- ▲ Baseline Milestone
- ▬ Actual Work
- ▬ Critical Remaining Work
- ▬ Remaining Work
- ▬ Project Baseline

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING


Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 28 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

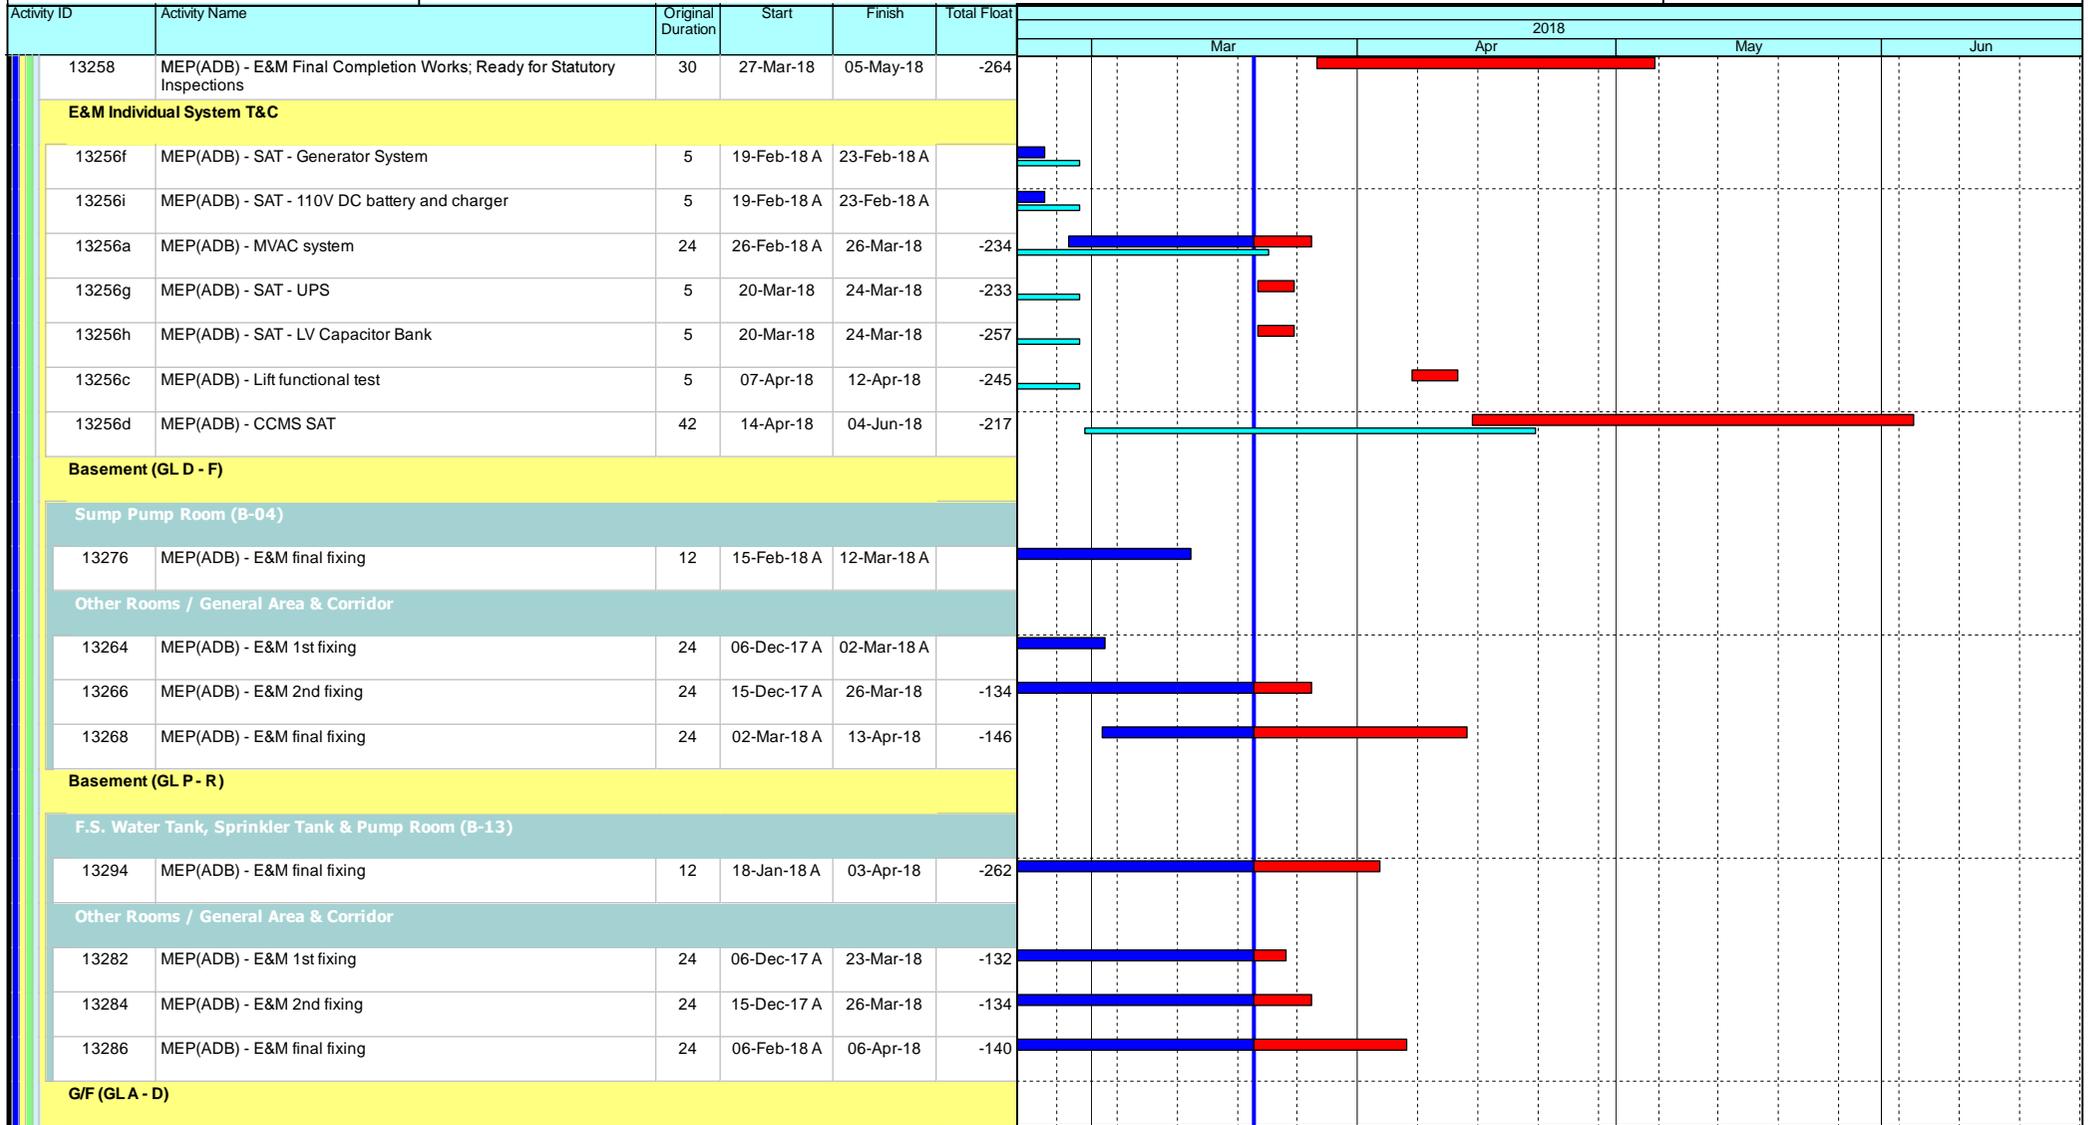TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 29 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

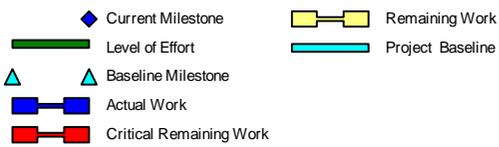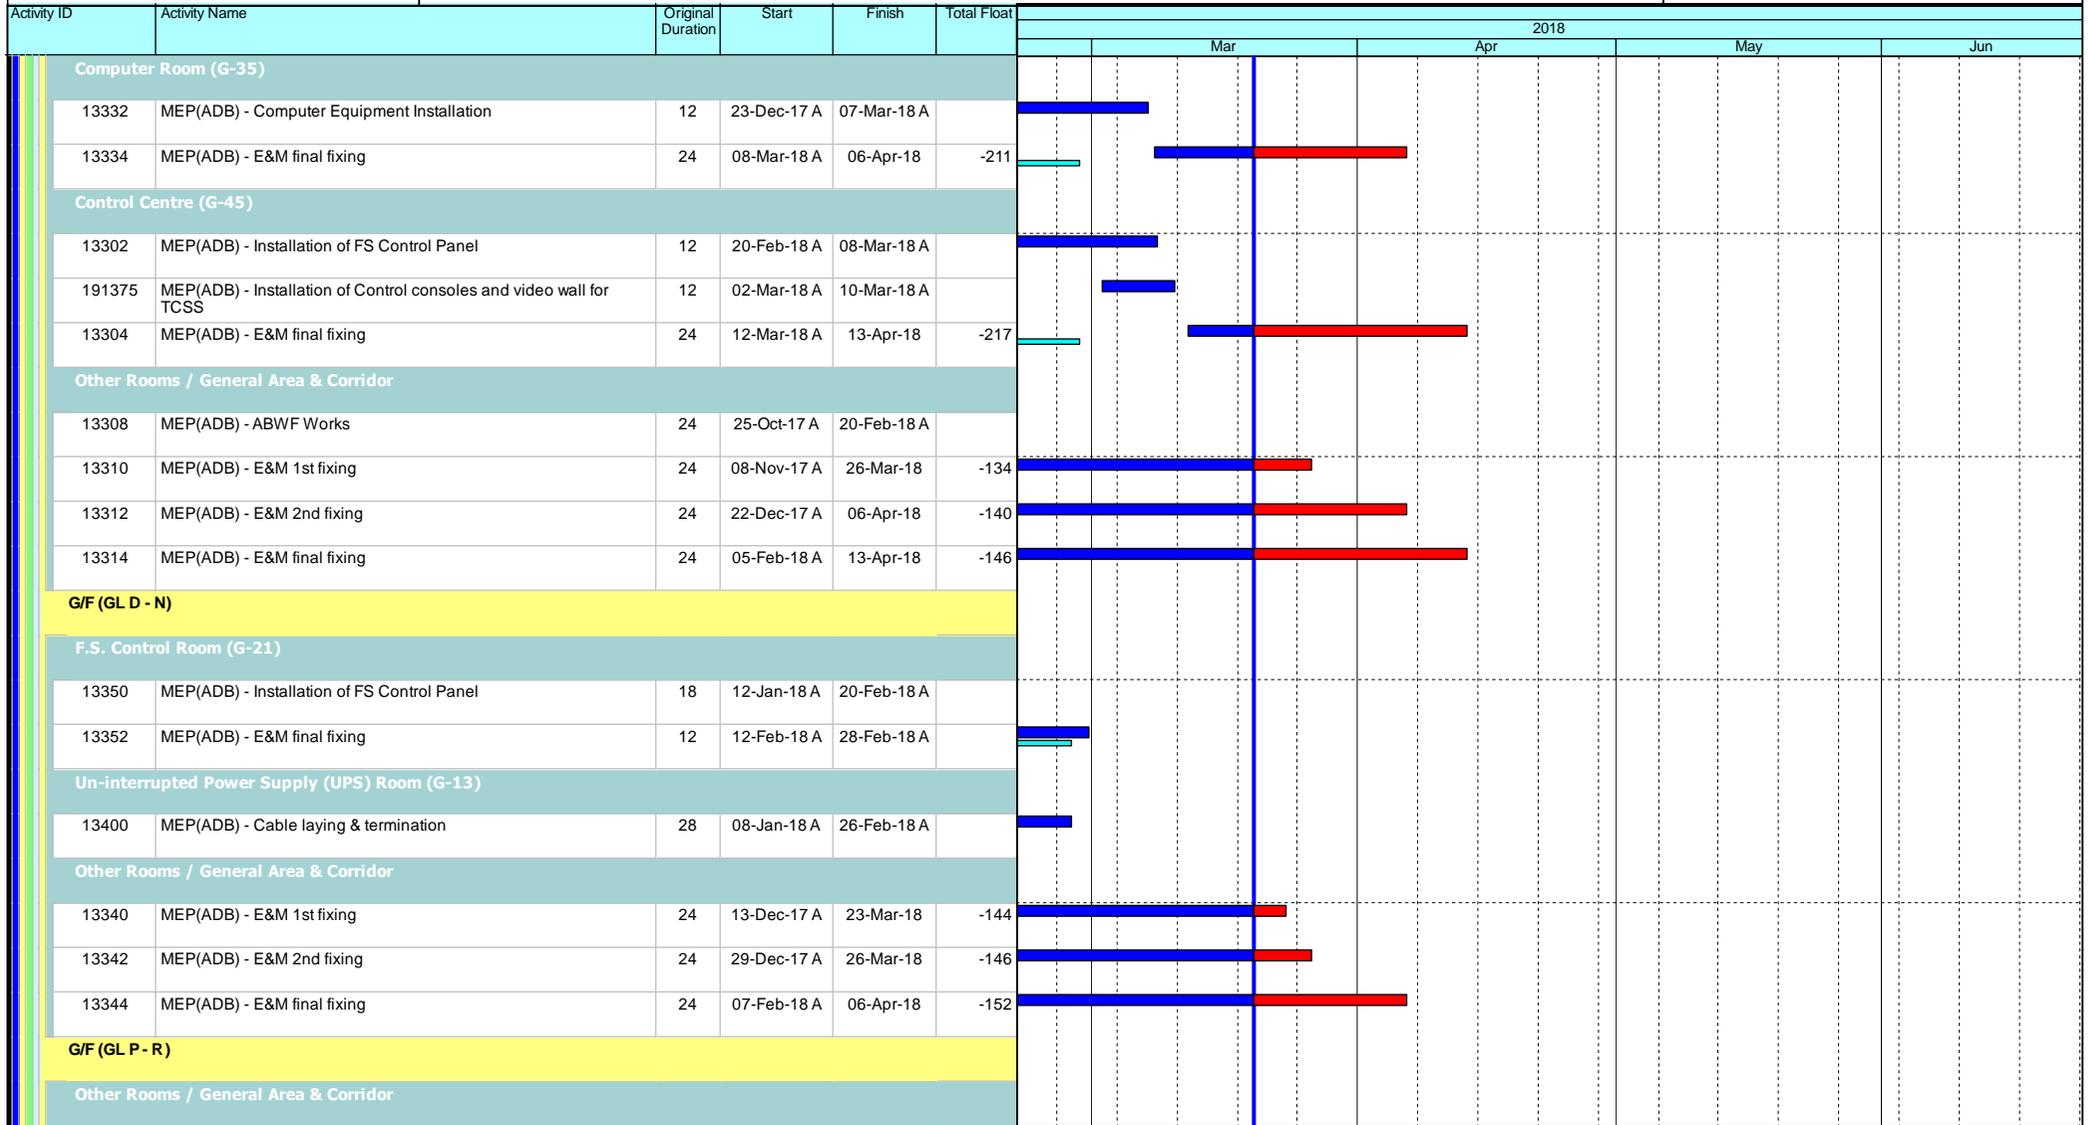TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 30 of 39


Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018			
						Mar	Apr	May	Jun
13408	MEP(ADB) - E&M 1st fixing	24	10-Jan-18 A	26-Mar-18	-146				
13410	MEP(ADB) - E&M 2nd fixing	24	13-Feb-18 A	06-Apr-18	-152				
13412	MEP(ADB) - E&M final fixing	24	06-Mar-18 A	13-Apr-18	-158				
1/F (GLA - D)									
Water Pump Room (L1-08)									
13430	MEP(ADB) - E&M 2nd fixing	12	18-Dec-17 A	21-Mar-18	-254				
13426	MEP(ADB) - Installation of water Pump	24	28-Dec-17 A	06-Apr-18	-264				
13428	MEP(ADB) - E&M final fixing	24	10-Jan-18 A	13-Apr-18	-270				
Other Rooms / General Area & Corridor									
13416	MEP(ADB) - E&M 1st fixing	24	14-Dec-17 A	21-Feb-18 A					
13418	MEP(ADB) - E&M 2nd fixing	24	28-Dec-17 A	21-Mar-18	-130				
13420	MEP(ADB) - E&M final fixing	24	22-Feb-18 A	06-Apr-18	-140				
External Works									
13432	ADB - Road and drainage works (EVA)	42	11-Dec-17 A	27-Mar-18	-280				
13438	ADB - Final completion works (include CCMS interface)	60	09-Jan-18 A	25-Apr-18	-280				
13434	ADB - External concrete pavement (EVA)	24	18-Jan-18 A	18-Apr-18	-274				
13436	ADB - External Fence Wall (include metal gate)	21	28-Mar-18	25-Apr-18	-280				
E&M Testing & Commissioning / Statutory Inspection									
13454	MEP(ADB) - Submission of Form 5 to EMSD	0	13-Apr-18		-216				
13444	MEP(ADB) - Ready for Statutory Inspection	0	26-Apr-18		-280				
13456	MEP(ADB) - Submission of Form 501 to FSD	0	26-Apr-18		-280				
13462	MEP(ADB) - Submission of Form 314 to FSD	0	26-Apr-18		-183				
KD03M7	MEP(ADB) - Milestone for KD06	0		26-Apr-18	-198				
13454a	MEP(ADB) - Use Permit - Lift	0	27-Apr-18		-216				

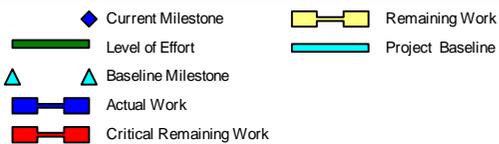

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
Baseline: SA01
Layout: Update Three Month Rolling
U049
Page 31 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

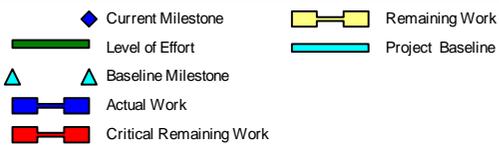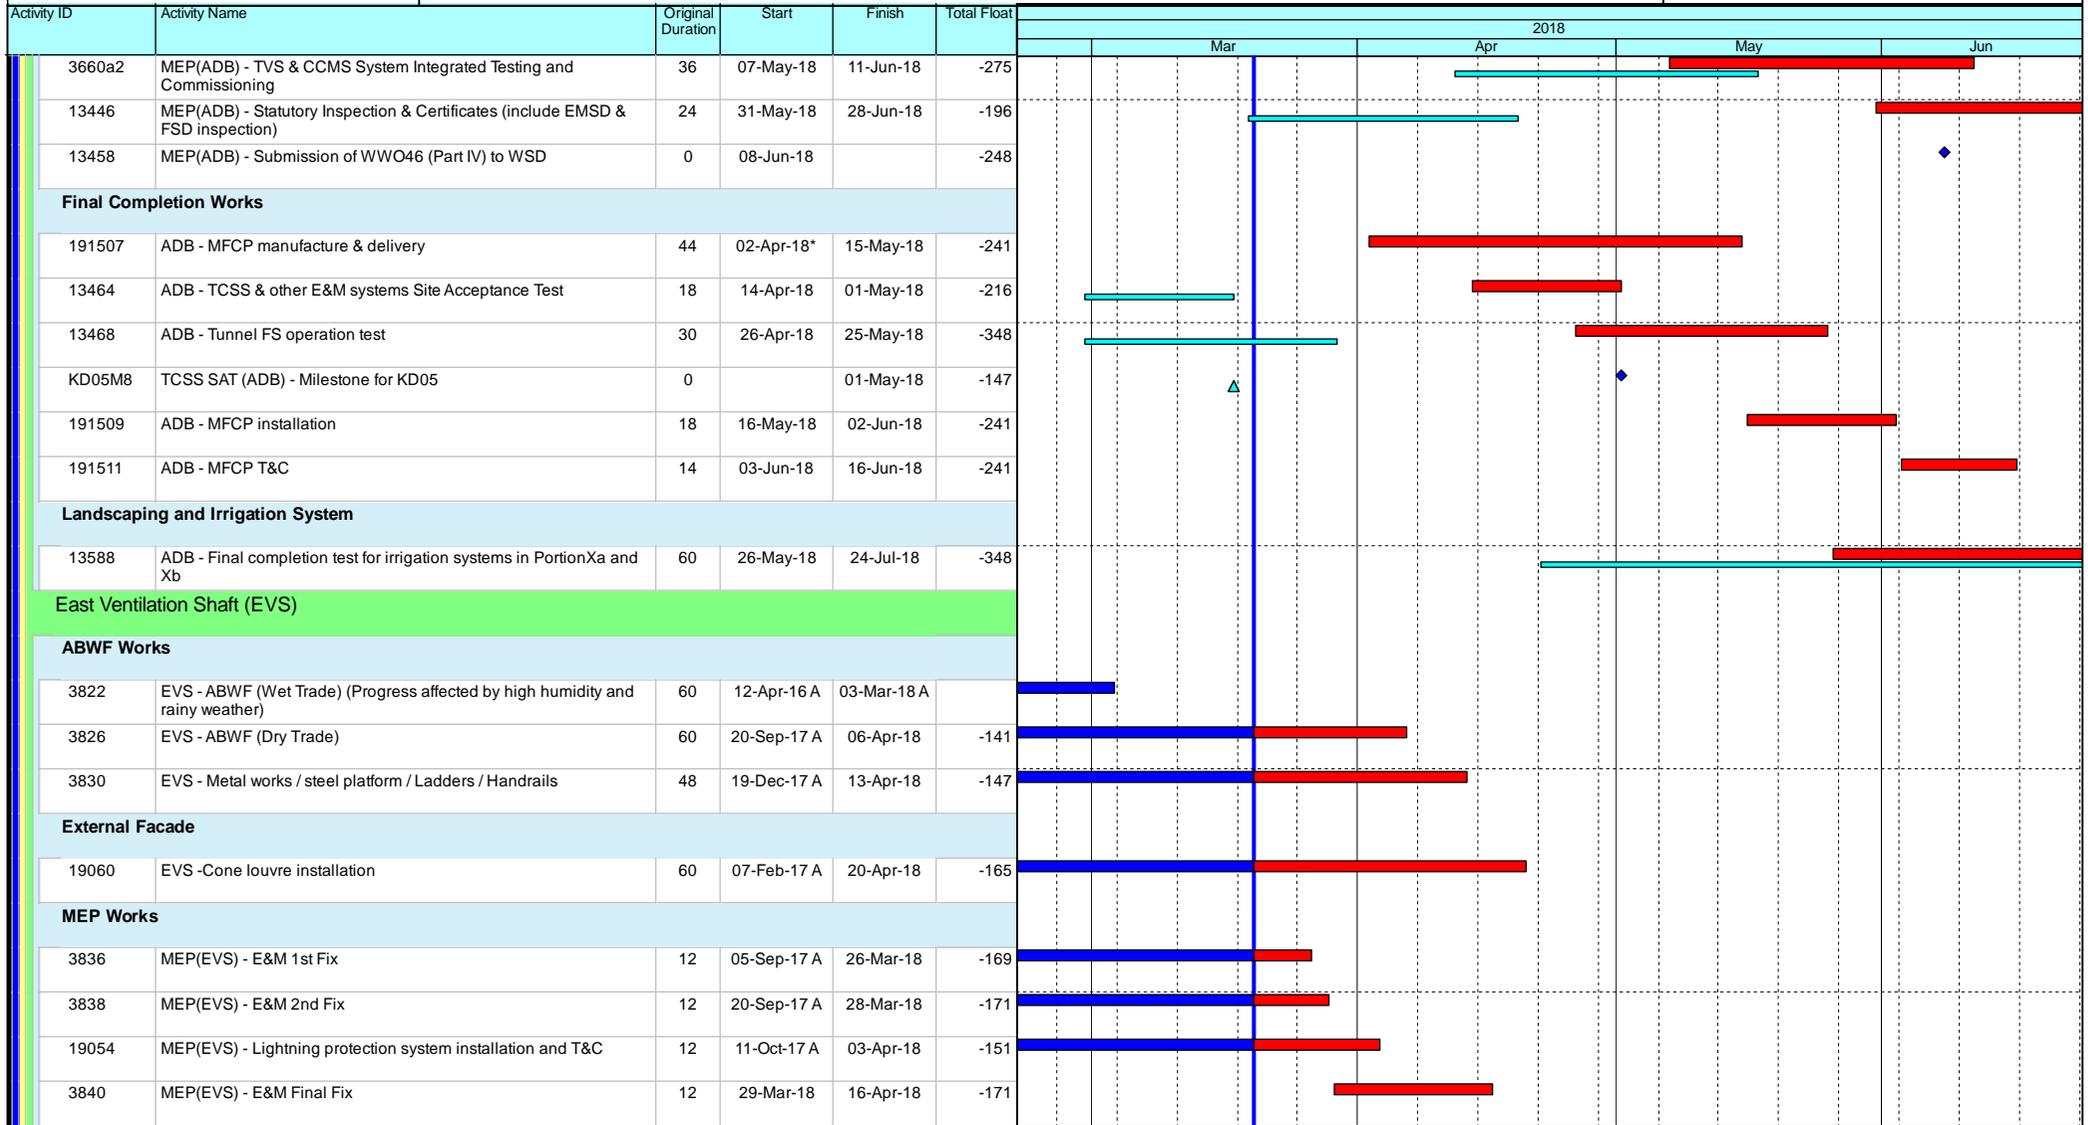TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING



Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 32 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

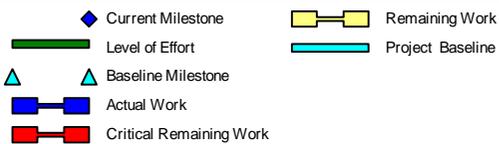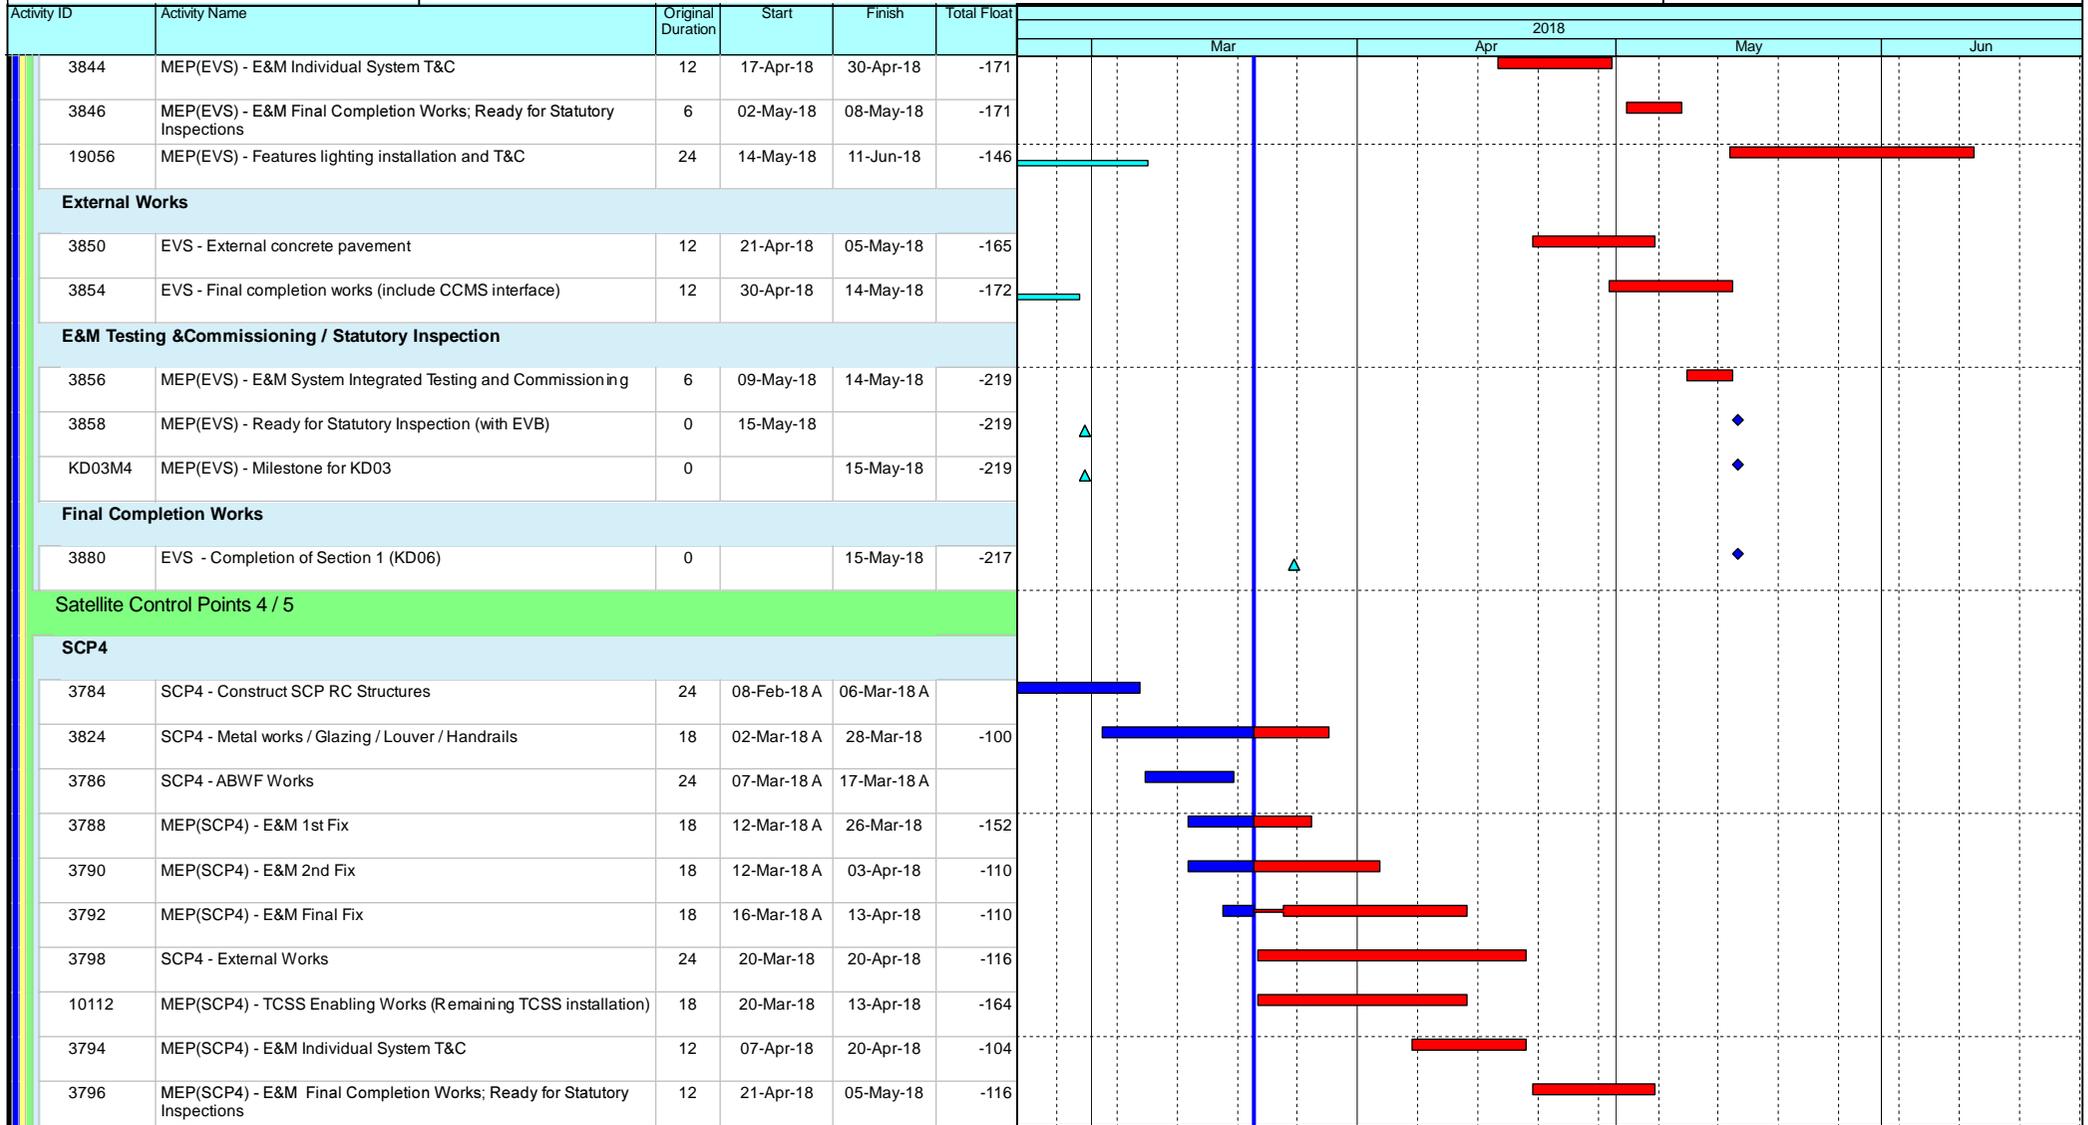TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING


Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 33 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

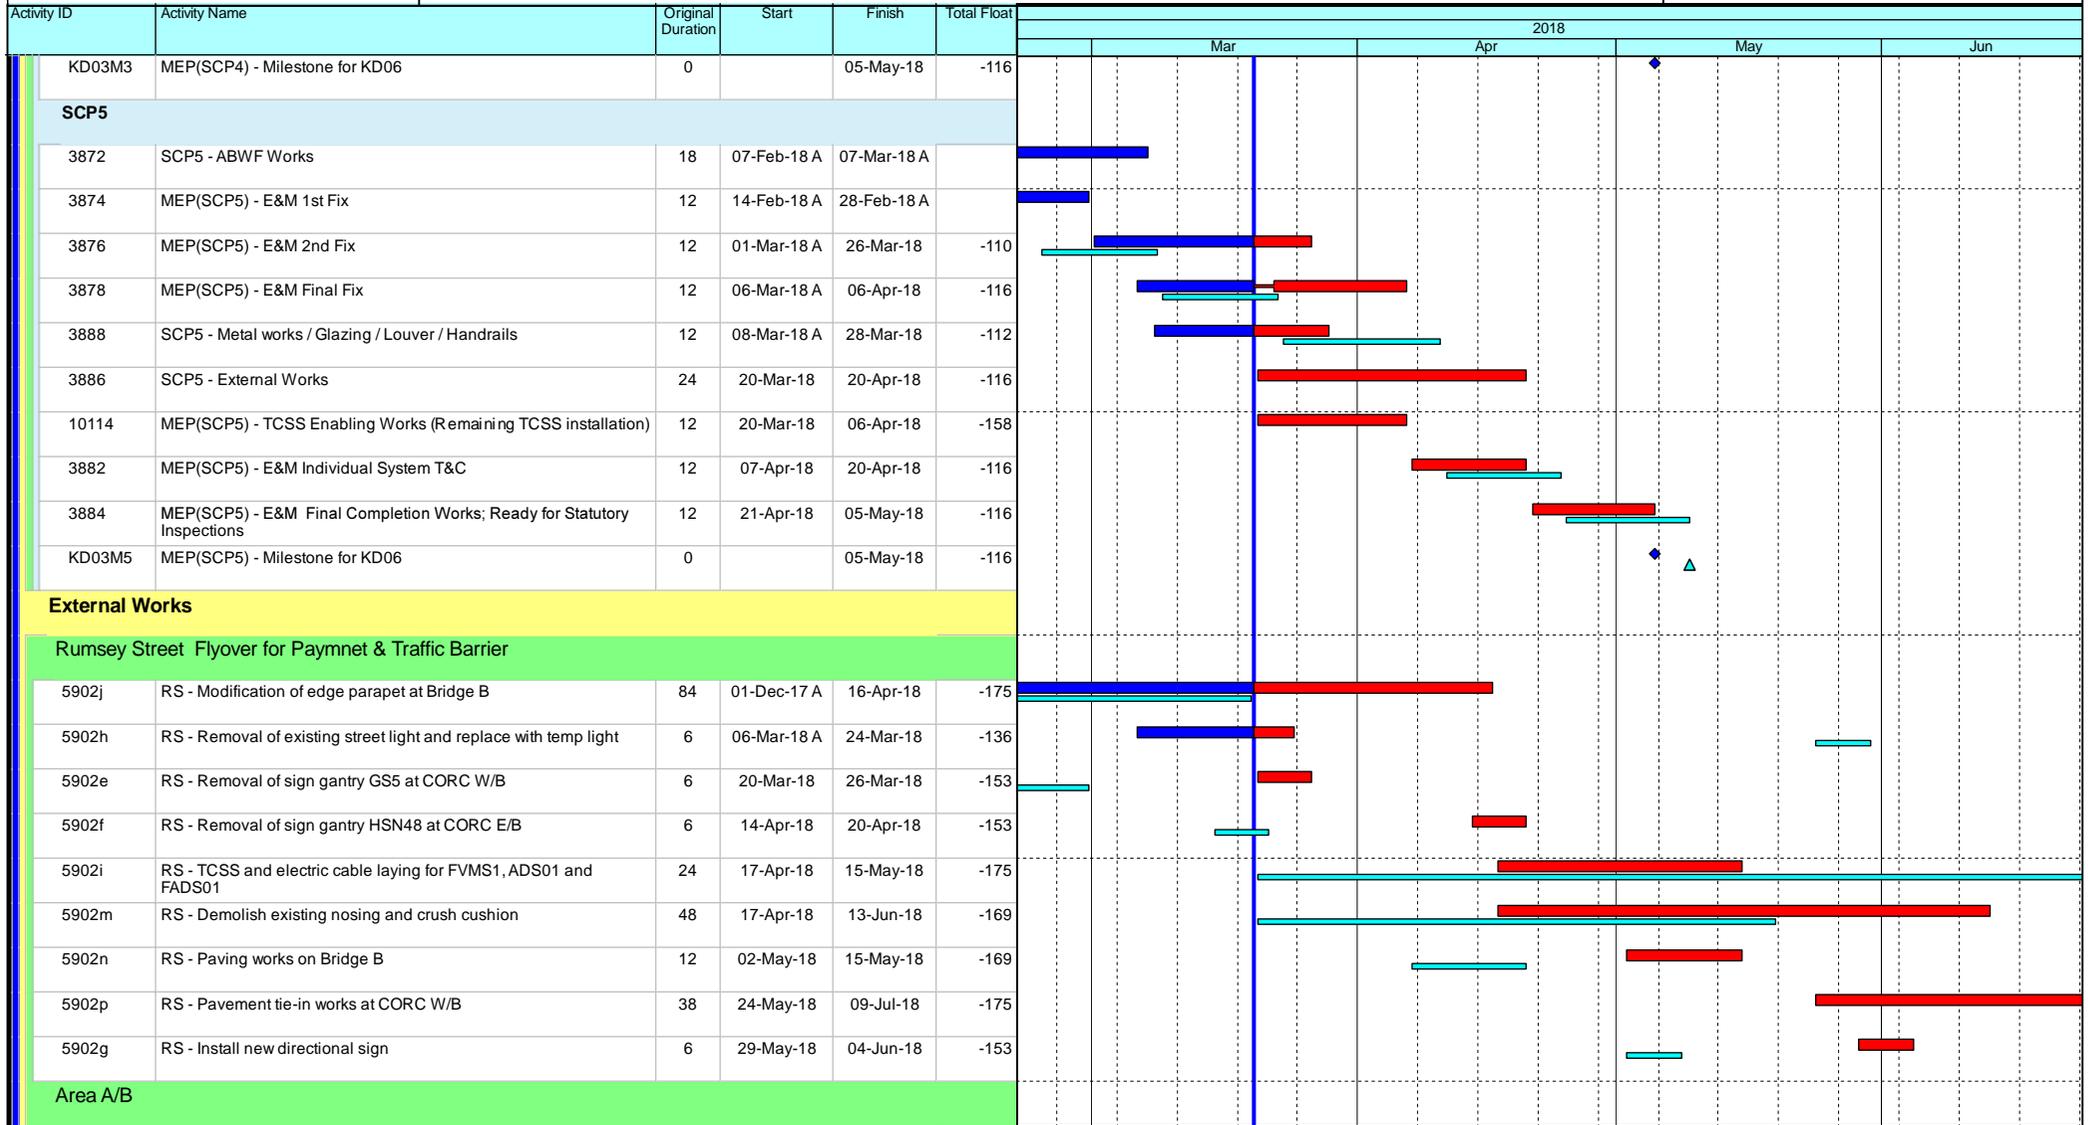TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING


Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 34 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

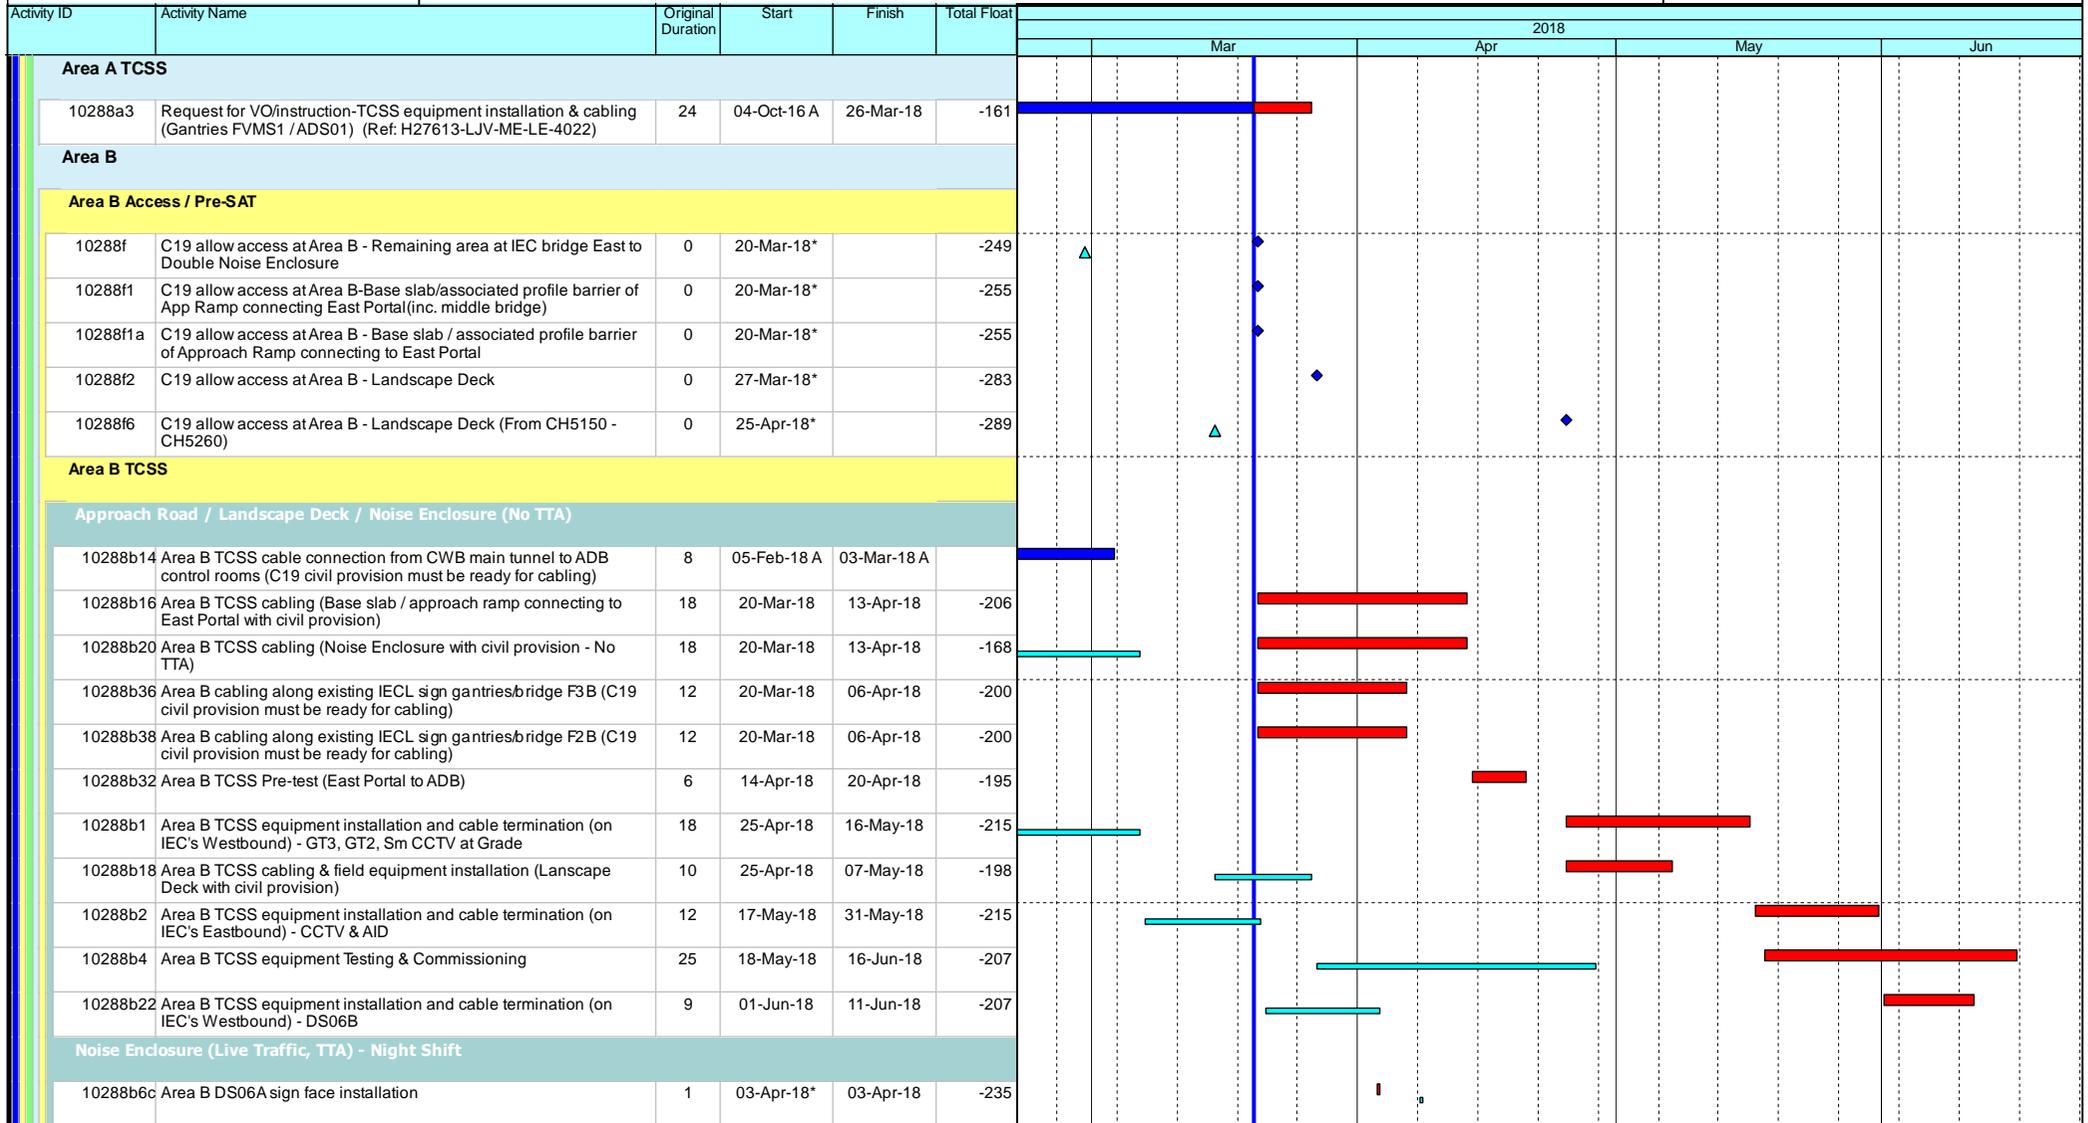TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 35 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018			
						Mar	Apr	May	Jun
10288b6b	Area B FADS06 sign face installation	4	29-Apr-18*	02-May-18	-268				
10288b6	Area B TCSS equipment installation and cable termination (on IEC's Westbound) - FADS06	10	03-May-18	14-May-18	-213				
10288b6a	Area B TCSS equipment installation and cable termination (on IEC's Westbound) - DS06A	6	08-May-18	14-May-18	-213				
10288b8	Area B TCSS equipment Testing & Commissioning	20	15-May-18	07-Jun-18	-213				
10288b10	Area B TCSS equipment installation and cable termination (on IEC's Eastbound) - FADS08A	6	15-May-18	21-May-18	-205				
Existing IEC (Live Traffic, TTA) - Night Shift									
10288b30	Area B TCSS cabling (Existing IEC with civil provision)	24	20-Mar-18	20-Apr-18	-180				
10288b24	Area B TCSS equipment installation and cable termination (on IEC's Westbound) - ADS06	10	20-Mar-18	03-Apr-18	-160				
10288b24	ADS06 A-frame and main beam completion by C19	0		20-Mar-18*	-224				
10288b24	Area B TCSS equipment installation and cable termination (on IEC's Westbound) - VMS7	14	23-May-18	07-Jun-18	-205				
10288b26	Area B TCSS equipment Testing & Commissioning	12	08-Jun-18	22-Jun-18	-213				
Area B Tunnel Lighting									
Landscape Deck									
10288c1	Area B Tunnel Lighting (Landscape Deck) - Brackets / Cable Containment / Conduit / Junction Box installation	18	27-Mar-18	20-Apr-18	-229				
10288d2	Area B Tunnel Lighting (Landscape Deck) - Bracket installation (Cable Trench)	18	27-Mar-18	20-Apr-18	-229				
10288d3	Area B Tunnel Lighting (Landscape Deck) - Cable laying (Cable Trench)	24	25-Apr-18	24-May-18	-209				
10288c8	Area B Tunnel Lighting (Landscape Deck) - Brackets/Cable Containment/Conduit/Junction Box installation (CH5150-CH5260)	30	25-Apr-18	31-May-18	-232				
10288c2	Area B Tunnel Lighting (Landscape Deck) - Tunnel Lighting installation (Base / Reinforcement lighting)	34	05-May-18	14-Jun-18	-232				
10288d1	Area B Tunnel Lighting (Landscape Deck) - Cable laying / Control cable wiring (High Level)	42	14-May-18	04-Jul-18	-232				
10288d5	Area B Tunnel Lighting (Landscape Deck) - Cable termination (Cable Trench)	17	25-May-18	13-Jun-18	-209				
10288d4	Area B Tunnel Lighting (Landscape Deck) - Cable termination (High Level)	38	28-May-18	12-Jul-18	-232				
Remaining Area (Noise Enclosure) (No TTA Required)									
18000a	Area B - C19 Handover of completed route of cable ductings from SCP-5 to CH 5420 / Bridge F1B1	0	26-Feb-18 A						
18000	Area B - C19 Handover of completed route of cable ductings from SCP-5 to CH 5420 / Bridge F1B2	0	20-Mar-18*		-226				

- ◆ Current Milestone
- Level of Effort
- ▲ Baseline Milestone
- Actual Work
- Critical Remaining Work
- Remaining Work
- Project Baseline

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING


Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 36 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

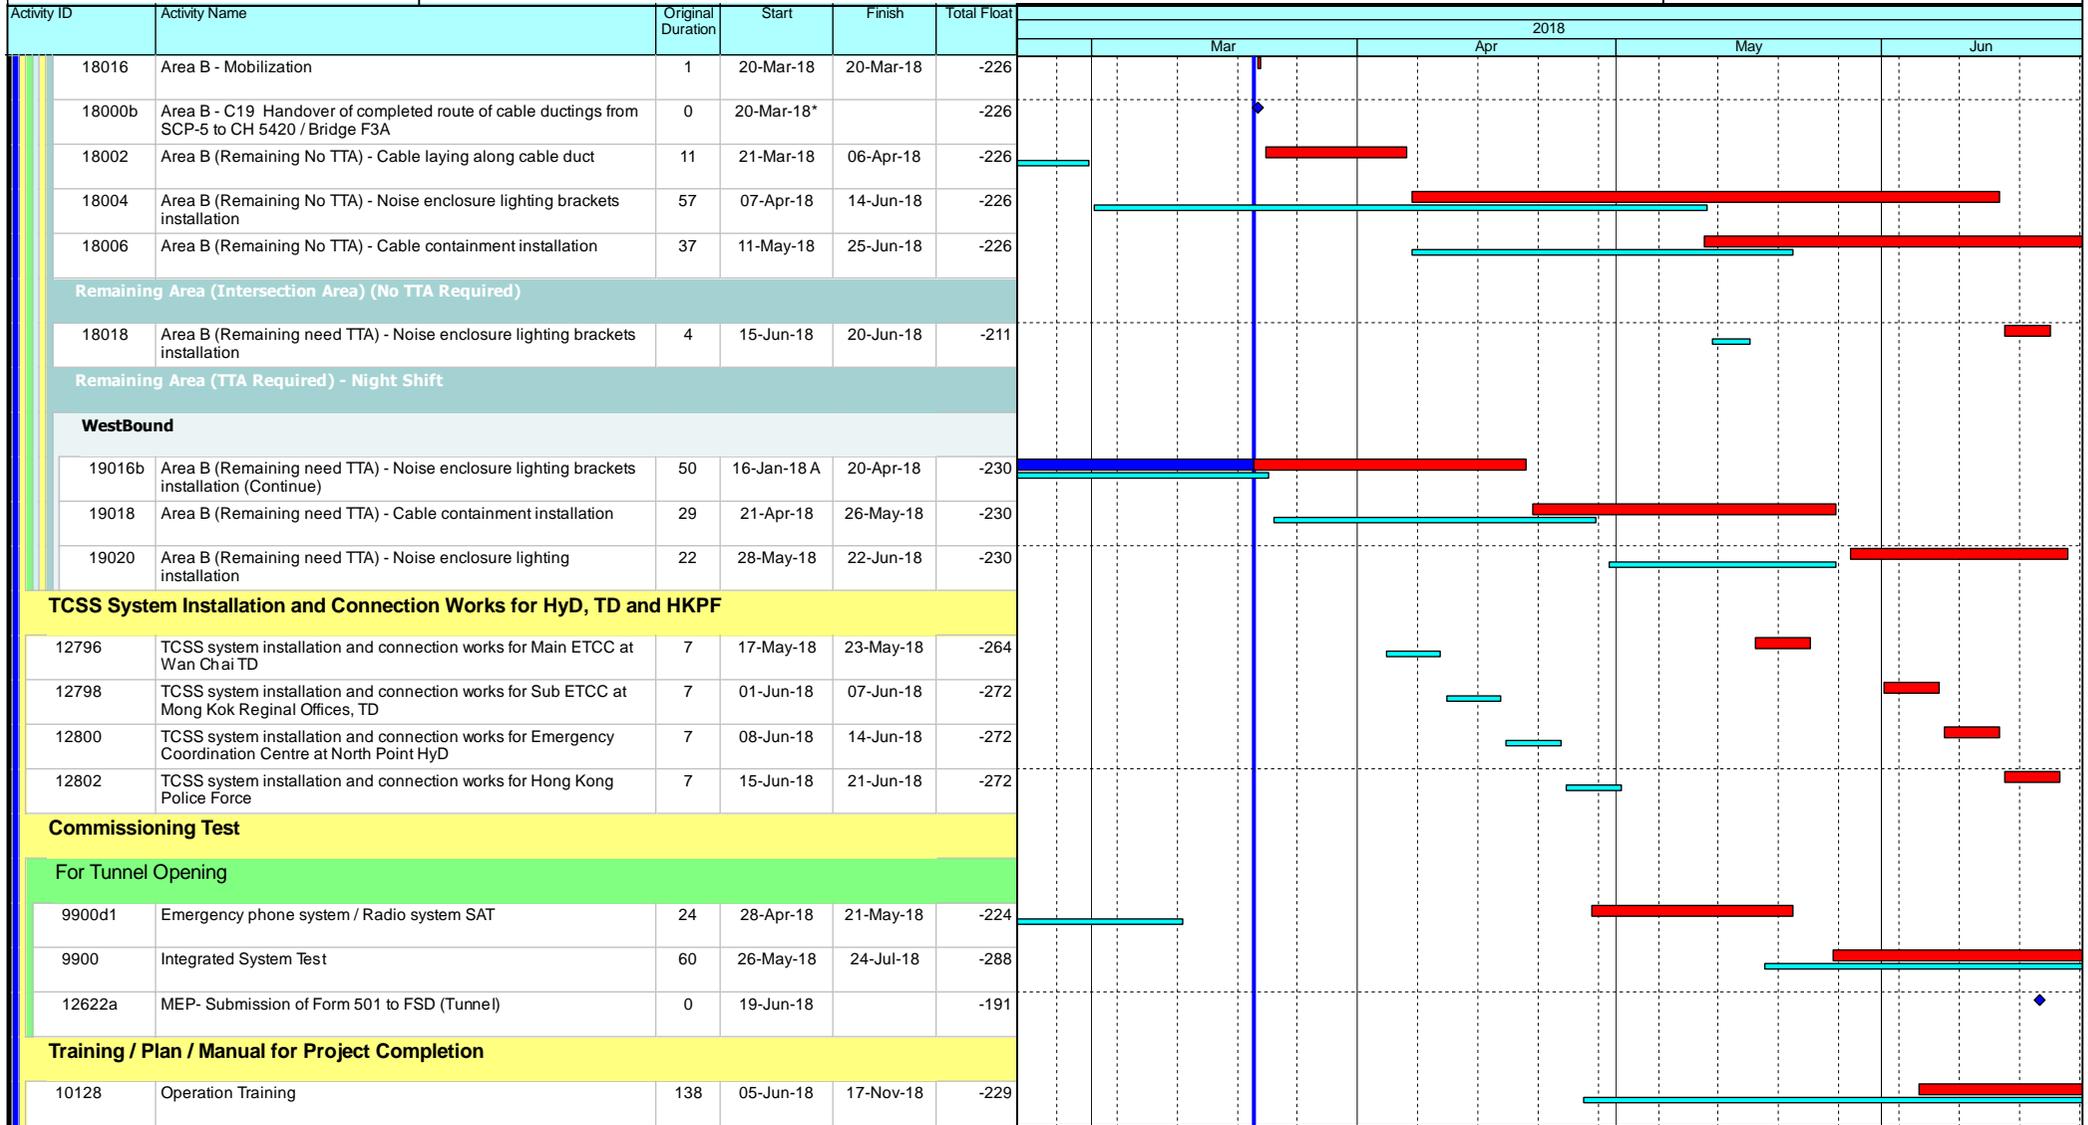TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING


Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 37 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

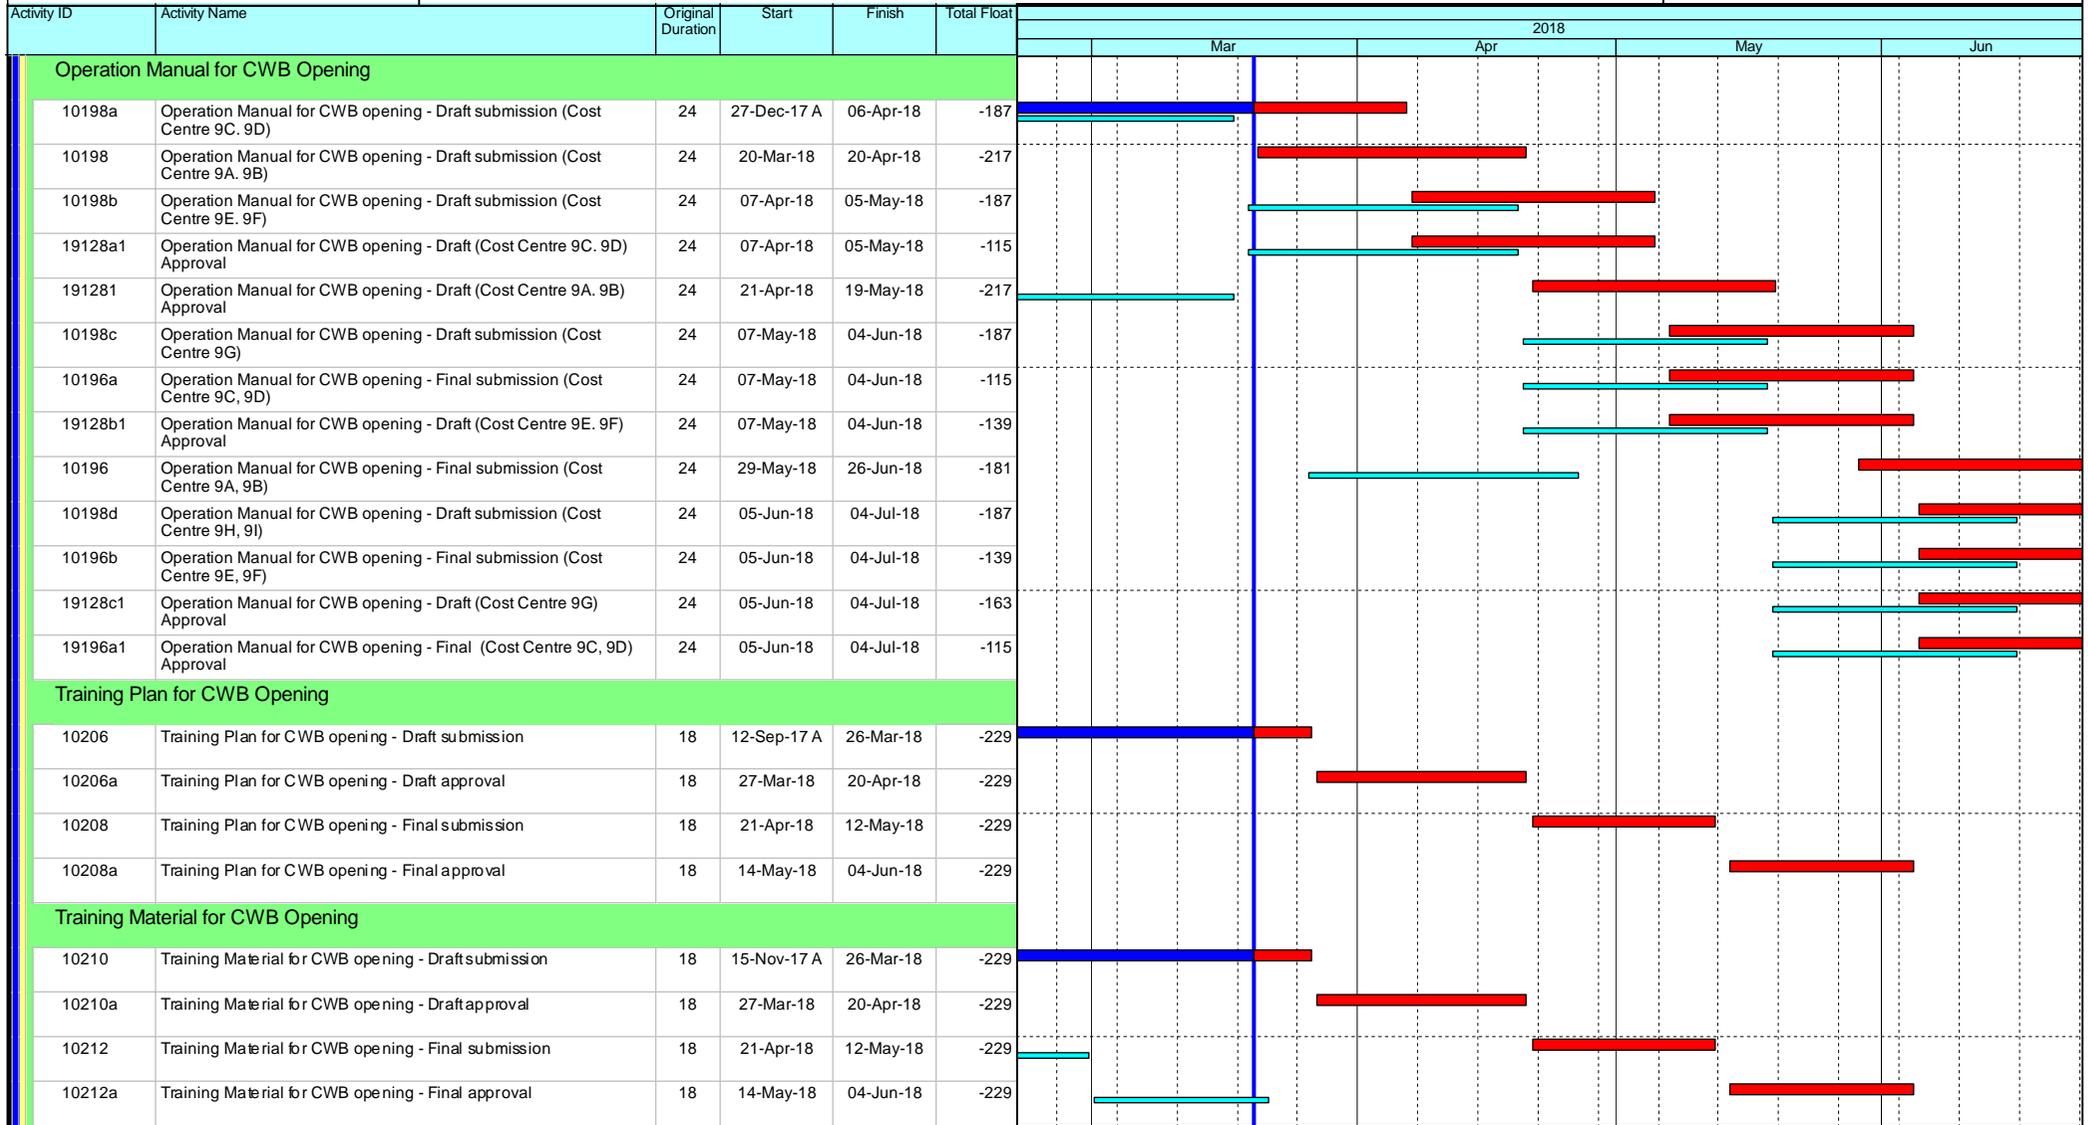TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.



- Current Milestone
- Remaining Work
- Level of Effort
- Project Baseline
- Baseline Milestone
- Actual Work
- Critical Remaining Work

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 38 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW

Data Date: 20-Mar-18

CWB(CC) - Commissioning Contract

TASK filters: 3 Months_4, 3MRP, No Original Sections, No Summary, Not HL.

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	2018														
						Mar			Apr			May			Jun					
Maintenance Manual / Plan																				
10200	Maintenance Plan	18	14-May-18	04-Jun-18	-199															
10220	Maintenance Manual / logbook - Draft submission	18	05-Jun-18	26-Jun-18	-199															

-  Current Milestone
-  Level of Effort
-  Baseline Milestone
-  Actual Work
-  Critical Remaining Work
-  Remaining Work
-  Project Baseline

Leighton Contractors (Asia) Limited Programme Update 49 (March 2018) THREE MONTH ROLLING

Project ID: H2613-U049
 Baseline: SA01
 Layout: Update Three Month Rolling
 U049
 Page 39 of 39

Date	Revision	Checked	Appro...
20-Feb-18	U048	AT	CW
20-Mar-18	U049	AT	CW